


# Asbestos Register

(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Hannam Vale Public School (2131)</b>
<b>Region:</b>	<b>North Coast AMU</b>
<b>State Electorate:</b>	<b>Port Macquarie</b>
<b>Local Government Area:</b>	<b>Mid-Coast</b>

Last Reviewed By:	WSP 31-OCT-2016
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

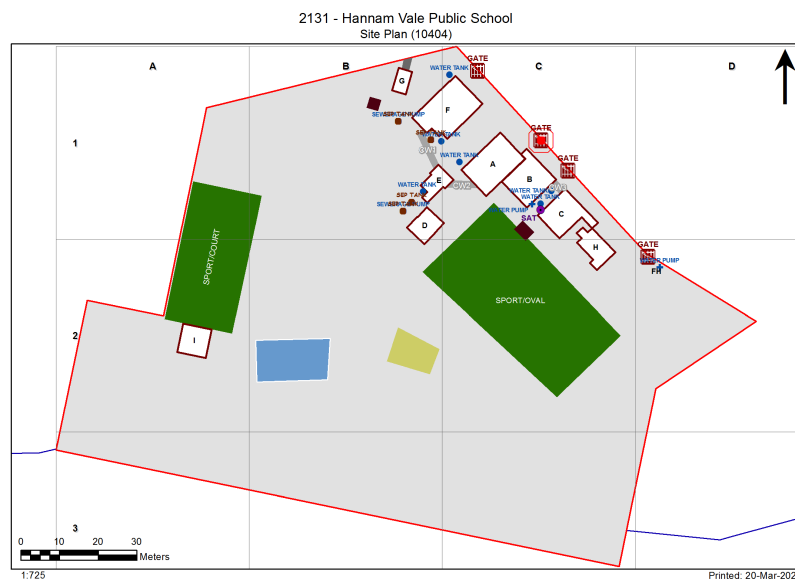

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

### Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

### Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

### Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

#### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - Staff Facilities/Administration - 1892 - Timber</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting						
Wall Cladding	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	AC Fragments/Debris						
<b>Interior</b>							
<b>B00A - R0001 - Principal - 15 m2</b>							
No Asbestos							
<b>B00A - R0002 - Entry Vestibule - 9.61 m2</b>							
No Asbestos							
<b>B00A - R0003 - Clerical Office - 11.78 m2</b>							
No Asbestos							
<b>B00A - R0004 - Staff Room - 13.78 m2</b>							
No Asbestos							
<b>B00A - R0005 - Covered Outdoor Learning Area - 76.15 m2</b>							
No Asbestos							
<b>B00B - General Learning/Administration - 1926 - Timber</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Electrical - Backing Board	Resinous Board						
<b>Interior</b>							
<b>B00B - R0001 - Home Base - 54.46 m2</b>							
No Asbestos							
<b>B00B - R0002 - K.L.A. Store - 4.36 m2</b>							
No Asbestos							
<b>B00B - R0003 - Clerical Office - 10.66 m2</b>							
No Asbestos							
<b>B00B - R0004 - Movement - 4.53 m2</b>							
No Asbestos							
<b>B00B - R0005 - External Movement - 22.44 m2</b>							
No Asbestos							
<b>B00C - Library - 1875 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids	AC Fragments/Debris	1	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Underfloor Voids	AC Fragments/Debris						
Eaves Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00C - R0001 - Library Office/Workroom - 18.38 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0002 - Reading Area - 28.06 m2</b>							

No Asbestos							
<b>B00C - R0003 - K.L.A. Store - 12.38 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0004 - External Movement - 24.78 m2</b>							
No Asbestos							
<b>B00D - Pupil Facilities/Administration - 1926 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00D - R0001 - Canteen Covered Area - 21.44 m2</b>							
No Asbestos							
<b>B00D - R0002 - General Assistant/Bulk Store - 21.71 m2</b>							
No Asbestos							
<b>B00E - Pupil Facilities/Staff Facilities - 1926 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting						
Gable Ends	Flat AC Sheeting						
<b>Interior</b>							
<b>B00E - R0001 - Movement - 1.27 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0002 - Staff Toilet - 1.48 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0003 - Drinking Facilities - 2.72 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0004 - Movement - 1.3 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0005 - Toilets - Girls - 2.93 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0006 - Toilets - Girls - 1.52 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0007 - Toilets - Boys - 4.05 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0008 - Toilets - Boys - 1.49 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0009 - External Movement - 17.3 m2</b>							
No Asbestos							
<b>B00F - Administration/Other-Community Use - 1926 - Timber</b>							

<b>Exterior</b>							
Underfloor Voids	Compressed AC Sheet						
Eaves Linings	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids							
<b>Interior</b>							
<b>B00F - R0001 - External Movement - 19.87 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00F - R0002 - Other-Community Use - 15.1 m2</b>							
No Asbestos							
<b>B00F - R0003 - Movement - 4.45 m2</b>							
No Asbestos							
<b>B00F - R0004 - Withdrawal Space - 1hb - 14.7 m2</b>							
No Asbestos							
<b>B00F - R0005 - Withdrawal Space - 1hb - 19.87 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B00F - R0006 - Seminar/Study - 15.65 m2</b>							
Ceiling Structures/Linings - Access Hatch	Flat AC Sheeting	1m2	Middle portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0007 - Staff Shower/Change - 6.22 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting						
<b>B00F - R0008 - General Storeroom - 10.04 m2</b>							
No Asbestos							
<b>B00F - R0009 - Staff Toilet - 2.34 m2</b>							
No Asbestos							
<b>B00F - R0010 - Staff Kitchen - 12.84 m2</b>							
No Asbestos							
<b>B00F - R0011 - External Movement - 6.9 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00F - R0012 - Cleaning Distributed Store - 6.71 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting						
<b>B00G - Other-Vacant - 1926 - Fibre Cement Clad</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Wall Cladding	Flat AC Sheeting	60m2	All surfaces	Some Damage - Unsealed (3)	Medium (2)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00G - R0001 - Garden Store - 21.02 m2</b>							
No Asbestos							
<b>B00H - Communal Facilities - 2005 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						

Electrical - Backing Board	Resinous Board	1	North	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00H - R0001 - Communal Space - 31.24 m2</b>							
No Asbestos							
<b>B00H - R0002 - Raised Platform - 9.71 m2</b>							
No Asbestos							
<b>B00H - R0003 - Performance Store - 4.89 m2</b>							
No Asbestos							
<b>B00H - R0004 - Movement - 3.61 m2</b>							
No Asbestos							
<b>B00I - Storage - 1988 - Brick/Block</b>							
<b>Exterior</b>							
Underfloor Voids	Requires Inspection						
Ceiling Voids	Requires Inspection						
<b>Interior</b>							
<b>B00I - R0001 - Sports Store - 49.7 m2</b>							
Requires Inspection							

## Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020