


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Fairy Meadow Public School (1898)
Region:	Southern NSW AMU
State Electorate:	Keira
Local Government Area:	Wollongong

Last Reviewed By:	WSP 15-FEB-2017
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

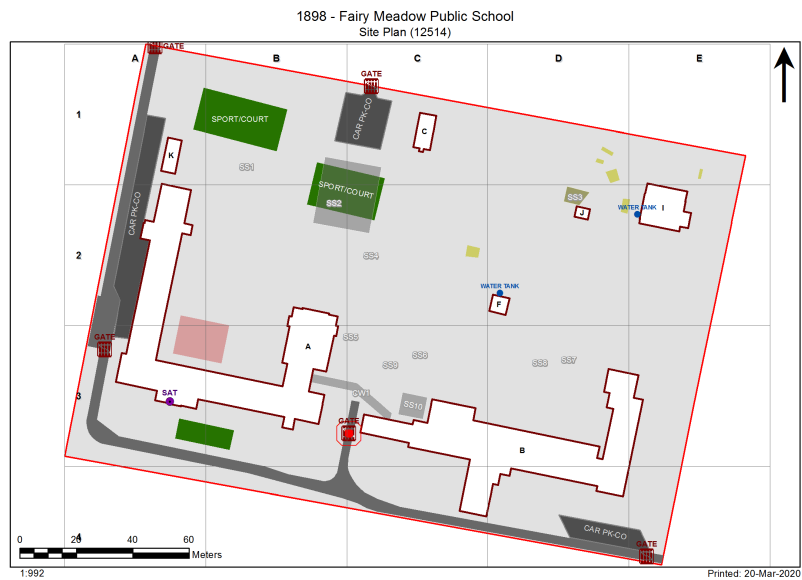

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - General Learning/Administration - 1965 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Wall Linings Internal - Infill	Flat AC Sheeting	320	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B00A - M0001 - Plant - 6.58 m2							
No Asbestos							
B00A - R0005 - Main Switch Board - 3.35 m2							
No Asbestos							
B00A - R0007 - Movement - 4.74 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0008 - Cleaning Supplies - 3.57 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0011 - Craft Store - 17.63 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0012 - Home Base - 67.63 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0014 - Home Base - 66.09 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0015 - Home Base Store - 5.11 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0016 - Withdrawal Space - 1hb - 17.75 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0017 - Home Base Store - M - 5.22 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0018 - Home Base - M - 67.31 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0019 - Movement - 5.29 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0020 - Movement - 9.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0021 - Garden Store - 3.62 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0023 - General Storeroom - 10.77 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0024 - Sports Store - 7.54 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0025 - Movement - 62.56 m2							
No Asbestos							
B00A - R0031 - Toilets - Girls - 16.45 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R0032 - General Assistant/Bulk Store - 3.64 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0033 - Toilets - Boys - 16.64 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R0035 - Movement - 178.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00A - R0037 - Movement - 43.39 m2							
Floor Coverings Res/Textile	Vinyl Tiles	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0038 - Staff Room - 75.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00A - R0039 - Sick Bay - 25.72 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0040 - Duplicating Workroom - 40.76 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0042 - Cleaning Distributed Store - 4.53 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0044 - Movement - 11.5 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0045 - Interview - 13.25 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0046 - General Storeroom - 14.62 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0047 - Distribution Board - .69 m2							
						Note: No inspection of live electrical installation	
No Asbestos							
B00A - R0048 - Plant - .95 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0049 - Seminar/Study - 14.95 m2							
No Asbestos							
B00A - R0050 - Interview - 6.83 m2							
No Asbestos							
B00A - R0051 - Toilets - Girls - 1.48 m2							
No Asbestos							
B00A - R0052 - Handwashing Facilities - .96 m2							
No Asbestos							
B00A - R0053 - Hall Chair Store - 7.27 m2							

No Asbestos							
B00A - R0054 - Movement - 3.42 m2							
No Asbestos							
B00A - R0055 - Movement - 2.89 m2							
No Asbestos							
B00A - R0056 - Raised Platform - 46.1 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0057 - Handwashing Facilities - .95 m2							
No Asbestos							
B00A - R0058 - Toilets - Boys - 1.5 m2							
No Asbestos							
B00A - R0059 - Hall Chair Store - 7.28 m2							
No Asbestos							
B00A - R0060 - Movement - 3.45 m2							
No Asbestos							
B00A - R0061 - Movement - 2.82 m2							
No Asbestos							
B00A - R0062 - Communal Space - 222.8 m2							
No Asbestos							
B00A - R0065 - Movement - 8.81 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0066 - General Storeroom - 3.88 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0067 - Clerical Office - 13.93 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0068 - Deputy Principal - 14.68 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0069 - General Storeroom - 4.33 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0070 - General Storeroom - 2.69 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0071 - Staff Toilet - 2.14 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0072 - Principal - 24.44 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0073 - Deputy Principal - 14.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0074 - Entry Vestibule - 76.73 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Main Entrance	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00A - R0075 - Stairs - 8.22 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00A - R0076 - Stairs - 8.6 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00A - R0077 - Movement - 6.62 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00A - R0078 - Sports Store - 14.27 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00A - R0079 - Stairs - 8.42 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00A - R0080 - Stairs - 8.88 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00A - R0082 - Movement - 3.07 m2		
No Asbestos		
B00A - R0083 - Reading Area - 201.98 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)	
B00A - R0084 - Library Office/Workroom - 28.58 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00A - R0085 - Garden Store - 10.61 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00A - R0086 - Movement - 81.92 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)	
B00A - R0087 - Canteen - 29.4 m2		
No Asbestos		
B00A - R0088 - Canteen Office/Store - 10.74 m2		
No Asbestos		
B00A - R0089 - Other - 2.21 m2		
No Asbestos		
B00A - R0090 - Staff Toilet - 7.71 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00A - R0091 - Other - 2.23 m2		
No Asbestos		
B00A - R0092 - Staff Toilet - 7.89 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00A - R0093 - Staff Toilet - 7.46 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00A - R0094 - Other - 1.68 m2		
No Asbestos		
B00A - R0095 - Other - 1.67 m2		
No Asbestos		
B00A - R0096 - Staff Toilet - 6.66 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	

B00A - R0097 - External Movement - 11.25 m2							
No Asbestos							
B00A - R1004 - Distribution Board - .88 m2							Note: No inspection of live electrical installation
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R1005 - Movement - 80.38 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Floor Coverings Res/Textile	Vinyl Tiles	81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1006 - General Storeroom - 17.49 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1007 - Home Base - 67.88 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1009 - Home Base - 65.77 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1010 - Home Base Store - 5.15 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R1011 - Practical Activities - 1hb - 17.61 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1012 - Home Base Store - 5.15 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R1013 - Home Base - 67.31 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1014 - Cleaning Distributed Store - 2.69 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R1015 - Home Base Store - 7.33 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R1016 - Home Base Store - 7.28 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R1017 - Home Base - 66.26 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1018 - Movement - 39.66 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1019 - Movement - 117.74 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Floor Coverings Res/Textile	Vinyl Tiles	118m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1020 - Home Base - 65.69 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00A - R1021 - Home Base Store - 5.12 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles							
B00A - R1022 - Personal Effects Storage - 16.68 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1023 - Distribution Board - .75 m2 Note: No inspection of live electrical installation								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1024 - Home Base - 67.8 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00A - R1025 - Home Base Store - 5.2 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles							
B00A - R1026 - Home Base - M - 65.85 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00A - R1027 - Home Base Store - M - 5.15 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles							
B00A - R1028 - General Storeroom - 17.67 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1029 - Home Base - 67.56 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00A - R1030 - Home Base Store - 5.15 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles							
B00A - R1031 - Home Base - 65.93 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00A - R1032 - Home Base Store - 5.17 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles							
B00A - R1033 - Withdrawal Space - 1hb - 17.67 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							

Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1034 - Home Base - 66.91 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1035 - Home Base Store - 5.17 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R1036 - Cleaning Distributed Store - 1.63 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R1037 - Stairs - 11.47 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1038 - Stairs - 12.35 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1039 - Stairs - 12.09 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1040 - Stairs - 12.61 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1041 - Home Base - 144.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00A - R1042 - Home Base Store - 11.02 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1043 - Home Base Store - 8.35 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R1044 - Home Base - 65.53 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1045 - Home Base Store - 10.57 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - General Learning - 1955 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	175m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Fibre Cement Pipe	3	In wall cavity behind blue gas heaters	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids - Stored / Debris Material	AC Fragments/Debris	10	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	AC Fragments/Debris						
Interior							
B00B - R0001 - Movement - 1.91 m2							
No Asbestos							
B00B - R0002 - Uniform Shop - 17.54 m2							

Floor Coverings Res/Textile	Vinyl Tiles							
B00B - R0003 - Uniform Shop - 1.89 m2								
Floor Coverings Res/Textile	Vinyl Sheet							
B00B - R0004 - Communal Space - 81.66 m2								
Ceiling Structures/Linings	Flat AC Sheeting	82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0005 - Movement - 5.23 m2								
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0006 - Sports Store - 7.71 m2								
No Asbestos								
B00B - R0007 - Movement - 1.74 m2								
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0008 - General Storeroom - 3.57 m2								
No Asbestos								
B00B - R0009 - Toilets - Boys/Girls - 3.78 m2								
No Asbestos								
B00B - R0010 - Movement - 151.9 m2								
No Asbestos								
B00B - R0013 - Movement - 13.26 m2								
No Asbestos								
B00B - R0016 - Toilet - P - 6.22 m2								
No Asbestos								
B00B - R0017 - Home Base Store - 2.1 m2								
No Asbestos								
B00B - R0018 - Communal Space - 135.98 m2								
No Asbestos								
B00B - R0019 - Raised Platform - 26.16 m2								
No Asbestos								
B00B - R0020 - Withdrawal Space - 1hb - 11.93 m2								
No Asbestos								
B00B - R0021 - Movement - 6.5 m2								
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0027 - Movement - 1.73 m2								
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0029 - Movement - 1.93 m2								
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0030 - Other-Community Use - 6.78 m2								
Partition Walls (Cubicles)	Flat AC Sheeting	4m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00B - R0035 - Distribution Board - .73 m2								
Note: No inspection of live electrical installation								
No Asbestos								
B00B - R0037 - General Storeroom - 2.67 m2								
No Asbestos								
B00B - R0039 - Movement - 63.68 m2								
No Asbestos								
B00B - R0040 - Movement - 1.7 m2								
No Asbestos								

B00B - R0044 - General Storeroom - 9.94 m2							
No Asbestos							
B00B - R0045 - Movement - 11.14 m2							
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0046 - Movement - 8.02 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0047 - Movement - 1.66 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0048 - Movement - 16.06 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00B - R0049 - Toilets - Boys - 19.32 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00B - R0050 - Toilets - Girls - 26.53 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00B - R0051 - General Storeroom - 7.24 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0052 - Home Base - 80.17 m2							
No Asbestos							
B00B - R0053 - Practical Activities - 1hb - 20.58 m2							
No Asbestos							
B00B - R0054 - Home Base Store - 4.87 m2							
No Asbestos							
B00B - R0055 - Home Base Store - 4.84 m2							
No Asbestos							
B00B - R0056 - Withdrawal Space - 2hb - 12.71 m2							
No Asbestos							
B00B - R0057 - Practical Activities - 1hb - 20.54 m2							
No Asbestos							
B00B - R0058 - Home Base - 80.27 m2							
No Asbestos							
Plant / Equipment - Heater Unit	Fibre Cement Pipe	3	In wall cavity behind blue heater	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0059 - Home Base Store - 4.74 m2							
No Asbestos							
B00B - R0060 - Home Base - 60.47 m2							
Plant / Equipment - Heater Unit	Fibre Cement Pipe	3	In wall cavity behind blue gas heater	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
No Asbestos							
B00B - R0061 - Practical Activities - 1hb - 18.13 m2							
No Asbestos							
B00B - R0062 - Withdrawal Space - 1hb - 8.97 m2							
No Asbestos							
B00B - R0063 - Home Base - 60.18 m2							
No Asbestos							
Plant / Equipment - Heater Unit	Fibre Cement Pipe	3	In wall cavity behind blue gas heater	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)

B00B - R0064 - Practical Activities - 1hb - 15.6 m2							
No Asbestos							
B00B - R0065 - Special Programs Store - 6.42 m2							
No Asbestos							
B00B - R0066 - Special Programs Room - 29.63 m2							
No Asbestos							
B00B - R0067 - Withdrawal Space - 2hb - 33.28 m2							
No Asbestos							
B00B - R0068 - Home Base Store - 8.06 m2							
No Asbestos							
B00B - R0069 - Home Base Store - 7.89 m2							
No Asbestos							
B00B - R0070 - Home Base - 59.78 m2							
No Asbestos							
Plant / Equipment - Heater Unit	Fibre Cement Pipe	3	In wall cavity behind blue gas heater	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0071 - Practical Activities - 1hb - 15.4 m2							
No Asbestos							
B00B - R0072 - Special Programs Store - 6.54 m2							
No Asbestos							
B00B - R0073 - Withdrawal Space - 1hb - 8.98 m2							
No Asbestos							
B00B - R0074 - Practical Activities - 1hb - 19.2 m2							
No Asbestos							
B00B - R0075 - Home Base - 60.39 m2							
No Asbestos							
Plant / Equipment - Heater Unit	Fibre Cement Pipe	3	In wall cavity behind blue gas heater	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0076 - Home Base Store - 7.35 m2							
No Asbestos							
B00B - R0077 - Access Shower/Toilet - 12.74 m2							
No Asbestos							
B00B - R0078 - Toilet - Lobby - 8.8 m2							
No Asbestos							
B00B - R0079 - Practical Activities - 22.33 m2							
No Asbestos							
B00B - R0080 - Home Base Store - 4.73 m2							
No Asbestos							
B00B - R0081 - Withdrawal Space - 1hb - 32.68 m2							
No Asbestos							
Plant / Equipment - Heater Unit	Fibre Cement Pipe	3	In wall cavity behind blue gas heater	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0082 - Other - 39.23 m2							
No Asbestos							
Plant / Equipment - Heater Unit	Fibre Cement Pipe	3	In cavity wall behind blue gas heater	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0083 - Withdrawal Space - 1hb - 22.71 m2							

Plant / Equipment - Heater Unit	Fibre Cement Pipe	3	In wall cavity behind blue gas heater	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0084 - Home Base Store - 6.4 m2							
No Asbestos							
B00B - R0085 - Home Base - 50.31 m2							
Plant / Equipment - Heater Unit	Fibre Cement Pipe	3	In wall cavity behind blue gas heater	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0086 - External Movement - 19.52 m2							
No Asbestos							
B00C - Communal Facilities - 1965 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Cladding	Flat AC Sheeting						
Interior							
B00C - R0001 - Other - 26.01 m2							
No Asbestos							
B00C - R0002 - Other - 2.82 m2							
No Asbestos							
B00C - R0003 - Other - 19.75 m2							
No Asbestos							
B00C - R0004 - Other - 13.7 m2							
No Asbestos							
B00C - R0005 - Other - 1.64 m2							
No Asbestos							
B00C - R0006 - Other-Vacant - 1.21 m2							
No Asbestos							
B00F - Building Services - 1965 - Metal Shed							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Wall Cladding	Compressed AC Sheet	8m2	Dividing wall between FR0001 & FR0002	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00F - R0001 - General Assistant/Bulk Store - 6.81 m2							
Wall Linings Internal	Flat AC Sheeting	8m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0002 - Garden Store - 27.05 m2							
Wall Linings Internal	Flat AC Sheeting	8m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - Pre-School Facilities - 1965 - Brick/Veneer							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						

Underfloor Voids - Slab on Ground	No Asbestos Found							
Interior								
B00I - R0001 - Movement - 31.02 m2								
No Asbestos								
Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00I - R0002 - Toilets - Boys/Girls - Pre - 7.34 m2								
No Asbestos								
B00I - R0003 - General Storeroom - Pre - 4.33 m2								
No Asbestos								
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00I - R0006 - Home Base - Pre - 84.79 m2								
No Asbestos								
B00I - R0007 - Withdrawal - Pre - 12.14 m2								
No Asbestos								
B00I - R0008 - Distribution Board - .59 m2								
						Note: No inspection of live electrical installation		
No Asbestos								
B00I - R0009 - Staff Kitchen - 4.53 m2								
No Asbestos								
B00I - R0010 - Entry Vestibule - 8.09 m2								
No Asbestos								
B00I - R0011 - Personal Effects - Pre - 4.2 m2								
No Asbestos								
B00I - R0012 - General Storeroom - Pre - 8.9 m2								
No Asbestos								
B00I - R0013 - Staff Room - 4.49 m2								
No Asbestos								
B00I - R0015 - Cleaning Distributed Store - 4.59 m2								
No Asbestos								
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00I - R0016 - Staff Shower/Change - 10.6 m2								
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
No Asbestos								
B00I - R0017 - General Storeroom - Pre - 2.77 m2								
No Asbestos								
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00I - R0018 - Movement - 20.02 m2								
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	2m2	South, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00J - Pre-School Facilities - 1965 - Brick/Veneer								
Exterior								

Ceiling Voids - Flat Roof	No Asbestos Found							
Underfloor Voids - Slab on Ground	No Asbestos Found							
Interior								
B00J - R0001 - P.E. Store - 12.25 m2								
No Asbestos								
B00J - R0002 - Movement - 3.11 m2								
Ceiling Structures/Linings	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00K - Building Services - 2004 - Metal Shed								
Exterior								
Underfloor Voids - Slab on Ground	No Asbestos Found							
Ceiling Voids	No Asbestos Found							
Interior								
B00K - R0001 - General Assistant/Bulk Store - 57.88 m2								
No Asbestos								

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020