


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Frenchs Forest Public School (1946)
Region:	Northern Sydney AMU
State Electorate:	Davidson
Local Government Area:	Northern Beaches

Last Reviewed By:	Greencap 13-AUG-2014
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.	

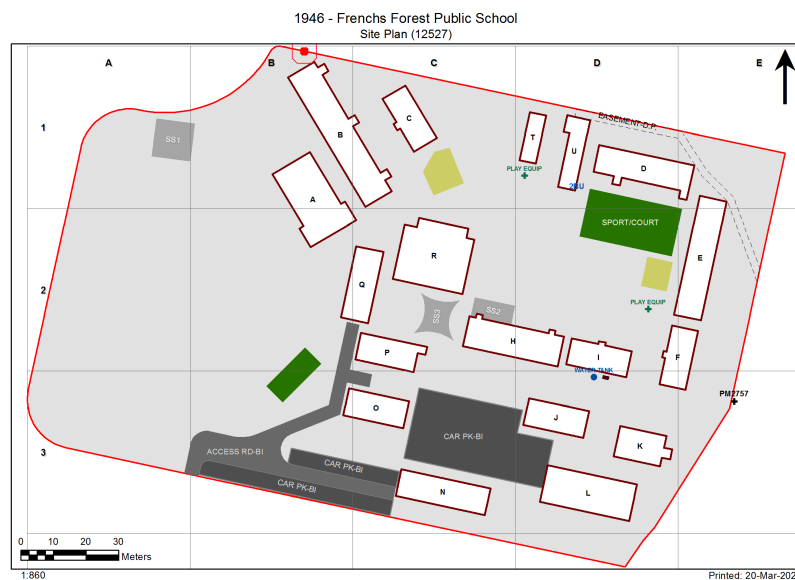

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Pupil Facilities - 1963 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00A - R0001 - Communal Space - 215.89 m2							
No Asbestos							
B00A - R0002 - Movement - 3.84 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0003 - Movement - 4.83 m2							
No Asbestos							
B00A - R0004 - Staff Kitchen - 14.51 m2							
No Asbestos							
B00A - R0005 - Staff Toilet - 3.99 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0006 - Staff Toilet - 3.99 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0007 - General Storeroom - 14.51 m2							
No Asbestos							
B00A - R0008 - Movement - 4.82 m2							
No Asbestos							
B00A - R0009 - Raised Platform - 55.22 m2							
No Asbestos							
B00A - R0010 - Movement - 3.84 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00B - General Learning - 1959 - Concrete Framed							
Exterior							
Eaves Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting	12m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Interior							
B00B - R0001 - Movement - 5.13 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0002 - General Storeroom - 18.89 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
B00B - R0003 - Cleaning Distributed Store - .93 m2							
No Asbestos							
B00B - R0004 - General Storeroom - 2.55 m2							
No Asbestos							
B00B - R0005 - Movement - 14.76 m2							
No Asbestos							

B00B - R0006 - Personal Effects Storage - 3.42 m2							
No Asbestos							
B00B - R0007 - Home Base Store - 7.89 m2							
No Asbestos							
B00B - R0008 - Home Base - 65.15 m2							
No Asbestos							
B00B - R0009 - Home Base - 65.52 m2							
No Asbestos							
B00B - R0010 - Home Base Store - 7.92 m2							
No Asbestos							
B00B - R0011 - Personal Effects Storage - 3.28 m2							
No Asbestos							
B00B - R0012 - Movement - 7.84 m2							
No Asbestos							
B00B - R0013 - Movement - 5.12 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0014 - Personal Effects Storage - 3.28 m2							
No Asbestos							
B00B - R0015 - Home Base Store - 7.92 m2							
No Asbestos							
B00B - R0016 - Home Base - 65.52 m2							
No Asbestos							
B00B - R0017 - Home Base - 65.52 m2							
No Asbestos							
B00B - R0018 - Home Base Store - 7.97 m2							
No Asbestos							
B00B - R0019 - Personal Effects Storage - 3.44 m2							
No Asbestos							
B00B - R0020 - Interview - 29.01 m2							
No Asbestos							
B00B - R0021 - Interview - 13.31 m2							
No Asbestos							
B00B - R0022 - Movement - 11.46 m2							
No Asbestos							
B00B - R0023 - Movement - 5.15 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - General Learning - 1959 - Concrete Framed							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting	12m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Flat AC Sheeting	2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Interior							
B00C - R0001 - Home Base - 58.52 m2							
No Asbestos							
B00C - R0002 - Home Base Store - 6.66 m2							
No Asbestos							

B00C - R0003 - Personal Effects Storage - 3.46 m2							
No Asbestos							
B00C - R0004 - Movement - 6.42 m2							
No Asbestos							
B00C - R0005 - Movement - 1.75 m2							
No Asbestos							
B00C - R0006 - Personal Effects Storage - 3.46 m2							
No Asbestos							
B00C - R0007 - Home Base Store - 6.66 m2							
No Asbestos							
B00C - R0008 - Home Base - 58.92 m2							
No Asbestos							
B00D - General Learning - 1959 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting	12m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Interior							
B00D - R0001 - Movement - 4.73 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00D - R0002 - Movement - 3.2 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R0003 - Personal Effects Storage - 3.2 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R0004 - Practical Activities - 1hb - 7.79 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R0005 - Home Base - 55.77 m2							
No Asbestos							
B00D - R0006 - Home Base - 84.63 m2							
No Asbestos							
B00D - R0007 - Practical Activities - 1hb - 3.93 m2							
Furniture / Fixtures	Vinyl Lining						
B00D - R0008 - Personal Effects Storage - 5.65 m2							
Electrical - Mounting Board	Flat AC Sheeting	1	Lower portion	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)
B00D - R0009 - Cleaning Distributed Store - .32 m2							
No Asbestos							
B00D - R0010 - Movement - 5.7 m2							
No Asbestos							
B00D - R0011 - Movement - 4.83 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00D - R0013 - Toilets - Boys/Girls - 3.21 m2							
Wall Linings Internal	Flat AC Sheeting	4m2	All surfaces	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0016 - Home Base - 50.71 m2							
No Asbestos							
B00E - General Learning - 1959 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting	12m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00E - R0001 - Home Base - 57.51 m2							
No Asbestos							
B00E - R0003 - Movement - 6.54 m2							
No Asbestos							
B00E - R0004 - Movement - 1.56 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00E - R0006 - Home Base - 57.36 m2							
No Asbestos							
B00E - R0007 - Home Base - 58.37 m2							
No Asbestos							
B00E - R0008 - Craft Store - 4.79 m2							
No Asbestos							
B00E - R0009 - Personal Effects Storage - 10.12 m2							
No Asbestos							
B00E - R0010 - Movement - 3.8 m2							
No Asbestos							
B00E - R0011 - Movement - 1.57 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00E - R0012 - Home Base Store - 4.79 m2							
No Asbestos							
B00E - R0013 - Home Base - 58 m2							
No Asbestos							
B00E - R0014 - Other - 6.47 m2							
No Asbestos							
B00E - R0015 - Other - 6.51 m2							
Electrical - Mounting Board	Flat AC Sheeting	6	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0016 - Home Base Store - 2.52 m2							
No Asbestos							
B00E - R0017 - Home Base Store - 2.63 m2							
No Asbestos							
B00F - General Learning - 1959 - Concrete							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting	12m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos

Underfloor Voids	AC Fragments/Debris	2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Interior							
B00F - R0004 - Movement - 1.38 m2							
No Asbestos							
B00F - R0007 - Home Base - 90.83 m2							
No Asbestos							
B00F - R0008 - Practical Activities - 1hb - 44.21 m2							
No Asbestos							
B00F - R0009 - Home Base Store - 2.98 m2							
No Asbestos							
B00F - R0010 - Home Base Store - 3.03 m2							
No Asbestos							
B00H - General Learning - 1963 - Concrete							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting	12m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids	Packing	5	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	AC Fragments/Debris	1	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Interior							
B00H - R0001 - Movement - 2.04 m2							
No Asbestos							
B00H - R0002 - Practical Activities - 1hb - 23.14 m2							
No Asbestos							
B00H - R0003 - Toilets - Boys/Girls - 1.91 m2							
No Asbestos							
B00H - R0004 - Home Base - 89.9 m2							
No Asbestos							
B00H - R0005 - Home Base - 65.73 m2							
No Asbestos							
B00H - R0006 - Practical Activities - 1hb - 11.73 m2							
No Asbestos							
B00H - R0007 - Special Programs Room - 18.8 m2							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Furniture / Fixtures	Vinyl Lining						
B00H - R0008 - Movement - 12.86 m2							
No Asbestos							
B00H - R0009 - General Storeroom - 1.8 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00H - R0010 - Kiln Room - 1.21 m2							
No Asbestos							
B00H - R0011 - General Storeroom - 17.51 m2							
No Asbestos							
B00H - R0012 - Disabled Toilet - 4.07 m2							

No Asbestos							
B00H - R0013 - Main Switch Board - 4.02 m2							
Electrical - Mounting Board	Flat AC Sheeting	1	North facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00H - R0014 - Movement - 6.86 m2							
No Asbestos							
B00H - R0015 - Movement - 1.95 m2							
No Asbestos							
B00I - General Learning - 1959 - Concrete							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting	12m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Interior							
B00I - R0002 - Home Base Store - 2.82 m2							
No Asbestos							
B00I - R0005 - Movement - 1.63 m2							
No Asbestos							
B00I - R0006 - Home Base Store - 2.82 m2							
No Asbestos							
B00I - R0008 - Home Base - 100.68 m2							
No Asbestos							
B00I - R0009 - Practical Activities - 1hb - 39.76 m2							
No Asbestos							
B00J - Other-After School Care - 1959 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting	12m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	Non Accessible Area						
Underfloor Voids	AC Fragments/Debris						
Interior							
B00J - R0001 - Special Programs Room - 56.61 m2							
No Asbestos							
B00J - R0002 - Out Of School Hours Care Centre - 5.13 m2							
No Asbestos							
B00J - R0003 - Out Of School Hours Care Centre - 6.66 m2							
No Asbestos							
B00J - R0004 - Out Of School Hours Care Centre - 7.77 m2							
No Asbestos							
B00J - R0005 - Out Of School Hours Care Centre - 1.58 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00J - R0006 - Out Of School Hours Care Centre - 5.13 m2							
No Asbestos							
B00J - R0007 - Special Programs Room - 56.76 m2							
No Asbestos							
B00K - General Learning - 1959 - Brick/Veneer							

Exterior							
Eaves Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Gable Ends	Flat AC Sheeting	12m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Cladding	Flat AC Sheeting	12m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Interior							
B00K - R0001 - Staff Toilet - 1.6 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Crocidolite (blue asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00K - R0002 - Cleaning Distributed Store - 4.54 m2							
No Asbestos							
B00K - R0003 - Movement - .86 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00K - R0004 - Movement - 2.15 m2							
No Asbestos							
B00K - R0005 - Toilets - Boys/Girls - 3.11 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Crocidolite (blue asbestos)
Wall Linings Internal	Flat AC Sheeting	4m2	South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00K - R0006 - Withdrawal Space - 1hb - 67.14 m2							
Floor Coverings Res/Textile	Vinyl Tiles	67m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0007 - General Storeroom - 6.51 m2							
No Asbestos							
B00K - R0008 - Withdrawal Space - 1hb - 25.68 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0009 - Movement - 6.97 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Crocidolite (blue asbestos)
B00K - R0010 - General Storeroom - 10.02 m2							
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - Other-Non-Govt Pre-School - 1959 - Brick/Block							
Exterior							
Gable Ends	Flat AC Sheeting	12m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Cladding	Flat AC Sheeting						
Underfloor Voids	No Asbestos Found						
Ceiling Voids	Non Accessible Area						
Interior							
B00L - R0001 - Other-Non Government Pre-Sch - 1.27 m2							

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00L - R0002 - Other-Non Government Pre-Sch - 6.77 m2							
No Asbestos							
B00L - R0003 - Other-Non Government Pre-Sch - 1.6 m2							
No Asbestos							
B00L - R0004 - Other-Non Government Pre-Sch - 56.99 m2							
No Asbestos							
B00L - R0005 - Other-Non Government Pre-Sch - 3.53 m2							
No Asbestos							
B00L - R0006 - Other-Non Government Pre-Sch - 62.22 m2							
Wall Linings Internal	Flat AC Sheeting						
Partition Walls (Cubicles)	Flat AC Sheeting						
B00L - R0007 - Other-Non Government Pre-Sch - 56.52 m2							
No Asbestos							
B00L - R0008 - Other-Non Government Pre-Sch - 10.71 m2							
No Asbestos							
B00L - R0009 - Other-Non Government Pre-Sch - 8.01 m2							
No Asbestos							
B00L - R0010 - Other-Non Government Pre-Sch - 6.32 m2							
No Asbestos							
B00L - R0011 - Other-Non Government Pre-Sch - 1.58 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00L - R0012 - Other-Non Government Pre-Sch - 56.92 m2							
No Asbestos							
B00L - R0013 - Other-Non Government Pre-Sch - 9.08 m2							
No Asbestos							
B00L - R0014 - Other-Non Government Pre-Sch - 8.12 m2							
No Asbestos							
B00N - Other-Commercial - 1959 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting	12m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00N - R0001 - Other-Commercial - 1.27 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00N - R0002 - Other-Commercial - 6.73 m2							
No Asbestos							
B00N - R0003 - Other-Commercial - 5.24 m2							
No Asbestos							
B00N - R0004 - Other-Commercial - 56.16 m2							
No Asbestos							
B00N - R0005 - Other-Commercial - 56.16 m2							
No Asbestos							
B00N - R0006 - Other-Commercial - 5.13 m2							

No Asbestos							
B00N - R0007 - Other-Commercial - 6.62 m2							
No Asbestos							
B00N - R0008 - Other-Commercial - 7.66 m2							
No Asbestos							
B00N - R0009 - Other-Commercial - 1.53 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00N - R0010 - Other-Commercial - 5.13 m2							
No Asbestos							
B00N - R0011 - Other-Commercial - 56.54 m2							
No Asbestos							
B00O - Other-Commercial - 1959 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00O - R0001 - Other-Commercial - 57.77 m2							
No Asbestos							
B00O - R0002 - Other-Commercial - 5.17 m2							
No Asbestos							
B00O - R0003 - Other-Commercial - 8.46 m2							
No Asbestos							
B00O - R0004 - Other-Commercial - 4.71 m2							
No Asbestos							
B00O - R0005 - Other-Commercial - 1.63 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00O - R0006 - Other-Commercial - 5.17 m2							
No Asbestos							
B00O - R0007 - Other-Commercial - 57.77 m2							
No Asbestos							
B00P - General Learning - 1959 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting	12m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Interior							
B00P - R0001 - Movement - 4.58 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00P - R0002 - Movement - 6.61 m2							
No Asbestos							
B00P - R0003 - General Storeroom - 21.52 m2							
Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00P - R0004 - Home Base - 85.9 m2							
No Asbestos							

B00P - R0005 - Sports Store - 22.54 m2							
Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00Q - Pupil Facilities - 1959 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Ends	Flat AC Sheeting	12m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Interior							
B00Q - R0001 - Staff Toilet - 1.92 m2							
No Asbestos							
B00Q - R0002 - Canteen Office/Store - 2.15 m2							
No Asbestos							
B00Q - R0003 - Movement - 5.22 m2							
No Asbestos							
B00Q - R0004 - Canteen - 22.85 m2							
No Asbestos							
B00Q - R0005 - Movement - 84.71 m2							
Ceiling Structures/Linings	Flat AC Sheeting	85m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00Q - R0006 - Toilets - Boys - 16.7 m2							
No Asbestos							
B00Q - R0007 - Toilets - Girls - 16.7 m2							
No Asbestos							
B00Q - R0008 - Cleaning Supplies - 10.93 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00Q - R0009 - General Assistant/Bulk Store - 10.93 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00R - Administration/Library - 1959 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	70m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	No Asbestos Found						
Ceiling Voids	Non Accessible Area						
Interior							
B00R - R0001 - Staff Room Annexe - 13.62 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00R - R0002 - Deputy Principal - 13.62 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00R - R0003 - Duplicating Workroom - 13.53 m2							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00R - R0004 - Staff Toilet - 10.15 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00R - R0005 - Staff Toilet - 6.68 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00R - R0006 - Deputy Principal - 17.09 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00R - R0007 - Movement - 18.92 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00R - R0008 - Distribution Board - 1.33 m2 Note: No inspection of live electrical installation							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00R - R0009 - General Storeroom - 20.06 m2							
Floor Coverings Res/Textile	Vinyl Tiles	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00R - R0010 - Cleaning Distributed Store - 6.49 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00R - R0011 - Security Store - 11.08 m2							
Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00R - R0012 - Movement - 21.97 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00R - R0013 - Movement - .81 m2							
No Asbestos							
B00R - R0014 - Deputy Principal - 16.03 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00R - R0015 - Sick Bay - 10.23 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00R - R0016 - Principal - 21.03 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00R - R0017 - Clerical Office - 15.55 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00R - R0018 - Entry Vestibule - 16.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00R - R0019 - Movement - 4.25 m2							
No Asbestos							
B00R - R0020 - Staff Room - 99.57 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00R - R0021 - Movement - 36.98 m2							
No Asbestos							
B00R - R1001 - Movement - 41.64 m2							
Ceiling Structures/Linings	Flat AC Sheeting	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00R - R1002 - Staff Toilet - 3.74 m2							
No Asbestos							
B00R - R1003 - Cleaning Distributed Store - 2.47 m2							
No Asbestos							
B00R - R1004 - Staff Toilet - 3.76 m2							
No Asbestos							
B00R - R1005 - Distribution Board - .82 m2							
No Asbestos							
Note: No inspection of live electrical installation							
B00R - R1006 - K.L.A. Store - 20.05 m2							
No Asbestos							
B00R - R1007 - Library Office/Workroom - 6.35 m2							
No Asbestos							
B00R - R1008 - Security Store - 13.62 m2							
No Asbestos							
B00R - R1012 - Reading Area - 228.43 m2							
No Asbestos							
B00R - R1013 - Special Programs Room - 68.03 m2							
No Asbestos							
B00T - Building Services - 1959 - Concrete							
Exterior							
Eaves Linings	Flat AC Sheeting	25m2	All surfaces	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Gable Ends	Flat AC Sheeting	8m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Cladding	Flat AC Sheeting	6m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Interior							
B00T - R0001 - Garden Store - 72.76 m2							

Ceiling Structures/Linings	Flat AC Sheeting	73m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00U - Pupil Facilities - 1975 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	25m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00U - R0001 - Toilets - Girls - 36.33 m2							
Plumbing / Pipework	Insulation Material	0.1	Incinerette	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	37m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00U - R0002 - Handwashing Facilities - 13.76 m2							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00U - R0003 - Handwashing Facilities - 29.3 m2							
Ceiling Structures/Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00U - R0004 - Toilets - Boys - 30.41 m2							
Ceiling Structures/Linings	Flat AC Sheeting	31m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020