


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Falconbridge Public School (4354)
Region:	Western Sydney AMU
State Electorate:	Blue Mountains
Local Government Area:	Blue Mountains

Last Reviewed By:	Greencap 22-JUN-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

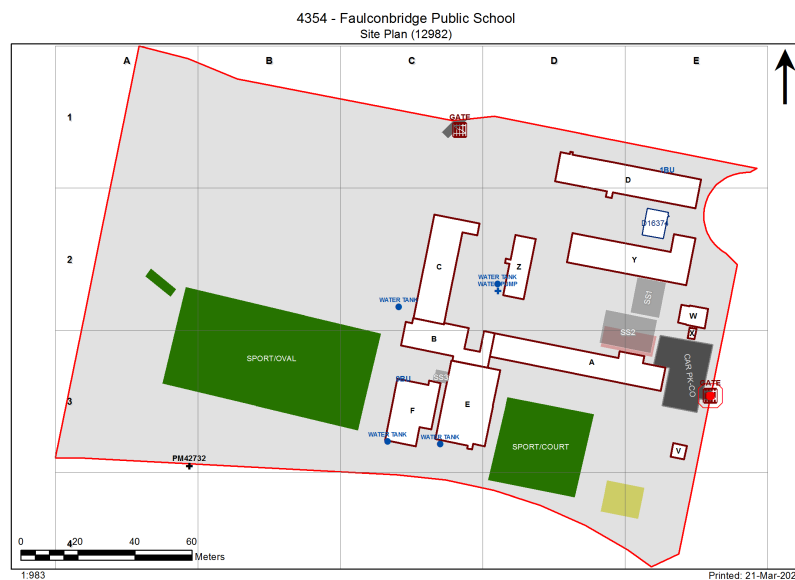

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration/General Learning - 1963 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	80m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Flat AC Sheeting	1	East	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Assumed Asbestos
Window	Mastic						
External Wall Structure	Mastic	100	All exterior windows	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Compressed AC Sheet						
Interior							
B00A - R0001 - Movement - 10.4 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00A - R0002 - Clerical Office - 10.61 m2							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	10.61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10.61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0003 - Principal - 20.75 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	20.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0004 - Sick Bay - 13.57 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	13.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0005 - General Storeroom - 8.22 m2							
No Asbestos							
B00A - R0006 - Movement - 29.47 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	29.47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	29.47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0007 - Duplicating Workroom - 20.19 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20.19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	20.19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0008 - Cleaning Distributed Store - 2.3 m2							
No Asbestos							
B00A - R0009 - Staff Room - 36.31 m2							
No Asbestos							
B00A - R0010 - Staff Toilet - 3.64 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3.64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00A - R0011 - Staff Toilet - 3.6 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00A - R0012 - Clerical Office - 11.65 m2							
No Asbestos							

B00A - R0014 - Movement - 1.68 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0016 - Communications Room - 10.75 m2							
No Asbestos							
B00A - R0017 - Home Base - 56.65 m2							
No Asbestos							
B00A - R0018 - Home Base Store - 4.83 m2							
No Asbestos							
B00A - R0019 - General Storeroom - 7.93 m2							
No Asbestos							
B00A - R0020 - Movement - 5.97 m2							
No Asbestos							
B00A - R0021 - Movement - 1.7 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0022 - Cleaning Distributed Store - .67 m2							
No Asbestos							
B00A - R0023 - Home Base Store - 4.83 m2							
No Asbestos							
B00A - R0024 - Home Base - 55.4 m2							
Plant / Equipment - Thermacon Heater	Millboard	3	South, West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0025 - Staff Room Annexe - 27.9 m2							
No Asbestos							
B00A - R0026 - Movement - 19.02 m2							
No Asbestos							
B00A - R0027 - Interview - 19.15 m2							
No Asbestos							
B00A - R0028 - Principal - 19.05 m2							
No Asbestos							
B00A - R0029 - Entry Vestibule - 25.8 m2							
No Asbestos							
B00A - R0030 - Clerical Office - 21.47 m2							
No Asbestos							
B00A - R0031 - Staff Toilet - 3.56 m2							
No Asbestos							
B00A - R0032 - Clerical Office - 14.47 m2							
No Asbestos							
B00A - R0033 - Movement - 2.18 m2							
No Asbestos							
B00A - R0034 - Home Base Store - .52 m2							
No Asbestos							
B00B - General Learning - 1963 - Brick/Veneer							
Exterior							
Ceiling Voids	Non Accessible Area						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Wall Linings Internal - Infill	Compressed AC Sheet						
Gable Verge Lining	Compressed AC Sheet						
Interior							
B00B - R0002 - Movement - 29.41 m2							

Wall Linings Internal - Infill	Flat AC Sheeting							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	2m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0003 - Home Base - 67.01 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	67.01m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	67.01m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0004 - Practical Activities - 1hb - 3.61 m2								
No Asbestos								
B00B - R0005 - Home Base - 67.01 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	67.01m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	67.01m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0006 - Practical Activities - 1hb - 3.61 m2								
No Asbestos								
B00B - R0007 - Cleaning Distributed Store - .79 m2								
Non Accessible								
B00B - R0008 - General Storeroom - 3.38 m2								
No Asbestos								
B00B - R0009 - External Movement - 107.19 m2								
No Asbestos								
B00C - General Learning/Communal Facilities - 1963 - Brick/Block								
Exterior								
Underfloor Voids	No Asbestos Found							
Gable Verge Lining	Compressed AC Sheet							
Ceiling Voids	No Asbestos Found							
Window	Mastic	2	North facing	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Assumed Asbestos	
Interior								
B00C - R0001 - Movement - 73.87 m2								
Ceiling Structures/Linings	Flat AC Sheeting	74m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Wall Linings Internal - Infill	Flat AC Sheeting							
B00C - R0002 - Home Base - 65.13 m2								
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	65.13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R0003 - Practical Activities - 1hb - 3.61 m2								
No Asbestos								
B00C - R0004 - Practical Activities - 1hb - 15.84 m2								
No Asbestos								
B00C - R0005 - Special Programs Room - 55.04 m2								
No Asbestos								
B00C - R0006 - Home Base - 54.65 m2								
No Asbestos								
B00C - R0007 - Practical Activities - 1hb - 15.84 m2								
No Asbestos								
B00C - R0008 - Practical Activities - 1hb - 15.84 m2								
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	15.84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0009 - Home Base - 54.88 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54.88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	54.88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0010 - Stairs - 6.02 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R9001 - Raised Platform - 26.08 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00C - R9002 - Practical Activities - 147.87 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00C - R9003 - Movement - 2.24 m2							
No Asbestos							
B00C - R9004 - Movement - 2.24 m2							
No Asbestos							
B00C - R9005 - Movement - 2.24 m2							
No Asbestos							
B00C - R9006 - Movement - 2.24 m2							
No Asbestos							
B00C - R9007 - Cleaning Distributed Store - 5.54 m2							
No Asbestos							
B00C - R9008 - Movement - 3.64 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R9009 - Music Store - 11.22 m2							
No Asbestos							
B00C - R9010 - Distribution Board - 1.05 m2							
						Note: No inspection of live electrical installation	
Electrical - Mounting Board	Resinous Membrane	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00C - R9011 - Stairs - 7.65 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - General Learning/Communal Facilities - 1963 - Brick/Block							
Exterior							
Underfloor Voids	Non Accessible Area						
Gable Verge Lining	Compressed AC Sheet						
Ceiling Voids	No Asbestos Found						
Interior							
B00D - R0001 - Toilets - Boys - 34.88 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0002 - Toilets - Girls - 34.88 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0003 - Personal Effects Storage - 7.39 m2							
No Asbestos							

B00D - R0004 - No Access - 2.98 m2							
No Asbestos							
B00D - R0005 - Home Base - 80.96 m2							
No Asbestos							
B00D - R0006 - Toilets - Boys/Girls - 3.2 m2							
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0007 - Practical Activities - 1hb - 3.61 m2							
No Asbestos							
B00D - R0008 - Home Base - 56.59 m2							
No Asbestos							
B00D - R0009 - Home Base Store - 6.32 m2							
No Asbestos							
B00D - R0010 - Personal Effects Storage - 7.39 m2							
Electrical - Mounting Board	Fibrous Membrane	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R0011 - Movement - 4.87 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	4.87m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0012 - General Storeroom - 21.18 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	21.18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Window	Mastic						
B00D - R0013 - Interview - 14.05 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14.05m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	14.05m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0014 - Practical Activities - 1hb - 15.74 m2							
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	15.74m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0015 - Home Base - 52.73 m2							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	52.73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0016 - Movement - 93.71 m2							
Ceiling Structures/Linings	Flat AC Sheeting	94m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Compressed AC Sheet						
B00D - R0017 - Stairs - 6.28 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R9001 - General Storeroom - 12.87 m2							
No Asbestos							
B00D - R9002 - Practical Activities - 128.24 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00D - R9003 - Movement - 2.22 m2							

No Asbestos								
B00D - R9004 - Movement - 2.22 m2								
No Asbestos								
B00D - R9005 - Movement - 2.22 m2								
No Asbestos								
B00D - R9006 - Movement - 2.22 m2								
No Asbestos								
B00D - R9007 - Movement - 9.3 m2								
No Asbestos								
B00D - R9008 - Cleaning Distributed Store - 3.65 m2								
No Asbestos								
B00D - R9009 - General Storeroom - 12.99 m2								
Ceiling Structures/Linings	Flat AC Sheeting	12.99m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R9010 - Stairs - 7.09 m2								
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - Pupil Facilities/Communal Facilities - 2010 - Brick/Veneer								
Exterior								
Ceiling Voids	No Asbestos Found							
Underfloor Voids - Slab on Ground	No Asbestos Found							
Interior								
B00E - R0001 - Communal Space - 148.92 m2								
No Asbestos								
B00E - R0002 - Raised Platform - 58.01 m2								
No Asbestos								
B00E - R0003 - Movement - 6.4 m2								
No Asbestos								
B00E - R0004 - Movement - 12.41 m2								
No Asbestos								
B00E - R0005 - Ramp - 11.98 m2								
No Asbestos								
B00E - R0006 - Hall Chair Store - 9.55 m2								
No Asbestos								
B00E - R0007 - Communal/Performance Store - 9.49 m2								
No Asbestos								
B00E - R0008 - P.E. Store - 13.05 m2								
No Asbestos								
B00E - R0009 - Toilet - Lobby - 2.3 m2								
No Asbestos								
B00E - R0010 - Toilets - Girls - 7.24 m2								
No Asbestos								
B00E - R0011 - Sound Cupboard - 2.07 m2								
No Asbestos								
B00E - R0012 - Toilet - Lobby - 3.16 m2								
No Asbestos								
B00E - R0013 - Toilets - Boys - 5.79 m2								
No Asbestos								
B00E - R0014 - Cleaning Distributed Store - 5.42 m2								
No Asbestos								
B00E - R0015 - Disabled Shower/Toilet - 6.87 m2								

No Asbestos							
B00E - R0016 - Main Switch Board - 3.17 m2							
No Asbestos							
B00E - R0017 - Covered Outdoor Learning Area - 157.32 m2							
No Asbestos							
B00E - R0018 - External Movement - 1.8 m2							
No Asbestos							
B00F - Library - 2011 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00F - R0001 - Reading Area - 167.3 m2							
No Asbestos							
B00F - R0002 - Library Office/Workroom - 23.89 m2							
No Asbestos							
B00F - R0003 - Communications Room - 8.08 m2							
No Asbestos							
B00F - R0004 - General Storeroom - 15.78 m2							
No Asbestos							
B00F - R0005 - Disabled Shower/Toilet - 5.97 m2							
No Asbestos							
B00F - R0006 - External Movement - 10.43 m2							
No Asbestos							
B00F - R0007 - External Movement - 68.31 m2							
No Asbestos							
B00V - Administration - 1967 - Timber							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids - Flat Roof	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	6m2	East & west	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Compressed AC Sheet						
Interior							
B00V - R0001 - Community Clinic - 6.7 m2							
Wall Linings Internal	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wnindow	Mastic						
B00V - R0002 - Community Clinic - 10.37 m2							
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00V - R0003 - Community Clinic - 3.85 m2							
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00W - Pupil Facilities - 1963 - Brick/Block							

Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground							
Interior							
B00W - R0005 - Canteen Covered Area - 18.37 m2							
No Asbestos							
B00W - R0006 - Canteen - 29.63 m2							
No Asbestos							
B00W - R0007 - Canteen Office/Store - 7.69 m2							
No Asbestos							
B00X - Electrical Services - 1963 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Window	Mastic						
Interior							
B00X - R0001 - Main Switch Board - 7.7 m2							
Electrical - Mounting Board	Resinous Membrane	1	Central north	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00Y - General Learning/Building Services - 1963 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	40m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Wall Linings Internal - Infill	Compressed AC Sheet	18	Northern lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Window	Mastic						
Gable Verge Lining	Compressed AC Sheet						
External Wall Structure	Mastic	100	Various throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00Y - R0001 - Outdoor Learning Area - 44.94 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Eave lining area	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Compressed AC Sheet	4m2	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00Y - R0002 - Toilets - Boys/Girls - 3.54 m2							
No Asbestos							
B00Y - R0003 - Home Base Store - 3.13 m2							
No Asbestos							
B00Y - R0004 - Personal Effects Storage - 6.52 m2							
No Asbestos							
B00Y - R0005 - Movement - 82.04 m2							
Ceiling Structures/Linings	Flat AC Sheeting	83m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Wall Linings Internal - Infill	Compressed AC Sheet	18m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00Y - R0006 - Home Base - 85.45 m2							
No Asbestos							
B00Y - R0007 - Home Base - 57.34 m2							
No Asbestos							
B00Y - R0008 - Home Base Store - 5.67 m2							
No Asbestos							
B00Y - R0009 - Personal Effects Storage - 4.45 m2							
Electrical - Mounting Board	Resinous Membrane	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00Y - R0010 - Movement - 26.67 m2							
No Asbestos							
B00Y - R0011 - Interview - 19.43 m2							
Floor Coverings Res/Textile	Vinyl Tiles	19.43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00Y - R0012 - General Storeroom - 9.32 m2							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00Y - R0013 - Toilets - Boys/Girls - 3.76 m2							
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Incinerator	Millboard	1	West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00Y - R0014 - General Storeroom - 3.23 m2							
Floor Coverings Res/Textile	Vinyl Tiles	3.23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00Y - R0015 - Other-Community Use - 20.73 m2							
Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00Y - R0016 - Cleaning Distributed Store - 3.34 m2							
Floor Coverings Res/Textile	Vinyl Tiles	3.34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00Y - R0017 - Movement - 3.32 m2							
No Asbestos							
B00Y - R0018 - Personal Effects Storage - 4.17 m2							
No Asbestos							
B00Y - R0019 - Home Base Store - 5.61 m2							
No Asbestos							
B00Y - R0020 - Special Programs Room - 57.35 m2							
No Asbestos							
B00Y - R9001 - General Assistant/Bulk Store - 23.01 m2							
Wall Linings Internal	Flat AC Sheeting	8m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00Y - R9002 - Sports Store - 16.6 m2							

Wall Linings Internal	Flat AC Sheeting	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00Z - Pupil Facilities - 1963 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00Z - R0001 - Toilets - Girls - 32.26 m2							
Partition Walls (Cubicles)	Flat AC Sheeting						
B00Z - R0002 - Movement - 41.21 m2							
No Asbestos							
B00Z - R0003 - Cleaning Distributed Store - 7.63 m2							
No Asbestos							
B00Z - R0005 - Cleaning Distributed Store - 7.55 m2							
No Asbestos							
B00Z - R0006 - Movement - 1.86 m2							
No Asbestos							
B00Z - R0007 - Disabled Shower/Toilet - 15.61 m2							
No Asbestos							
B00Z - R0008 - Toilets - Boys - 24.67 m2							
Partition Walls (Cubicles)	Flat AC Sheeting						
B00Z - R9001 - Garden Store - 14.51 m2							
No Asbestos							

Demountables

OS 602 16374 - Learning Unit - Standard With P.A.A. - Placement Date : 30-DEC-2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found