


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Fisher Road School (5405)
Region:	Northern Sydney AMU
State Electorate:	Wakehurst
Local Government Area:	Northern Beaches

Last Reviewed By:	WSP 15-SEP-2016
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

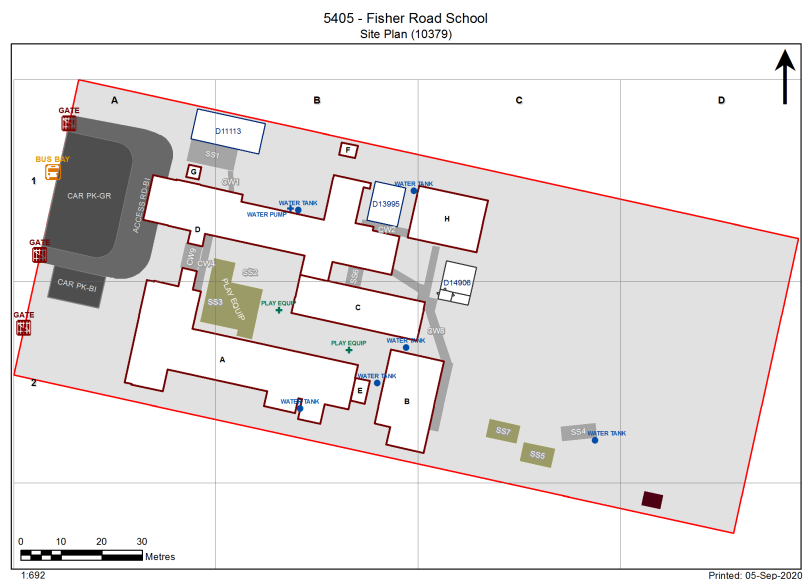

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration - 1971 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	35m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Interior							
B00A - R0003 - Staff Room - 32.03 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0004 - Cleaning Distributed Store - 7.23 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0005 - Movement - 2.7 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0006 - Entry Vestibule - 27.49 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0007 - External Movement - 51.01 m2							
Ceiling Structures/Linings	Flat AC Sheeting	51m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0008 - Clerical Office - 12.89 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0009 - General Storeroom - 12.03 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0010 - Duplicating Workroom - 12.62 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0011 - Staff Toilet - 4.96 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0012 - Staff Toilet - 5.55 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0013 - Movement - 4.79 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00A - R0014 - Deputy Principal - 15.65 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00A - R0015 - Principal - 15.74 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00A - R0016 - Home Base - M - 46.02 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00A - R0017 - Practical Activities - M - 1hb - 7.87 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00A - R0018 - Home Base Store - M - 4.58 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R0019 - Shower/Change - 5.69 m2								
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R0020 - Toilets - Girls - 11.28 m2								
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R0021 - Handwashing Facilities - 14.95 m2								
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R0022 - Cleaning Distributed Store - .8 m2								
Ceiling Structures/Linings	Flat AC Sheeting							
B00A - R0023 - Home Base Store - M - 3.78 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R0024 - Practical Activities - M - 1hb - 6.61 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00A - R0025 - Home Base - M - 45.82 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R0030 - Home Base - M - 44.09 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R0031 - Distribution Board - .77 m2								
Note: No inspection of live electrical installation								

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0032 - Practical Activities - M - 1hb - 4.84 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0033 - Home Base Store - M - 6.31 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0034 - Practical Activities - M - 1hb - 4.79 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0038 - Home Base - M - 46.02 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0040 - Toilets - Boys - 11.92 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0041 - Main Switch Board - 6.86 m2							
Electrical - Mounting Board	Resinous Board	2	South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0042 - Staff Room - 7.67 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0043 - Staff Toilet - 20.35 m2							
Ceiling Structures/Linings	No Asbestos Found						
B00A - R0045 - Access Shower/Toilet - 8.94 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0046 - Access Shower/Toilet - 5.34 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0047 - Movement - 4.6 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0048 - Access Shower/Toilet - 14.3 m2							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0050 - External Movement - 133.78 m2							
Ceiling Structures/Linings	Flat AC Sheeting	130m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00A - R0052 - External Movement - 22.77 m2							
No Asbestos							
B00A - R0053 - Staff Room - 18.83 m2							
Require Inspection							
B00A - R0054 - Staff Kitchen - 4.83 m2							
Require Inspection							
B00A - R0055 - External Movement - 50.26 m2							
Require Inspection							
B00A - R0056 - External Movement - 28.31 m2							
Require Inspection							
B00B - Pupil Facilities - 1971 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting						
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Interior							
B00B - R0001 - Hydrotherapy - Pool - 235.63 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00B - R0003 - Shower/Change - 18.66 m2							
No Asbestos							
B00B - R0004 - Shower/Change - 18.66 m2							
No Asbestos							
B00C - General Learning - 1971 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Interior							
B00C - R0001 - Toilets - Boys - 17.27 m2							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0002 - Toilets - Girls - 12.33 m2							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0003 - Laundry - Type 2 - 6.01 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00C - R0004 - Toilets - Boys/Girls - 4.48 m2								
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R0006 - General Storeroom - 7.78 m2								
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R0007 - General Storeroom - 6.74 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R0008 - Distribution Board - .87 m2								
Note: No inspection of live electrical installation								
No Asbestos								
B00C - R0009 - Special Programs Room - 61.23 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00C - R0012 - External Movement - 63.04 m2								
Ceiling Structures/Linings	Flat AC Sheeting	63m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R0013 - Access Shower/Toilet - Type 2 - 8.85 m2								
No Asbestos								
B00C - R0014 - Practical Activities - P - 1hb - 68.71 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles	69m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R0015 - Disabled Shower/Toilet - 16.85 m2								
No Asbestos								
B00D - General Learning - 1971 - Brick/Block								
Exterior								
Ceiling Voids - Raked Ceiling	Non Accessible Area							
Underfloor Voids - Slab on Ground	No Asbestos Found							
Eaves Linings	Flat AC Sheeting	120m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
Gable Verge Lining	Flat AC Sheeting	30m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
Interior								
B00D - R0002 - Home Base - M - 46.13 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R0003 - Home Base Store - M - 4.01 m2								

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R0004 - Practical Activities - M - 1hb - 8.39 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00D - R0005 - Shower/Change - 3.92 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00D - R0006 - Toilet - M - 4.55 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00D - R0007 - Cleaning Distributed Store - 2.31 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	3m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)	Assumed Asbestos	
B00D - R0008 - Toilet - M - 5.17 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00D - R0009 - Disabled Toilet - 3.45 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00D - R0010 - Movement - 14.92 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0011 - Practical Activities - M - 1hb - 8.39 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00D - R0012 - Home Base Store - M - 4.01 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R0013 - Home Base - M - 46.57 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R0014 - Withdrawal - M - 12.89 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0015 - Home Base Store - M - 12.64 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R0016 - Home Base - M - 65.9 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00D - R0017 - Distribution Board - .59 m2 Note: No inspection of live electrical installation								
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	

Electrical - Mounting Board	Resinous Board	1	East facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R0018 - Sports Store - 5.88 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00D - R0019 - Cleaning Distributed Store - 2.35 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00D - R0020 - General Assistant/Bulk Store - 12.19 m2							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0021 - Movement - 79.6 m2							
Ceiling Structures/Linings	Flat AC Sheeting	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0022 - External Movement - 19.26 m2							
Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0023 - Canteen - 19.76 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Tiles	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0024 - Canteen Office/Store - 2.71 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	3m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0025 - Staff Toilet - 5.22 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	6m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Tiles	3m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0026 - Covered Vehicle Area/Porte Cochere - 67.3 m2							
Ceiling Structures/Linings	Flat AC Sheeting	68m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0028 - Toilets - Boys - 16.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R0029 - Toilets - Girls - 16.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	17m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)	Assumed Asbestos
B00D - R0030 - External Movement - 13.16 m2							
No Asbestos							
B00D - R0031 - External Movement - 3.96 m2							
No Asbestos							
B00D - R0032 - Covered Outdoor Learning Area - 52.66 m2							
No Asbestos							
B00D - R0033 - External Movement - 169.44 m2							

Require Inspection

B00E - Administration - 1971 - Metal Shed

Exterior

Ceiling Voids - Raked Ceiling

No Asbestos Found

Underfloor Voids - Slab on Ground

No Asbestos Found

Interior

B00E - R0001 - General Storeroom - 18.88 m2

No Asbestos

B00F - Building Services - 2008 - Fibre Cement Clad

Exterior

Underfloor Voids - Slab on Ground

No Asbestos Found

Ceiling Voids

No Asbestos Found

Interior

B00F - R0001 - Garden Store - 11.8 m2

No Asbestos

B00G - Pupil Facilities - 2008 - Metal Shed

Exterior

Underfloor Voids - Slab on Ground

No Asbestos Found

Ceiling Voids

No Asbestos Found

Interior

B00G - R0001 - General Storeroom - 8.41 m2

No Asbestos

B00H - General Learning - 2010 - Fibre Cement Clad

Exterior

Underfloor Voids - Slab on Ground

No Asbestos Found

Ceiling Voids

No Asbestos Found

Interior

B00H - R0001 - External Movement - 38.5 m2

No Asbestos

B00H - R0002 - Practical Activities - 1hb - 19.37 m2

No Asbestos

B00H - R0003 - Home Base Store - 5.72 m2

No Asbestos

B00H - R0004 - Home Base - 58.79 m2

No Asbestos

B00H - R0005 - Withdrawal Space - 2hb - 10.68 m2

No Asbestos

B00H - R0006 - Home Base - 58.69 m2

No Asbestos

B00H - R0007 - Home Base Store - 5.72 m2

No Asbestos

B00H - R0008 - Practical Activities - 1hb - 19.37 m2

No Asbestos

Demountables**OS 533 11113 - Library/Group Study/Office/A V Store - Placement Date : 30-JUN-1995****Exterior**

Eaves Linings	Flat AC Sheeting	20.16m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Clerical Office**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

R2- Staff Room

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Assumed Asbestos
----------------------------	------------------	------	------------------

R3- Security Store

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos
----------------------------	------------------	-----	------------------

R4- Principal

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Assumed Asbestos
----------------------------	------------------	------	------------------

R5- Staff Toilet

Toilet Partitions	Compressed AC Sheet	4m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Assumed Asbestos

R6- Staff Toilet

Toilet Partitions	Compressed AC Sheet	4m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Assumed Asbestos

R7- Reading Area

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Assumed Asbestos
----------------------------	------------------	------	------------------

R8- Entry

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Assumed Asbestos

OS 601 13995 - Learning Unit - Standard/Withdrawal - Placement Date : 30-JUN-1995**Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Entry**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

R2- General Learning Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

R3- Store

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

OS 601 14906 - Learning Unit - Standard/Withdrawal - Placement Date : 29-APR-2000**Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Entry**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

R2- General Learning Space			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos
R3- Store			
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos