


# Asbestos Register

(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Finley High School (8360)</b>
<b>Region:</b>	<b>Southern NSW AMU</b>
<b>State Electorate:</b>	<b>Murray</b>
<b>Local Government Area:</b>	<b>Berrigan</b>

<b>Last Reviewed By:</b>	<b>WSP 28-FEB-2017</b>
<b>Last Revised By:</b>	<b>WSP 28-AUG-2020</b>

Historical Fibro In Grounds Investigations/Events	<b>No</b>
No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.	

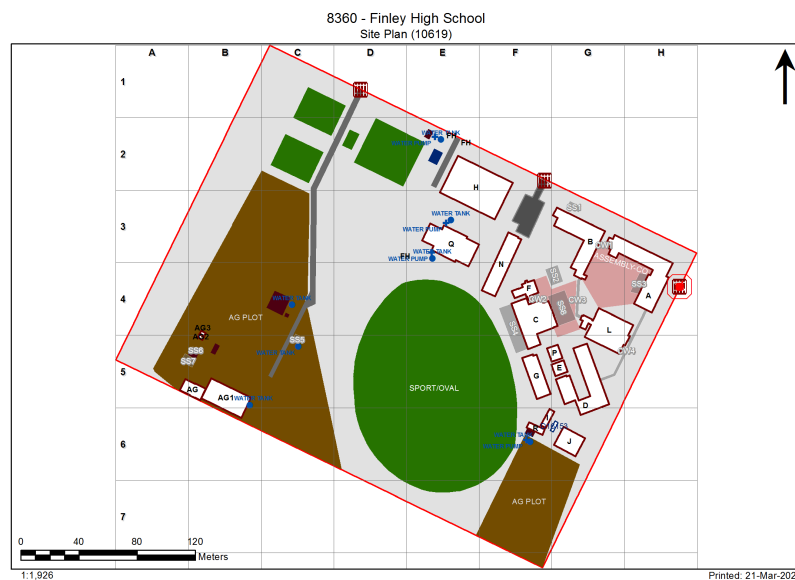

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

### Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

### Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

### Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

#### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - Various - 1958 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00A - R0001 - Plant - 6.49 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00A - R0002 - Distribution Board Cupboard - 8.39 m2</b> <span style="float: right;"><b>Note: No inspection of live electrical installation</b></span>							
Electrical - Mounting Board	Resinous Board	1	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00A - R0003 - Movement - 30.32 m2</b>							
No Asbestos							
<b>B00A - R0005 - Leading Teacher - 19.4 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0006 - General Storeroom - 9.15 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0007 - Staff - Toilet - 1.31 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0008 - General Storeroom - 4.24 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0009 - Cleaning Store - Distributed - 2.04 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0010 - Distribution Board Cupboard - .82 m2</b> <span style="float: right;"><b>Note: No inspection of live electrical installation</b></span>							
No Asbestos							
<b>B00A - R0011 - Principal Office - 19.34 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0012 - Interview/Office - Type 1 - 19.39 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0013 - Deputy Principal Office - 15.89 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0014 - Administration - Clerical - 15.89 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0017 - Cleaning Store - Distributed - 2.8 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0019 - Commonroom - 64.14 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R0020 - Ancillary Staff - 14.68 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						

<b>B00A - R0021 - Administration - Clerical - 19.44 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00A - R0024 - Movement - 8.4 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00A - R0025 - Distribution Board Cupboard - .78 m2</b>		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00A - R0026 - Cleaning Store - Distributed - 3.06 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00A - R0027 - Laboratory L.S. - 92.86 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )	
<b>B00A - R0028 - Apparatus Store - 9.86 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00A - R0029 - Preparation - 28.82 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00A - R0030 - General Storeroom - 6.24 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00A - R0031 - Cleaning Store - Distributed - 6.19 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00A - R0032 - General Storeroom - 12.77 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00A - R0033 - Staff Study - 38.81 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
Wall Linings Internal	Flat AC Sheeting	
<b>B00A - R0034 - Duplicating Workroom - 47.12 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
Wall Linings Internal	No Asbestos Found	
<b>B00A - R0035 - Administration - Clerical - 19 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00A - R0036 - Clinic - Boys - 12.78 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00A - R0037 - Stairs - 1.8 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00A - R0038 - Stairs - 8.52 m2</b>		
Ceiling Structures/Linings	No Asbestos Found	
<b>B00A - R0039 - External Movement - 8 m2</b>		
No Asbestos		
<b>B00A - R0040 - Movement - 89.03 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )	
<b>B00A - R0041 - Toilet - Lobby - 5.51 m2</b>		
No Asbestos		
<b>B00A - R0042 - Toilet - Lobby - 5.52 m2</b>		

No Asbestos							
<b>B00A - R0043 - Staff - Toilet - 1.89 m2</b>							
No Asbestos							
<b>B00A - R0044 - Staff - Toilet - 1.88 m2</b>							
No Asbestos							
<b>B00A - R0045 - Movement - 7.28 m2</b>							
No Asbestos							
<b>B00A - R0046 - Movement - 28.66 m2</b>							
No Asbestos							
<b>B00A - R0047 - External Movement - 60.98 m2</b>							
No Asbestos							
<b>B00A - R1001 - Computer Learning Space - 52.53 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - ( X5 )						
<b>B00A - R1003 - General Storeroom - 8.46 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00A - R1004 - Distribution Board Cupboard - .75 m2</b>							
							<b>Note: No inspection of live electrical installation</b>
No Asbestos							
<b>B00A - R1005 - General Storeroom - 3.08 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00A - R1006 - Resources Store - 6.19 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00A - R1007 - Darkroom Space - 6.29 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00A - R1008 - Art Learning Space - 79.14 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - ( X8 )						
<b>B00A - R1009 - Kiln Space - 6.16 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00A - R1010 - Resources Store - 6.15 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00A - R1011 - General Learning Space - 52.47 m2</b>							
Wall Linings Internal	Flat AC Sheeting	10m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - ( X5 )						
<b>B00A - R1012 - General Storeroom - 4.87 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00A - R1013 - Computer Store - 4.69 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00A - R1014 - Cleaning Store - Distributed - 2.99 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00A - R1015 - Computer Learning Space - 52.54 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - ( X5 )						
<b>B00A - R1016 - Stairs - 23.31 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - ( X3 )						

<b>B00A - R1017 - Stairs - 12.32 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R1018 - External Movement - 92.25 m2</b>							
No Asbestos							
<b>B00A - R1019 - Movement - 9.62 m2</b>							
No Asbestos							
<b>B00B - Technological &amp; Applied Studies - 1958 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	40m2	Variable positions	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>Interior</b>							
<b>B00B - R0002 - Toilets-Girls - 23.93 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Partition Walls (Cubicles)	Compressed AC Sheet						
Plant / Equipment - Incinerator	Encapsulated Asbestos material within unit	1	North facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00B - R0003 - Cleaning Store - Distributed - 3.85 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00B - R0004 - Distribution Board Cupboard - .83 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Electrical - Mounting Board	Resinous Board	2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Door - Lining	Flat AC Sheeting	4	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0005 - Toilets-Boys - 22.91 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Partition Walls (Cubicles)	Compressed AC Sheet						
<b>B00B - R0006 - General Storeroom - 10 m2</b>							
Wall Linings Internal	Flat AC Sheeting	4m2	East facing, West facing	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00B - R0007 - Staff Study - 26.19 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00B - R0008 - Staff Study - 26.19 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00B - R0009 - Staff Study - 32.09 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00B - R0010 - Staff Study - 17.34 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R0011 - Staff Study - 25.5 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						

Floor Coverings Res/Textile	Vinyl Tiles							
<b>B00B - R0012 - Distribution Board Cupboard - .83 m2</b>				<b>Note: No inspection of live electrical installation</b>				
Electrical - Mounting Board	Resinous Board	1	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>B00B - R0013 - Food Technology L.S. - 82.77 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )							
<b>B00B - R0019 - General Storeroom - 4.74 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Tiles							
<b>B00B - R0020 - Cleaning Store - Distributed - 4.73 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Tiles							
<b>B00B - R0021 - Stairs - 3.96 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00B - R0022 - Stairs - 4.46 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00B - R0023 - Lift - 2.24 m2</b>								
No Asbestos								
<b>B00B - R0024 - External Movement - 132.04 m2</b>								
No Asbestos								
<b>B00B - R0025 - Movement - 14.81 m2</b>								
No Asbestos								
<b>B00B - R0026 - Movement - 12.99 m2</b>								
No Asbestos								
<b>B00B - R0027 - Materials Store - Type 1 - 20.04 m2</b>								
No Asbestos								
<b>B00B - R0028 - Laundry - 1.94 m2</b>								
No Asbestos								
<b>B00B - R0029 - Food Technology L.S. - 81.99 m2</b>								
No Asbestos								
<b>B00B - R0030 - Pantry - 11.86 m2</b>								
No Asbestos								
<b>B00B - R0031 - Preparation - Materials - 19.73 m2</b>								
No Asbestos								
<b>B00B - R1002 - Staff Study - 26.41 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles							
<b>B00B - R1003 - Distribution Board Cupboard - .93 m2</b>				<b>Note: No inspection of live electrical installation</b>				
Electrical - Mounting Board	Resinous Board	2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
Door - Lining	No Asbestos Found							
<b>B00B - R1004 - Cleaning Store - Distributed - 3.62 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							

<b>B00B - R1008 - Materials Technology L.S. - 77.17 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00B - R1009 - Distribution Board Cupboard - .73 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Door - Lining	Flat AC Sheeting	4	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Mounting Board	Resinous Board	2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00B - R1010 - Resource/Project Store - 9.99 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00B - R1011 - General Storeroom - 17.6 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00B - R1012 - Art Learning Space - 66.25 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00B - R1013 - Music Store - 32.66 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00B - R1014 - Music Learning Space - 65.95 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00B - R1015 - Movement - 10.64 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R1016 - Movement - 10.47 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R1017 - Lift - 2.24 m2</b>							
No Asbestos							
<b>B00B - R1018 - Toilet - Lobby - 2.9 m2</b>							
No Asbestos							
<b>B00B - R1019 - Toilet - Lobby - 3.69 m2</b>							
No Asbestos							
<b>B00B - R1020 - Staff - Toilet - 1.98 m2</b>							
No Asbestos							
<b>B00B - R1021 - Staff - Toilet - 2.33 m2</b>							
No Asbestos							
<b>B00B - R1022 - Computer Store - 31.6 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R1023 - Commonroom - 66.67 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						



<b>B00B - R1024 - Movement - 148.13 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 120 - 250 m2) - ( X15 )						
<b>B00B - R1025 - Movement - 8.09 m2</b>							
No Asbestos							
<b>B00C - Pupil Facilities - 1958 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00C - R0001 - Multi-Purpose Space - 230.98 m2</b>							
Ceiling Structures/Linings	No Asbestos Found						
<b>B00C - R0002 - Toilets-Boys - 59.01 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0004 - Movement - 13.92 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0005 - Shower/Change - 28.92 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	29m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00C - R0006 - Cleaning Store - Distributed - 4.46 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0007 - General Storeroom - 6.81 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0008 - General Storeroom - 11.69 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0009 - Shower/Change - 28.93 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	29m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0010 - Cleaning Store - Distributed - 4.47 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0011 - Toilets-Girls - 92.48 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	93m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	24m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0012 - General Storeroom - 12.45 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0013 - External Movement - 37.07 m2</b>							
No Asbestos							
<b>B00C - R0014 - External Movement - 54.91 m2</b>							
No Asbestos							
<b>B00D - General Learning - 1958 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						

Eaves Linings	Flat AC Sheeting	70m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Wall Cladding	Flat AC Sheeting	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00D - R0001 - Cleaning Store - Distributed - 6.09 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00D - R0002 - Resource/Project Store - 13.02 m2</b>							
Door - Lining	No Asbestos Found						
Electrical - Backing Board	No Asbestos Found						
<b>B00D - R0003 - Staff Study - 13.35 m2</b>							
No Asbestos							
<b>B00D - R0004 - Movement - 162.9 m2</b>							
Floor Coverings Res/Textile	Compressed AC Sheet	163m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	163m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Wall Linings Internal - Electrical Box/ Cabinet	No Asbestos Found						
Electrical - Backing Board	No Asbestos Found						
<b>B00D - R0005 - General Learning Space - 53.56 m2</b>							
No Asbestos							
<b>B00D - R0006 - General Learning Space - 53.56 m2</b>							
No Asbestos							
<b>B00D - R0007 - General Learning Space - 53.55 m2</b>							
Wall Linings Internal - Infill	No Asbestos Found						
<b>B00D - R0008 - General Learning Space - 53.7 m2</b>							
Wall Linings Internal	No Asbestos Found						
<b>B00D - R0009 - Staff Study - 22.39 m2</b>							
No Asbestos							
<b>B00D - R0010 - General Learning Space - 53.7 m2</b>							
No Asbestos							
<b>B00D - R0011 - General Learning Space - 53.49 m2</b>							
Wall Linings Internal	No Asbestos Found						
<b>B00D - R0012 - Darkroom Space - 20.97 m2</b>							
No Asbestos							
<b>B00D - R0013 - General Learning Space - 53.78 m2</b>							
No Asbestos							
<b>B00D - R0014 - General Learning Space - 53.7 m2</b>							
No Asbestos							
<b>B00D - R0015 - General Storeroom - 22.5 m2</b>							
Wall Linings Internal	Flat AC Sheeting	12m2	South facing	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00E - Senior Learning - 1890 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00E - R0001 - Movement - 19.27 m2</b>							
Floor Coverings Res/Textile	Compressed AC Sheet	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)

<b>B00E - R0002 - Staff Study - 35.25 m2</b>							
Wall Linings Internal	Flat AC Sheeting	2m2	South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Linings Internal	No Asbestos Found						
<b>B00E - R0003 - Resource/Project Store - 14.76 m2</b>							
No Asbestos							
<b>B00F - Pupil Facilities - 1958 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	25m2	All surfaces	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found						
Wall Cladding	No Asbestos Found						
<b>Interior</b>							
<b>B00F - R0001 - Movement - 33.38 m2</b>							
No Asbestos							
<b>B00F - R0002 - Student Canteen - 51.51 m2</b>							
Wall Linings Internal	Flat AC Sheeting	30m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0003 - Office/Store - 4.02 m2</b>							
No Asbestos							
<b>B00F - R0004 - General Storeroom - 5.58 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0006 - Staff - Toilet - 2.53 m2</b>							
No Asbestos							
<b>B00F - R0007 - Movement - 1.66 m2</b>							
No Asbestos							
<b>B00F - R0008 - Movement - 24.27 m2</b>							
No Asbestos							
<b>B00G - General Learning - 1958 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00G - R0001 - Movement - 64.59 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	65m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Compressed AC Sheet	65m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00G - R0002 - General Learning Space - 53.78 m2</b>							
Wall Linings Internal	No Asbestos Found						
<b>B00G - R0003 - General Learning Space - 53.79 m2</b>							
Wall Linings Internal	No Asbestos Found						
<b>B00G - R0004 - General Learning Space - 53.78 m2</b>							
Wall Linings Internal	Flat AC Sheeting	2m2	North facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

<b>B00G - R0005 - General Learning Space - 53.7 m2</b>							
Wall Linings Internal	Flat AC Sheeting	3m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00H - Multi Purpose Facilities - 1985 - Brick/Veneer</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00H - R0001 - Sport Equipment Store - 20.95 m2</b>							
No Asbestos							
<b>B00H - R0002 - Multi-Purpose Space - 520.54 m2</b>							
No Asbestos							
<b>B00H - R0003 - Chair Store - 51.44 m2</b>							
No Asbestos							
<b>B00H - R0004 - Toilets-Disabled - 4.03 m2</b>							
No Asbestos							
<b>B00H - R0005 - Distribution Board Cupboard - 3.42 m2</b>							
No Asbestos							Note: No inspection of live electrical installation
<b>B00H - R0006 - Movement - 2.83 m2</b>							
No Asbestos							
<b>B00H - R0007 - Shower/Change - 49.25 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
Partition Walls (Cubicles)	Compressed AC Sheet						
<b>B00H - R0008 - Sport Equipment Store - 68.05 m2</b>							
No Asbestos							
<b>B00H - R0009 - Stage - 70.92 m2</b>							
No Asbestos							
<b>B00H - R0010 - Shower/Change - 49.39 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
Partition Walls (Cubicles)	Compressed AC Sheet						
<b>B00H - R0011 - Cleaning Store - Distributed - 3.67 m2</b>							
No Asbestos							
<b>B00H - R0012 - Movement - 2.82 m2</b>							
No Asbestos							
<b>B00H - R0013 - Staff Kitchen - 14.11 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00H - R0014 - General Storeroom - 5.91 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00H - R0015 - Staff Study - 12.32 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00H - R0016 - Movement - 250.72 m2</b>							
No Asbestos							
<b>B00I - Agricultural Science - 1958 - Timber</b>							
<b>Exterior</b>							
Floor Coverings Res/Textile	Compressed AC Sheet	1	Redundant Step	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						

Underfloor Voids	No Asbestos Found							
Eaves Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)	
Electrical - Backing Board	Resinous Board	1	East facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>Interior</b>								
<b>B001 - R0001 - General Assistants - 16.77 m2</b>								
Wall Linings Internal	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)	
<b>B001 - R0002 - General Storeroom - 10.04 m2</b>								
Wall Linings Internal	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)	
<b>B001 - R0003 - Machine Storage - 11.16 m2</b>								
Wall Linings Internal	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)	
<b>B001 - R0004 - Class Tools Storage - 6.7 m2</b>								
Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)	
<b>B00J - Multi Purpose Facilities - 1993 - Brick/Veneer</b>								
<b>Exterior</b>								
Underfloor Voids - Slab on Ground	No Asbestos Found							
Ceiling Voids	No Asbestos Found							
<b>Interior</b>								
<b>B00J - R0001 - Movement - 40.14 m2</b>								
No Asbestos								
<b>B00J - R0002 - Multi-Purpose Space - 119.57 m2</b>								
Floor Coverings Res/Textile	No Asbestos Found							
<b>B00J - R0003 - Staff Kitchen - 11.85 m2</b>								
No Asbestos								
<b>B00J - R0004 - Toilets-Girls - 5.66 m2</b>								
No Asbestos								
<b>B00J - R0005 - Senior Study - 50.28 m2</b>								
Floor Coverings Res/Textile	No Asbestos Found							
<b>B00L - Library/Science Learning - 1973 - Brick/Block</b>								
<b>Exterior</b>								
Ceiling Voids - Raked Ceiling	No Asbestos Found							
Underfloor Voids	No Asbestos Found							
<b>Interior</b>								
<b>B00L - M1001 - No Access - 11.31 m2</b>								
No Asbestos								
<b>B00L - M1002 - Special Learning Space - 38.1 m2</b>								
Ceiling Structures/Linings	No Asbestos Found							
<b>B00L - M1003 - Main Area - 68.26 m2</b>								

No Asbestos							
<b>B00L - M1004 - No Access - 10.15 m2</b>							
No Asbestos							
<b>B00L - M1005 - Staff Study - 15.04 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00L - M1006 - No Access - 11.39 m2</b>							
No Asbestos							
<b>B00L - M1007 - Stairs - 2.66 m2</b>							
No Asbestos							
<b>B00L - M1008 - Stairs - 2.59 m2</b>							
No Asbestos							
<b>B00L - R0001 - Laboratory L.S. - 86.74 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00L - R0002 - Plant - 9.84 m2</b>							
Plant / Equipment	Fibrous Membrane	16	Variable positions	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plumbing / Pipework	Fibre Cement Pipe	1	South facing	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Plant / Equipment	Insulation Material - Rope	3	To Flue	Friable Asbestos (5)	Medium (2)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00L - R0003 - Chemical Store - 17.01 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00L - R0004 - Distribution Board Cupboard - .45 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
No Asbestos							
<b>B00L - R0005 - Laboratory L.S. - 86.17 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00L - R0008 - Laboratory L.S. - 86.26 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00L - R0009 - Cleaning Store - Distributed - 8.01 m2</b>							
No Asbestos							
<b>B00L - R0010 - Movement - 3.18 m2</b>							
No Asbestos							
<b>B00L - R0011 - Laboratory L.S. - 91.16 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00L - R0012 - Preparation - 44.54 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00L - R0013 - Chemical Store - 3.31 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						

<b>B00L - R0014 - Movement - 40.37 m2</b>		
Floor Coverings Res/Textile	Vinyl Tiles	
<b>B00L - R0015 - Stairs - 8.01 m2</b>		
No Asbestos		
<b>B00L - R0016 - Movement - 23.21 m2</b>		
No Asbestos		
<b>B00L - R0018 - Preparation - 44.71 m2</b>		
No Asbestos		
<b>B00L - R1001 - Seminar - 25.11 m2</b>		
No Asbestos		
<b>B00L - R1002 - No Access - 6.23 m2</b>		
No Asbestos		
<b>B00L - R1003 - No Access - 4.19 m2</b>		
No Asbestos		
<b>B00L - R1004 - Cleaning Store - Distributed - .32 m2</b>		
No Asbestos		
<b>B00L - R1006 - Movement - 4.43 m2</b>		
No Asbestos		
<b>B00L - R1007 - Distribution Board Cupboard - .21 m2</b>		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00L - R1008 - Seminar - 11.39 m2</b>		
No Asbestos		
<b>B00L - R1009 - Seminar - 13.14 m2</b>		
No Asbestos		
<b>B00L - R1010 - Main Area - 325.69 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - ( X25 )	
<b>B00L - R1011 - Audio Visual Workroom - 28.37 m2</b>		
No Asbestos		
<b>B00L - R1012 - Librarian - 11.33 m2</b>		
No Asbestos		
<b>B00L - R1013 - Workroom - 12.78 m2</b>		
No Asbestos		
<b>B00L - R1014 - Workroom - 17.64 m2</b>		
No Asbestos		
<b>B00L - R1016 - Movement - 1.87 m2</b>		
No Asbestos		
<b>B00L - R1018 - Main Area - 71.59 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )	
<b>B00L - R1019 - Stairs - 17.35 m2</b>		
No Asbestos		
<b>B00L - R1020 - Movement - 22.45 m2</b>		
No Asbestos		
<b>B00L - R1021 - Stairs - 1.25 m2</b>		
No Asbestos		
<b>B00L - R1022 - Stairs - 1.24 m2</b>		
No Asbestos		
<b>B00L - R1023 - Toilet - Lobby - 1.65 m2</b>		
No Asbestos		
<b>B00L - R1024 - Staff - Toilet - 1.35 m2</b>		
No Asbestos		

<b>B00L - R1025 - Toilet - Lobby - 1.61 m2</b>							
No Asbestos							
<b>B00L - R1026 - Staff - Toilet - 1.34 m2</b>							
No Asbestos							
<b>B00N - Support Unit/Technological &amp; Applied Studies - 1958 - Timber</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	AC Fragments/Debris	2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						
Material - Packing	Flat AC Sheeting						
<b>Interior</b>							
<b>B00N - R0002 - Cleaning Store - Distributed - 6.18 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00N - R0003 - General Learning Space - 53.92 m2</b>							
Wall Linings Internal	No Asbestos Found						
<b>B00N - R0004 - General Learning Space - 52.74 m2</b>							
No Asbestos							
<b>B00N - R0005 - General Learning Space - 80.77 m2</b>							
Wall Linings Internal	No Asbestos Found						
<b>B00N - R0008 - Distribution Board Cupboard - .4 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00N - R0010 - Home Base Store - S - 8.2 m2</b>							
No Asbestos							
<b>B00N - R0011 - Home Base Store - S - 4.03 m2</b>							
No Asbestos							
<b>B00N - R0012 - General Learning Space - S/P - 34.54 m2</b>							
No Asbestos							
<b>B00N - R0013 - Seminar - Type 3 - 5.01 m2</b>							
No Asbestos							
<b>B00N - R0014 - General Learning Space - S/P - 32.95 m2</b>							
No Asbestos							
<b>B00N - R0015 - Practical Activity Area - 19.59 m2</b>							
No Asbestos							
<b>B00N - R0016 - Staff Kitchen - 6.24 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B00N - R0017 - Student Laundry - Type 3 - 15.97 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B00N - R0018 - Toilets-Disabled - 5.61 m2</b>							
Wall Linings Internal	No Asbestos Found						
<b>B00N - R0019 - Movement - 74.2 m2</b>							
Floor Coverings Res/Textile	Compressed AC Sheet	75m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	75m2	All surfaces	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00N - R0020 - Movement - 9.67 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)



Floor Coverings Res/Textile	Compressed AC Sheet	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	4m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00P - Senior Learning - 1958 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						
Electrical - Backing Board	Resinous Board	1	South facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00P - R0001 - General Storeroom - 9.26 m2</b>							
Wall Linings Internal	Flat AC Sheeting	3m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00P - R0002 - Movement - 15.54 m2</b>							
Floor Coverings Res/Textile	Compressed AC Sheet	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	4m2	North facing, South facing	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00P - R0003 - General Learning Space - 40.19 m2</b>							
Wall Linings Internal	No Asbestos Found						
<b>B00P - R0004 - General Storeroom - 5.39 m2</b>							
No Asbestos							
<b>B00Q - Technological &amp; Applied Studies - 2007 - Brick/Veneer</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00Q - M0001 - Plant - 55.42 m2</b>							
No Asbestos							
<b>B00Q - R0001 - External Movement - 66.49 m2</b>							
No Asbestos							
<b>B00Q - R0002 - General Learning Space - 59.96 m2</b>							
No Asbestos							
<b>B00Q - R0003 - Seminar/Technology Space - 29.55 m2</b>							
No Asbestos							
<b>B00Q - R0004 - Workshop Area - 132.08 m2</b>							
No Asbestos							
<b>B00Q - R0005 - Entry - 1.46 m2</b>							
No Asbestos							
<b>B00Q - R0006 - Workshop Area - 47.07 m2</b>							
No Asbestos							
<b>B00Q - R0007 - Welding Area - 8.5 m2</b>							
No Asbestos							
<b>B00Q - R0008 - Welding Store - 1.44 m2</b>							
No Asbestos							
<b>B00Q - R0009 - Welding Store - 1.44 m2</b>							
No Asbestos							
<b>B00Q - R0010 - Bulk Store - 35.19 m2</b>							

No Asbestos		
<b>B00Q - R0011 - Dust Extraction Space - 6.87 m2</b>		
No Asbestos		
<b>B00Q - R0012 - Workshop Area - 126.21 m2</b>		
No Asbestos		
<b>B00Q - R0013 - Welding Area - 3.56 m2</b>		
No Asbestos		
<b>B00Q - R0014 - Welding Area - 3.56 m2</b>		
No Asbestos		
<b>B00Q - R0015 - Welding Area - 3.56 m2</b>		
No Asbestos		
<b>B00Q - R0016 - Project Store - Type 1 - 36.83 m2</b>		
No Asbestos		
<b>B00Q - R0017 - Materials Store - 14.34 m2</b>		
No Asbestos		
<b>B00Q - R0018 - Plant - 3.36 m2</b>		
No Asbestos		
<b>B00R - Art - 2008 - Metal Shed</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00R - R0001 - Art Learning Space - 44.44 m2</b>		
No Asbestos		
<b>B0AG - Agricultural Science - 2009 - Brick/Veneer</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B0AG - R0001 - Plant Space - 64.73 m2</b>		
No Asbestos		
<b>B0AG - R0002 - Class Tools Storage - 33.92 m2</b>		
No Asbestos		
<b>B0AG - R0003 - Agriculture Covered Area - 34.47 m2</b>		
No Asbestos		
<b>BAG1 - Agricultural Science - 2011 - Steel</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>BAG1 - R0001 - Agriculture Covered Area - 433.52 m2</b>		
No Asbestos		
<b>BAG2 - Agricultural Science - 2011 - Brick/Veneer</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		

<b>BAG2 - R0001 - Toilets-Unisex - 5.13 m2</b>	
No Asbestos	
<b>BAG2 - R0002 - Toilet - Lobby - 3.16 m2</b>	
No Asbestos	
<b>BAG3 - Agricultural Science - 2011 - Brick/Veneer</b>	
<b>Exterior</b>	
Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found
<b>Interior</b>	
<b>BAG3 - R0001 - Movement - 4.86 m2</b>	
No Asbestos	
<b>BAG3 - R0002 - Chemical Store - 2.33 m2</b>	
No Asbestos	

## Demountables

OS 759 16153 - Darkroom - Placement Date : 23-AUG-2005

### Exterior

Eaves Linings	Flat AC Sheeting	2.88m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

### Interior

#### R1 - Darkroom Space

End Wall Panel	Flat AC Sheeting	36m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Assumed Asbestos