


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Francis Greenway High School (8439)
Region:	Hunter/Central Coast AMU
State Electorate:	Maitland
Local Government Area:	Maitland

Last Reviewed By:	WSP 30-JUN-2017
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

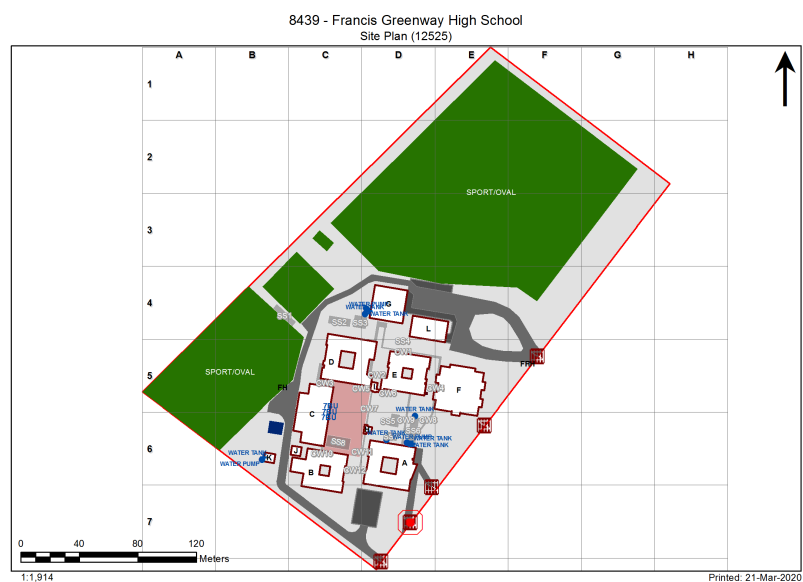

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration/General Learning - 1966 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
External Wall Structure - Awnings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Interior							
B00A - R0003 - Duplicating Workroom - 13.14 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0004 - Staff - Toilet - 2.91 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0005 - General Storeroom - 3.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0006 - Principal Office - 19.92 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0017 - Staff Study - 36.39 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00A - R0018 - Cleaning Store - Distributed - 1.66 m2							
No Asbestos							
B00A - R0019 - Distribution Board Cupboard - 1.67 m2							
						Note: No inspection of live electrical installation	
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0020 - General Storeroom - 9.42 m2							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0021 - General Storeroom - 9.81 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0022 - Stage - 24.64 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0023 - General Learning Space - 52.23 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0024 - General Learning Space - 51.12 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00A - R0025 - Music Learning Space - 58.45 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00A - R0026 - Staff - Toilet - 2.96 m2		
No Asbestos		
B00A - R0032 - Stairs - 5.53 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00A - R0033 - Stairs - 7.98 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00A - R0034 - Clinic - 5.2 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00A - R0035 - Uniform Shop - 10.57 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00A - R0036 - Deputy Principal Office - 26.38 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	
B00A - R0037 - Office/Store - 18.74 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	
B00A - R0038 - Office/Store - 13.21 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	
B00A - R0040 - Administration - Clerical - 71.1 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00A - R0041 - Public Reception - 12.2 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00A - R0042 - Interview/Meeting - 10.8 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00A - R0043 - Movement - 6.17 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00A - R0044 - Student Reception - 18.16 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00A - R0045 - Administration - Executive - 26.52 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00A - R0046 - Movement - 7.51 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00A - R0047 - Movement - 22.67 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	

B00A - R0048 - Toilet - Lobby - 2.08 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0049 - Toilets-Unisex - 1.55 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0050 - Toilets-Disabled - 6.55 m2							
Ceiling Structures/Linings	No Asbestos Found						
B00A - R0051 - Movement - 171.83 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00A - R0052 - External Movement - 29.06 m2							
Require Inspection							
B00A - R1001 - General Learning Space - 59.55 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1002 - Staff - Toilet - 2.96 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1003 - General Learning Space - 52.53 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1004 - General Learning Space - 54.93 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	No Asbestos Found						
B00A - R1009 - General Learning Space - 59.18 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1010 - Bulk Store - 5.22 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Sheet						
B00A - R1011 - General Storeroom - 5.08 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Sheet						
B00A - R1012 - General Learning Space - 52.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1013 - Cleaning Store - Distributed - 2.04 m2							
No Asbestos							
B00A - R1014 - Cleaning Store - Distributed - 1.66 m2							
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R1015 - Computer Learning Space - 59.47 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1016 - General Learning Space - 52.61 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00A - R1017 - General Learning Space - 52.6 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00A - R1018 - Movement - 132.48 m2								
No Asbestos								
B00A - R1019 - Stairs - 4.93 m2								
No Asbestos								
B00A - R1020 - Stairs - 5 m2								
No Asbestos								
B00A - R1021 - Commonroom - 29.86 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)							
B00A - R1022 - Office/Store - 31.75 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1023 - Computer Room - 75.65 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	76m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - Technological & Applied Studies - 1966 - Brick/Block								
Exterior								
External Wall Structure - Awnings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Ceiling Voids - Flat Roof	No Asbestos Found							
Underfloor Voids - Slab on Ground	No Asbestos Found							
Interior								
B00B - R0002 - Computer Room - 27.75 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00B - R0003 - Design L.S. - 59.76 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0004 - Staff - Toilet - 2.89 m2								
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00B - R0005 - Distribution Board Cupboard - .42 m2								
Note: No inspection of live electrical installation								
No Asbestos								

B00B - R0006 - Materials Technology L.S. - 112.67 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00B - R0007 - Materials Technology L.S. - 90.83 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00B - R0008 - General Storeroom - 12.38 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0009 - Welding Area - 20.49 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Plant / Equipment	Compressed AC Sheet	4	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0012 - Design L.S. - Type 8 - 39.32 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0013 - Movement - 113.45 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00B - R0014 - Stairs - 1.07 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0015 - Staff Study - 23.19 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0016 - Covered Outdoor Space - 76.46 m2							
No Asbestos							
B00B - R0017 - Materials Store - 4.02 m2							
No Asbestos							
B00B - R0018 - Project Store - Type 1 - 11.38 m2							
No Asbestos							
B00B - R0020 - Staff Kitchen - 6.51 m2							
No Asbestos							
B00B - R0022 - Staff Lounge - 100.23 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R1003 - General Storeroom - 6.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1005 - Materials Technology L.S. - 59.56 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1006 - Staff - Toilet - 2.89 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R1007 - Distribution Board Cupboard - .42 m2							
Note: No inspection of live electrical installation							

No Asbestos							
B00B - R1008 - Materials Technology L.S. - 81.5 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00B - R1009 - General Storeroom - 16.42 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R1010 - General Storeroom - 12.85 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R1011 - General Storeroom - 6.12 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R1012 - General Storeroom - 6.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1013 - Food Technology L.S. - 80.37 m2							
Floor Coverings Res/Textile	Vinyl Tiles	81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00B - R1014 - Laundry - 22.39 m2							
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R1015 - Computer Resource - 16.25 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1016 - General Storeroom - 6.33 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R1019 - Movement - 95 m2							
No Asbestos							
B00B - R1020 - Stairs - 3.81 m2							
No Asbestos							
B00B - R1021 - Other - 16.61 m2							
No Asbestos							
B00B - R1022 - Food Technology L.S. - 91.8 m2							
No Asbestos							
B00B - R1023 - Pantry - 10.49 m2							
No Asbestos							
B00B - R1024 - Other - 17.84 m2							
No Asbestos							
B00B - R1025 - Food Technology L.S. - 53.67 m2							
No Asbestos							
B00C - Pupil Facilities - 1966 - Brick/Block							
Exterior							

Ceiling Voids - Flat Roof	No Asbestos Found							
Underfloor Voids - Slab on Ground	No Asbestos Found							
Interior								
B00C - R0001 - General Storeroom - 26.62 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00C - R0002 - Fitness Laboratory - 320.86 m2								
Wall Linings Internal - Infill	Flat AC Sheeting	100m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R0003 - Workshop Area - 43.22 m2								
No Asbestos								
B00C - R0004 - Resource/Project Store - 11.54 m2								
Ceiling Structures/Linings	Flat AC Sheeting							
B00C - R0005 - General Storeroom - 26.16 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00C - R0006 - Movement - 5.95 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00C - R0007 - Movement - 6.52 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00C - R0008 - Sport Equipment Store - 13.05 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00C - R0009 - Cleaning Supplies Store - 6.37 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00C - R0011 - Staff - Toilet - 2.89 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R0012 - Bulk Store - 3.06 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00C - R0013 - General Storeroom - 12.97 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Ceiling Structures/Linings	Flat AC Sheeting							
B00C - R0014 - Movement - 27.4 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00C - R0015 - General Storeroom - 19.74 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00C - R0016 - General Storeroom - 2.13 m2								
No Asbestos								
B00C - R0017 - Cleaning Supplies Store - 14.86 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00C - R0018 - Staff - Toilet - 3.24 m2								

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Partition Walls (Cubides)	Compressed AC Sheet	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R0019 - Cleaning Store - Distributed - 1.62 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00C - R0020 - Movement - 8.26 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00C - R0021 - Movement - 14.67 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00C - R0022 - External Movement - 126.52 m2								
No Asbestos								
B00C - R0023 - Student Canteen - 37.17 m2								
No Asbestos								
B00C - R0024 - Student Canteen - 20.12 m2								
No Asbestos								
B00C - R0025 - Stairs - 5.58 m2								
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R0026 - Stairs - 7.84 m2								
Ceiling Structures/Linings	No Asbestos Found							
B00C - R1001 - Toilets-Girls - 26.03 m2								
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R1002 - Movement - 15.8 m2								
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R1003 - Staff Shower - 6.6 m2								
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R1004 - Toilets-Girls - 39.73 m2								
Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R1005 - Shower/Change - 37.89 m2								
Ceiling Structures/Linings	Flat AC Sheeting							
B00C - R1006 - Shower/Change - 39.42 m2								
Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R1007 - Toilets-Boys - 39.67 m2								
Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R1008 - Staff Shower - 6.67 m2								
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R1009 - Movement - 16.07 m2								
No Asbestos								
B00C - R1010 - Darkroom Space - 30.05 m2								
No Asbestos								

B00C - R1011 - Stairs - 13.91 m2							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00C - R1012 - Stairs - 14.07 m2							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00D - Science/General Learning - 1974 - Brick/Block							
Exterior							
External Wall Structure - Awnings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00D - R0001 - Laboratory L.S. - 98.31 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R0002 - Chemical Store - 4.73 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R0003 - Cleaning Store - Distributed - 4.62 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R0004 - Toilets-Girls - 24.11 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0005 - Toilets-Boys - 24.11 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0006 - Laboratory L.S. - 85.26 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R0007 - Preparation - 38.45 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R0008 - Laboratory L.S. - 98.31 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R0009 - General Storeroom - 4.69 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R0010 - Cleaning Store - Distributed - 4.84 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R0011 - Staff Study - 24.47 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00D - R0012 - Bulk Store - 52.24 m2							
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R0013 - Laboratory L.S. - 85.26 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R0014 - Preparation - 38.45 m2							
Floor Coverings Res/Textile	Vinyl Tiles	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Furniture / Fixtures	Compressed AC Sheet						
Furniture / Fixtures	Compressed AC Sheet						
B00D - R0015 - Movement - 164.1 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00D - R0016 - Stairs - 6.58 m2							
No Asbestos							
B00D - R0017 - Stairs - 7.48 m2							
No Asbestos							
B00D - R0018 - External Movement - 32.32 m2							
No Asbestos							
B00D - R0019 - External Movement - 25.2 m2							
No Asbestos							
B00D - R1001 - General Learning Space - 58.73 m2							
Floor Coverings Res/Textile	Vinyl Tiles	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1002 - Staff - Toilet - 3.41 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R1003 - Cleaning Store - Distributed - .44 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	3m2	West door	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R1004 - Distribution Board Cupboard - .74 m2							
Note: No inspection of live electrical installation							
Wall Linings Internal - Infill	Flat AC Sheeting	5m2	West door	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R1005 - General Learning Space - 49.7 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1006 - Interview/Office - Type 1 - 12.79 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R1007 - General Storeroom - 6.22 m2							
No Asbestos							
B00D - R1009 - General Learning Space - 50.8 m2							

Floor Coverings Res/Textile	Vinyl Tiles	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00D - R1010 - General Learning Space - 50.8 m2							
Floor Coverings Res/Textile	Vinyl Tiles	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1011 - General Learning Space - 58.73 m2							
Floor Coverings Res/Textile	Vinyl Tiles	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1012 - Staff - Toilet - 3.33 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R1013 - Cleaning Store - Distributed - .43 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	3m2	East, door panel	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R1014 - Distribution Board Cupboard - .73 m2 Note: No inspection of live electrical installation							
Wall Linings Internal - Infill	Flat AC Sheeting	5m2	East, door panel	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R1015 - Staff Study - 23.95 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00D - R1016 - Store - 25.39 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1017 - General Storeroom - 6.06 m2							
No Asbestos							
B00D - R1018 - Staff Study - 12.78 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00D - R1019 - General Learning Space - 58.72 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1026 - Movement - 156.17 m2							
No Asbestos							
B00D - R1027 - Movement - 8.64 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R1028 - General Learning Space - 48.75 m2							
Floor Coverings Res/Textile	Vinyl Tiles	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00D - R1029 - Stairs - 6.58 m2							
No Asbestos							
B00D - R1030 - Stairs - 7.48 m2							
No Asbestos							
B00D - R1031 - G.L.S. Store - 12.79 m2							
No Asbestos							
B00D - R1032 - G.L.S. Store - 12.76 m2							
No Asbestos							
B00D - R1033 - Laboratory L.S. - 73.28 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - Computer Learning/General Learning - 1966 - Brick/Block							
Exterior							
External Wall Structure - Awnings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00E - R0003 - Distribution Board Cupboard - .42 m2					Note: No inspection of live electrical installation		
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00E - R0004 - Staff - Toilet - 2.88 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0005 - Music Learning Space - 59.34 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R0006 - General Learning Space - 50.77 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R0007 - General Storeroom - 6.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0008 - General Storeroom - 6.2 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0009 - Computer Learning Space - 59.54 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R0012 - Cleaning Store - Distributed - 1.61 m2							
No Asbestos							

B00E - R0013 - Cleaning Store - Distributed - 1.76 m2							
No Asbestos							
B00E - R0019 - Stairs - 5.64 m2							
No Asbestos							
B00E - R0020 - Stairs - 5.51 m2							
No Asbestos							
B00E - R0021 - Food/Research Space - 16.48 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0022 - Food Technology L.S. - 42.41 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R0023 - Laundry - 22.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0024 - Access Student Shower/Toilet/Change - 15.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0025 - General Learning Space - 66.54 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R0026 - Commonroom - 32.38 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0027 - General Learning Space - 52.53 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R0028 - External Movement - 21.57 m2							
No Asbestos							
B00E - R0029 - Special Learning Space - 44.5 m2							
Require Inspection							
B00E - R0030 - Staff Kitchen - 2.37 m2							
Require Inspection							
B00E - R0031 - Movement - 111.72 m2							
Require Inspection							
B00E - R1001 - General Learning Space - 60.34 m2							
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	2	East, West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1002 - General Learning Space - 52.74 m2							
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	2	North, East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1003 - Distribution Board Cupboard - .42 m2							
Note: No inspection of live electrical installation							
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00E - R1004 - Art Learning Space - 60.08 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						

Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	2	North, South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00E - R1005 - Art Learning Space - 52.89 m2							
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	2	North, South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1006 - General Storeroom - 4.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1007 - KIn Space - 18.5 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1009 - General Learning Space - 52.6 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1010 - Cleaning Store - Distributed - 1.61 m2							
No Asbestos							
B00E - R1011 - Cleaning Store - Distributed - 1.76 m2							
No Asbestos							
B00E - R1012 - General Learning Space - 59.51 m2							
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	2	North, East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1013 - General Learning Space - 52.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	60m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1014 - General Storeroom - 4.29 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R1015 - Interview - 14.47 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R1016 - Movement - 100.12 m2							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R1017 - Staff - Toilet - 2.89 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R1019 - General Learning Space - 49.79 m2							
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	2	East, West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1020 - Stairs - 4.65 m2							
No Asbestos							
B00E - R1021 - Stairs - 4.75 m2							
No Asbestos							
B00E - R1022 - Movement - 1.2 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1023 - Movement - 7.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00F - Multi Purpose Facilities - 1984 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00F - M0002 - Control Room - 3.5 m2							
No Asbestos							
B00F - M0003 - Movement - 35.22 m2							
No Asbestos							
B00F - M0005 - General Storeroom - 28.6 m2							
No Asbestos							
B00F - M0006 - Stairs - 6.13 m2							
No Asbestos							
B00F - M0007 - Stairs - 6.91 m2							
No Asbestos							
B00F - M0008 - Multi-Purpose Space - 91.97 m2							
No Asbestos							
B00F - M0009 - Stairs - 3.2 m2							
No Asbestos							
B00F - R0001 - Shower/Change - 32.31 m2							
No Asbestos							
B00F - R0002 - Sport Equipment Store - 12.69 m2							
No Asbestos							
B00F - R0003 - Movement - 2.72 m2							
No Asbestos							
B00F - R0004 - Movement - 3.04 m2							
No Asbestos							
B00F - R0006 - Movement - 3.1 m2							
No Asbestos							
B00F - R0007 - Movement - 2.72 m2							
No Asbestos							
B00F - R0008 - Shower/Change - 32.38 m2							
No Asbestos							
B00F - R0009 - Sport Equipment Store - 7.21 m2							
No Asbestos							
B00F - R0010 - Staff Change - 5.77 m2							

No Asbestos		
B00F - R0011 - Multi-Purpose Space - 481.4 m2		
No Asbestos		
B00F - R0012 - Movement - 4.14 m2		
No Asbestos		
B00F - R0013 - Chair Store - 27.32 m2		
No Asbestos		
B00F - R0014 - Cleaning Store - Distributed - 2.05 m2		
No Asbestos		
B00F - R0015 - Toilets-Boys - 16.93 m2		
No Asbestos		
B00F - R0016 - Toilets-Disabled - 4.18 m2		
No Asbestos		
B00F - R0017 - Distribution Board Cupboard - 1.18 m2		Note: No inspection of live electrical installation
No Asbestos		
B00F - R0018 - Entry - 24.76 m2		
No Asbestos		
B00F - R0019 - Staff Kitchen - 12.57 m2		
No Asbestos		
B00F - R0020 - Toilets-Girls - 25.39 m2		
No Asbestos		
B00F - R0021 - Staff Study - 17.54 m2		
No Asbestos		
B00F - R0022 - Movement - 1.76 m2		
No Asbestos		
B00F - R0023 - External Movement - 33.66 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00F - R0024 - External Movement - 11.03 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00F - R0025 - External Movement - 11.03 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00F - R0026 - External Movement - 11.03 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00F - R0027 - External Movement - 11.03 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00F - R0028 - External Movement - 15.89 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00F - R0029 - Stairs - 6.08 m2		
No Asbestos		
B00F - R0030 - Stairs - 4.4 m2		
No Asbestos		
B00F - R0031 - Stairs - 1.02 m2		
No Asbestos		
B00F - R0032 - Stage - 81.38 m2		
No Asbestos		
B00G - Library - 1994 - Brick/Block		
Exterior		

Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00G - R0001 - Main Area - 344.2 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0002 - Resources - 36.65 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0003 - Librarian - 10.76 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0004 - Entry - 12.43 m2		
No Asbestos		
B00G - R0005 - Movement - 1.5 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0006 - Cleaning Store - Distributed - 3.15 m2		
No Asbestos		
B00G - R0007 - Staff - Toilet - 5.7 m2		
No Asbestos		
B00G - R0008 - Audio Visual Workroom - 22.93 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0009 - Distribution Board Cupboard - .72 m2		
		Note: No inspection of live electrical installation
No Asbestos		
B00G - R0010 - Seminar - 13.13 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0011 - Seminar - 14.26 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0012 - Seminar - 14.26 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00H - Electrical Services - 1966 - Concrete		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00H - R9001 - Garden Store Room - 6.53 m2		
No Asbestos		
B00H - R9002 - Main Switchroom - 5.06 m2		
No Asbestos		
B00H - R9003 - External Movement - 11.18 m2		
No Asbestos		
B00I - Mechanical Services - 2003 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00I - R0001 - Movement - 3.71 m2		
No Asbestos		

B00I - R0002 - Lift - 1.96 m2		
No Asbestos		
B00I - R0003 - Movement - 6.71 m2		
No Asbestos		
B00I - R0004 - External Movement - 10.34 m2		
No Asbestos		
B00I - R1001 - Movement - 3.71 m2		
No Asbestos		
B00I - R1002 - Lift - 1.96 m2		
No Asbestos		
B00I - R1003 - Movement - 3.77 m2		
No Asbestos		
B00I - R1004 - Movement - 10.34 m2		
No Asbestos		
B00I - R1005 - Movement - 2.94 m2		
No Asbestos		
B00J - Building Services - 2002 - Metal Shed		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00J - R0001 - Maintenance Bulk Store - 40.46 m2		
No Asbestos		
B00K - Building Services - 2002 - Metal Shed		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00K - R0001 - Maintenance Bulk Store - 40.84 m2		
No Asbestos		
B00L - Physical Education - 2013 - Steel		
Exterior		
Ceiling Voids - Flat Roof	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Interior		
B00L - R0001 - Gymnasium - 33.38 m2		
No Asbestos		
B00L - R0002 - Gymnasium - 68.38 m2		
No Asbestos		
B00L - R0003 - Fitness Store - 12.78 m2		
No Asbestos		
B00L - R0004 - Office/Store - 44.51 m2		
No Asbestos		
B00L - R0005 - Movement - 2.73 m2		
No Asbestos		
B00L - R0006 - Toilets-Unisex - 3.84 m2		
No Asbestos		
B00L - R0008 - P.E. Store - 33.38 m2		
No Asbestos		

B00L - R0009 - Tea Room - 1.71 m2	
No Asbestos	
B00L - R0011 - External Movement - 137.83 m2	
Require Inspection	

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020