


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Fairvale High School (8456)
Region:	South Western Sydney AMU
State Electorate:	Fairfield
Local Government Area:	Fairfield

Last Reviewed By:	Greencap 13-AUG-2014
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

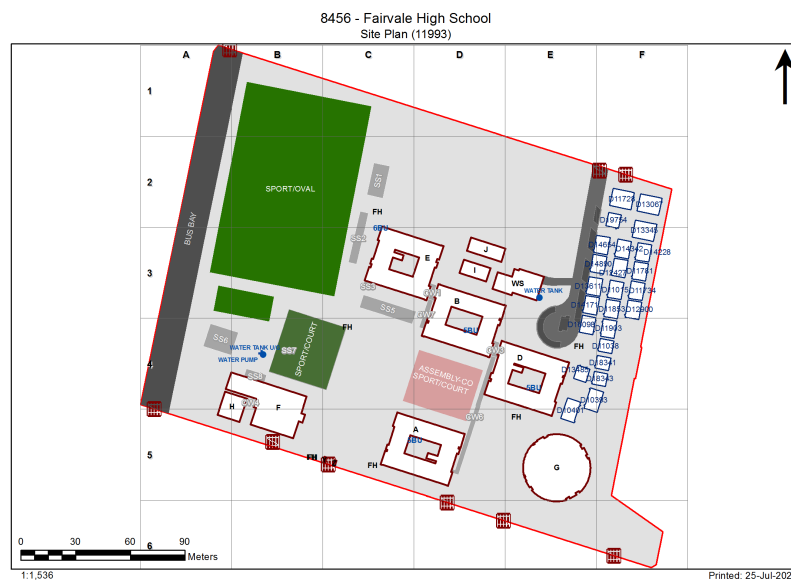

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration/Computer Learning/General Learning - 1969 - Brick/Block							
Exterior							
Wall Cladding	Flat AC Sheeting	200m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00A - R0001 - Staff - Toilet - 2.92 m2							
No Asbestos							
B00A - R0002 - Plant - 1.17 m2							
Door - Lining	Flat AC Sheeting	4	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0003 - Cleaning Supplies Store - 3.83 m2							
No Asbestos							
B00A - R0004 - External Stairs - 2.13 m2							
No Asbestos							
B00A - R0005 - Senior Learning Centre - 37.74 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0006 - Ancillary Staff - 23.93 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0009 - Staff - Toilet - 4.34 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0010 - Staff - Toilet - 4.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0011 - External Stairs - 1.97 m2							
No Asbestos							
B00A - R0018 - General Storeroom - 3.04 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0019 - Staff - Toilet - 2.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0022 - Archive Store - 2.86 m2							
No Asbestos							
B00A - R0024 - Plant - 1.27 m2							
Door - Lining	Flat AC Sheeting	4	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0025 - Resources Store - 3.87 m2							
No Asbestos							
B00A - R0026 - General Learning Space - 51.2 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0027 - Resources Store - 10.44 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0029 - Office/Store - 24.8 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0030 - Laboratory L.S. - 91.91 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00A - R0031 - Preparation - Science - 29.22 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0032 - Resources Store - 8.92 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0033 - Laboratory L.S. - 84.09 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00A - R0035 - Public Reception - 25.64 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0036 - Administration - Clerical - 8.26 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0037 - Administration - Clerical - 12.64 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0038 - Principal Office - 23.53 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0039 - General Storeroom - 8.56 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0040 - Administration - Clerical - 43.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0041 - Administration - Clerical - 11.59 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0042 - Pupil Entry - 7.31 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0043 - Printing/Photocopying - 19.93 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0044 - Interview/Office - Type 1 - 14.33 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0045 - Interview/Office - Type 1 - 14.77 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0046 - Office/Store - 11.94 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00A - R0047 - Movement - 9.41 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00A - R0048 - Administration - Clerical - 8.61 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00A - R0049 - Deputy Principal Office - 19.39 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00A - R0050 - General Storeroom - 5.83 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00A - R0051 - Archive Store - 14.66 m2								
No Asbestos								
B00A - R0052 - General Storeroom - 25.82 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R0053 - Cleaning Supplies Store - 14.63 m2								
No Asbestos								
B00A - R0054 - Handwashing Facilities - .19 m2								
No Asbestos								
B00A - R0056 - External Movement - 156.75 m2								
Require Inspection								
B00A - R0057 - Movement - 5.21 m2								
Require Inspection								
B00A - R0058 - Lift - 2.8 m2								
Require Inspection								
B00A - R1001 - Staff - Toilet - 2.81 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00A - R1002 - Distribution Board Cupboard - 1.15 m2								
Note: No inspection of live electrical installation								
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
Door - Lining	Flat AC Sheeting	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1003 - External Stairs - 5.96 m2								
No Asbestos								
B00A - R1004 - Computer Learning Space - 51.27 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00A - R1005 - System Administrators Office - 12.71 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00A - R1006 - Computer Learning Space - 57.64 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00A - R1007 - Resources Store - 6.16 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1008 - Resources Store - 5.94 m2								

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1009 - General Learning Space - 52.22 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00A - R1010 - Materials Learning Space - Type 1 - 65.24 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00A - R1014 - Materials Learning Space - Type 1 - 70.71 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00A - R1015 - Resources Store - 12.33 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00A - R1016 - Cleaning Store - Distributed - 2.82 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00A - R1017 - Distribution Board Cupboard - 1.22 m2								
						Note: No inspection of live electrical installation		
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
Door - Lining	Flat AC Sheeting	6	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1018 - General Learning Space - 50.99 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1019 - Resources Store - 4.96 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00A - R1020 - Resources Store - 5.37 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1021 - Toilets-Girls - 26.4 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Partition Walls (Cubides)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1022 - General Learning Space - 52.15 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00A - R1023 - General Learning Space - 52 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)							
B00A - R1027 - Computer Resource - 5.16 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							

B00A - R1028 - External Stairs - 6.02 m2							
No Asbestos							
B00A - R1029 - Staff Study - 26.07 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1030 - Computer Learning Space - 51.07 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00A - R1031 - Staff Study - 46.69 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1032 - Tea Room - 11.07 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R1033 - Handwashing Facilities - .18 m2							
No Asbestos							
B00A - R1035 - External Movement - 171.92 m2							
Require Inspection							
B00A - R1036 - Movement - 5.18 m2							
Require Inspection							
B00B - Technological & Applied Studies/Music/Art - 1969 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00B - R0002 - Laundry - 6.62 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0006 - Kitchen - Type 2 - 78.66 m2							
No Asbestos							
B00B - R0010 - Resources Store - 5.48 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0011 - Resources Store - 5.25 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0012 - General Storeroom - 3.74 m2							
No Asbestos							
B00B - R0013 - Plant - 1.13 m2							
Door - Lining	Flat AC Sheeting	4	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0014 - Staff - Toilet - 2.79 m2							
No Asbestos							
B00B - R0020 - Music Store - 5.43 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0021 - Music Learning Space - 51.06 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0022 - Resources Store - 4.89 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0023 - Plant - 1.24 m2							
Door - Lining	Flat AC Sheeting	4	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0024 - Cleaning Store - Distributed - 2.81 m2							
No Asbestos							
B00B - R0027 - General Storeroom - 3.74 m2							
No Asbestos							
B00B - R0029 - Welding Area - 8.5 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0030 - Metal Technology Bay - 38.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R0032 - Resources Store - 25.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00B - R0033 - Food Technology L.S. - 37.84 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0034 - External Stairs - 2.11 m2							
No Asbestos							
B00B - R0035 - Materials Learning Space - Type 1 - 62.9 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R0036 - Welding/Hot Metals Area - 6.45 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0037 - Welding/Hot Metals Area - 7.02 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0038 - Materials Learning Space - Type 1 - 63.84 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R0039 - External Stairs - 2.19 m2							
No Asbestos							

B00B - R0043 - Kitchen - Type 2 - 64.81 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R0044 - Laundry - 8.29 m2							
No Asbestos							
B00B - R0045 - Food Technology L.S. - 38.93 m2							
No Asbestos							
B00B - R0046 - Change - 8.37 m2							
No Asbestos							
B00B - R0047 - Movement - 3.59 m2							
No Asbestos							
B00B - R0048 - Preparation - 16.09 m2							
No Asbestos							
B00B - R0049 - Pantry - 4.81 m2							
No Asbestos							
B00B - R0050 - General Learning Space - 56.71 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0051 - Handwashing Facilities - .9 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0052 - General Learning Space - 49.76 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0053 - Handwashing Facilities - .51 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0054 - Handwashing Facilities - .18 m2							
No Asbestos							
B00B - R0055 - External Movement - 185.04 m2							
No Asbestos							
B00B - R1001 - External Stairs - 6.09 m2							
No Asbestos							
B00B - R1002 - Distribution Board Cupboard - 1.24 m2							
							Note: No inspection of live electrical installation
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Door - Lining	Flat AC Sheeting	4	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1003 - Cleaning Store - Distributed - 2.82 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R1004 - Art Learning Space - 61.16 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1005 - Resources Store - 9.2 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1006 - Resources Store - 5.94 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1007 - Resources Store - 6.07 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1008 - Art Learning Space - 52.08 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R1009 - Art Learning Space - 52 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1010 - Kiln Space - 27.35 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Plant / Equipment - Kiln	Insulation Material	2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00B - R1011 - Resources Store - 10.72 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1014 - Music Store - 11.53 m2								
No Asbestos								
B00B - R1015 - Music Learning Space - 51.13 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R1016 - Dust Extraction Space - 5.2 m2								
No Asbestos								
B00B - R1017 - Distribution Board Cupboard - 1.13 m2								
						Note: No inspection of live electrical installation		
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Door - Lining	Flat AC Sheeting	6	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1018 - Staff - Toilet - 2.84 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1019 - Computer Learning Space - 57.27 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R1021 - Wood Technology Bay - 17.41 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1023 - Materials Learning Space - Type 1 - 83.89 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							

Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00B - R1024 - Music Store - 5.42 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1025 - Printing/Photocopying - 4.85 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1026 - Music Learning Space - 51.13 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R1029 - Materials Learning Space - Type 1 - 71.74 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00B - R1030 - Dust Extraction Space - 4.82 m2								
No Asbestos								
B00B - R1031 - External Stairs - 6.03 m2								
No Asbestos								
B00B - R1032 - Staff Study - 44.27 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R1033 - Materials Store - 18.67 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R1034 - Class Tools Storage - 8.3 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1035 - Handwashing Facilities - .18 m2								
No Asbestos								
B00B - R1036 - External Movement - 176.84 m2								
No Asbestos								
B00D - Science Learning/General Learning/Support Unit - 1975 - Brick/Block								
Exterior								
Wall Cladding	Flat AC Sheeting	200m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
Underfloor Voids - Slab on Ground	No Asbestos Found							
Ceiling Voids - Flat Roof	No Asbestos Found							
Interior								
B00D - R0001 - Toilets-Boys - 28.95 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R0003 - Staff Study - 39 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00D - R0004 - Plant - .72 m2								
Door - Lining	Flat AC Sheeting	4	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R0005 - Preparation - Science - 19.35 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							

Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0006 - General Storeroom - 5.9 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0007 - Laboratory L.S. - 92.07 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00D - R0008 - Chemical Store - 25.85 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0009 - Toilets-Girls - 27.95 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Partition Walls (Cubicles)	Compressed AC Sheet	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0010 - Special Learning Space - 50.41 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0011 - Plant - .69 m2							
Door - Lining	Flat AC Sheeting	4	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0012 - Staff - Toilet - 3.61 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R0013 - Cleaning Store - Distributed - 3.29 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R0014 - Laboratory L.S. - 84.22 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00D - R0017 - Laboratory L.S. - 92.17 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Floor Coverings Res/Textile	Vinyl Tiles	93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0018 - Special Learning Space - 57.52 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0019 - Interview/Office - Type 1 - 13.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0020 - Resources Store - 4.98 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0021 - General Learning Space - 50.78 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R0023 - Cleaning Store - Distributed - 9.87 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0024 - External Stairs - 7.25 m2								
No Asbestos								
B00D - R0025 - External Stairs - 7.57 m2								
No Asbestos								
B00D - R0026 - Darkroom Space - 1.11 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00D - R0027 - Dark Room - 24.19 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0028 - Movement - 1.77 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00D - R0029 - Preparation - Science - 38.53 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0031 - External Movement - 194.71 m2								
Require Inspection								
B00D - R0032 - Movement - 5.21 m2								
Require Inspection								
B00D - R0033 - Lift - 2.8 m2								
Require Inspection								
B00D - R1001 - General Learning Space - 57.35 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00D - R1002 - External Stairs - 7.66 m2								
No Asbestos								
B00D - R1003 - Distribution Board Cupboard - 1.13 m2								
Note: No inspection of live electrical installation								
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Door - Lining	Flat AC Sheeting	6	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R1004 - Cleaning Store - Distributed - 4.47 m2								
No Asbestos								
B00D - R1006 - General Learning Space - 51.93 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00D - R1007 - General Learning Space - 52.44 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00D - R1008 - Seminar - 24.91 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R1009 - Office/Store - 6.21 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	

B00D - R1011 - Handwashing Facilities - .49 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1013 - General Storeroom - 11.33 m2							
No Asbestos							
B00D - R1014 - General Learning Space - 51.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1015 - Distribution Board Cupboard - .86 m2							
Note: No inspection of live electrical installation							
Door - Lining	Flat AC Sheeting	2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1018 - Staff - Toilet - 3.67 m2							
No Asbestos							
B00D - R1019 - Computer Learning Space - 57.34 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1020 - Resources Store - 6 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R1021 - Resources Store - 6.19 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R1022 - Seminar - 25.57 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00D - R1023 - Resources Store - 6.02 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R1024 - Resources Store - 5.88 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R1025 - General Learning Space - 51.93 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00D - R1026 - General Learning Space - 52.87 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00D - R1027 - General Learning Space - 56.97 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						

Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00D - R1028 - Resources Store - 12.93 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R1029 - Resources Store - 5 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00D - R1030 - General Learning Space - 51.06 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00D - R1031 - External Stairs - 7.71 m2								
No Asbestos								
B00D - R1032 - Movement - 6.76 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R1033 - Staff Study - 24.13 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R1034 - Tea Room - 1.18 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00D - R1035 - Staff Study - 37.65 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R1036 - Tea Room - 5.99 m2								
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00D - R1037 - External Movement - 183.46 m2								
Require Inspection								
B00D - R1038 - Movement - 5.21 m2								
Require Inspection								
B00E - General Learning/Administration/Science Learning - 1975 - Brick/Block								
Exterior								
Ceiling Voids	No Asbestos Found							
Wall Cladding	Flat AC Sheeting	200m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
Underfloor Voids - Slab on Ground	No Asbestos Found							
Interior								
B00E - R0001 - Computer Learning Space - 32.26 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0003 - Administration - Clerical - 13.11 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R0004 - Deputy Principal Office - 19.37 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R0005 - Student Waiting - 6.23 m2								

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00E - R0006 - Student Waiting - 6.44 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00E - R0007 - Deputy Principal Office - 19.45 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R0008 - Administration - Clerical - 12.93 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R0009 - Staff Study - 44.72 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00E - R0010 - General Storeroom - 7.3 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00E - R0011 - Staff Study - 32.54 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R0013 - Resources Store - 5.04 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0014 - Toilets-Boys - 11.89 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0015 - Cleaning Store - Distributed - .38 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00E - R0016 - Resources Store - 3.65 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0018 - Dark Room - 29.05 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R0022 - General Learning Space - 52.72 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00E - R0023 - Archive Store - 17.82 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0024 - Toilets-Girls - 12.15 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Plant / Equipment - Incinerator	Insulation Material	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00E - R0025 - Cleaning Store - Distributed - .4 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							

B00E - R0026 - Resources Store - 4.1 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0028 - Cleaning Store - Distributed - 4.48 m2							
No Asbestos							
B00E - R0029 - General Storeroom - 4.54 m2							
No Asbestos							
B00E - R0030 - Staff Study - 6.42 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0031 - Darkroom Space - 2.86 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0032 - External Stairs - 2.03 m2							
No Asbestos							
B00E - R0033 - Careers Advisers Office - 31.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0034 - Leading Teacher - 19.43 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0035 - External Stairs - 2.12 m2							
No Asbestos							
B00E - R0036 - Performing Arts Store - 16.35 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0037 - General Storeroom - 16.34 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0038 - Movement Studio - 133.49 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00E - R0039 - Movement - 12.87 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0041 - Staff Study - 45.36 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0042 - Tea Room - 6.67 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0043 - Staff Study - 25.97 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0044 - Tea Room - 4.72 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0045 - External Movement - 171.68 m2							
Require Inspection							
B00E - R0046 - Movement - 5.21 m2							
Require Inspection							
B00E - R0047 - Lift - 2.8 m2							

Require Inspection							
B00E - R1001 - Laboratory L.S. - 86.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00E - R1002 - Preparation - Science - 22.77 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1003 - Apparatus Storage - 2.74 m2							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R1004 - Resources Store - 12.6 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1005 - Laboratory L.S. - 92.63 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00E - R1006 - Computer Learning Space - 32.6 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R1007 - Cleaning Store - Distributed - 4.9 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1008 - Resources Store - 5.39 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1009 - General Learning Space - 51.56 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1010 - Distribution Board Cupboard - .92 m2							
						Note: No inspection of live electrical installation	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Door - Lining	Flat AC Sheeting	6	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1012 - Staff - Toilet - 3.53 m2							
No Asbestos							
B00E - R1013 - External Stairs - 7.77 m2							
No Asbestos							
B00E - R1014 - Staff Study - 59.37 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1015 - Resources Store - 25.81 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						

Floor Coverings Res/Textile	Vinyl Tiles	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1016 - General Learning Space - 52.51 m2							
Floor Coverings Res/Textile	Vinyl Tiles	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1017 - General Learning Space - 52.43 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1018 - General Learning Space - 59.44 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1019 - Interview/Office - Type 1 - 12.89 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1020 - Resources Store - 5.04 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1021 - General Learning Space - 51.41 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1022 - Distribution Board Cupboard - .98 m2							
Note: No inspection of live electrical installation							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Door - Lining	Flat AC Sheeting	6	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00E - R1023 - Cleaning Store - Distributed - .44 m2							
Door - Lining	Flat AC Sheeting	6	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1024 - Staff - Toilet - 3.28 m2							
No Asbestos							
B00E - R1025 - External Stairs - 7.82 m2							
No Asbestos							
B00E - R1026 - Cleaning Store - Distributed - .45 m2							
Door - Lining	Flat AC Sheeting	4	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1027 - External Movement - 180.58 m2							
Require Inspection							
B00E - R1028 - Movement - 5.21 m2							
Require Inspection							
B00F - Library - 1993 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground							

Ceiling Voids	Non Accessible Area						
Interior							
B00F - R0001 - Seminar - 14.34 m2							
No Asbestos							
B00F - R0002 - Seminar - 14.73 m2							
No Asbestos							
B00F - R0003 - Seminar/Study - 14.67 m2							
No Asbestos							
B00F - R0004 - Main Entry - 17.28 m2							
No Asbestos							
B00F - R0005 - Distribution Board Cupboard - .97 m2							
No Asbestos							Note: No inspection of live electrical installation
B00F - R0006 - Cleaning Store - Distributed - 2.44 m2							
No Asbestos							
B00F - R0007 - Staff - Toilet - 4.98 m2							
No Asbestos							
B00F - R0008 - Audio Visual Workroom - 26.48 m2							
No Asbestos							
B00F - R0009 - Library Administration - 37.17 m2							
No Asbestos							
B00F - R0010 - Librarian - 11.1 m2							
No Asbestos							
B00F - R0011 - Main Area - 403.3 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00F - R0012 - External Movement - 12.54 m2							
No Asbestos							
B00F - R0013 - External Movement - 12.67 m2							
No Asbestos							
B00F - R0015 - Senior Study - 58.44 m2							
No Asbestos							
B00F - R0016 - Tea Room - 2.27 m2							
No Asbestos							
B00F - R0017 - General Storeroom - 8.67 m2							
No Asbestos							
B00F - R0018 - Access Student Shower/Toilet/Change - 5.5 m2							
No Asbestos							
B00F - R0019 - General Learning Space - 63.57 m2							
No Asbestos							
B00F - R0020 - Plant - .61 m2							
No Asbestos							
B00F - R0021 - External Movement - 26.54 m2							
No Asbestos							
B00G - Multi Purpose Facilities - 1973 - Concrete							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Underfloor Voids	Flat AC Sheeting	1	Under stage	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Window	Mastic						

Interior							
B00G- M0001 - Control Room - 130.31 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00G- M0002 - Stairs - 2.11 m2							
Ceiling Structures/Linings	No Asbestos Found						
B00G- R0001 - Distribution Board Cupboard - 1.34 m2							
Note: No inspection of live electrical installation							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G- R0002 - Chair Store - 39.41 m2							
No Asbestos							
B00G- R0003 - Cleaning Store - Distributed - 3.08 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G- R0004 - General Storeroom - 10.76 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G- R0006 - Fitness Laboratory - 52.02 m2							
No Asbestos							
B00G- R0008 - Staff Kitchen - 19.91 m2							
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles						
B00G- R0009 - General Storeroom - 10.85 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G- R0019 - Stage - 72.29 m2							
No Asbestos							
B00G- R0020 - Sport Equipment Store - 28.95 m2							
No Asbestos							
B00G- R0022 - Stairs - .82 m2							
No Asbestos							
B00G- R0023 - Multi-Purpose Space - 596.25 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - (X25)						
B00G- R0024 - Toilet - Lobby - 1.92 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G- R0025 - Change - 28.75 m2							
Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G- R0026 - Toilet - Lobby - 1.97 m2							
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G- R0027 - Change - 26.64 m2							

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G- R0028 - Toilet - Lobby - 2.31 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G- R0029 - Toilets-Boys - 8.88 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G- R0030 - Music Store - 18.66 m2							
No Asbestos							
B00G- R0031 - Toilet - Lobby - 2.28 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G- R0032 - Toilets-Girls - 9.84 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G- R0033 - External Movement - 4.05 m2							
No Asbestos							
B00G- R0034 - External Movement - 4.01 m2							
No Asbestos							
B00G- R0035 - External Movement - 9.68 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G- R0036 - External Movement - 9.35 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - Language Centre - 2010 - Brick/Veneer							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00H - R0001 - Computer Learning Space - 91.92 m2							
No Asbestos							
B00H - R0002 - Seminar - Type 2 - 18.74 m2							
No Asbestos							
B00H - R0003 - Resources Store - 10.08 m2							
No Asbestos							
B00H - R0004 - Computer Store - 9 m2							
No Asbestos							
B00H - R0005 - External Movement - 27.17 m2							
No Asbestos							
B00I - Storage - 2015 - Steel							
Exterior							
Require Inspection							
Interior							
B00I - R0001 - General Assistants - 28.1 m2							
Require Inspection							
B00I - R0002 - General Assistants - 85.5 m2							
Require Inspection							

B00J - Storage - 2015 - Steel**Exterior**

Require Inspection

Interior**B00J - R0001 - Large Equipment Store - 146.01 m2**

Require Inspection

B00Y - Building Services - 1968 - Brick/Block**Exterior**

Ceiling Voids - Flat Roof No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

Interior**B00Y - R0001 - Plant - 2.98 m2**

Plant / Equipment	Gasket Material	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-------------------	-----------------	---	------------	--------------------	---------	--------------------	-----------------------------

B00Z - Building Services - 1968 - Brick/Block**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids - Flat Roof No Asbestos Found

Interior**B00Z - R0001 - Plant - 2.87 m2**

Plant / Equipment	Gasket Material	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-------------------	-----------------	---	------------	--------------------	---------	--------------------	-----------------------------

B0WS - Storage - 2008 - Steel**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B0WS - R0002 - Wood Technology Bay - 168.59 m2**

No Asbestos

B0WS - R0003 - Materials Store - Type 1 - 23.92 m2

No Asbestos

B0WS - R0004 - Movement - 66.74 m2

No Asbestos

B0WS - R0005 - Project Store - Type 1 - 12.57 m2

No Asbestos

B0WS - R0006 - Project Store - Type 1 - 10.58 m2

No Asbestos

B0WS - R0007 - Dust Extraction Space - 9.8 m2

No Asbestos

B0WS - R0008 - Distribution Board Cupboard - .49 m2**Note: No inspection of live electrical installation**

No Asbestos

Demountables

OS 831 10393 - Girls Shower/Change/Toilet - Placement Date : 24-AUG-2018

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 830 10401 - Boys Shower/Change/Toilet - Placement Date : 15-AUG-2018

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 11015 - Learning Unit - Standard/Withdrawal - Placement Date : 04-JAN-2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 600 11038 - Learning Unit - Small - Placement Date : 22-DEC-2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

NS 200 11728 - Art Learning Space/Workshop/Bulk Store - Placement Date : 30-JUN-1995

No Asbestos Found

OS 601 11734 - Learning Unit - Standard/Withdrawal - Placement Date : 30-DEC-2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 11781 - Learning Unit - Standard/Withdrawal - Placement Date : 19-DEC-2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 11853 - Learning Unit - Standard/Withdrawal - Placement Date : 23-DEC-2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 751 11903 - Learning Unit - ESL - Placement Date : 22-FEB-1996

Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- EsI

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Assumed Asbestos

R2- EsI

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Assumed Asbestos

OS 601 12427 - Learning Unit - Standard/Withdrawal - Placement Date : 22-DEC-2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 12900 - Learning Unit - Standard/Withdrawal - Placement Date : 28-DEC-2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

NS 200 13067 - Art Learning Space/Workshop/Bulk Store - Placement Date : 19-DEC-2011

No Asbestos Found

NS 200 13345 - Art Learning Space/Workshop/Bulk Store - Placement Date : 20-DEC-2011

No Asbestos Found

OS 801 13485 - FSU - Placement Date : 30-AUG-2018

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 13611 - Learning Unit - Standard/Withdrawal - Placement Date : 07-JAN-2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 14171 - Learning Unit - Standard/Withdrawal - Placement Date : 07-JAN-2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 14228 - Learning Unit - Standard/Withdrawal - Placement Date : 13-DEC-2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 14342 - Learning Unit - Standard/Withdrawal - Placement Date : 23-DEC-2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 14654 - Learning Unit - Standard/Withdrawal - Placement Date : 04-JAN-2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 14890 - Learning Unit - Standard/Withdrawal - Placement Date : 30-DEC-2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 751 16098 - Learning Unit - ESL - Placement Date : 11-FEB-2015

No Asbestos Found

OS 600 18341 - Learning Unit - Small - Placement Date : 12-DEC-2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 600 18343 - Learning Unit - Small - Placement Date : 29-DEC-2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 600 19754 - Learning Unit - Small - Placement Date : 12-NOV-2019

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found