


# Asbestos Register

(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Fairfield High School (8550)</b>
<b>Region:</b>	<b>South Western Sydney AMU</b>
<b>State Electorate:</b>	<b>Fairfield</b>
<b>Local Government Area:</b>	<b>Fairfield</b>

<b>Last Reviewed By:</b>	<b>Greencap 07-DEC-2017</b>
<b>Last Revised By:</b>	

<b>Historical Fibro In Grounds Investigations/Events</b>	<b>No</b>
No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.	

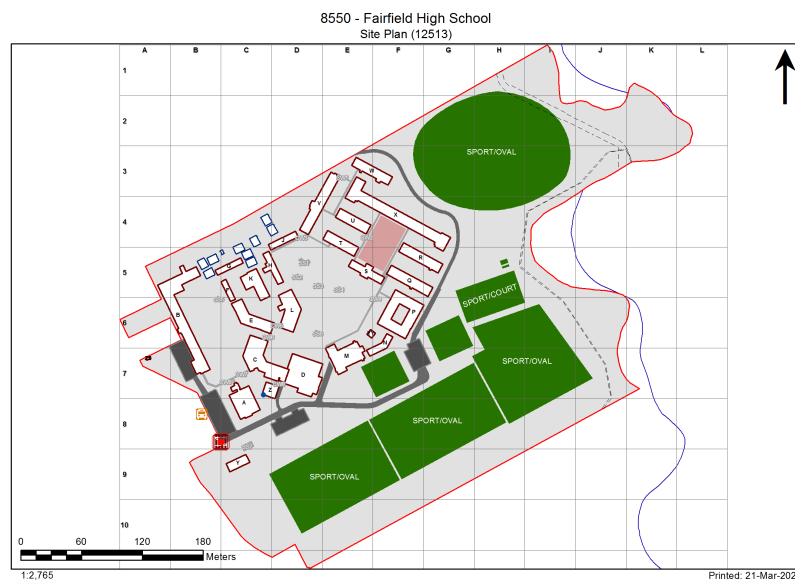

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - Science Learning/Library - 1970 - Brick/Block</b>							
<b>Exterior</b>							
External Roof Structure		2	South east	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
External Roof Structure	Mastic	1	Middle portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Linings Internal - Infill	Flat AC Sheeting	12	North, South, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids - Flat Roof	No Asbestos Found						
Window	Mastic						
External Roof Structure	Insulation Material	1	Middle portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>Interior</b>							
<b>B00A - M1001 - Seminar/Study - 18.71 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00A - M1002 - Seminar - 20.17 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00A - M1006 - General Storeroom - 2.73 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00A - M1009 - Stairs - 2.75 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00A - M1010 - Stairs - 2.78 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00A - M1011 - Main Area - 123.77 m2</b>							
No Asbestos							
<b>B00A - M1012 - Chair Store - 7.18 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00A - M1013 - General Storeroom - 5.57 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00A - R0001 - Laboratory L.S. - 91.48 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00A - R0002 - Preparation - Science - 47.86 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00A - R0003 - Laboratory L.S. - 91.37 m2</b>							
Ceiling Structures/Linings	Vermiculite						
<b>B00A - R0004 - Resources Store - 12.23 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0005 - Laboratory L.S. - 91.47 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00A - R0006 - Preparation - Science - 47.42 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00A - R0007 - Distribution Board Cupboard - .41 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
No Asbestos							
<b>B00A - R0008 - Laboratory L.S. - 91.56 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00A - R0009 - Movement - 40.51 m2</b>							
No Asbestos							
<b>B00A - R0010 - Cleaning Store - Distributed - 7.78 m2</b>							
No Asbestos							
<b>B00A - R0011 - External Movement - 30.15 m2</b>							
No Asbestos							
<b>B00A - R0012 - Plant - 16.81 m2</b>							
Plant / Equipment - Air Conditioning Unit	Encapsulated Asbestos material within unit	1	South east	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00A - R0013 - Stairs - 7.8 m2</b>							
No Asbestos							
<b>B00A - R1001 - Seminar/Study - 26.2 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00A - R1002 - Plant - .59 m2</b>							
No Asbestos							
<b>B00A - R1003 - Distribution Board Cupboard - .55 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
No Asbestos							
<b>B00A - R1004 - Cleaning Store - Distributed - 1.97 m2</b>							
No Asbestos							
<b>B00A - R1006 - Seminar - 23.4 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00A - R1007 - Audio Visual Workroom - 29.06 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00A - R1008 - Resources Store - 7.51 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00A - R1009 - Library Administration - 20.15 m2</b>							
No Asbestos							
<b>B00A - R1010 - Librarian - 10.57 m2</b>							
No Asbestos							
<b>B00A - R1011 - Staff - Toilet - 3.31 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1012 - Staff - Toilet - 3.33 m2</b>							

Wall Linings Internal - Infill	Flat AC Sheeting	1m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1014 - External Movement - 27.6 m2</b>							
No Asbestos							
<b>B00A - R1016 - Stairs - 1.38 m2</b>							
Ceiling Structures/Linings	Vermiculite						
<b>B00A - R1017 - Stairs - 1.39 m2</b>							
Ceiling Structures/Linings	Vermiculite						
<b>B00A - R1018 - External Stairs - 16.74 m2</b>							
No Asbestos							
<b>B00A - R1019 - Main Entry - 3.57 m2</b>							
No Asbestos							
<b>B00A - R1020 - Main Area - 381.93 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1021 - Senior Study - 11.6 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - Intensive English Centre/Music/Administration - 1970 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	400m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground							
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00B - R0001 - Staff - Toilet - 6.66 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite						
<b>B00B - R0002 - Staff - Toilet - 6.72 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0004 - Public Reception - 32.61 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0005 - Deputy Principal Office - 15.66 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0008 - Main Switchroom - 6.44 m2</b>							
No Asbestos							
<b>B00B - R0013 - Cleaning Store - Distributed - 2.13 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0014 - Toilets-Girls - 4.45 m2</b>							
Ceiling Structures/Linings	Vermiculite						
<b>B00B - R0015 - Distribution Board Cupboard - 4.8 m2</b>							
<b>Note: No inspection of live electrical installation</b>							

No Asbestos							
<b>B00B - R0016 - Apparatus Storage - 27.12 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0020 - General Learning Space - 53.58 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0022 - General Learning Space - 53.58 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0024 - Museum - 55.38 m2</b>							
No Asbestos							
<b>B00B - R0025 - General Storeroom - 11.94 m2</b>							
No Asbestos							
<b>B00B - R0028 - Dark Room - 43.47 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0029 - Archive Store - 21.6 m2</b>							
Furniture / Fixtures - Safe / Vault	Insulation Material	1	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00B - R0030 - Archive Store - 1.68 m2</b>							
No Asbestos							
<b>B00B - R0032 - Staff - Toilet - 4.2 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0033 - Movement - 2.93 m2</b>							
Ceiling Structures/Linings	Vermiculite						
<b>B00B - R0034 - Seminar - 57.25 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0035 - General Storeroom - 5.78 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0036 - Interview/Office - Type 1 - 8.85 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0037 - Careers Advisers Office - 9.18 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0038 - Senior Study - 126.64 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0039 - Toilet - Lobby - 10.94 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0044 - Stairs - 6.69 m2</b>							

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0045 - Stairs - 7.16 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0047 - General Storeroom - 8.1 m2</b>							
No Asbestos							
<b>B00B - R0048 - Administration - Clerical - 34.28 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0049 - Student Reception - 25.3 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0050 - Movement - 29.89 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0051 - Stairs - 4.97 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0052 - Leading Teacher - 13.3 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0053 - Interview/Office - Type 2 - 23.08 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0054 - Staff Study - 89.61 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	90m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0055 - Tea Room - 6.33 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0056 - Staff Study - 36.28 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0057 - General Learning Space - 56.58 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0058 - External Movement - 60.58 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0059 - Movement - 36.4 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0060 - General Learning Space - 42.24 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0061 - General Learning Space - 50.71 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0062 - External Movement - 66.83 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0063 - Movement - 40.86 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0064 - Darkroom Space - 1.4 m2</b>							
No Asbestos							
<b>B00B - R0065 - General Storeroom - 11.93 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00B - R0066 - Movement - 15.16 m2</b>							
No Asbestos							
<b>B00B - R0067 - Stairs - 7.87 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0068 - External Movement - 61.52 m2</b>							
No Asbestos							
<b>B00B - R0069 - Toilets-Boys - 6.56 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
Partition Walls (Cubides)	Compressed AC Sheet	5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0070 - Toilets-Girls - 6.52 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
Partition Walls (Cubides)	Compressed AC Sheet	7m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0071 - Plant - 2.44 m2</b>							
No Asbestos							
<b>B00B - R1001 - General Learning Space - 53.58 m2</b>							
No Asbestos							
<b>B00B - R1002 - General Learning Space - 53.22 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00B - R1003 - General Learning Space - 52.85 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00B - R1004 - Administration - Executive - 6.72 m2</b>							
No Asbestos							
<b>B00B - R1005 - Ancillary Staff - 6.68 m2</b>							
No Asbestos							
<b>B00B - R1006 - General Storeroom - 6.72 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Middle portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1007 - General Learning Space - 53.14 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00B - R1008 - Shared Study Space - 13.18 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00B - R1009 - Shared Study Space - 13.21 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1010 - Music Learning Space - 66.14 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1011 - Interview - 11.67 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)



<b>B00B - R1012 - Interview - 11.67 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00B - R1013 - Cleaning Store - Distributed - 2.16 m2</b>							
No Asbestos							
<b>B00B - R1014 - Staff - Toilet - 4.48 m2</b>							
No Asbestos							
<b>B00B - R1015 - Distribution Board Cupboard - .34 m2</b>				<b>Note: No inspection of live electrical installation</b>			
No Asbestos							
<b>B00B - R1016 - Staff Study - 26.42 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00B - R1017 - Staff Lounge - 31.34 m2</b>							
No Asbestos							
<b>B00B - R1018 - Art Learning Space - 63.04 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00B - R1019 - General Learning Space - 53.95 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00B - R1020 - Cleaning Store - Distributed - 1.99 m2</b>							
No Asbestos							
<b>B00B - R1021 - Resources Store - 6.04 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00B - R1022 - General Storeroom - 5.04 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1023 - Computer Learning Space - 53.44 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00B - R1024 - Office/Store - 6.75 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00B - R1025 - Computer Learning Space - 52.71 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00B - R1026 - Distribution Board Cupboard - .13 m2</b>				<b>Note: No inspection of live electrical installation</b>			
No Asbestos							
<b>B00B - R1027 - Music Learning Space - 53.63 m2</b>							
No Asbestos							
<b>B00B - R1028 - Computer Learning Space - 52.41 m2</b>							
No Asbestos							
<b>B00B - R1029 - Music Store - 13.79 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

<b>B00B - R1030 - General Learning Space - 51.91 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00B - R1031 - General Learning Space - 68.88 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00B - R1034 - External Stairs - 16.01 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1036 - External Stairs - 16.78 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1037 - External Stairs - 16.85 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1038 - Handwashing Facilities - .41 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00B - R1039 - External Stairs - 14 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1040 - External Movement - 299.31 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	300m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - Administration/Staff - 1980 - Brick/Block</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting						
<b>Interior</b>							
<b>B00C - R0001 - Main Switchroom - 6.99 m2</b>							
No Asbestos							
<b>B00C - R0004 - Movement - 7.14 m2</b>							
No Asbestos							
<b>B00C - R0005 - Staff - Toilet - 8.27 m2</b>							
No Asbestos							
<b>B00C - R0006 - Staff - Toilet - 8.13 m2</b>							
No Asbestos							
<b>B00C - R0007 - Toilets-Disabled - 4.06 m2</b>							
No Asbestos							
<b>B00C - R0019 - Deputy Principal Office - 12.39 m2</b>							
No Asbestos							
<b>B00C - R0020 - Deputy Principal Office - 13.7 m2</b>							
No Asbestos							
<b>B00C - R0028 - Principal Office - 19.8 m2</b>							
No Asbestos							
<b>B00C - R0029 - Interview/Meeting - 13.56 m2</b>							
No Asbestos							

<b>B00C - R0030 - Interview/Meeting - 13.56 m2</b>							
No Asbestos							
<b>B00C - R0032 - Distribution Board Cupboard - 2.15 m2</b>							<b>Note: No inspection of live electrical installation</b>
No Asbestos							
<b>B00C - R0033 - Administration - Clerical - 12.74 m2</b>							
Furniture / Fixtures - Safe / Vault	Encapsulated Asbestos material within unit	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00C - R0034 - Printing/Photocopying - 17.11 m2</b>							
No Asbestos							
<b>B00C - R0035 - Clinic - 10.95 m2</b>							
No Asbestos							
<b>B00C - R0036 - Toilets-Boys - 1.44 m2</b>							
No Asbestos							
<b>B00C - R0037 - Toilets-Girls - 1.43 m2</b>							
No Asbestos							
<b>B00C - R0038 - General Storeroom - 10.96 m2</b>							
No Asbestos							
<b>B00C - R0039 - Administration - Clerical - 35.21 m2</b>							
No Asbestos							
<b>B00C - R0040 - Cleaning Store - Distributed - 2.47 m2</b>							
No Asbestos							
<b>B00C - R0041 - Tea Room - 9.36 m2</b>							
No Asbestos							
<b>B00C - R0042 - General Storeroom - 15.5 m2</b>							
No Asbestos							
<b>B00C - R0043 - Leading Teacher - 15.75 m2</b>							
No Asbestos							
<b>B00C - R0044 - External Movement - 294.71 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00C - R0045 - Public Reception - 67.48 m2</b>							
No Asbestos							
<b>B00C - R0046 - Administration - Clerical - 64.21 m2</b>							
No Asbestos							
<b>B00C - R0047 - Student Reception - 46.4 m2</b>							
No Asbestos							
<b>B00C - R0048 - Toilet - Lobby - 1.59 m2</b>							
No Asbestos							
<b>B00C - R0049 - Staff - Toilet - 1.57 m2</b>							
No Asbestos							
<b>B00C - R0050 - Toilet - Lobby - 1.58 m2</b>							
No Asbestos							
<b>B00C - R0051 - Staff - Toilet - 1.6 m2</b>							
No Asbestos							
<b>B00C - R0052 - Commonroom - 114.21 m2</b>							
No Asbestos							
<b>B00C - R0053 - Staff Kitchen - 11.11 m2</b>							
No Asbestos							
<b>B00C - R0054 - Interview/Office - Type 2 - 29.9 m2</b>							
No Asbestos							
<b>B00C - R0055 - Tea Room - 1.17 m2</b>							
No Asbestos							

## B00D - Physical Education/Pupil Facilities - 1980 - Brick/Block

### Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids		1	Central North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos

### Interior

#### B00D - R0001 - Toilets-Boys - 22.37 m2

No Asbestos

#### B00D - R0002 - Toilets-Girls - 21.71 m2

No Asbestos

#### B00D - R0003 - Vending Machines - 3.6 m2

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------	-----------------------------

#### B00D - R0004 - Change - 23.74 m2

No Asbestos

#### B00D - R0005 - Change - 23.5 m2

No Asbestos

#### B00D - R0006 - Movement - 2.92 m2

No Asbestos

#### B00D - R0007 - Change - 22.64 m2

No Asbestos

#### B00D - R0008 - Change - 22.39 m2

No Asbestos

#### B00D - R0009 - Movement - 3.11 m2

No Asbestos

#### B00D - R0010 - Movement - 26.73 m2

No Asbestos

#### B00D - R0011 - Student Canteen - 68.76 m2

No Asbestos

#### B00D - R0012 - Office/Store - 3.74 m2

No Asbestos

#### B00D - R0013 - Staff - Toilet - 2.29 m2

No Asbestos

#### B00D - R0014 - Sport Equipment Store - 52.99 m2

No Asbestos

#### B00D - R0015 - Sport Equipment Store - 20.85 m2

No Asbestos

#### B00D - R0016 - Sport Equipment Store - 8.59 m2

Floor Coverings Res/Textile	Vinyl Tiles						
-----------------------------	-------------	--	--	--	--	--	--

#### B00D - R0017 - Cleaning Store - Distributed - 2.74 m2

Floor Coverings Res/Textile	Vinyl Tiles						
-----------------------------	-------------	--	--	--	--	--	--

#### B00D - R0018 - Sport Equipment Store - 8.58 m2

Floor Coverings Res/Textile	Vinyl Tiles						
-----------------------------	-------------	--	--	--	--	--	--

#### B00D - R0019 - Gymnasium - 479.17 m2

No Asbestos

#### B00D - R0020 - External Movement - 140.28 m2

Ceiling Structures/Linings	Flat AC Sheeting	127m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	-------	------------	--------------------	---------	--------------------	-----------------------------

#### B00D - R0021 - External Movement - 19.33 m2

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - Art - 1980 - Brick/Veneer</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00E - R0001 - Art Learning Space - 62.71 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00E - R0002 - Art Learning Space - 50.34 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00E - R0003 - External Movement - 11.71 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0004 - Resources Store - 28.81 m2</b>							
No Asbestos							
<b>B00E - R0006 - Visual Arts Store - 7.69 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00E - R0007 - Resources Store - 18.2 m2</b>							
No Asbestos							
<b>B00E - R0008 - Kin Space - 10.32 m2</b>							
No Asbestos							
<b>B00E - R0009 - Visual Arts Workshop - 86.75 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00E - R0010 - External Movement - 12 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0011 - Art Learning Space - 50.34 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00E - R0012 - Art Learning Space - 63.08 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00E - R0013 - External Movement - 25.2 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0014 - External Movement - 48.89 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0015 - Staff Study - 16.94 m2</b>							
No Asbestos							
<b>B00E - R0016 - Tea Room - 1.18 m2</b>							
No Asbestos							
<b>B00F - Storage - 1955 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Ends	Flat AC Sheeting	5m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Flat AC Sheeting	3	Central	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos

Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00F - R0001 - General Storeroom - 13.03 m2</b>							
No Asbestos							
<b>B00F - R0003 - General Storeroom - 24.59 m2</b>							
No Asbestos							
<b>B00F - R0004 - General Storeroom - 27.36 m2</b>							
No Asbestos							
<b>B00F - R0005 - General Storeroom - 21.34 m2</b>							
No Asbestos							
<b>B00F - R0006 - General Storeroom - 14.1 m2</b>							
No Asbestos							
<b>B00G - Storage - 1955 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Window	Mastic						
<b>Interior</b>							
<b>B00G - R0001 - Craft Store - 35.23 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0002 - General Storeroom - 22.06 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0003 - General Storeroom - 26.04 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0005 - Cleaning Supplies Store - 12.62 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0006 - Toilets-Girls - 31.53 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0007 - General Storeroom - 1.29 m2</b>							
No Asbestos							
<b>B00H - Technological &amp; Applied Studies/Computer Learning - 1955 - Concrete</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Window	Mastic						
<b>Interior</b>							
<b>B00H - R0001 - General Storeroom - 9.3 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00H - R0002 - General Storeroom - 8.97 m2</b>							

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00H - R0005 - Staff - Toilet - 4.35 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00H - R0006 - General Storeroom - 4.32 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00H - R0007 - Movement - 2.87 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00H - R0008 - Kitchen - Type 2 - 35.73 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00H - R0009 - Student Kitchen - 18.7 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting						
<b>B00H - R0010 - Nutrition Room - 54.97 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting						
<b>B00H - R0011 - Movement - 16.74 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00H - R0012 - Computer Learning Space - 60.86 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00H - R0013 - System Administrators Office - 16.83 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00J - Pupil Facilities - 1955 - Concrete</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Window	Mastic						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00J - R0002 - Office/Store - 5.04 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00J - R0003 - Garden Store Room - 11.47 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00J - R0005 - Toilets-Girls - 46.9 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00J - R0006 - Toilets-Girls - 33.47 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Partition Walls (Cubides)	Compressed AC Sheet						
<b>B00J - R0007 - Toilets-Boys - 46.59 m2</b>							

Ceiling Structures/Linings	Flat AC Sheeting	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00J - R0008 - Toilets-Boys - 33.47 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00K - Technological &amp; Applied Studies - 1955 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	30m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Plant / Equipment	Gasket Material	1	Southeast	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>Interior</b>							
<b>B00K - R0007 - Cleaning Store - Distributed - 2.66 m2</b>							
No Asbestos							
<b>B00K - R0008 - Distribution Board Cupboard - 1.23 m2</b>							
No Asbestos							
<b>B00K - R0010 - General Learning Space - 58.75 m2</b>							
No Asbestos							
<b>B00K - R0011 - Materials Store - 9.7 m2</b>							
No Asbestos							
<b>B00K - R0012 - Project Store - Type 1 - 15.65 m2</b>							
No Asbestos							
<b>B00K - R0013 - Workshop Area - 112.11 m2</b>							
No Asbestos							
<b>B00K - R0014 - Metal Technology Bay - 4.09 m2</b>							
No Asbestos							
<b>B00K - R0015 - Metal Technology Bay - 3.97 m2</b>							
No Asbestos							
<b>B00K - R0016 - Metal Technology Bay - 3.97 m2</b>							
No Asbestos							
<b>B00K - R0017 - Metal Technology Bay - 4.11 m2</b>							
No Asbestos							
<b>B00K - R0018 - External Movement - 12.59 m2</b>							
No Asbestos							
<b>B00K - R0019 - External Movement - 112.2 m2</b>							
No Asbestos							
<b>B00K - R0020 - External Movement - 29.15 m2</b>							
No Asbestos							
<b>B00K - R0021 - Materials Store - 23.82 m2</b>							
No Asbestos							
<b>B00L - Technological &amp; Applied Studies - 1980 - Brick/Veneer</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting						
Underfloor Voids - Slab on Ground							
Ceiling Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00L - R0002 - Resources Store - 19.13 m2</b>							
Floor Coverings Res/Textile	Resinous Membrane						



<b>B00L - R0003 - Materials Technology L.S. - 66.69 m2</b>							
Floor Coverings Res/Textile	Resinous Board						
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00L - R0004 - Distribution Board Cupboard - .19 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Wall Linings Internal	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00L - R0005 - Materials Technology L.S. - 102.89 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
Floor Coverings Res/Textile	Resinous Membrane						
<b>B00L - R0006 - General Storeroom - 4.52 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00L - R0007 - Materials Technology L.S. - 121.77 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00L - R0008 - General Storeroom - 11.97 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00L - R0009 - Computer Learning Space - 66.36 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00L - R0010 - Staff Study - 24.65 m2</b>							
No Asbestos							
<b>B00L - R0011 - External Movement - 98.89 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting						
<b>B00L - R0013 - Plant - 9.15 m2</b>							
No Asbestos							
<b>B00L - R0014 - Materials Store - 19.28 m2</b>							
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00L - R0015 - Stairs - 10.46 m2</b>							
No Asbestos							
<b>B00L - R1002 - Office/Store - 19.27 m2</b>							
Floor Coverings Res/Textile	Resinous Membrane						
<b>B00L - R1003 - Movement - 14.89 m2</b>							
No Asbestos							
<b>B00L - R1004 - Design/Technology L.S. - 49.21 m2</b>							
No Asbestos							
<b>B00L - R1005 - Stairs - 21.3 m2</b>							
No Asbestos							
<b>B00L - R1006 - Design/Technology L.S. - 51.27 m2</b>							
No Asbestos							
<b>B00L - R1007 - Handwashing Facilities - .93 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						

## B00M - Multi Purpose Facilities - 1993 - Brick/Block

### Exterior

Eaves Linings	Flat AC Sheeting	40m2	North, East, West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	AC Fragments/Debris - Flat AC Sheet	4	East	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found						

### Interior

#### B00M - M0001 - Other-Vacant - 6.92 m2

Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						

#### B00M - M0002 - Movement - 12.43 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

#### B00M - M0004 - Other-Vacant - 6.75 m2

Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						

#### B00M - M0005 - Movement - 2.7 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

#### B00M - M0006 - Movement - 9.8 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

#### B00M - M0007 - Movement - 6.08 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

#### B00M - R0001 - Plant - 15.18 m2

Plant / Equipment - Fan Unit(s)	Gasket Material	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
---------------------------------	-----------------	---	------------	--------------------	---------	--------------------	------------------

#### B00M - R0002 - Multi-Purpose Space - 415.82 m2

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Underside of raised Control Room	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	30m2	North, South, East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

#### B00M - R0003 - General Storeroom - 6.1 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

#### B00M - R0004 - General Storeroom - 7.08 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

#### B00M - R0005 - Staff Kitchen - 6.72 m2

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						

#### B00M - R0006 - Toilets-Unisex - 8.51 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

#### B00M - R0009 - Tea Room - 7.61 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

#### B00M - R0010 - Toilets-Unisex - 5.61 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

#### B00M - R0015 - External Movement - 9.47 m2

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
----------------------------	------------------	------	------------	--------------------	---------	--------------------	---

#### B00M - R0016 - External Movement - 9.64 m2

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00M - R0017 - Movement - 14.62 m2</b>							
No Asbestos							
<b>B00M - R0018 - Chair Store - 22.72 m2</b>							
No Asbestos							
<b>B00M - R0019 - Chair Store - 30.09 m2</b>							
No Asbestos							
<b>B00M - R0020 - Movement - 12.56 m2</b>							
No Asbestos							
<b>B00M - R0021 - External Movement - 3.19 m2</b>							
No Asbestos							
<b>B00M - R0022 - External Movement - 3.2 m2</b>							
No Asbestos							
<b>B00M - R0023 - Stairs - .15 m2</b>							
No Asbestos							
<b>B00M - R0024 - Stairs - .15 m2</b>							
No Asbestos							
<b>B00M - R0025 - Stage - 89.11 m2</b>							
No Asbestos							
<b>B00M - R9001 - General Storeroom - 88.84 m2</b>							
No Asbestos							
<b>B00N - Building Services - 1993 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	60m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00N - R0001 - Fitness Laboratory - 46.04 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00N - R0003 - Fitness Laboratory - 11.21 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00N - R0004 - Fitness Laboratory - 9.52 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00N - R0005 - Toilets-Unisex - 3.13 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00N - R0006 - Shower - 3.67 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Northeast	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00N - R0007 - General Storeroom - 22.51 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00N - R0008 - General Storeroom - 27.7 m2</b>							

Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00N - R0010 - Staff - Toilet - 4.96 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00N - R0011 - Office/Store - 13.4 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00N - R0012 - General Storeroom - 8.75 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00N - R0013 - Plant - .86 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00N - R0014 - General Assistants - 10.69 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00N - R0015 - Garden Store Room - 5.61 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00P - General Learning/Science Learning - 1955 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00P - R0001 - Change - 46.46 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
Partition Walls (Cubicles)	Compressed AC Sheet	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00P - R0002 - Sport Equipment Store - 13.4 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00P - R0003 - Sport Equipment Store - 13.58 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00P - R0004 - Toilets-Unisex - 8.41 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00P - R0006 - General Storeroom - 5.09 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00P - R0007 - Resources Store - 11.61 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00P - R0008 - Staff - Toilet - 15.93 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00P - R0009 - Cleaning Store - Distributed - 4.65 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00P - R0010 - Distribution Board Cupboard - 1.54 m2</b> <span style="float: right;"><b>Note: No inspection of live electrical installation</b></span>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00P - R0011 - Staff Study - 26.68 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00P - R0012 - Chemical Store - 25.91 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00P - R0013 - Science Laboratory - 93.46 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	94m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00P - R0014 - Preparation - Science - 29.48 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00P - R0015 - Resources Store - 10.03 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00P - R0016 - Science Laboratory - 93.77 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00P - R0019 - Science Laboratory - 93.64 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
Plant / Equipment - Fume Cupboard	Flat AC Sheeting	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00P - R0020 - Distribution Board Cupboard - 2.37 m2</b> <span style="float: right;"><b>Note: No inspection of live electrical installation</b></span>							
No Asbestos							
<b>B00P - R0024 - General Storeroom - 3.82 m2</b>							
No Asbestos							
<b>B00P - R0027 - External Stairs - 5.07 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00P - R0028 - Change - 36.69 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Southeast	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00P - R0029 - Plant - 1.43 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
Plumbing / Pipework	Fibre Cement Pipe	1	Central	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos

<b>B00P - R0030 - Preparation - Science - 39.47 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00P - R0031 - Multi-Purpose Space - 81.64 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00P - R0032 - Other-Not Used - 6.2 m2</b>							
No Asbestos							
<b>B00P - R0033 - External Stairs - 5.28 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00P - R0034 - External Movement - 247.73 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - Composite Sample						
<b>B00P - R1001 - Computer Learning Space - 53.36 m2</b>							
No Asbestos							
<b>B00P - R1002 - General Learning Space - 53.36 m2</b>							
No Asbestos							
<b>B00P - R1003 - General Learning Space - 52.56 m2</b>							
No Asbestos							
<b>B00P - R1004 - General Storeroom - 6.23 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00P - R1005 - General Storeroom - 6.21 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00P - R1006 - General Learning Space - 53.29 m2</b>							
No Asbestos							
<b>B00P - R1007 - Distribution Board Cupboard - .55 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
No Asbestos							
<b>B00P - R1011 - Resources Store - 25.91 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00P - R1012 - Cleaning Store - Distributed - 5.76 m2</b>							
No Asbestos							
<b>B00P - R1013 - Resources Store - 17.82 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00P - R1014 - General Storeroom - 4.53 m2</b>							
No Asbestos							
<b>B00P - R1015 - Resources Store - 4.22 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00P - R1016 - General Learning Space - 52.71 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00P - R1017 - General Learning Space - 51.83 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00P - R1018 - General Learning Space - 52.78 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00P - R1019 - Resources Store - 4.37 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00P - R1020 - General Storeroom - 4.62 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00P - R1021 - General Learning Space - 54.31 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00P - R1022 - General Storeroom - 13.21 m2</b>							
No Asbestos							
<b>B00P - R1023 - General Storeroom - 13.07 m2</b>							
No Asbestos							
<b>B00P - R1024 - Music Learning Space - 64.52 m2</b>							
No Asbestos							
<b>B00P - R1025 - General Storeroom - 26.97 m2</b>							
No Asbestos							
<b>B00P - R1027 - Staff - Toilet - 3.88 m2</b>							
No Asbestos							
<b>B00P - R1028 - Cleaning Store - Distributed - 1.69 m2</b>							
No Asbestos							
<b>B00P - R1029 - External Movement - 195.83 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	193m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00P - R1030 - Distribution Board Cupboard - .82 m2</b>						<b>Note: No inspection of live electrical installation</b>	
No Asbestos							
<b>B00P - R1031 - External Stairs - 15.01 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00P - R1032 - External Stairs - 15.02 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00P - R1033 - Staff Study - 57.99 m2</b>							
No Asbestos							
<b>B00P - R1034 - Tea Room - 2.36 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00Q - Performance Learning - 1955 - Concrete</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00Q - R0002 - Office/Store - 7.76 m2</b>							
No Asbestos							
<b>B00Q - R0003 - Performance Store - 7.24 m2</b>							
No Asbestos							
<b>B00Q - R0004 - Movement - 47.19 m2</b>							
No Asbestos							
<b>B00Q - R0007 - Performance Store - 9.48 m2</b>							
No Asbestos							
<b>B00Q - R0008 - Performance Store - 7.08 m2</b>							
No Asbestos							
<b>B00Q - R0009 - Performance Store - 11.62 m2</b>							
Wall Linings Internal	Flat AC Sheeting	40m2	East, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

<b>B00Q - R0010 - Movement - 2.15 m2</b>							
Wall Linings Internal	Flat AC Sheeting	10m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00Q - R0012 - General Storeroom - 2.22 m2</b>							
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00Q - R0013 - Office/Store - 6.84 m2</b>							
Wall Linings Internal	Flat AC Sheeting	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00Q - R0014 - General Storeroom - 14.68 m2</b>							
No Asbestos							
<b>B00Q - R0015 - External Movement - 2.96 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	North, South, East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00Q - R0016 - Tea Room - 6.66 m2</b>							
No Asbestos							
<b>B00Q - R0017 - Staff Study - 64.7 m2</b>							
No Asbestos							
<b>B00Q - R0019 - External Movement - 2.86 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00Q - R0020 - Performance Workshop - 54.14 m2</b>							
No Asbestos							
<b>B00Q - R0021 - Performance Workshop - 91.9 m2</b>							
No Asbestos							
<b>B00Q - R0022 - Control Room - 3.64 m2</b>							
No Asbestos							
<b>B00Q - R0023 - Performance Workshop - 53.26 m2</b>							
Wall Linings Internal	Flat AC Sheeting	50m2	South & East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00Q - R0024 - Performance Workshop - 53.29 m2</b>							
No Asbestos							
<b>B00R - General Learning/Computer Learning - 1955 - Concrete</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00R - R0001 - General Learning Space - 53.27 m2</b>							
No Asbestos							
<b>B00R - R0002 - General Storeroom - 4.43 m2</b>							
No Asbestos							
<b>B00R - R0003 - Computer Learning Space - 53.13 m2</b>							
No Asbestos							
<b>B00R - R0004 - General Learning Space - 53.27 m2</b>							
No Asbestos							
<b>B00R - R0005 - General Learning Space - 53.29 m2</b>							
No Asbestos							
<b>B00R - R0006 - General Storeroom - 8.16 m2</b>							
No Asbestos							



<b>B00R - R0007 - General Storeroom - 4.62 m2</b>							
No Asbestos							
<b>B00R - R0008 - Resources Store - 5.93 m2</b>							
No Asbestos							
<b>B00R - R0009 - Resources Store - 11.64 m2</b>							
No Asbestos							
<b>B00R - R0011 - Staff - Toilet - 15.03 m2</b>							
No Asbestos							
<b>B00R - R0012 - Movement - 104.68 m2</b>							
No Asbestos							
<b>B00R - R0013 - External Movement - 3.1 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	North, South, East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00R - R0014 - Staff Study - 50.37 m2</b>							
No Asbestos							
<b>B00R - R0015 - Tea Room - 2.1 m2</b>							
No Asbestos							
<b>B00R - R0016 - External Movement - 2.85 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00S - Staff/Administration - 1955 - Concrete</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area						
Window	Mastic						
Underfloor Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00S - R0001 - Cleaning Store - Distributed - 2.24 m2</b>							
No Asbestos							
<b>B00S - R0005 - Staff Study - 16.3 m2</b>							
No Asbestos							
<b>B00S - R0006 - General Storeroom - 7.25 m2</b>							
No Asbestos							
<b>B00S - R0007 - Staff Study - 19.45 m2</b>							
No Asbestos							
<b>B00S - R0009 - Interview/Meeting - 19.43 m2</b>							
No Asbestos							
<b>B00S - R0010 - Staff - Toilet - 4.14 m2</b>							
No Asbestos							
<b>B00S - R0011 - Interview/Office - Type 1 - 16.43 m2</b>							
No Asbestos							
<b>B00S - R0012 - Careers Advisers Office - 13.32 m2</b>							
No Asbestos							
<b>B00S - R0013 - Resources Store - 7.05 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00S - R0014 - Leading Teacher - 17.93 m2</b>							
No Asbestos							
<b>B00S - R0015 - Staff - Toilet - 3.46 m2</b>							

No Asbestos							
<b>B00S - R0016 - Staff - Toilet - 5.17 m2</b>							
No Asbestos							
<b>B00S - R0020 - Printing/Photocopying - 20.91 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00S - R0021 - Movement - 89.72 m2</b>							
No Asbestos							
<b>B00S - R0022 - External Movement - 2.98 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00S - R0023 - General Storeroom - 1.62 m2</b>							
No Asbestos							
<b>B00S - R0024 - Staff - Toilet - 1.67 m2</b>							
No Asbestos							
<b>B00S - R0025 - Staff Study - 53.14 m2</b>							
No Asbestos							
<b>B00T - General Learning - 1955 - Concrete</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
Window	Mastic						
<b>Interior</b>							
<b>B00T - R0001 - General Learning Space - 53.28 m2</b>							
No Asbestos							
<b>B00T - R0002 - Staff Study - 17.57 m2</b>							
No Asbestos							
<b>B00T - R0003 - General Learning Space - 53.35 m2</b>							
No Asbestos							
<b>B00T - R0004 - General Learning Space - 53.34 m2</b>							
No Asbestos							
<b>B00T - R0006 - General Storeroom - 4.45 m2</b>							
No Asbestos							
<b>B00T - R0007 - General Learning Space - 53.27 m2</b>							
No Asbestos							
<b>B00T - R0008 - General Storeroom - 7.95 m2</b>							
No Asbestos							
<b>B00T - R0009 - External Movement - 3.02 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	North, South, East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00T - R0010 - Resources Store - 13.1 m2</b>							
No Asbestos							
<b>B00T - R0013 - Movement - 71.85 m2</b>							
No Asbestos							
<b>B00T - R0014 - Handwashing Facilities - 1.06 m2</b>							

No Asbestos							
<b>B00U - General Learning/Computer Learning - 1955 - Concrete</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Underfloor Voids	Non Accessible Area						
Window	Mastic						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00U - R0001 - Tea Room - 7.83 m2</b>							
No Asbestos							
<b>B00U - R0003 - Cleaning Store - Distributed - 8.63 m2</b>							
No Asbestos							
<b>B00U - R0004 - Staff Study - 44.57 m2</b>							
No Asbestos							
<b>B00U - R0005 - Resources Store - 17.86 m2</b>							
No Asbestos							
<b>B00U - R0006 - Computer Learning Space - 53.35 m2</b>							
No Asbestos							
<b>B00U - R0007 - General Learning Space - 53.27 m2</b>							
No Asbestos							
<b>B00U - R0008 - General Learning Space - 53.21 m2</b>							
No Asbestos							
<b>B00U - R0010 - External Movement - 2.96 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	North, South, East, Upper portion	Poor Condition - Extensive Damage (4)	Medium (2)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00U - R0011 - External Movement - 3.2 m2</b>							
Wall Linings Internal	Flat AC Sheeting	6m2	North, South, East, Upper portion	Poor Condition - Extensive Damage (4)	Medium (2)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00U - R0012 - Toilet - Lobby - 2.91 m2</b>							
No Asbestos							
<b>B00U - R0013 - Staff - Toilet - 1.39 m2</b>							
No Asbestos							
<b>B00U - R0014 - Staff - Toilet - 1.37 m2</b>							
No Asbestos							
<b>B00U - R0015 - Movement - 75.47 m2</b>							
No Asbestos							
<b>B00U - R0016 - Handwashing Facilities - 1.09 m2</b>							
No Asbestos							
<b>B00V - Technological &amp; Applied Studies - 1955 - Concrete</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Window	Mastic						
Underfloor Voids	Non Accessible Area						
Ceiling Voids	Non Accessible Area						
<b>Interior</b>							

<b>B00V - R0001 - Plant - 8.97 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00V - R0002 - Laundry - 39.18 m2</b>							
No Asbestos							
<b>B00V - R0004 - Toilets-Unisex - 4.77 m2</b>							
No Asbestos							
<b>B00V - R0006 - Resources Store - 5.93 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00V - R0007 - Resources Store - 8.64 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00V - R0008 - Preparation - 13.3 m2</b>							
No Asbestos							
<b>B00V - R0009 - General Storeroom - 21.77 m2</b>							
No Asbestos							
<b>B00V - R0010 - Staff Study - 52.92 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00V - R0011 - External Movement - 2.95 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00V - R0012 - General Storeroom - 7.44 m2</b>							
No Asbestos							
<b>B00V - R0013 - Food Technology L.S. - 80.67 m2</b>							
No Asbestos							
<b>B00V - R0014 - Preparation - 8.87 m2</b>							
No Asbestos							
<b>B00V - R0015 - Preparation - 8.41 m2</b>							
No Asbestos							
<b>B00V - R0016 - Food Technology L.S. - 89.74 m2</b>							
No Asbestos							
<b>B00V - R0019 - General Storeroom - 12.95 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00V - R0020 - Food/Research Space - 28.1 m2</b>							
No Asbestos							
<b>B00V - R0021 - Kitchen - Type 2 - 97.32 m2</b>							
No Asbestos							
<b>B00V - R0022 - Distribution Board Cupboard - .48 m2</b>							
							<b>Note: No inspection of live electrical installation</b>
No Asbestos							
<b>B00V - R0023 - Staff Study - 20.41 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00V - R0024 - Plant - .75 m2</b>							
No Asbestos							
<b>B00V - R0025 - External Movement - 4.39 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00V - R0026 - External Movement - 2.89 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

<b>B00V - R0027 - External Movement - 2.4 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00V - R0028 - Movement - 114.49 m2</b>							
No Asbestos							
<b>B00V - R0029 - Cleaning Store - Distributed - .46 m2</b>							
No Asbestos							
<b>B00V - R0030 - Handwashing Facilities - .85 m2</b>							
No Asbestos							
<b>B00W - General Learning/Computer Learning - 1955 - Concrete</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	Non Accessible Area						
Ceiling Voids	No Asbestos Found						
Window	Mastic						
<b>Interior</b>							
<b>B00W - R0001 - General Learning Space - 67.71 m2</b>							
No Asbestos							
<b>B00W - R0002 - General Storeroom - 6.11 m2</b>							
No Asbestos							
<b>B00W - R0003 - General Storeroom - 2.96 m2</b>							
No Asbestos							
<b>B00W - R0004 - General Storeroom - 2.96 m2</b>							
No Asbestos							
<b>B00W - R0005 - General Learning Space - 65.18 m2</b>							
No Asbestos							
<b>B00W - R0006 - Computer Resource - 22.97 m2</b>							
No Asbestos							
<b>B00W - R0007 - Materials Technology L.S. - 65.11 m2</b>							
No Asbestos							
<b>B00W - R0008 - Resources Store - 6.09 m2</b>							
No Asbestos							
<b>B00W - R0011 - Materials Technology L.S. - 67.82 m2</b>							
No Asbestos							
<b>B00W - R0012 - Plant - .61 m2</b>							
No Asbestos							
<b>B00W - R0015 - External Movement - 3.85 m2</b>							
No Asbestos							
<b>B00W - R0016 - External Movement - 3.82 m2</b>							
No Asbestos							
<b>B00W - R0017 - Resources Store - 6.14 m2</b>							
No Asbestos							
<b>B00W - R0018 - Toilets-Unisex - 6.08 m2</b>							
No Asbestos							
<b>B00W - R0019 - Handwashing Facilities - .66 m2</b>							
No Asbestos							
<b>B00W - R0020 - Movement - 47.11 m2</b>							
No Asbestos							
<b>B00X - General Learning/Computer Learning - 1955 - Concrete</b>							
<b>Exterior</b>							

Eaves Linings	Flat AC Sheeting	200m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Window	Mastic						
Underfloor Voids	AC Fragments/Debris - Flat AC Sheet	50	Northwest	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00X - R0001 - General Learning Space - 54.09 m2</b>							
No Asbestos							
<b>B00X - R0002 - General Learning Space - 54.97 m2</b>							
No Asbestos							
<b>B00X - R0003 - Resources Store - 11.81 m2</b>							
No Asbestos							
<b>B00X - R0004 - Special Learning Space - 58.22 m2</b>							
No Asbestos							
<b>B00X - R0005 - Special Learning Space - 30.01 m2</b>							
No Asbestos							
<b>B00X - R0006 - Resources Store - 8.89 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00X - R0007 - Resources Store - 8.66 m2</b>							
No Asbestos							
<b>B00X - R0010 - General Storeroom - 8.91 m2</b>							
No Asbestos							
<b>B00X - R0011 - Resources Store - 8.62 m2</b>							
No Asbestos							
<b>B00X - R0012 - Resources Store - 17.06 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00X - R0013 - General Learning Space - 53.36 m2</b>							
No Asbestos							
<b>B00X - R0014 - Computer Learning Space - 53.28 m2</b>							
No Asbestos							
<b>B00X - R0015 - General Learning Space - 53.36 m2</b>							
No Asbestos							
<b>B00X - R0016 - General Learning Space - 53.35 m2</b>							
No Asbestos							
<b>B00X - R0017 - Staff - Toilet - 4.27 m2</b>							
No Asbestos							
<b>B00X - R0018 - Sport Equipment Store - 12.58 m2</b>							
No Asbestos							
<b>B00X - R0020 - General Storeroom - 18.05 m2</b>							
No Asbestos							
<b>B00X - R0021 - General Learning Space - 55.85 m2</b>							
No Asbestos							
<b>B00X - R0022 - Tea Room - 7.39 m2</b>							
No Asbestos							
<b>B00X - R0023 - Resources Store - 10.11 m2</b>							
No Asbestos							
<b>B00X - R0024 - General Learning Space - 55.85 m2</b>							
No Asbestos							
<b>B00X - R0025 - General Storeroom - 20.06 m2</b>							
No Asbestos							

<b>B00X - R0027 - General Storeroom - 3.71 m2</b>							
No Asbestos							
<b>B00X - R0029 - Movement - 84.08 m2</b>							
No Asbestos							
<b>B00X - R0031 - External Movement - 3.02 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00X - R0032 - General Learning Space - 46.85 m2</b>							
No Asbestos							
<b>B00X - R0033 - General Learning Space - 46.84 m2</b>							
No Asbestos							
<b>B00X - R0034 - Movement - 115.62 m2</b>							
No Asbestos							
<b>B00X - R0035 - Handwashing Facilities - .88 m2</b>							
No Asbestos							
<b>B00X - R0036 - Cleaning Store - Distributed - .42 m2</b>							
No Asbestos							
<b>B00X - R0037 - Handwashing Facilities - 1.13 m2</b>							
No Asbestos							
<b>B00X - R0038 - Cleaning Store - Distributed - .57 m2</b>							
No Asbestos							
<b>B00X - R0039 - General Learning Space - 62.73 m2</b>							
No Asbestos							
<b>B00X - R0040 - Seminar - 30.2 m2</b>							
No Asbestos							
<b>B00X - R0041 - Handwashing Facilities - .81 m2</b>							
No Asbestos							
<b>B00X - R0042 - Cleaning Store - Distributed - .4 m2</b>							
No Asbestos							
<b>B00X - R0043 - Movement - 95.48 m2</b>							
No Asbestos							
<b>B00X - R0044 - External Movement - 2.87 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00X - R0045 - Computer Learning Space - 89.17 m2</b>							
No Asbestos							
<b>B00Y - Computer Learning/Art - 1950 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00Y - R0001 - Special Learning Space - 43.84 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00Y - R0002 - Special Learning Space - 44.71 m2</b>							
No Asbestos							
<b>B00Y - R0003 - Special Learning Space - 44.53 m2</b>							
No Asbestos							
<b>B00Y - R0004 - External Movement - 39.25 m2</b>							
No Asbestos							
<b>B00Y - R0005 - Student Drinking Facilities - 11.73 m2</b>							
No Asbestos							

**B00Z - General Learning - 2008 - Brick/Veneer****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	

**Interior****B00Z - R0001 - General Learning Space - 91.97 m2**

No Asbestos

**B00Z - R0002 - Seminar - 18.84 m2**

No Asbestos

**B00Z - R0003 - Archive Store - 10.04 m2**

No Asbestos

**B00Z - R0004 - Secure Storeroom - 9.1 m2**

No Asbestos

**B00Z - R0005 - External Movement - 27.39 m2**

No Asbestos

**B0YY - Storage - 2008 - Metal Shed****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	

**Interior****B0YY - R0001 - Machine Storage - 34.93 m2**

No Asbestos

**B0ZZ - Building Services - 2008 - Brick/Block****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids - Flat Roof	No Asbestos Found	

**Interior****B0ZZ - R0001 - Plant - 6.6 m2**

Plant / Equipment	Gasket Material	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
-------------------	-----------------	---	------------	--------------------	---------	--------------------	------------------



**Demountables****OS 601 10192 - Learning Unit - Standard/Withdrawal - Placement Date : 12-JAN-2017**

No Asbestos Found

**OS 602 11788 - Learning Unit - Standard With P.A.A. - Placement Date : 30-JUN-1995**

No Asbestos Found

**OS 601 12396 - Learning Unit - Standard/Withdrawal - Placement Date : 11-JAN-2017**

No Asbestos Found

**OS 844 12705 - Country Toilet - Reltc - Boys/Girls - Placement Date : 16-MAY-2009**

No Asbestos Found

**OS 602 15321 - Learning Unit - Standard With P.A.A. - Placement Date : 20-JAN-2009****Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.**

No Asbestos Found

**OS 601 16155 - Learning Unit - Standard/Withdrawal - Placement Date : 12-JAN-2017**

No Asbestos Found

**OS 602 17671 - Learning Unit - Standard With P.A.A. - Placement Date : 20-JAN-2009****Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.**

No Asbestos Found

**OS 601 18224 - Learning Unit - Standard/Withdrawal - Placement Date : 11-JAN-2017****Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.**

No Asbestos Found

**OS 606 19196 - Learning Unit - Standard With P.A.A A/C - Placement Date : 31-JAN-2018****Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.**

No Asbestos Found

**OS 602 19510 - Learning Unit - Standard With P.A.A. - Placement Date : 13-DEC-2018****Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.**

No Asbestos Found