


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Hay Public School (2145)
Region:	Southern NSW AMU
State Electorate:	Murray
Local Government Area:	Hay

Last Reviewed By:	WSP 12-JUL-2016
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

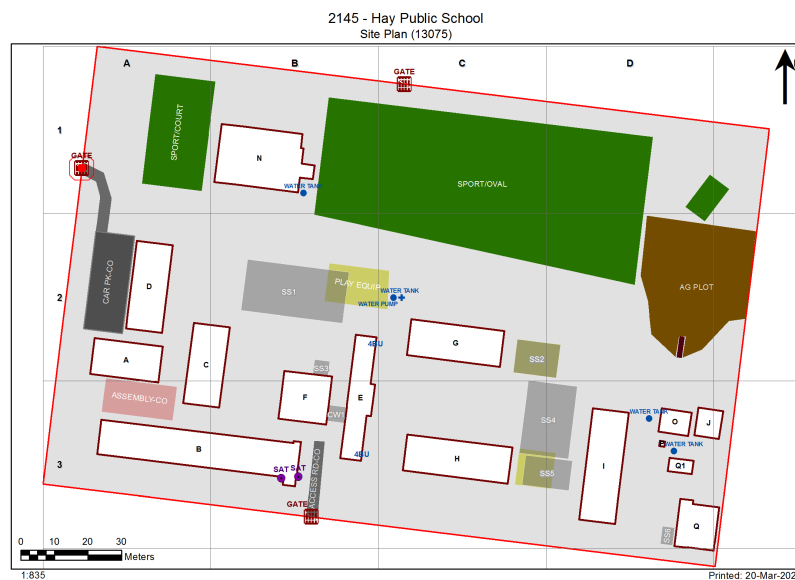

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration - 1974 - Brick/Veneer							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00A - R0001 - Movement - 24.8 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	7m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0002 - Duplicating Workroom - 35.12 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Thermacon Heater	Insulation Material	1	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0003 - Staff Toilet - 4.08 m2							
No Asbestos							
B00A - R0004 - Staff Toilet - 4.55 m2							
No Asbestos							
B00A - R0005 - Cleaning Supplies - 1.22 m2							
No Asbestos							
B00A - R0006 - Sick Bay - 7.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Thermacon Heater	Insulation Material	1	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0007 - General Storeroom - 7.28 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	7.5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0008 - Interview - 10.68 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0009 - Staff Toilet - 3.48 m2							
No Asbestos							
B00A - R0010 - Principal - 16.93 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0011 - General Storeroom - .51 m2							
No Asbestos							
B00A - R0012 - Cleaning Supplies - 1.06 m2							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	0.5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0013 - Distribution Board - .59 m2							Note: No inspection of live electrical installation
Wall Linings Internal	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	0.75m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	0.75m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Mounting Board	Resinous Board	1	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0014 - Entry Vestibule - 18.56 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0015 - Clerical Office - 14.3 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0016 - Deputy Principal - 14.26 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Plant / Equipment - Thermacon Heater	Insulation Material	1	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0017 - Movement - 8.61 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0018 - Movement - 24.79 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	20m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - General Learning/Other - 1960 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00B - R0001 - Distribution Board - .68 m2							Note: No inspection of live electrical installation
No Asbestos							
B00B - R0002 - Distance Education Centre - 8.38 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0003 - Distance Education Centre - 10.66 m2							
No Asbestos							
B00B - R0004 - Distance Education Centre - 27.84 m2							
No Asbestos							
B00B - R0005 - Distance Education Centre - 67.47 m2							
No Asbestos							
B00B - R0006 - Distance Education Centre - 26.71 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos

Floor Coverings Res/Textile	Vinyl Tiles	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0007 - Special Programs Room - 43.74 m2							
No Asbestos							
B00B - R0008 - Personal Effects Storage - 9.6 m2							
No Asbestos							
B00B - R0009 - Home Base - 54.16 m2							
No Asbestos							
B00B - R0010 - Home Base - 67.82 m2							
No Asbestos							
B00B - R0011 - General Storeroom - 8.31 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0012 - Personal Effects Storage - 10.04 m2							
No Asbestos							
B00B - R0013 - General Storeroom - 6.36 m2							
No Asbestos							
B00B - R0014 - Distribution Board - .28 m2							
Note: No inspection of live electrical installation							
Electrical - Mounting Board	Resinous Board	2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0015 - Home Base - 53.79 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	3	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00B - R0016 - Home Base Store - 8.18 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0017 - General Storeroom - 17.24 m2							
Floor Coverings Res/Textile	Vinyl Tiles	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting						
B00B - R0018 - Cleaning Supplies - 3.82 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0019 - Movement - 119.69 m2							
Ceiling Structures/Linings	Flat AC Sheeting	120m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting						
B00B - R0020 - Practical Activities - 1hb - 12.89 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0021 - External Movement - 8.72 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00C - Library - 1960 - Brick/Veneer							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						

Ceiling Voids	No Asbestos Found						
Interior							
B00C - R0001 - Library Office/Workroom - 9.97 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	1	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00C - R0004 - General Storeroom - 6.56 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0005 - Distribution Board - .68 m2 Note: No inspection of live electrical installation							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Mounting Board	Resinous Board	1	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0006 - Movement - 5.76 m2							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	0.5m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0007 - Movement - 28.97 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	12m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0008 - Communications Room - 12.72 m2							
No Asbestos							
B00C - R0009 - Movement - 29.21 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	12m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0010 - Reading Area - 148.16 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	4	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - General Learning/Pupil Facilities - 1960 - Brick/Veneer							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00D - R0001 - Movement - 31.39 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	10m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0002 - Toilets - Boys - 27.47 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting						
B00D - R0003 - Toilets - Girls - 26.21 m2							

Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting						
B00D - R0004 - Personal Effects Storage - 6.52 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting						
B00D - R0005 - Home Base Store - 6.6 m2							
Floor Coverings Res/Textile	Vinyl Tiles	6.6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0006 - Home Base - 56.42 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	3	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R0007 - Home Base - 57.06 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R0008 - Personal Effects Storage - 5.44 m2							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0009 - Distribution Board - .67 m2						Note: No inspection of live electrical installation	
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0010 - Home Base Store - 6.6 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0011 - Movement - 31.41 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	16m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - Staff Facilities/Pupil Facilities - 1960 - Timber							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Interior							
B00E - R0003 - Sports Store - 37.81 m2							
Ceiling Structures/Linings	Flat AC Sheeting	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0005 - Movement - 11.97 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

Wall Linings Internal - Infill	Flat AC Sheeting							
B00E - R0008 - Staff Toilet - 3.75 m2								
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00E - R0010 - General Storeroom - 10.72 m2								
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00E - R0011 - General Storeroom - 1.35 m2								
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00E - R0012 - Staff Toilet - 1.36 m2								
Ceiling Structures/Linings	Flat AC Sheeting	1.5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00E - R0013 - General Assistant/Bulk Store - 31.63 m2								
Ceiling Structures/Linings	Flat AC Sheeting	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	100m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00E - R0015 - Staff Room - 47.38 m2								
Ceiling Structures/Linings	Flat AC Sheeting							
B00E - R0016 - Staff Kitchen - 11.79 m2								
Wall Linings Internal	Flat AC Sheeting	20m2	North & East	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting							
B00E - R0017 - Canteen - 30.13 m2								
No Asbestos								
B00E - R0018 - Canteen Office/Store - 15.09 m2								
No Asbestos								
B00E - R0019 - Movement - 19.18 m2								
No Asbestos								
B00F - Pupil Facilities - 1960 - Brick/Veneer								
Exterior								
Underfloor Voids - Slab on Ground	No Asbestos Found							
Ceiling Voids	No Asbestos Found							
Interior								
B00F - R0001 - Movement - 62.38 m2								
No Asbestos								

B00F - R0002 - Movement - 128.48 m2							
No Asbestos							
B00G - General Learning - 1960 - Brick/Veneer							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00G - R0001 - Movement - 33.3 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	12m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0002 - Home Base Store - 6.61 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0003 - Personal Effects Storage - 6.59 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting						
B00G - R0004 - Home Base - 56.66 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	3	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00G - R0005 - Home Base - 56.97 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00G - R0006 - Home Base Store - 6.28 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0007 - Home Base Store - 5.85 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0008 - Distribution Board - .52 m2							
						Note: No inspection of live electrical installation	
Floor Coverings Res/Textile	Vinyl Tiles	0.5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0009 - Personal Effects Storage - 13.72 m2							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0010 - Home Base - 56.71 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	3	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00G - R0011 - Movement - 33.29 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	12m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - General Learning - 1960 - Brick/Veneer							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						

Interior							
B00H - R0001 - Movement - 36.95 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	12m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0002 - Home Base - 56.65 m2							
No Asbestos							
B00H - R0003 - Home Base Store - 6.67 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0004 - Home Base Store - 6.63 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0005 - Personal Effects Storage - 13.66 m2							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0006 - Home Base - 55.46 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	1	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00H - R0007 - Staff Toilet - 3.99 m2							
Plant / Equipment - Incinerator	Insulation Material	1	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00H - R0008 - Movement - 20.75 m2							
Floor Coverings Res/Textile	Vinyl Tiles	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0009 - Staff Room Annexe - 14.97 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Plant / Equipment - Thermacon Heater	Insulation Material	1	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00H - R0010 - General Storeroom - 7.57 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00H - R0011 - Distribution Board - .46 m2 Note: No inspection of live electrical installation							
Floor Coverings Res/Textile	Vinyl Tiles	0.5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0012 - Withdrawal Space - 1hb - 23.89 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Plant / Equipment - Thermacon Heater	Insulation Material	2	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00H - R0013 - General Storeroom - 18.18 m2							
No Asbestos							
B00H - R0014 - Cleaning Supplies - 3.61 m2							
No Asbestos							
B00H - R0015 - General Storeroom - .47 m2							
Floor Coverings Res/Textile	Vinyl Tiles	0.5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0016 - Movement - 36.95 m2							

Wall Linings Internal - Infill	Flat AC Sheeting	12m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - General Learning/Pupil Facilities - 1960 - Brick/Veneer							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B001 - R0001 - Toilets - Girls - 18.35 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
B001 - R0002 - Toilets - Boys - 17.53 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
B001 - R0003 - Toilets - Boys/Girls - 3.53 m2							
No Asbestos							
B001 - R0004 - General Storeroom - 3.55 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0005 - Distribution Board - .18 m2 Note: No inspection of live electrical installation							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting						
Electrical - Mounting Board	Resinous Board	1	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0006 - Personal Effects Storage - 6.88 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0007 - Home Base - 84.92 m2							
Plant / Equipment - Thermocon Heater	Insulation Material	2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B001 - R0008 - Home Base - 84.18 m2							
No Asbestos							
B001 - R0009 - Movement - 40.28 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	20m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0010 - Toilets - Boys/Girls - 3.74 m2							
No Asbestos							
B001 - R0011 - General Storeroom - 2.65 m2							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0012 - Personal Effects Storage - 6.55 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0013 - Movement - 58.04 m2							
Ceiling Structures/Linings	Flat AC Sheeting						

Wall Linings Internal - Infill	Flat AC Sheeting	12m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - Special Purpose - 1900 - Timber							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00J - R0001 - Movement - 13.13 m2							
Wall Linings Internal	Flat AC Sheeting						
B00J - R0002 - General Storeroom - 46.36 m2							
Wall Linings Internal - Splash back	Flat AC Sheeting						
B00N - Communal Facilities - 2010 - Brick/Veneer							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00N - R0001 - Communal Space - 146.28 m2							
No Asbestos							
B00N - R0002 - Raised Platform - 60.64 m2							
No Asbestos							
B00N - R0003 - Hall Chair Store - 9.13 m2							
No Asbestos							
B00N - R0004 - Communal/Performance Store - 9.54 m2							
No Asbestos							
B00N - R0005 - P.E Store - 13.56 m2							
No Asbestos							
B00N - R0006 - Toilet - Lobby - 2.43 m2							
No Asbestos							
B00N - R0007 - Toilets - Girls - 7.4 m2							
No Asbestos							
B00N - R0008 - Sound Cupboard - 2.01 m2							
No Asbestos							
B00N - R0009 - Toilet - Lobby - 3.39 m2							
No Asbestos							
B00N - R0010 - Toilets - Boys - 5.67 m2							
No Asbestos							
B00N - R0011 - Cleaning Distributed Store - 3.6 m2							
No Asbestos							
B00N - R0012 - Plant - 1.58 m2							
No Asbestos							
B00N - R0013 - Main Switch Board - 3.23 m2							
No Asbestos							
B00N - R0014 - Access Shower/Toilet - 6.84 m2							
No Asbestos							
B00N - R0015 - Movement - 12.39 m2							
No Asbestos							
B00N - R0016 - Movement - 10.7 m2							
No Asbestos							
B00N - R0017 - Movement - 5.97 m2							

No Asbestos		
B00N - R0018 - External Movement - 104.66 m2		
No Asbestos		
B00N - R0019 - Plant - 12.82 m2		
No Asbestos		
B00O - Special Purpose - 2010 - Brick/Veneer		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00O - R0001 - Special Programs Room - 22.4 m2		
No Asbestos		
B00O - R0002 - Special Programs Room - 35.88 m2		
No Asbestos		
B00O - R0003 - Staff Toilet - 2.2 m2		
No Asbestos		
B00P - Building Services - 2012 - Brick/Veneer		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00P - R0001 - Plant - 2.19 m2		
No Asbestos		
B00Q - Residential Facilities - 1940 - Timber		
Exterior		
Require Inspection		
Interior		
B00Q - R0001 - Residence - Movement - 17.94 m2		
Require Inspection		
B00Q - R0002 - Residence - Movement - 10.24 m2		
Require Inspection		
B00Q - R0003 - Residence - Bedroom - 16.72 m2		
Require Inspection		
B00Q - R0004 - Residence - Toilet - 1.33 m2		
Require Inspection		
B00Q - R0005 - Residence - Bathroom - 5.79 m2		
Require Inspection		
B00Q - R0006 - Residence - Kitchen - 13.95 m2		
Require Inspection		
B00Q - R0007 - Residence - Laundry - 6.2 m2		
Require Inspection		
B00Q - R0008 - Residence - Plant - .79 m2		
Require Inspection		
B00Q - R0009 - Residence - Toilet - 1.12 m2		
Require Inspection		
B00Q - R0010 - Residence - Living - 17.76 m2		
Require Inspection		
B00Q - R0011 - Residence - Bedroom - 8.95 m2		
Require Inspection		

B00Q - R0012 - Residence - Lounge - 17.94 m2
Require Inspection
B00Q - R0013 - Residence - Bedroom - 15.67 m2
Require Inspection
B00Q - R0014 - Residence - Bedroom - 9.42 m2
Require Inspection
B0Q1 - Residential Facilities - 1970 - Fibre Clad Shed
Exterior
Require Inspection
Interior
B0Q1 - R0001 - Residence - Garage - 26.44 m2
Require Inspection

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020