


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Heathcote Public School (2149)
Region:	Sydney AMU
State Electorate:	Heathcote
Local Government Area:	Sutherland

Last Reviewed By:	WSP 11-SEP-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

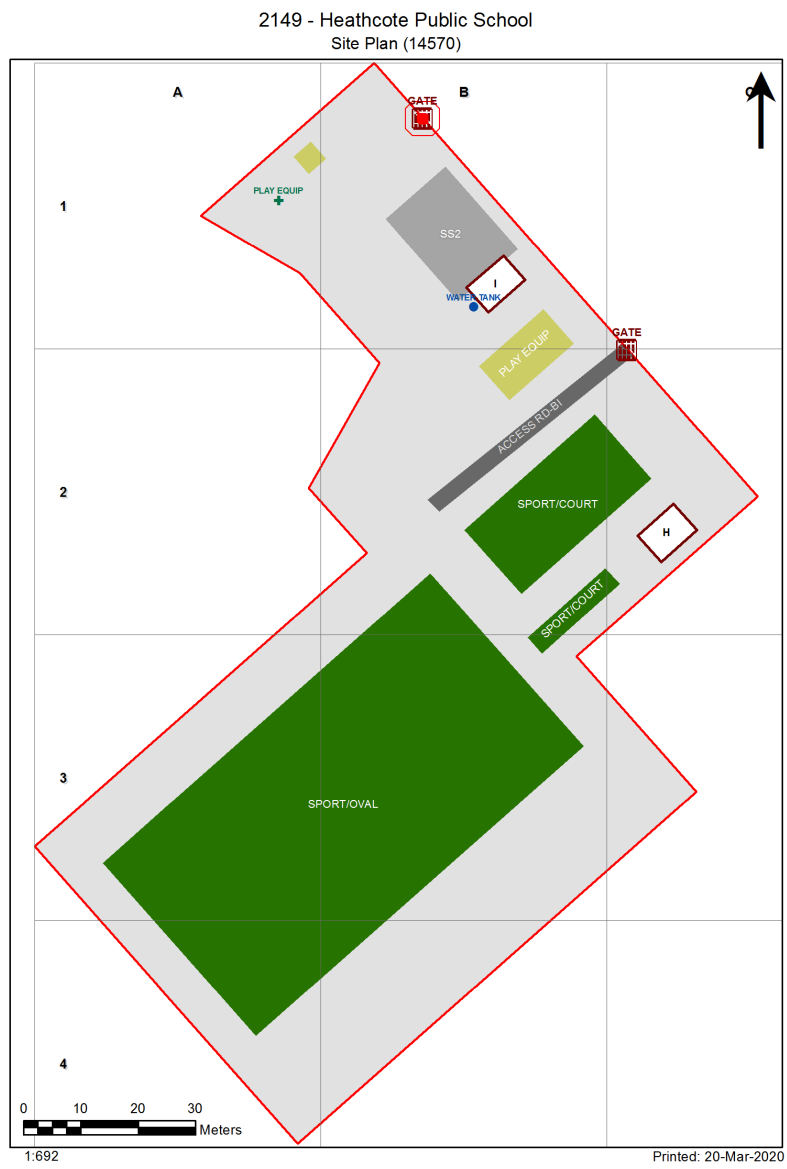

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - General Learning - 1924 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Gable Verge Lining	Flat AC Sheeting	10m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00A - R0001 - Movement - 4.7 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0003 - Cleaning Distributed Store - .5 m2							
Electrical - Mounting Board	Encapsulated Asbestos material within unit	2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0004 - Distribution Board - .5 m2 Note: No inspection of live electrical installation							
No Asbestos							
B00A - R0005 - Movement - 15.95 m2							
No Asbestos							
B00A - R0006 - General Storeroom - 10.29 m2							
No Asbestos							
B00A - R0007 - Home Base Store - 2.79 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0008 - Practical Activities - 1hb - 6.23 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0009 - Home Base - 55.95 m2							
No Asbestos							
B00A - R0010 - Home Base - 55.94 m2							
No Asbestos							
B00A - R0011 - Practical Activities - 1hb - 4.95 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0012 - Home Base Store - 4.14 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0013 - Movement - 4.27 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0014 - Movement - 4.56 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0015 - General Storeroom - 17.38 m2							
No Asbestos							
B00A - R0016 - General Storeroom - .5 m2							
No Asbestos							
B00A - R9001 - General Assistant/Bulk Store - 25.52 m2							

Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R9002 - General Storeroom - 3.25 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R9003 - General Storeroom - 2.94 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R9004 - General Assistant/Bulk Store - 20.22 m2							
Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - Administration - 1979 - Brick/Block							
Exterior							
Gable Verge Lining	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00B - R0001 - Clerical Office - 13.01 m2							
No Asbestos							
B00B - R0002 - Duplicating Workroom - 32.79 m2							
No Asbestos							
B00B - R0003 - Deputy Principal - 12.42 m2							
No Asbestos							
B00B - R0004 - Security Store - 25.36 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00B - R0005 - Staff Room Annexe - 12.98 m2							
No Asbestos							
B00B - R0007 - Cleaning Distributed Store - 2.18 m2							
No Asbestos							
B00B - R0008 - Distribution Board - 2.17 m2							
No Asbestos							Note: No inspection of live electrical installation
B00B - R0010 - Community Clinic - 23.2 m2							
No Asbestos							
B00B - R0011 - Movement - 15.1 m2							
No Asbestos							
B00B - R0013 - Principal - 20.33 m2							
No Asbestos							
B00B - R0014 - Interview - 12.05 m2							
No Asbestos							
B00B - R0015 - Sick Bay - 12.28 m2							
No Asbestos							

B00B - R0016 - Entry Vestibule - 16.41 m2							
No Asbestos							
B00B - R0017 - Movement - 24.13 m2							
No Asbestos							
B00B - R0018 - Movement - 127.65 m2							
Ceiling Structures/Linings	Flat AC Sheeting	128m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0019 - Staff Kitchen - 9.2 m2							
No Asbestos							
B00B - R0020 - Staff Room - 59.03 m2							
No Asbestos							
B00B - R0021 - Toilet - Lobby - 1.24 m2							
No Asbestos							
B00B - R0022 - Staff Toilet - 8.51 m2							
No Asbestos							
B00B - R0023 - Toilet - Lobby - 1.11 m2							
No Asbestos							
B00B - R0024 - Staff Toilet - 8.2 m2							
No Asbestos							
B00C - Library/Pupil Facilities - 1979 - Brick/Block							
Exterior							
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00C - R0001 - Toilets - Girls - 4.11 m2							
No Asbestos							
B00C - R0002 - Toilets - Boys - 4 m2							
No Asbestos							
B00C - R0003 - Movement - 11.03 m2							
No Asbestos							
B00C - R0004 - Distribution Board - 1.29 m2						Note: No inspection of live electrical installation	
No Asbestos							
B00C - R0005 - Cleaning Distributed Store - 2.64 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00C - R0006 - Library Office/Workroom - 22.12 m2							
No Asbestos							
B00C - R0007 - Communications Room - 10.83 m2							
No Asbestos							
B00C - R0008 - Library Office/Workroom - 8.25 m2							
No Asbestos							
B00C - R0012 - Movement - 150.36 m2							
Ceiling Structures/Linings	Flat AC Sheeting	151m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0013 - Reading Area - 211.6 m2							
No Asbestos							
B00C - R0014 - Seminar/Study - 48.99 m2							
No Asbestos							

B00D - General Learning/Pupil Facilities - 1979 - Brick/Block**Exterior**

Gable Verge Lining	Flat AC Sheeting	60m2	North facing, South facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
--------------------	------------------	------	--	--------------------	---------	--------------------	--

Ceiling Voids	No Asbestos Found
---------------	-------------------

Underfloor Voids	No Asbestos Found
------------------	-------------------

Interior**B00D - R0001 - Movement - 46.23 m2**

Ceiling Structures/Linings	Flat AC Sheeting	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------	--

B00D - R0002 - Sports Store - 21.13 m2

Floor Coverings Res/Textile	Vinyl Tiles
-----------------------------	-------------

B00D - R0003 - Toilets - Boys - 5.46 m2

No Asbestos

B00D - R0004 - Toilets - Girls - 6.72 m2

No Asbestos

B00D - R0005 - Home Base - 54.42 m2

No Asbestos

B00D - R0006 - Practical Activities - 1hb - 16.66 m2

Floor Coverings Res/Textile	Vinyl Tiles
-----------------------------	-------------

B00D - R0007 - Home Base - 54.57 m2

No Asbestos

B00D - R0008 - Practical Activities - 1hb - 16.68 m2

Floor Coverings Res/Textile	Vinyl Tiles
-----------------------------	-------------

B00D - R0009 - Home Base - 54.5 m2

No Asbestos

B00D - R0010 - Practical Activities - 1hb - 16.61 m2

Floor Coverings Res/Textile	Vinyl Tiles
-----------------------------	-------------

B00D - R0011 - Home Base - 54.2 m2

No Asbestos

B00D - R0012 - Practical Activities - 1hb - 16.61 m2

Floor Coverings Res/Textile	Vinyl Tiles
-----------------------------	-------------

B00D - R0013 - Movement - 37.02 m2

Ceiling Structures/Linings	Flat AC Sheeting	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------	--

B00D - R0014 - Withdrawal Space - 1hb - 12.56 m2

No Asbestos

B00D - R0015 - Toilets - Girls - 28.93 m2

No Asbestos

B00D - R0016 - Toilets - Boys - 29.04 m2

No Asbestos

B00D - R0017 - General Storeroom - 14.92 m2

Floor Coverings Res/Textile	Vinyl Tiles
-----------------------------	-------------

B00D - R0018 - Cleaning Distributed Store - 3.2 m2

Floor Coverings Res/Textile	Vinyl Tiles
-----------------------------	-------------

B00D - R0019 - Distribution Board - 1.32 m2**Note: No inspection of live electrical installation**

Electrical - Mounting Board	Encapsulated Asbestos material within unit	2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0020 - General Storeroom - 10.15 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R0021 - Home Base - 54.5 m2							
No Asbestos							
B00D - R0022 - Practical Activities - 1hb - 16.77 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R0023 - Movement - 35.81 m2							
Ceiling Structures/Linings	Flat AC Sheeting	36m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0024 - Movement - 47.71 m2							
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0025 - Movement - 26.43 m2							
Ceiling Structures/Linings	Flat AC Sheeting	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0026 - Home Base - 53.75 m2							
No Asbestos							
B00D - R0027 - Practical Activities - 1hb - 16.47 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R0028 - Home Base - 53.75 m2							
No Asbestos							
B00D - R0029 - Practical Activities - 1hb - 16.47 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R0030 - Home Base - 54.57 m2							
No Asbestos							
B00D - R0031 - Practical Activities - 1hb - 16.7 m2							
No Asbestos							
B00D - R0032 - Home Base - 54.27 m2							
No Asbestos							
B00D - R0033 - Practical Activities - 1hb - 16.63 m2							
No Asbestos							
B00D - R0034 - Home Base - 54.5 m2							
No Asbestos							
B00D - R0035 - Practical Activities - 1hb - 16.61 m2							
No Asbestos							
B00D - R0037 - Cleaning Distributed Store - .53 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0039 - Movement - 167.56 m2							
Ceiling Structures/Linings	Flat AC Sheeting	168m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0040 - Disabled Toilet - 11.89 m2							
No Asbestos							
B00E - Communal Facilities/Other - 1979 - Brick/Block							
Exterior							

Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00E - R0001 - Cleaning Supplies - 10.01 m2							
No Asbestos							
B00E - R0002 - Distribution Board - .58 m2							
No Asbestos							
B00E - R0009 - Distribution Board - .39 m2							
No Asbestos							
B00E - R0012 - Cleaning Supplies - 9.1 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00E - R0013 - Movement - 3.58 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0015 - Raised Platform - 32.15 m2							
No Asbestos							
B00E - R0016 - Hall Chair Store - 3.6 m2							
No Asbestos							
B00E - R0017 - Communal Space - 185.76 m2							
No Asbestos							
B00E - R0018 - Hall Chair Store - 3.8 m2							
No Asbestos							
B00E - R0021 - Canteen - 44.98 m2							
No Asbestos							
B00E - R0022 - Canteen Office/Store - 13.55 m2							
No Asbestos							
B00E - R0023 - External Movement - 127.89 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00E - R0024 - Toilets - Boys - 6.43 m2							
No Asbestos							
B00E - R0025 - Movement - 23.42 m2							
No Asbestos							
B00E - R0026 - Toilet - Lobby - 1.51 m2							
No Asbestos							
B00E - R0027 - Toilets - Girls - 6.22 m2							
No Asbestos							
B00E - R0028 - Toilet - Lobby - 1.64 m2							
No Asbestos							
B00F - Pupil Facilities - 1979 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	15m2	North facing, South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00F - R0001 - Movement - 24.42 m2							

Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0002 - Toilets - Girls - 24.62 m2							
Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0003 - Toilets - Boys - 27.6 m2							
Ceiling Structures/Linings	Flat AC Sheeting	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - General Learning/Pupil Facilities - 1979 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	45m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00G - R0001 - Movement - 1.19 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00G - R0002 - Practical Activities - 1hb - 6.16 m2							
No Asbestos							
B00G - R0004 - Home Base - 85.42 m2							
No Asbestos							
B00G - R0005 - Home Base - 56.82 m2							
No Asbestos							
B00G - R0006 - Home Base Store - 4.69 m2							
No Asbestos							
B00G - R0007 - Practical Activities - 1hb - 5.93 m2							
No Asbestos							
B00G - R0008 - Movement - 18.31 m2							
No Asbestos							
B00G - R0010 - General Storeroom - 25.04 m2							
No Asbestos							
B00G - R0011 - General Storeroom - 17.19 m2							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0012 - Personal Effects Storage - 6.33 m2							
No Asbestos							
B00G - R0013 - General Storeroom - 19.36 m2							
No Asbestos							
B00G - R0014 - Staff Toilet - 1.53 m2							

Wall Linings Internal	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles						
B00G - R0015 - Home Base - 77.45 m2							
No Asbestos							
B00G - R0016 - Practical Activities - 1hb - 6.56 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00G - R0017 - Home Base - 56.3 m2							
No Asbestos							
B00G - R0018 - Practical Activities - 1hb - 5.42 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00G - R0019 - Main Switch Board - 4.93 m2							
Electrical - Mounting Board	Encapsulated Asbestos material within unit	3	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0020 - Movement - 3.01 m2							
No Asbestos							
B00G - R0021 - Movement - 4.84 m2							
No Asbestos							
B00G - R0022 - Movement - 77.82 m2							
No Asbestos							
B00G - R0023 - Home Base Store - 2.88 m2							
No Asbestos							
B00G - R0024 - Toilet - Lobby - 1.62 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0025 - Toilets-Unisex - 1.52 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0026 - Toilet - Lobby - 1.7 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0027 - Toilets-Unisex - 1.71 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - Pupil Facilities - 1924 - Brick/Block							

Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00H - R0001 - Toilets - Boys - 13.79 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0002 - Toilets - Girls - 13.94 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0003 - Drinking Facilities - 14.01 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00I - Other - 2009 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00I - R0001 - Sports Store - 16.88 m2							
No Asbestos							
B00I - R0002 - Garden Store - 16.95 m2							
No Asbestos							
B00I - R0003 - External Movement - 7.39 m2							
No Asbestos							

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020