


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Helensburgh Public School (2153)
Region:	Southern NSW AMU
State Electorate:	Heathcote
Local Government Area:	Wollongong

Last Reviewed By:	WSP 15-FEB-2017
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

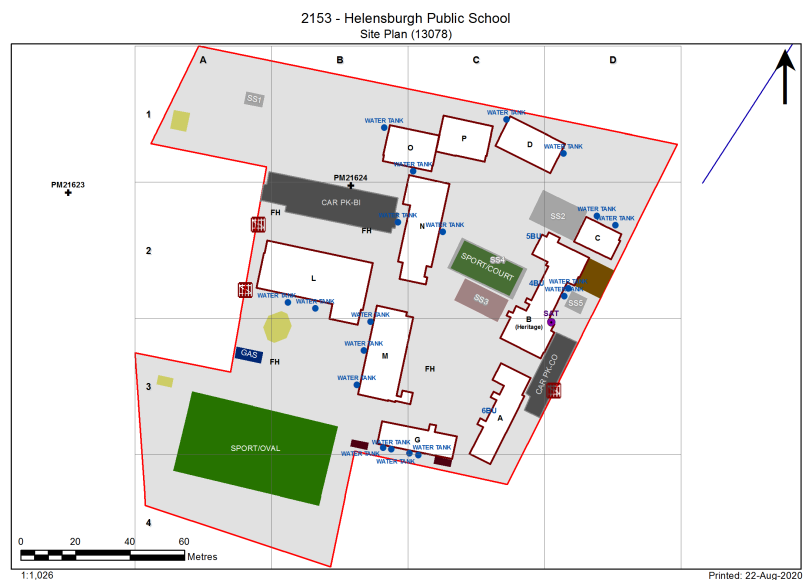

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - General Learning - 1956 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Verge Lining	Flat AC Sheeting	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Interior							
B00A - R0001 - Staff Room Annexe - 14.09 m2							
No Asbestos							
B00A - R0002 - Staff Room Annexe - 13.81 m2							
No Asbestos							
B00A - R0003 - Communications Cupboard - .43 m2							
No Asbestos							
B00A - R0004 - Movement - 12.36 m2							
No Asbestos							
B00A - R0005 - Movement - 1.2 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0006 - Movement - 4.61 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0007 - Home Base - 56.76 m2							
No Asbestos							
B00A - R0008 - Sports Store - 3.59 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0009 - Interview - 20.71 m2							
No Asbestos							
B00A - R0010 - Movement - 13.28 m2							
No Asbestos							
B00A - R0011 - Cleaning Distributed Store - 3.57 m2							
No Asbestos							
B00A - R0012 - Movement - 4.58 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0013 - Home Base - 57.33 m2							
No Asbestos							
B00A - R0014 - Canteen - 31.14 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Flat AC Sheeting	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0015 - Canteen Office/Store - 2.92 m2							

Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0016 - Canteen Office/Store - 3.37 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0017 - Movement - 37.85 m2							
No Asbestos							
B00A - R0018 - Home Base Store - 6.62 m2							
No Asbestos							
B00A - R0019 - Home Base Store - 6.7 m2							
No Asbestos							
B00A - R9001 - Special Programs Room - 52.13 m2							
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R9002 - General Storeroom - 75.83 m2							
No Asbestos							
B00A - R9003 - Kiln Room - 1.81 m2							
No Asbestos							
B00B - Library/General Learning - 1890 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting						
Gable Verge Lining	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Interior							
B00B - R0001 - Home Base - 64.74 m2							
No Asbestos							
B00B - R0002 - K.L.A. Store - 18.36 m2							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0003 - Movement - 6.04 m2							
No Asbestos							
B00B - R0005 - Home Base - 50.82 m2							
No Asbestos							
B00B - R0006 - Movement - 4.73 m2							
No Asbestos							
B00B - R0007 - Movement - 4.16 m2							
No Asbestos							
B00B - R0008 - Movement - 1.26 m2							
No Asbestos							
B00B - R0009 - Personal Effects Storage - 4.48 m2							

No Asbestos							
B00B - R0014 - Movement - 4.6 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00B - R0015 - Movement - 10.46 m2							
No Asbestos							
B00B - R0017 - Home Base - 51.72 m2							
No Asbestos							
B00B - R0018 - Home Base - 51.95 m2							
No Asbestos							
B00B - R0019 - Practical Activities - 1hb - 30.09 m2							
No Asbestos							
B00B - R0020 - Cleaning Distributed Store - 2.59 m2							
No Asbestos							
B00B - R0021 - Reading Area - 51.94 m2							
No Asbestos							
B00B - R0022 - Personal Effects Storage - 24.79 m2							
Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0023 - Special Programs Room - 26.65 m2							
No Asbestos							
B00B - R0024 - Home Base - 64.33 m2							
No Asbestos							
B00B - R0025 - Home Base Store - 6.4 m2							
No Asbestos							
B00B - R0026 - Home Base Store - 8.14 m2							
No Asbestos							
B00B - R0027 - Staff Toilet - 2.6 m2							
No Asbestos							
B00B - R0028 - External Movement - 2.94 m2							
Requires Inspection							
B00B - R0029 - External Movement - 3.06 m2							
Requires Inspection							
B00B - R9001 - General Assistant/Bulk Store - 64.41 m2							
No Asbestos							
B00B - R9002 - Withdrawal Space - 1hb - 49.97 m2							
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R9003 - Home Base Store - 5.95 m2							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R9004 - Movement - 7.98 m2							
No Asbestos							
B00B - R9005 - General Storeroom - 9.37 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	1m2	North facing, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - General Learning - 1956 - Timber							
Exterior							

Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting						
Interior							
B00C - R0001 - Toilets - Boys/Girls - 2.56 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0003 - Home Base - 53.53 m2							
Wall Linings Internal	Compressed AC Sheet	2m2	South facing, West facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0004 - Home Base - 53.73 m2							
Wall Linings Internal	Compressed AC Sheet	2m2	South Facing, West facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0005 - Movement - 26.37 m2							
Ceiling Structures/Linings	Flat AC Sheeting	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	12m2	North facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0006 - Movement - 1.19 m2							
No Asbestos							
B00D - General Learning - 1956 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	AC Fragments/Debris	1	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	AC Fragments/Debris	1	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00D - R0001 - Practical Activities - 1hb - 13.63 m2							
No Asbestos							
B00D - R0002 - Toilets - Boys/Girls - 3.27 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0003 - Home Base - 79.5 m2							
No Asbestos							
B00D - R0004 - Home Base - 79.76 m2							
No Asbestos							
B00D - R0005 - Practical Activities - 1hb - 13.61 m2							
No Asbestos							
B00D - R0006 - Toilets - Boys/Girls - 3.26 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0007 - Movement - 49.91 m2							

Wall Linings Internal - Infill	Flat AC Sheeting	11m2	North facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - General Learning - 1956 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	50m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	AC Fragments/Debris	1	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	AC Fragments/Debris	1	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids - Raked Ceiling	AC Fragments/Debris						
Interior							
B00G - R0002 - Staff Room - 37.33 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00G - R0003 - Movement - 9.69 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00G - R0004 - General Storeroom - 21.23 m2							
No Asbestos							
B00G - R0005 - Personal Effects Storage - 3.95 m2							
No Asbestos							
B00G - R0006 - Cleaning Distributed Store - .74 m2							
No Asbestos							
B00G - R0007 - Distribution Board - .68 m2						Note: No inspection of live electrical installation	
Floor Coverings Res/Textile	Vinyl Tiles						
Wall Linings Internal	Flat AC Sheeting						
B00G - R0008 - Home Base Store - 4.52 m2							
No Asbestos							
B00G - R0009 - Home Base - 57.32 m2							
No Asbestos							
B00G - R0010 - Home Base - 56.93 m2							
No Asbestos							
B00G - R0011 - Home Base Store - 4.59 m2							
No Asbestos							
B00G - R0012 - Personal Effects Storage - 4.85 m2							
No Asbestos							
B00G - R0013 - Movement - 2.44 m2							
No Asbestos							
B00G - R0014 - Movement - 1.51 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0015 - Movement - 4.58 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0016 - Movement - 2.97 m2							

No Asbestos	
B00G - R0017 - Staff Toilet - 2.03 m2	
No Asbestos	
B00L - Communal Facilities/Pupil Facilities - 2004 - Brick/Veneer	
Exterior	
Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found
Interior	
B00L - R0001 - Communal Space - 200.1 m2	
No Asbestos	
B00L - R0002 - Raised Platform - 54.71 m2	
No Asbestos	
B00L - R0003 - Performance Store - 11.15 m2	
No Asbestos	
B00L - R0004 - Main Switch Board - 3.2 m2	
No Asbestos	
B00L - R0005 - Cleaning Distributed Store - 3.39 m2	
No Asbestos	
B00L - R0006 - Chair Store - 11.1 m2	
No Asbestos	
B00L - R0007 - Movement - 4.82 m2	
No Asbestos	
B00L - R0008 - Toilets - Girls - 11.1 m2	
No Asbestos	
B00L - R0009 - Toilets - Boys - 8.38 m2	
No Asbestos	
B00L - R0010 - P.E Store - 17.26 m2	
No Asbestos	
B00L - R0011 - Communications Cupboard - 2.05 m2	
No Asbestos	
B00L - R0012 - Movement - 28.47 m2	
No Asbestos	
B00L - R0013 - Movement - 7.57 m2	
No Asbestos	
B00L - R0014 - Disabled Shower/Toilet - 6.85 m2	
No Asbestos	
B00L - R0015 - Covered Outdoor Space - 288.28 m2	
No Asbestos	
B00L - R0016 - Canteen Office/Store - 6.13 m2	
No Asbestos	
B00L - R0017 - Canteen - 45.7 m2	
No Asbestos	
B00L - R0018 - Movement - 10.75 m2	
No Asbestos	
B00L - R9001 - Cleaning Supplies - 7.01 m2	
No Asbestos	
B00L - R9002 - Garden Store - 15.16 m2	
No Asbestos	
B00L - R9003 - General Assistant/Bulk Store - 15.06 m2	
No Asbestos	

B00L - R9004 - Sports Store - 21.21 m2		
No Asbestos		
B00M - General Learning/Library - 2008 - Brick/Veneer		
Exterior		
Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00M - R0001 - Toilets - Boys - 14.42 m2		
No Asbestos		
B00M - R0002 - Toilets - Girls - 18.66 m2		
No Asbestos		
B00M - R0003 - Practical Activities - 19.72 m2		
No Asbestos		
B00M - R0004 - Home Base Store - 6.02 m2		
No Asbestos		
B00M - R0005 - Home Base - 60.1 m2		
No Asbestos		
B00M - R0006 - Withdrawal Space - 2hb - 11.65 m2		
No Asbestos		
B00M - R0007 - Home Base - 59.8 m2		
No Asbestos		
B00M - R0008 - Home Base Store - 6.14 m2		
No Asbestos		
B00M - R0009 - Practical Activities - 19.78 m2		
No Asbestos		
B00M - R0010 - Toilets - Girls - 38.76 m2		
No Asbestos		
B00M - R0011 - Access Shower/Toilet - 7.09 m2		
No Asbestos		
B00M - R0012 - Cleaning Distributed Store - 4.78 m2		
No Asbestos		
B00M - R0013 - Toilets - Boys - 35.54 m2		
No Asbestos		
B00M - R0014 - Movement - 27.29 m2		
No Asbestos		
B00M - R0015 - External Movement - 89.46 m2		
No Asbestos		
B00M - R0016 - External Stairs - 6.73 m2		
No Asbestos		
B00M - R0017 - External Movement - 13.32 m2		
No Asbestos		
B00M - R1001 - Reading Area - 228.99 m2		
No Asbestos		
B00M - R1002 - Library Office/Workroom - 25.55 m2		
No Asbestos		
B00M - R1003 - Communications Room - 8.19 m2		
No Asbestos		
B00M - R1004 - K.L.A. Store - 19.82 m2		
No Asbestos		
B00M - R1005 - Staff Toilet - 4.79 m2		

No Asbestos		
B00M - R1006 - Movement - 2.83 m2		
No Asbestos		
B00M - R1007 - Cleaning Distributed Store - 2.61 m2		
No Asbestos		
B00M - R1008 - Distribution Board - 1.15 m2		Note: No inspection of live electrical installation
No Asbestos		
B00M - R1009 - External Movement - 133.64 m2		
No Asbestos		
B00N - Administration - 2008 - Brick/Veneer		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00N - R0001 - Entry Vestibule - 24.29 m2		
No Asbestos		
B00N - R0002 - Clerical Office - 34 m2		
No Asbestos		
B00N - R0003 - Clerical/Printing - 24.08 m2		
No Asbestos		
B00N - R0004 - Sick Bay - 9.04 m2		
No Asbestos		
B00N - R0005 - Access Shower/Toilet - 5.16 m2		
No Asbestos		
B00N - R0006 - Cleaning Distributed Store - 3.9 m2		
No Asbestos		
B00N - R0007 - Staff Toilet - 5.2 m2		
No Asbestos		
B00N - R0008 - Staff Toilet - 5.09 m2		
No Asbestos		
B00N - R0009 - Staff Toilet - 5.26 m2		
No Asbestos		
B00N - R0010 - Staff Room - 50.94 m2		
No Asbestos		
B00N - R0011 - Staff Room Annexe - 27.26 m2		
No Asbestos		
B00N - R0012 - Security Store - 14.78 m2		
No Asbestos		
B00N - R0013 - Interview - 18.55 m2		
No Asbestos		
B00N - R0014 - Deputy Principal - 13.12 m2		
No Asbestos		
B00N - R0015 - Principal - 17.25 m2		
No Asbestos		
B00N - R0016 - Interview - 13.15 m2		
No Asbestos		
B00N - R0017 - Movement - 63.97 m2		
No Asbestos		
B00N - R0018 - External Movement - 30.85 m2		
No Asbestos		

B00N - R0019 - External Movement - 45.07 m2		
No Asbestos		
B00N - R0020 - Staff Kitchen - 11.52 m2		
No Asbestos		
B00N - R0021 - Deputy Principal - 13.27 m2		
No Asbestos		
B00N - R0023 - Distribution Board - .85 m2		Note: No inspection of live electrical installation
No Asbestos		
B00O - General Learning - 2010 - Brick/Veneer		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00O - R0001 - Home Base - 61.38 m2		
No Asbestos		
B00O - R0002 - Home Base Store - 6.34 m2		
No Asbestos		
B00O - R0003 - Practical Activities - 1hb - 19.25 m2		
No Asbestos		
B00O - R0004 - Withdrawal Space - 2hb - 11.78 m2		
No Asbestos		
B00O - R0005 - Home Base - 61.33 m2		
No Asbestos		
B00O - R0006 - Home Base Store - 6.34 m2		
No Asbestos		
B00O - R0007 - Practical Activities - 1hb - 19.18 m2		
No Asbestos		
B00O - R0008 - External Movement - 43.24 m2		
No Asbestos		
B00P - General Learning/Building Services - 2010 - Brick/Veneer		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00P - R0001 - Home Base - 61.26 m2		
No Asbestos		
B00P - R0002 - Home Base Store - 6.34 m2		
No Asbestos		
B00P - R0003 - Practical Activities - 1hb - 19.28 m2		
No Asbestos		
B00P - R0004 - Withdrawal Space - 2hb - 11.78 m2		
No Asbestos		
B00P - R0005 - Home Base - 61.31 m2		
No Asbestos		
B00P - R0006 - Home Base Store - 6.34 m2		
No Asbestos		
B00P - R0007 - Practical Activities - 1hb - 19.17 m2		
No Asbestos		

B00P - R0008 - External Movement - 43.95 m2	
No Asbestos	
B00P - R9001 - Sports Store - 12.12 m2	
No Asbestos	
B00P - R9002 - General Assistant/Bulk Store - 15.32 m2	
No Asbestos	
B00P - R9003 - Garden Store - 12.07 m2	
No Asbestos	

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020