


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Hinton Public School (2167)
Region:	Hunter/Central Coast AMU
State Electorate:	Port Stephens
Local Government Area:	Port Stephens

Last Reviewed By:	Greencap 07-OCT-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

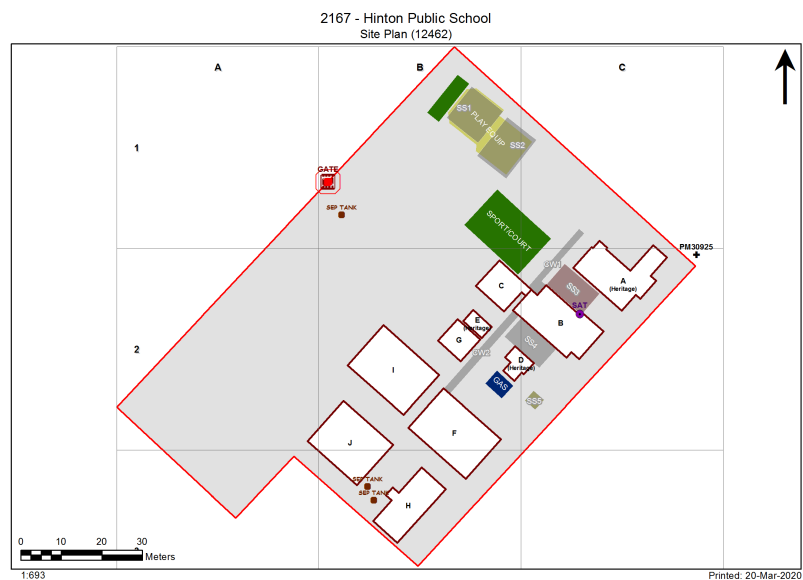

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration/Library - 1877 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids	Non Accessible Area						
Interior							
B00A - R0001 - Communications Room - 17.96 m2							
No Asbestos							
B00A - R0002 - Staff Room - 23.53 m2							
No Asbestos							
B00A - R0003 - Movement - 9.32 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0004 - Library Office/Workroom - 22.5 m2							
No Asbestos							
B00A - R0005 - Reading Area - 69.89 m2							
No Asbestos							
B00A - R0006 - Movement - 4.69 m2							
No Asbestos							
B00A - R0007 - Personal Effects Storage - 15.77 m2							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - Pupil Facilities - 1970 - Timber							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Interior							
B00B - R0001 - Staff Toilet - 4.13 m2							
No Asbestos							
B00B - R0002 - General Storeroom - 10.53 m2							
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00B - R0003 - General Storeroom - 8.56 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R0004 - General Storeroom - 6.55 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R0005 - Canteen - 25.44 m2							
No Asbestos							
B00B - R0006 - Movement - 6.76 m2							
No Asbestos							
B00B - R0007 - Movement - 115.16 m2							
No Asbestos							
B00B - R0008 - Movement - 12.91 m2							

No Asbestos	
B00C - Pupil Facilities - 1970 - Brick/Block	
Exterior	
Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found
Interior	
B00C - R0001 - Drinking Facilities - 4.46 m2	
No Asbestos	
B00C - R0002 - Toilets - Boys - 17.82 m2	
No Asbestos	
B00C - R0004 - Drinking Facilities - 3.33 m2	
No Asbestos	
B00C - R0006 - Toilets - Girls - 20.28 m2	
No Asbestos	
B00C - R0007 - Movement - 21.59 m2	
No Asbestos	
B00C - R0008 - Disabled Shower/Toilet - 5.7 m2	
No Asbestos	
B00D - Pupil Facilities - 1877 - Timber	
Exterior	
Ceiling Voids - Raked Ceiling	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found
Interior	
B00D - R0001 - Canteen Covered Area - 20.15 m2	
No Asbestos	
B00D - R0002 - Sports Store - 9.28 m2	
No Asbestos	
B00E - Pupil Facilities - 1865 - Timber	
Exterior	
Ceiling Voids - Raked Ceiling	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found
Interior	
B00E - R0001 - Canteen Covered Area - 20.21 m2	
No Asbestos	
B00F - General Learning - 1999 - Brick/Veneer	
Exterior	
Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found
Interior	
B00F - R0001 - Practical Activities - 1hb - 16.29 m2	
No Asbestos	
B00F - R0002 - Personal Effects Storage - 3.76 m2	
No Asbestos	
B00F - R0003 - Home Base Store - 6.18 m2	
No Asbestos	
B00F - R0004 - Home Base - 62.77 m2	
No Asbestos	

B00F - R0005 - Withdrawal Space - 1hb - 11.71 m2							
No Asbestos							
B00F - R0006 - Home Base - 61.5 m2							
No Asbestos							
B00F - R0007 - Home Base Store - 6.12 m2							
No Asbestos							
B00F - R0008 - Personal Effects Storage - 3.78 m2							
No Asbestos							
B00F - R0009 - Practical Activities - 1hb - 16.29 m2							
No Asbestos							
B00F - R0010 - Movement - 39.94 m2							
No Asbestos							
B00G - Mechanical Services - 2000 - Metal Shed							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00G - R0001 - General Assistant/Bulk Store - 53.04 m2							
No Asbestos							
B00H - Administration - 2002 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	AC Fragments/Debris	2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Interior							
B00H - R0001 - Clerical Office - 23.91 m2							
No Asbestos							
B00H - R0002 - Principal - 10.94 m2							
No Asbestos							
B00H - R0003 - Staff Toilet - 1.47 m2							
Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0004 - Staff Shower/Change - 5.01 m2							
Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0005 - Movement - 9.79 m2							
No Asbestos							
B00H - R0006 - Duplicating Workroom - 21.5 m2							
No Asbestos							
B00H - R0007 - Staff Room - 19.84 m2							
No Asbestos							
B00H - R0008 - Movement - 6.21 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0009 - Garage/Carport - 21.53 m2							
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00H - R0010 - Movement - 4.85 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0011 - Movement - 7.02 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - Pupil Facilities - 2004 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00I - R0001 - Practical Activities - 1hb - 18.98 m2							
No Asbestos							
B00I - R0002 - Home Base Store - 5.47 m2							
No Asbestos							
B00I - R0003 - Home Base - 59.84 m2							
No Asbestos							
B00I - R0004 - Withdrawal Space - 2hb - 11.54 m2							
No Asbestos							
B00I - R0005 - Home Base - 59.84 m2							
No Asbestos							
B00I - R0006 - Home Base Store - 5.93 m2							
No Asbestos							
B00I - R0007 - Practical Activities - 1hb - 18.93 m2							
No Asbestos							
B00I - R0008 - Distribution Board - .29 m2							
No Asbestos							Note: No inspection of live electrical installation
B00I - R0009 - Movement - 39.04 m2							
No Asbestos							
B00J - General Learning - 2010 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00J - R0001 - External Movement - 39.22 m2							
No Asbestos							
B00J - R0002 - Sports Store - 8.19 m2							
No Asbestos							
B00J - R0003 - Special Programs Room - 60.35 m2							
No Asbestos							
B00J - R0004 - Home Base - 58.53 m2							
No Asbestos							
B00J - R0005 - Withdrawal Space - 1hb - 8.79 m2							
No Asbestos							
B00J - R0006 - Home Base Store - 5.65 m2							
No Asbestos							
B00J - R0007 - Practical Activities - 20.42 m2							
No Asbestos							

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020