

Asbestos Register


(Hazardous Materials and Risk Assessment)

School:	Holbrook Public School (2170)
Region:	Southern NSW AMU
State Electorate:	Albury
Local Government Area:	Greater Hume

Last Reviewed By:	Greencap 02-SEP-2016
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

2170 - Holbrook Public School
Site Plan (12651)

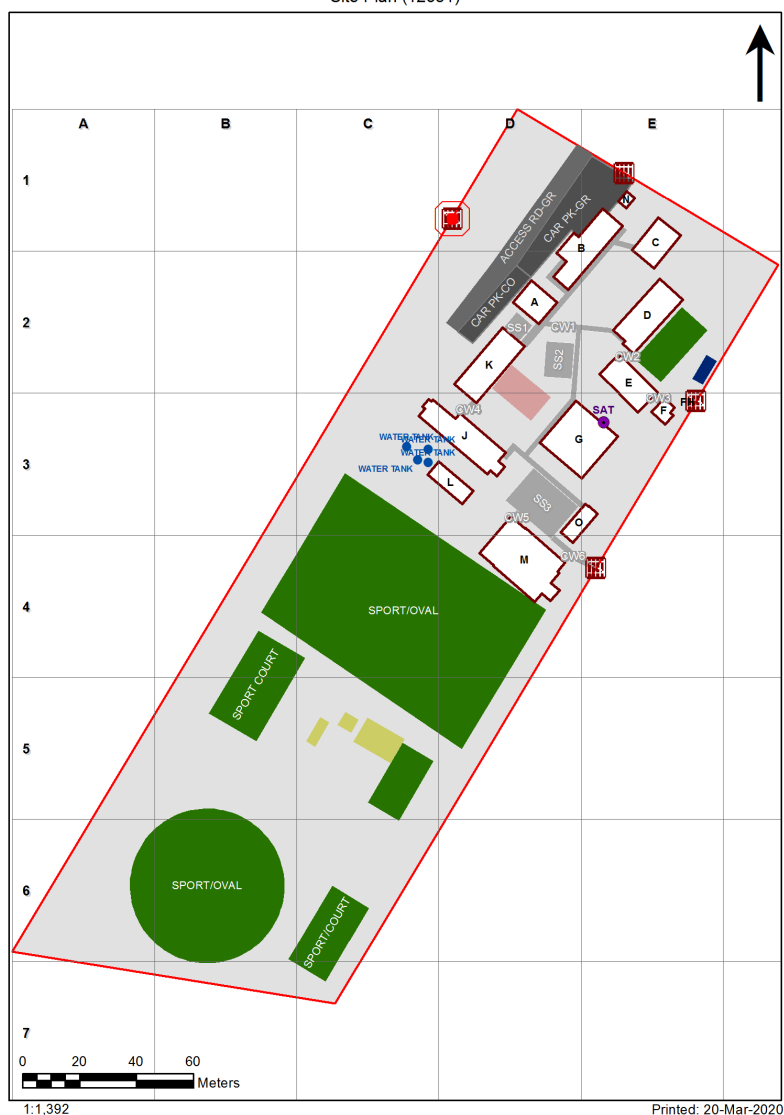

1:1,392

Printed: 20-Mar-2020

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration - 1966 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	8m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00A - R0001 - Sick Bay - 10.82 m2							
No Asbestos							
B00A - R0002 - Staff Toilet - 4.99 m2							
Plant / Equipment - Incinerator	Millboard	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0003 - Staff Toilet - 1.78 m2							
No Asbestos							
B00A - R0004 - Movement - 12.78 m2							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0005 - Entry Vestibule - 17.35 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R0006 - Principal - 20.03 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R0007 - Staff Toilet - 3.32 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R0008 - Distribution Board - .26 m2 Note: No inspection of live electrical installation							
Wall Linings Internal - Infill	Flat AC Sheeting						
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0009 - Clerical Office - 26.56 m2							
Wall Linings Internal - Infill	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0010 - Movement - 3.69 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - Communal Facilities/Special Purpose - 1969 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

External Wall Structure - Awnings	Flat AC Sheeting	2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Ends	Flat AC Sheeting	4m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
Interior							
B00B - R0001 - Special Programs Room - 42.87 m2							
No Asbestos							
B00B - R0002 - Special Programs Room - 37.44 m2							
No Asbestos							
B00B - R0003 - Communal Space - 92.85 m2							
No Asbestos							
B00B - R0004 - Movement - 36.63 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R0005 - Cleaning Supplies - 4.2 m2							
No Asbestos							
B00B - R0006 - General Storeroom - 8.51 m2							
No Asbestos							
B00B - R0007 - Craft Store - 3.98 m2							
No Asbestos							
B00B - R0008 - Uniform Shop - 9.71 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00C - Staff Facilities/Music - 1969 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Interior							
B00C - R0001 - Home Base - 52.24 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0002 - Staff Room - 52.24 m2							

Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	2m2	South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0004 - External Movement - 21.52 m2							
Floor Coverings Res/Textile	Compressed AC Sheet						
B00C - R0005 - General Storeroom - 12.95 m2							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - General Learning - 1961 - Timber							
Exterior							
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B00D - R0001 - Cleaning Supplies - 2.68 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0002 - Movement - 56.75 m2							
Floor Coverings Res/Textile	Compressed AC Sheet						
Ceiling Structures/Linings	Flat AC Sheeting	57m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0003 - Interview - 10.59 m2							
No Asbestos							
B00D - R0004 - Withdrawal Space - 1hb - 15.63 m2							
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0005 - Home Base - 66.54 m2							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	2m2	North facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0006 - Home Base - 53.41 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	North facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00D - R0007 - Staff Room Annexe - 15.62 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	North facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00D - R0008 - General Storeroom - 6.92 m2							
No Asbestos							
B00D - R0009 - Movement - 3.57 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00E - General Learning - 1961 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting	45m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Interior							
B00E - R0001 - Practical Activities - 1hb - 10.11 m2							
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0002 - Toilets - Boys/Girls - 3.24 m2							
Wall Linings Internal	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0003 - Home Base - 93.62 m2							
No Asbestos							
B00E - R0004 - General Storeroom - 22.31 m2							
No Asbestos							
B00E - R0005 - Movement - 37.31 m2							
Floor Coverings Res/Textile	Compressed AC Sheet						
Wall Linings Internal	Flat AC Sheeting	3m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - Pupil Facilities - 1969 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00F - R0001 - Movement - 14.85 m2							

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0002 - Toilets - Boys - 9.42 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0003 - Toilets - Girls - 8.26 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - Library - 1975 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00G - R0001 - Seminar/Study - 12.7 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00G - R0002 - Reading Area - 190.89 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00G - R0003 - Seminar/Study - 53.26 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00G - R0004 - Library Office/Workroom - 19.82 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00G - R0005 - Library Office/Workroom - 5.8 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00G - R0006 - Toilets - Boys - 2.93 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00G - R0007 - Distribution Board - .75 m2							
						Note: No inspection of live electrical installation	
Electrical - Mounting Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00G - R0008 - Cleaning Supplies - 1.59 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00G - R0009 - Toilets - Girls - 3.59 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00G - R0010 - Duplicating Workroom - 12.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						

B00G - R0011 - K.L.A. Store - 12.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00G - R0012 - K.L.A. Store - 12.7 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00J - General Learning/Special Purpose - 1961 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	40m2	South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Gable Verge Lining	Flat AC Sheeting	30m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Interior							
B00J - R0001 - General Storeroom - 9.92 m2							
No Asbestos							
B00J - R0002 - Plant - .5 m2							
No Asbestos							
B00J - R0003 - Canteen - 25.3 m2							
No Asbestos							
B00J - R0004 - Home Base - 64.91 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00J - R0005 - Home Base Store - 5.83 m2							
No Asbestos							
B00J - R0006 - General Storeroom - 2.52 m2							
No Asbestos							
B00J - R0007 - Withdrawal Space - 1hb - 13.16 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00J - R0008 - Distribution Board - 2.96 m2							
Note: No inspection of live electrical installation							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Mounting Board	Resinous Board	2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Linings Internal	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00J - R0009 - Craft Store - 16.54 m2							
No Asbestos							
B00J - R0010 - Home Base - 88.26 m2							
Floor Coverings Res/Textile	Vinyl Tiles	89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - R0011 - Movement - 44.33 m2							
Ceiling Structures/Linings	Flat AC Sheeting	45m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00J - R0012 - Distribution Board - 2.88 m2							
Note: No inspection of live electrical installation							

No Asbestos							
B00K - General Learning - 1891 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	40m2	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Gable Verge Lining	Flat AC Sheeting	30m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Interior							
B00K - R0001 - Movement - 52.45 m2							
Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00K - R0002 - Home Base - 57.05 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00K - R0003 - Home Base - 60.99 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00K - R0004 - Home Base Store - 5.5 m2							
No Asbestos							
B00K - R0005 - Distribution Board - .37 m2							
Note: No inspection of live electrical installation							
Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00K - R0006 - Home Base Store - 6.27 m2							
No Asbestos							
B00K - R0007 - Home Base - 52.68 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00L - Building Services - 2009 - Steel							
Exterior							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids	No Asbestos Found						
Interior							
B00L - R0001 - Sports Store - 22.86 m2							
No Asbestos							
B00L - R0002 - General Storeroom - 22.98 m2							
No Asbestos							
B00L - R0003 - General Storeroom - 23.04 m2							
No Asbestos							
B00L - R0004 - Garden Store - 22.8 m2							
No Asbestos							

B00M - Communal Facilities - 2010 - Brick/Veneer

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area	
Ceiling Voids	No Asbestos Found	

Interior

B00M - R0001 - Chair Storeroom - 9.55 m2

No Asbestos

B00M - R0002 - Communal Space - 145.32 m2

No Asbestos

B00M - R0003 - Covered Outdoor Learning Area - 111.84 m2

No Asbestos

B00M - R0004 - Distribution Board - 3.23 m2

Note: No inspection of live electrical installation

No Asbestos

B00M - R0005 - Disabled Toilet - 6.87 m2

No Asbestos

B00M - R0006 - Cleaning Distributed Store - 3.5 m2

No Asbestos

B00M - R0007 - Cleaning Supplies - 1.6 m2

No Asbestos

B00M - R0008 - Toilet - Lobby - 3.3 m2

No Asbestos

B00M - R0009 - Toilets - Boys - 5.71 m2

No Asbestos

B00M - R0010 - Communications Room - 2.06 m2

No Asbestos

B00M - R0011 - Toilets - Girls - 7.31 m2

No Asbestos

B00M - R0012 - Toilet - Lobby - 2.36 m2

No Asbestos

B00M - R0013 - Hall Chair Store - 13.03 m2

No Asbestos

B00M - R0014 - Hall Chair Store - 9.55 m2

No Asbestos

B00M - R0015 - Raised Platform - 60.12 m2

No Asbestos

B00M - R0016 - Movement - 13.55 m2

No Asbestos

B00M - R0017 - Ramp - 10.25 m2

No Asbestos

B00M - R0018 - Movement - 5.97 m2

No Asbestos

B00M - R0019 - Plant - 15.16 m2

No Asbestos

B00N - Building Services - 2009 - Metal Shed

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area	
Ceiling Voids	No Asbestos Found	

Interior

B00N - R0001 - General Storeroom - 15.62 m2

No Asbestos	
B000 - Pupil Facilities - 2011 - Brick/Veneer	
Exterior	
Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area
Interior	
B000 - R0001 - Toilets - Girls - 16.26 m2	
No Asbestos	
B000 - R0002 - Cleaning Distributed Store - 3.71 m2	
No Asbestos	
B000 - R0003 - Disabled Shower/Toilet - 9.77 m2	
No Asbestos	
B000 - R0004 - Toilets - Boys - 14.47 m2	
No Asbestos	
B000 - R0005 - External Movement - 19.41 m2	
No Asbestos	

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020