

Asbestos Register


(Hazardous Materials and Risk Assessment)

| | |
|------------------------|-------------------------------|
| School: | Homebush Public School (2173) |
| Region: | South Western Sydney AMU |
| State Electorate: | Strathfield |
| Local Government Area: | Strathfield |

| | |
|-------------------|----------------------|
| Last Reviewed By: | Greencap 29-MAY-2015 |
| Last Revised By: | |

| | |
|--|-----------|
| Historical Fibro In Grounds Investigations/Events | No |
| <p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p> | |

2173 - Homebush Public School
Site Plan (12654)

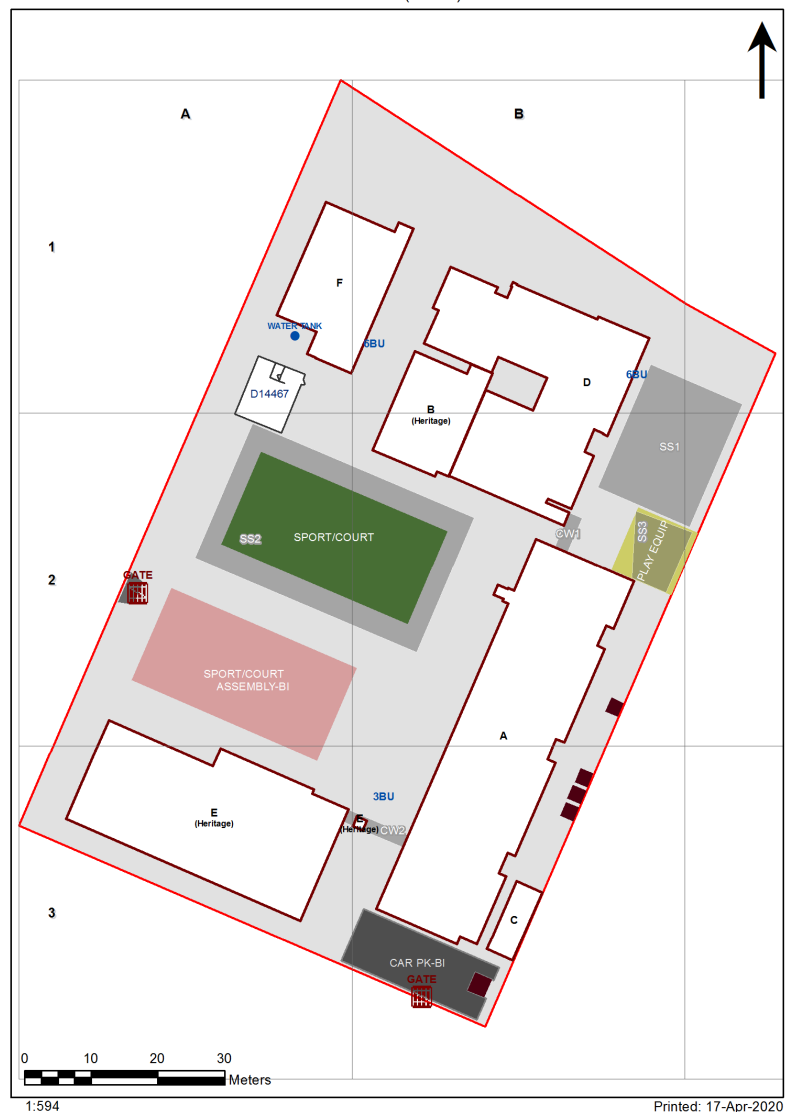

1:594

Printed: 17-Apr-2020

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

| Rating | Description |
|----------------------------|--|
| Good condition (1) | For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles |
| Minimal damage (2) | For non-friable asbestos that has a very small amount of damage, eg hairline cracks. |
| Some damage / unsealed (3) | For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed. |
| Poor condition (4) | For non-friable asbestos that has extensive damage. Visible asbestos debris |
| Friable asbestos (5) | Any occurrence of friable asbestos |

| Product | Material Description | Extent | Location | Material Condition | Risk Status | Remediation Priority | Result |
|---|---|--------|----------------------------|--------------------|-------------|--|-----------------------------|
| B00A - General Learning/Library - 1974 - Brick/Block | | | | | | | |
| Exterior | | | | | | | |
| External Wall Structure - Awnings | Flat AC Sheeting | 5 | Ground Floor, southern end | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| Ceiling Voids | Non Accessible Area | | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | | |
| Interior | | | | | | | |
| B00A - R0001 - Library Office/Workroom - 21.39 m2 | | | | | | | |
| Ceiling Structures/Linings | Vermiculite - Composite Sample - (10 - 40 m2) - (X3) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 22m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R0002 - Toilets - Girls - 2.68 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0003 - Cleaning Distributed Store - .78 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0004 - Movement - 5.84 m2 | | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 6m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R0005 - Reading Area - 251.11 m2 | | | | | | | |
| Ceiling Structures/Linings | Vermiculite - Composite Sample - (> 250 m2) - (X25) | | | | | | |
| B00A - R0006 - Movement - 4.75 m2 | | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 5m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R0008 - Distribution Board - .43 m2 | | | | | | | |
| | | | | | | Note: No inspection of live electrical installation | |
| No Asbestos | | | | | | | |
| B00A - R0009 - Toilets - Boys - 2.68 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0010 - K.L.A. Store - 16.01 m2 | | | | | | | |
| Ceiling Structures/Linings | Vermiculite - Composite Sample - (10 - 40 m2) - (X3) | | | | | | |
| B00A - R0011 - Reading Area - 18.07 m2 | | | | | | | |
| Ceiling Structures/Linings | Vermiculite - Composite Sample - (10 - 40 m2) - (X3) | | | | | | |
| B00A - R0012 - Library Office/Workroom - 8.11 m2 | | | | | | | |
| Ceiling Structures/Linings | Vermiculite - Composite Sample - (< 10 m2) - (X2) | | | | | | |
| B00A - R0013 - Communications Room - 11.86 m2 | | | | | | | |
| Ceiling Structures/Linings | Vermiculite - Composite Sample - (10 - 40 m2) - (X3) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 12m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R0014 - External Movement - 25.97 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0015 - External Movement - 4.33 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0016 - External Movement - 25.64 m2 | | | | | | | |
| No Asbestos | | | | | | | |

| | | | | | | | |
|--|--|------|---------------------------|--------------------|---------|--------------------|-----------------------------|
| B00A - R0017 - External Movement - 4.29 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0018 - Hall Chair Store - 35.22 m2 | | | | | | | |
| Ceiling Structures/Linings | Vermiculite - Composite Sample - (10 - 40 m2) - (X3) | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 11m2 | West facing | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R0019 - Communal Space - 190.14 m2 | | | | | | | |
| Ceiling Structures/Linings | Vermiculite - Composite Sample - (120 - 250 m2) - (X15) | | | | | | |
| B00A - R0020 - General Storeroom - 3.18 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0021 - Plant - 2.88 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0022 - General Storeroom - 2.52 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0023 - P.E Store - 3.15 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0024 - Raised Platform - 83.33 m2 | | | | | | | |
| Ceiling Structures/Linings | Vermiculite - Composite Sample - (70 - 120 m2) - (X8) | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 15m2 | West | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R0025 - Toilets - Girls - 14.15 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0026 - Toilets - Boys - 14.21 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0027 - Sports Store - 13.53 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 14m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R0028 - Canteen - 42.87 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 43m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R0029 - Canteen Office/Store - 2.58 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 3m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R0030 - Staff Toilet - 3.09 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0031 - Canteen Office/Store - 5.98 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 6m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R0032 - Cleaning Supplies - 10.87 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 11m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| Plant / Equipment - Flue | Fibre Cement Pipe | 1 | Hot water heater cupboard | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R0033 - Lift - 1.46 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0034 - External Movement - 10.32 m2 | | | | | | | |
| No Asbestos | | | | | | | |

| | | | | | | | |
|---|-------------|------|--------------|--------------------|---------|--------------------|-----------------------------|
| B00A - R1001 - Home Base - 70.02 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 2m2 | East facing | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R1002 - Withdrawal Space - 1hb - 16.96 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R1003 - Home Base Store - 4.45 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 5m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R1004 - Home Base - 68.11 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 20m2 | East facing | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R1005 - Home Base - 69.75 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R1006 - Toilets - Girls - 5.92 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R1007 - Toilets - Boys - 4.96 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R1008 - Toilets - Girls - 5.62 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R1009 - Toilets - Boys - 4.95 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R1010 - Withdrawal Space - 1hb - 16.61 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R1011 - Home Base Store - 4.45 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 5m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R1012 - Practical Activities - 1hb - 19.53 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 20m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R1013 - Home Base - 50.55 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R1014 - Practical Activities - 1hb - 19.51 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 20m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R1015 - Home Base - 50.54 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R1016 - Withdrawal Space - 1hb - 17.04 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R1017 - Home Base Store - 4.44 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 5m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R1018 - Practical Activities - 1hb - 19.44 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 20m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R1019 - Home Base - 50.55 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R1020 - Toilets - Girls - 5.83 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R1021 - Toilets - Boys - 4.89 m2 | | | | | | | |

| | | | | | | | |
|--|--|-------|---|--------------------|---------|--------------------|---|
| No Asbestos | | | | | | | |
| B00A - R1022 - Other-Community Use - 11.68 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R1023 - Cleaning Distributed Store - 3.2 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 4m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R1024 - General Storeroom - 12.41 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 13m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R1025 - Movement - 320.7 m2 | | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 100m2 | East facing | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00A - R1026 - Movement - 5.24 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - General Learning/Pupil Facilities - 1897 - Brick/Block | | | | | | | |
| Exterior | | | | | | | |
| Eaves Linings | Flat AC Sheeting | 45m2 | North facing, South facing, West facing | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos), Amosite (brown asbestos) |
| Ceiling Voids | Non Accessible Area | | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | | |
| Interior | | | | | | | |
| B00B - R0001 - Movement - 33.26 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0002 - Toilets - Girls - 11.28 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0003 - Toilets - Boys - 12.65 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0004 - Home Base - 86.72 m2 | | | | | | | |
| Ceiling Structures/Linings | Vermiculite - Composite Sample - (70 - 120 m2) - (X8) | | | | | | |
| B00B - R0005 - Practical Activities - 1hb - 14.49 m2 | | | | | | | |
| Ceiling Structures/Linings | Vermiculite - Composite Sample - (10 - 40 m2) - (X3) | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 15m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Vinyl Tiles - Adhesive | | | | | | |
| B00B - R0006 - Toilets - Boys/Girls - 2.19 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0007 - Movement - 9.04 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0008 - Movement - 9.08 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R1001 - Movement - 33.26 m2 | | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 15m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00B - R1002 - Home Base - 53.16 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R1003 - Practical Activities - 1hb - 21.18 m2 | | | | | | | |

| | | | | | | | |
|---|------------------------|-------|--------------|--------------------|---------|--------------------|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | 22m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Vinyl Tiles - Adhesive | | | | | | |
| B00B - R1004 - Home Base - 53.01 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R1005 - Practical Activities - 1hb - 21.21 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 22m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Vinyl Tiles - Adhesive | | | | | | |
| B00C - Building Services - 1974 - Brick/Block | | | | | | | |
| Exterior | | | | | | | |
| Ceiling Voids | No Asbestos Found | | | | | | |
| Underfloor Voids - Slab on Ground | No Asbestos Found | | | | | | |
| Interior | | | | | | | |
| B00C - R0001 - Main Switch Board - 8.95 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0002 - Garden Store - 15 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0003 - Garden Store - 12.85 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - General Learning - 1975 - Brick/Block | | | | | | | |
| Exterior | | | | | | | |
| Eaves Linings | Flat AC Sheeting | 250m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Assumed Asbestos |
| Ceiling Voids | Non Accessible Area | | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | | |
| Interior | | | | | | | |
| B00D - R0001 - Home Base - 58.17 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0002 - Practical Activities - 1hb - 18.89 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 19m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00D - R0003 - Withdrawal Space - 1hb - 12.84 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0004 - Toilets - Boys/Girls - 3 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0005 - General Storeroom - 5.51 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 6m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00D - R0006 - Movement - 72.69 m2 | | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | | | | | | |
| B00D - R0007 - Withdrawal Space - 1hb - 13.4 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0008 - Practical Activities - 1hb - 17.64 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 18m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |

| | | | | | | | |
|---|-------------|------|--------------|--------------------|---------|--------------------|-----------------------------|
| B00D - R0009 - Home Base - 66.49 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0010 - Toilets - Boys/Girls - 3 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0011 - Special Programs Room - 29.24 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 10m2 | East facing | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00D - R0012 - P.E Store - 1.48 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 2m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00D - R0013 - Movement - 6.64 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0014 - Staff Toilet - 4.42 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0020 - General Storeroom - 1.29 m2 | | | | | | | |
| Non Accessible | | | | | | | |
| B00D - R0021 - Plant - 1.95 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0022 - Staff Toilet - 4.08 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0023 - Deputy Principal - 18.41 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0024 - Movement - 18.25 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0025 - Movement - 115.01 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0026 - Movement - 23.61 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0027 - Home Base - 43.94 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0028 - General Storeroom - 32.86 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0029 - Stairs - 4.25 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R1001 - Practical Activities - 1hb - 19.71 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 20m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00D - R1002 - Withdrawal Space - 1hb - 33.66 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R1003 - Withdrawal Space - 1hb - 11.18 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R1004 - Withdrawal Space - 1hb - 12.84 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R1005 - Movement - 18.61 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 2m2 | South facing | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00D - R1006 - Home Base Store - 6.01 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 7m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00D - R1007 - Home Base - 53.28 m2 | | | | | | | |

| | | | | | | | |
|--|---------------------|------|--------------|--------------------|---------|--------------------|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles | 20m2 | North facing | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00D - R1008 - Home Base - 70.79 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R1009 - Practical Activities - 1hb - 18.77 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 19m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00D - R1010 - Movement - 3.59 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R1011 - Movement - 12.05 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R1012 - Home Base - 51 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R1013 - Practical Activities - 1hb - 21.63 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 22m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00D - R1014 - Movement - 13.92 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R1015 - Toilets - Girls - 14.01 m2 | | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | 45m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00D - R1016 - Cleaning Distributed Store - 1.05 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R1017 - Toilets - Boys - 12.26 m2 | | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | 45m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00D - R1018 - Movement - 18.25 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R1019 - General Storeroom - 13.94 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R1020 - Home Base Store - 13.98 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R1022 - Movement - 5.78 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R1023 - Movement - 40.89 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R1024 - Stairs - 16.46 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R1025 - Outdoor Learning Area - 95.11 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R1026 - Garden Store - 7.65 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - General Learning/Administration - 1916 - Brick/Block | | | | | | | |
| Exterior | | | | | | | |
| Ceiling Voids | Non Accessible Area | | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | | |
| Interior | | | | | | | |
| B00E - R0001 - External Movement - 49.04 m2 | | | | | | | |
| No Asbestos | | | | | | | |

| | | | | | | | |
|---|------------------------|------|--------------|--------------------|---------|--------------------|--|
| B00E - R0002 - General Storeroom - 6.05 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0003 - Movement - 3.45 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0004 - Staff Toilet - 6.08 m2 | | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 7m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| B00E - R0005 - Movement - 5.21 m2 | | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 6m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| B00E - R0006 - Staff Toilet - 13.78 m2 | | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 14m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| B00E - R0007 - General Storeroom - 2.42 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0008 - Staff Room - 62.89 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0009 - Deputy Principal - 23.64 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0010 - General Storeroom - 9.5 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0011 - General Storeroom - 11.69 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 12m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00E - R0012 - General Assistant/Bulk Store - 11.36 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0013 - Duplicating Workroom - 13.52 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0014 - Clerical Office - 21.82 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0015 - Interview - 12.46 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0016 - Principal - 30.01 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0017 - Cleaning Distributed Store - 1.52 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 2m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Vinyl Tiles - Adhesive | | | | | | |
| B00E - R0018 - Toilets - Girls - 12.49 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0019 - Toilets - Boys - 11 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0020 - Movement - 2.33 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0021 - Disabled Toilet - 3.02 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0022 - External Movement - 29.28 m2 | | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 20m2 | West | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |

| | | | | | | | |
|---|------------------------|------|--------------|--------------------|---------|--------------------|-----------------------------|
| B00E - R0023 - Entry Vestibule - 53.95 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0024 - Movement - 17.32 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0025 - Practical Activities - 1hb - 19.15 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 20m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Vinyl Tiles - Adhesive | | | | | | |
| B00E - R0026 - Home Base - 48.52 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0027 - Home Base - 51.06 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0028 - Practical Activities - 1hb - 22.18 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0029 - Stairs - 9.26 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0030 - Stairs - 6.76 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0031 - Lift - 1.57 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R1001 - Movement - 54.25 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R1002 - Movement - 93.19 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R1003 - Toilets - Girls - 22.66 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R1004 - Home Base - 74.96 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 20m2 | East facing | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00E - R1005 - Withdrawal Space - 1hb - 25.29 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 15m2 | South facing | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00E - R1006 - Home Base - 50.11 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 20m2 | East facing | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00E - R1007 - Practical Activities - 1hb - 18.31 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 19m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00E - R1008 - Home Base - 58.33 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R1009 - Home Base - 58.26 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R1010 - Practical Activities - 1hb - 17.69 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R1011 - Toilets - Boys - 12.32 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R1012 - Cleaning Distributed Store - 1.51 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 1m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |

| | | | | | | | |
|--|------------------------|------|-------------|--------------------|---------|--------------------|-----------------------------|
| Floor Coverings Res/Textile | Vinyl Tiles - Adhesive | | | | | | |
| B00E - R1013 - Special Programs Room - 40.15 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 30m2 | West facing | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00E - R1014 - General Storeroom - 8.46 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R1015 - General Storeroom - 7.81 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 7m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| Floor Coverings Res/Textile | Vinyl Tiles - Adhesive | | | | | | |
| B00E - R1016 - Stairs - 11.63 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R1017 - Stairs - 13.84 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - General Learning - 2010 - Brick/Veneer | | | | | | | |
| Exterior | | | | | | | |
| No Asbestos | | | | | | | |
| Interior | | | | | | | |
| B00F - R0001 - External Movement - 69.04 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0002 - Practical Activities/Movement - 1hb - 18.32 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0003 - Home Base Store - 6.19 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0004 - Home Base - 61.16 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0005 - Withdrawal Space - 2hb - 11.67 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0006 - Home Base - 60.99 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0007 - No Access - 6.19 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0008 - Practical Activities/Movement - 1hb - 18.93 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0009 - No Access - .6 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0010 - External Stairs - 9.61 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R1001 - External Movement - 59.67 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R1002 - Practical Activities/Movement - 1hb - 19.14 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R1003 - Home Base Store - 6.08 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R1004 - Home Base - 61.33 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R1005 - Withdrawal Space - 2hb - 11.74 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R1006 - Home Base - 61.19 m2 | | | | | | | |

| | |
|--|--|
| No Asbestos | |
| B00F - R1007 - Home Base Store - 6.08 m2 | |
| No Asbestos | |
| B00F - R1008 - Practical Activities/Movement - 1hb - 19.21 m2 | |
| No Asbestos | |
| B00F - R1009 - External Stairs - 15.44 m2 | |
| No Asbestos | |

Demountables

OS 602 14467 - Learning Unit - Standard With P.A.A. - Placement Date : 01-FEB-2020

No Asbestos Found