


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Hurstville South Public School (2198)
Region:	Sydney AMU
State Electorate:	Oatley
Local Government Area:	Georges River

Last Reviewed By:	Greencap 28-SEP-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

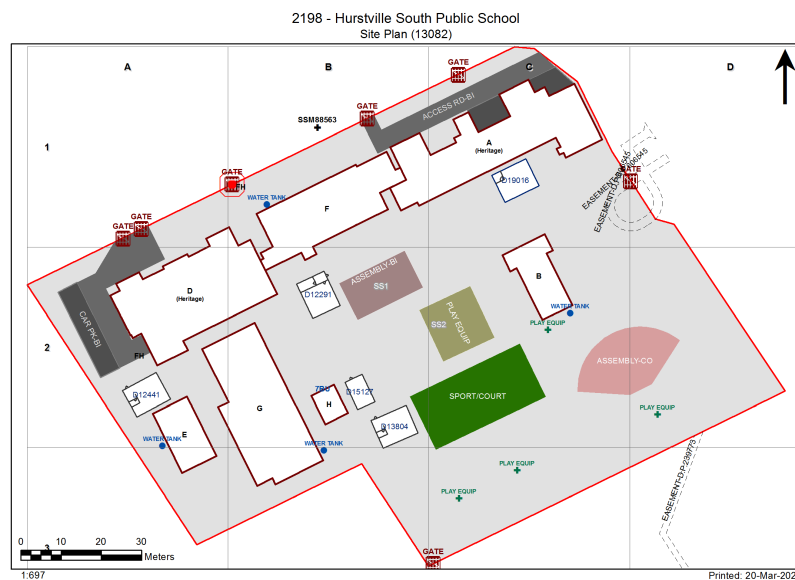

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - General Learning/Library - 1922 - Brick/Block							
Exterior							
Wall Cladding	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	10m2	South of Room R0003 & R0004	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	2m2	North of Room R0030	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Flat AC Sheeting	5	Various Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Crocidolite (blue asbestos)
Interior							
B00A - R0001 - Clerical Office/Workroom - 31.54 m2							
No Asbestos							
B00A - R0002 - Security Store - 6.55 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R0003 - Staff Room - 56.71 m2							
No Asbestos							
B00A - R0004 - Movement - 6.66 m2							
No Asbestos							
B00A - R0005 - Movement - 1.23 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0006 - Staff Toilet - 3.23 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0007 - Staff Toilet - 3.61 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0008 - Movement - 4.15 m2							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0009 - Movement - 75 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	30m2	Central, adjacent Sink	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Reinspect / Delete	Flat AC Sheeting	3	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0010 - Home Base - 47.75 m2							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0011 - Home Base - 47.55 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R0012 - Special Programs Room - 47.63 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R0013 - Reading Area - 97.02 m2							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	97m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0014 - Library Office/Workroom - 16.15 m2							
No Asbestos							
B00A - R0015 - Movement - 3.17 m2							
No Asbestos							
B00A - R0016 - Security Store - 4.01 m2							
No Asbestos							
B00A - R0018 - K.L.A. Store - 24.44 m2							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	No Asbestos Found						
B00A - R0019 - Movement - 2.23 m2							
No Asbestos							
B00A - R0020 - Cleaning Distributed Store - 4.94 m2							
No Asbestos							
B00A - R0021 - Movement - 12.87 m2							
No Asbestos							
B00A - R0022 - Reading Area - 24.83 m2							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0023 - Garden Store - 3.61 m2							
No Asbestos							
B00A - R0024 - Movement - 1.95 m2							
No Asbestos							
B00A - R0025 - Principal - 18.17 m2							
No Asbestos							
B00A - R0026 - Movement - 13.45 m2							
No Asbestos							
B00A - R0027 - Movement - 2.04 m2							
No Asbestos							
B00A - R0028 - General Storeroom - 5 m2							
No Asbestos							
B00A - R0029 - Duplicating Workroom - 12.59 m2							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						

Floor Coverings Res/Textile	Vinyl Sheet						
B00A - R0030 - Movement - 6.4 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0031 - Stairs - 5.9 m2							
No Asbestos							
B00A - R0032 - Stairs - 2.23 m2							
No Asbestos							
B00A - R1001 - Home Base - 50.6 m2							
Ceiling Structures/Linings - Access Hatch	Flat AC Sheeting	0.5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1002 - Home Base - 49.32 m2							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Ceiling Structures/Linings - Access Hatch	Flat AC Sheeting	0.5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1003 - Craft Store - 13.29 m2							
Floor Coverings Res/Textile	Vinyl Tiles	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1004 - Movement - 128.69 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	3m2	Central, adjacent Sink	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	No Asbestos Found						
B00A - R1006 - Home Base - 49.51 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	49.49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1007 - Home Base - 49.51 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	49.49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1009 - Home Base - 50.38 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1010 - Community Clinic - 15.92 m2							
No Asbestos							
B00A - R1011 - Staff Toilet - 4.03 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1012 - Movement - 3.15 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00A - R1014 - General Storeroom - 9.1 m2							
No Asbestos							
B00A - R1015 - Clerical Office - 18.23 m2							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1016 - Music Store - 8.71 m2							
Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Compressed AC Sheet	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Compressed AC Sheet	5m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1017 - Stairs - 11.14 m2							
No Asbestos							
B00A - R1018 - Stairs - 11.14 m2							
No Asbestos							
B00A - R1019 - Practical Activities - 2hb - 38.09 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R1020 - Withdrawal Space - 2hb - 10.73 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1021 - Practical Activities - 2hb - 38.22 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R1022 - Withdrawal Space - 2hb - 10.73 m2							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - Pupil Facilities - 1946 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	25m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	10m2	North facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Requires Inspection						
Interior							
B00B - R0001 - General Storeroom - 18 m2							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0002 - Drinking Facilities - 15.68 m2							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0003 - Toilets - Boys - 33.89 m2							
Ceiling Structures/Linings	Flat AC Sheeting	34m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet						

Furniture / Fixtures - Cistern	Compressed AC Sheet							
Ceiling Structures/Linings - Access Hatch	Flat AC Sheeting	1m2	Northwest	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0004 - Cleaning Distributed Store - .96 m2								
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0005 - Toilets - Girls - 38.63 m2								
Ceiling Structures/Linings	Flat AC Sheeting	39m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet							
Furniture / Fixtures - Cistern	Compressed AC Sheet							
B00B - R0006 - Cleaning Distributed Store - .87 m2								
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0007 - Drinking Facilities - 15.72 m2								
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0008 - Cleaning Supplies - 21.72 m2								
Ceiling Structures/Linings	Flat AC Sheeting	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet							
Furniture / Fixtures - Sink	Bituminous - Lining							
B00D - General Learning/Communal Facilities - 1926 - Brick/Block								
Exterior								
External Roof Structure	Compressed AC Sheet	15	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
Material - Stored / Debris Material	Flat AC Sheeting	1	Top of roof, above south-east corner of R0020	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Assumed Asbestos	
Underfloor Voids	Requires Inspection							
Ceiling Voids	Requires Inspection							
Interior								
B00D - M0001 - Movement - 5.6 m2								
Ceiling Structures/Linings	Flat AC Sheeting	4.63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - M0002 - Movement - 4.07 m2								
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R0001 - Movement - 41.77 m2								
No Asbestos								
B00D - R0002 - Home Base - 48.03 m2								
Furniture / Fixtures - Blackboard	Compressed AC Sheet	5	South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	No Asbestos Found							
B00D - R0004 - Home Base - 48.7 m2								
Furniture / Fixtures - Blackboard	Compressed AC Sheet	8	South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	No Asbestos Found							
B00D - R0005 - Home Base - 69.34 m2								
Furniture / Fixtures - Blackboard	Compressed AC Sheet	10	South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	

Floor Coverings Res/Textile	No Asbestos Found							
B00D - R0006 - Movement - 1.51 m2								
No Asbestos								
B00D - R0007 - Movement - 24.47 m2								
No Asbestos								
B00D - R0008 - Staff Toilet - 4.92 m2								
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00D - R0009 - Staff Room Annexe - 19.81 m2								
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Flat AC Sheeting							
B00D - R0012 - Personal Effects Storage - 13.11 m2								
No Asbestos								
B00D - R0014 - Movement - 73.5 m2								
No Asbestos								
B00D - R0016 - Cleaning Distributed Store - 3.58 m2								
No Asbestos								
B00D - R0017 - Movement - 4.07 m2								
No Asbestos								
B00D - R0018 - Personal Effects Storage - 13.11 m2								
No Asbestos								
B00D - R0019 - General Storeroom - 3.57 m2								
No Asbestos								
B00D - R0020 - Interview - 9.85 m2								
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00D - R0021 - Clerical Office - 9.85 m2								
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00D - R0022 - Stairs - 7.09 m2								
Wall Linings Internal - Infill	Flat AC Sheeting	0.2m2	Upper, eastern wall. Behind motion sensor.	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00D - R0023 - Stairs - 7.1 m2								
No Asbestos								
B00D - R0024 - Practical Activities - 2hb - 35.74 m2								
No Asbestos								
B00D - R0025 - Withdrawal Space - 2hb - 11.63 m2								
Floor Coverings Res/Textile	No Asbestos Found							
B00D - R0026 - Home Base X2 - 146.49 m2								
Requires Inspection								
B00D - R1001 - General Storeroom - 19.94 m2								
Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R1002 - Home Base - 50.82 m2								

Furniture / Fixtures - Blackboard	Compressed AC Sheet	5	South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	51m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1004 - Home Base - 49.6 m2							
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Furniture / Fixtures - Blackboard	Compressed AC Sheet	10	South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	No Asbestos Found						
B00D - R1005 - Home Base - 73.37 m2							
Furniture / Fixtures - Blackboard	Compressed AC Sheet	10	South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	74m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	No Asbestos Found						
B00D - R1006 - Movement - 84.49 m2							
Ceiling Structures/Linings	Flat AC Sheeting	85m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1007 - Personal Effects Storage - 10.24 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1009 - Personal Effects Storage - 10.22 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Encapsulated Asbestos material within unit	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R1010 - General Storeroom - 15.55 m2							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1011 - Stairs - 12.45 m2							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1012 - Stairs - 12.63 m2							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1013 - Practical Activities - 2hb - 36.37 m2							
Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	No Asbestos Found						
B00D - R1014 - Withdrawal Space - 2hb - 11.59 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	No Asbestos Found						
B00D - R1015 - Home Base Store - 4.06 m2							
Requires Inspection							
B00D - R1016 - Practical Activities - 1hb - 17.47 m2							
Requires Inspection							
B00D - R1017 - Home Base - 47.59 m2							
Requires Inspection							
B00D - R1018 - Home Base - 48.68 m2							
Requires Inspection							
B00D - R1019 - Practical Activities - 1hb - 17.08 m2							
Requires Inspection							

B00D - R1020 - Home Base Store - 4 m2							
Requires Inspection							
B00D - R1021 - Withdrawal Space - 2hb - 8.09 m2							
Requires Inspection							
B00D - R9001 - Movement - 5.45 m2							
No Asbestos							
B00D - R9002 - General Storeroom - 11.86 m2							
Plant / Equipment - Kiln	Encapsulated Asbestos material within unit	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R9003 - Movement - 24.01 m2							
No Asbestos							
B00D - R9004 - Stairs - 10.35 m2							
No Asbestos							
B00E - Pupil Facilities/General Learning - 1913 - Timber							
Exterior							
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Eaves Linings	No Asbestos Found						
Interior							
B00E - R0001 - Movement - 33.43 m2							
Wall Linings Internal	Flat AC Sheeting						
B00E - R0002 - Canteen Office/Store - 10.74 m2							
No Asbestos							
B00E - R0003 - Canteen - 44.16 m2							
No Asbestos							
B00E - R0004 - Practical Activities - 4hb - 44.16 m2							
Wall Linings Internal - Infill	Flat AC Sheeting						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0005 - Uniform Shop - 11.51 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00F - General Learning - 2008 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00F - R0001 - External Movement - 15.8 m2							
No Asbestos							
B00F - R0002 - External Stairs - 2.54 m2							
No Asbestos							
B00F - R0003 - External Stairs - 1.06 m2							
No Asbestos							
B00F - R0004 - External Movement - 22.28 m2							
No Asbestos							
B00F - R0005 - Movement - 2.94 m2							
No Asbestos							
B00F - R0006 - Lift - 4.41 m2							
No Asbestos							

B00F - R0007 - External Movement - 5.8 m2	
No Asbestos	
B00F - R0008 - External Movement - 97.09 m2	
No Asbestos	
B00F - R0009 - Home Base Store - 6.24 m2	
No Asbestos	
B00F - R0010 - Practical Activities - 16.84 m2	
No Asbestos	
B00F - R0011 - Home Base - 62.89 m2	
No Asbestos	
B00F - R0012 - Withdrawal Space - 2hb - 8.74 m2	
No Asbestos	
B00F - R0013 - Distribution Board - .87 m2	
No Asbestos	Note: No inspection of live electrical installation
B00F - R0014 - Practical Activities - 18.53 m2	
No Asbestos	
B00F - R0015 - Home Base Store - 6.24 m2	
No Asbestos	
B00F - R0016 - Home Base - 60.64 m2	
No Asbestos	
B00F - R0017 - Withdrawal Space - 2hb - 12.23 m2	
No Asbestos	
B00F - R0018 - Home Base - 61.48 m2	
No Asbestos	
B00F - R0019 - Practical Activities - 19.43 m2	
No Asbestos	
B00F - R0020 - Home Base Store - 6.24 m2	
No Asbestos	
B00F - R0021 - External Movement - 17.49 m2	
No Asbestos	
B00F - R1001 - External Movement - 106.06 m2	
No Asbestos	
B00F - R1002 - Movement - 2.94 m2	
No Asbestos	
B00F - R1004 - External Movement - 8.06 m2	
No Asbestos	
B00F - R1005 - External Movement - 12.86 m2	
No Asbestos	
B00F - R1006 - Home Base Store - 6.24 m2	
No Asbestos	
B00F - R1007 - Practical Activities - 16.84 m2	
No Asbestos	
B00F - R1008 - Home Base - 62.89 m2	
No Asbestos	
B00F - R1009 - Distribution Board - .87 m2	
No Asbestos	Note: No inspection of live electrical installation
B00F - R1010 - Home Base Store - 6.24 m2	
No Asbestos	
B00F - R1011 - Practical Activities - 18.53 m2	
No Asbestos	
B00F - R1012 - Home Base - 60.64 m2	
No Asbestos	

B00F - R1013 - Withdrawal Space - 2hb - 12.23 m2	
No Asbestos	
B00F - R1014 - Home Base - 61.48 m2	
No Asbestos	
B00F - R1015 - Practical Activities - 19.43 m2	
No Asbestos	
B00F - R1016 - Home Base Store - 6.24 m2	
No Asbestos	
B00F - R1018 - External Stairs - 11.23 m2	
No Asbestos	
B00F - R1020 - Withdrawal Space - 2hb - 8.74 m2	
No Asbestos	
B00G - Communal Facilities - 2010 - Brick/Veneer	
Exterior	
Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found
Interior	
B00G - R0001 - Communal Space - 216.64 m2	
No Asbestos	
B00G - R0002 - Movement - 14.57 m2	
No Asbestos	
B00G - R0003 - Raised Platform - 48.58 m2	
No Asbestos	
B00G - R0004 - Ramp - 13 m2	
No Asbestos	
B00G - R0005 - Access Shower/Toilet - 6.64 m2	
No Asbestos	
B00G - R0006 - Main Switch Board - 3.51 m2	
No Asbestos	
B00G - R0007 - Cleaning Distributed Store - 3.22 m2	
No Asbestos	
B00G - R0008 - Toilet - Lobby - 3.3 m2	
No Asbestos	
B00G - R0009 - Toilets - Boys - 5.63 m2	
No Asbestos	
B00G - R0010 - Toilet - Lobby - 2.47 m2	
No Asbestos	
B00G - R0011 - Toilets - Girls - 7.24 m2	
No Asbestos	
B00G - R0012 - P.E. Store - 16.77 m2	
No Asbestos	
B00G - R0013 - Communal/Performance Store - 10.35 m2	
No Asbestos	
B00G - R0014 - Chair Storeroom - 12.68 m2	
No Asbestos	
B00G - R0015 - Sound Cupboard - 2.02 m2	
No Asbestos	
B00G - R0016 - Plant - .35 m2	
No Asbestos	
B00G - R0017 - Plant - 1.57 m2	
No Asbestos	

B00G - R0018 - External Movement - 7.56 m2		
No Asbestos		
B00G - R0019 - Covered Outdoor Learning Area - 214.18 m2		
No Asbestos		
B00H - Pupil Facilities - 2010 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00H - R0001 - Toilets - Boys - 19.01 m2		
No Asbestos		
B00H - R0002 - Toilets - Girls - 23.47 m2		
No Asbestos		

Demountables

OS 601 12291 - Learning Unit - Standard/Withdrawal - Placement Date : 13-JAN-2005

Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- Entry

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

R2- General Learning Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

R3- Store

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

OS 602 12441 - Learning Unit - Standard With P.A.A. - Placement Date : 21-NOV-2014

No Asbestos Found

OS 602 13804 - Learning Unit - Standard With P.A.A. - Placement Date : 20-JAN-2017

No Asbestos Found

OS 750 15127 - Learning Unit - ESL - Placement Date : 06-DEC-2013

No Asbestos Found

OS 606 19016 - Learning Unit - Standard With P.A.A A/C - Placement Date : 05-JAN-2018

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found