


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Hamilton South Public School (3795)
Region:	Hunter/Central Coast AMU
State Electorate:	Newcastle
Local Government Area:	Newcastle

Last Reviewed By:	Greencap 10-FEB-2015
Last Revised By:	AECOM 25-JUN-2020

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

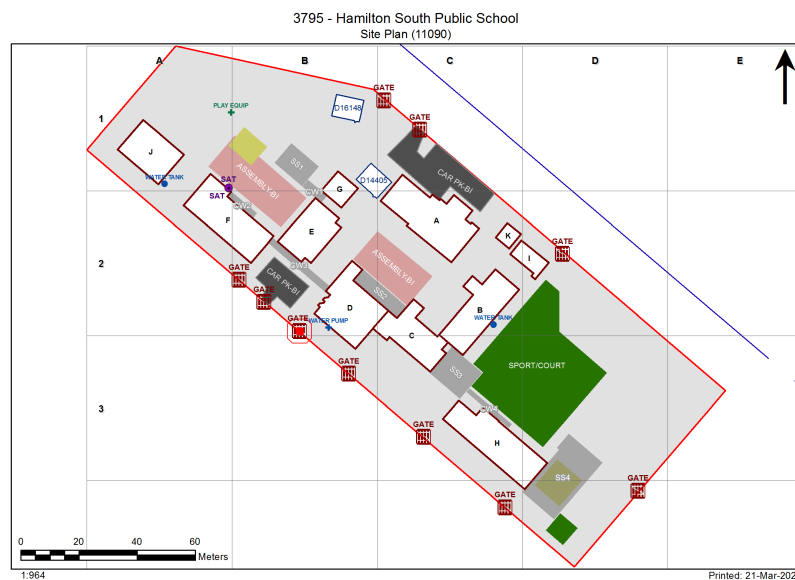

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Communal Facilities/Pupil Facilities - 1976 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Interior							
B00A - R0001 - Garden Store - 8.5 m2							
No Asbestos							
B00A - R0002 - Raised Platform - 19.25 m2							
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0003 - Uniform Shop - 7.09 m2							
No Asbestos							
B00A - R0004 - Communal Space - 155.7 m2							
Ceiling Structures/Linings	Flat AC Sheeting	156.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0005 - Movement - 36.77 m2							
Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0008 - Staff Toilet - 4.3 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4.30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Plant / Equipment - Incinerator	Insulation Material - Rope			Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0009 - Movement - 22.43 m2							
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0010 - Covered Outdoor Learning Area - 100.37 m2							
No Asbestos							
B00A - R0011 - Canteen - 26.18 m2							
No Asbestos							
B00A - R0012 - Canteen Office/Store - 9.33 m2							
No Asbestos							
B00A - R0013 - Communal/Performance Store - 4.32 m2							
No Asbestos							
B00A - R0014 - General Storeroom - 20.49 m2							
No Asbestos							
B00A - R0015 - Toilet - Lobby - 1.01 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	2.00m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - General Learning/Pupil Facilities - 1977 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Voids - Raked Ceiling	No Asbestos Found							
Underfloor Voids - Slab on Ground	Non Accessible Area							
Interior								
B00B - R0001 - Practical Activities - 1hb - 18.69 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R0002 - Home Base - 50.85 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R0003 - Movement - 62.74 m2								
No Asbestos								
B00B - R0004 - Home Base - 50.85 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0005 - Practical Activities - 1hb - 18.69 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R0006 - General Storeroom - 5.55 m2								
No Asbestos								
B00B - R0007 - Toilets - Girls - 21.61 m2								
No Asbestos								
B00B - R0008 - Toilets - Boys - 20.62 m2								
No Asbestos								
B00B - R0009 - Cleaning Distributed Store - 1.31 m2								
No Asbestos								
B00B - R0010 - Distribution Board - 1.06 m2								
Note: No inspection of live electrical installation								
No Asbestos								
B00B - R0011 - General Storeroom - 8.09 m2								
No Asbestos								
B00B - R0012 - P.E Store - 18.2 m2								
No Asbestos								
B00B - R1001 - Practical Activities - 1hb - 18.78 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1002 - Home Base - 50.96 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1003 - Movement - 63.94 m2								
Ceiling Structures/Linings	Flat AC Sheeting	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1004 - Home Base - 51.2 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1005 - Practical Activities - 1hb - 18.76 m2								
Floor Coverings Res/Textile	Vinyl Tiles	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1006 - Toilets - Girls - 20.91 m2								
Partition Walls (Cubicles)	Compressed AC Sheet							

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1007 - Toilets - Boys - 20.43 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1008 - Cleaning Distributed Store - 1.37 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1.37m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Sample Result(s) to be recorded
B00B - R1009 - Distribution Board - 1.04 m2							
Note: No inspection of live electrical installation							
Ceiling Structures/Linings	Flat AC Sheeting	2.00m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1010 - Cleaning Supplies - 8.06 m2							
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1011 - General Storeroom - 15.56 m2							
No Asbestos							
B00C - General Learning - 1977 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00C - R0001 - Movement - 65.23 m2							
No Asbestos							
B00C - R0002 - Practical Activities - 1hb - 18.76 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00C - R0003 - Home Base - 50.88 m2							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00C - R0004 - Home Base - 50.88 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00C - R0005 - Practical Activities - 1hb - 18.84 m2							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0006 - General Storeroom - 5.48 m2							
No Asbestos							
B00C - R0007 - No Access - 11.04 m2							
No Asbestos							
B00C - R0008 - Cleaning Supplies - 7.93 m2							
No Asbestos							
B00C - R1001 - Movement - 52.9 m2							
Ceiling Structures/Linings	Flat AC Sheeting	53.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R1002 - Practical Activities - 1hb - 18.78 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R1003 - Home Base - 51.34 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R1004 - Home Base - 51.1 m2							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R1005 - Practical Activities - 1hb - 18.78 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - Administration/Library - 1977 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	80m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00D - R0001 - General Storeroom - 5.51 m2							
No Asbestos							
B00D - R0002 - Movement - 48.99 m2							
Ceiling Structures/Linings	Flat AC Sheeting	49.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0003 - Principal - 14.61 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0004 - Movement - 21.98 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0005 - Interview - 12.43 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0006 - Staff Room - 70.57 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B00D - R0007 - Duplicating Workroom - 12.16 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0008 - General Storeroom - 10.64 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0009 - Distribution Board - 1.43 m2								
Note: No inspection of live electrical installation								
No Asbestos								
B00D - R0010 - Cleaning Distributed Store - 3.12 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00D - R0011 - Clerical Office/Workroom - 22.9 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0012 - Clerical Office - 13.52 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0013 - Entry Vestibule - 12.97 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0014 - Deputy Principal - 12.59 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0015 - Sick Bay - 6.98 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00D - R0016 - Movement - 8.71 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00D - R0017 - Staff Room Annexe - 11.59 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0018 - Staff Toilet - 6.97 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Plant / Equipment - Incinerator	Insulation Material	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
Partition Walls (Cubides)	Compressed AC Sheet	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R0019 - Disabled Toilet - 6.29 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Plant / Equipment - Incinerator	Insulation Material	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
Partition Walls (Cubides)	Compressed AC Sheet	2.00m2	North	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)	
B00D - R1001 - Movement - 36.42 m2								
Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R1002 - Reading Area - 174.62 m2								
No Asbestos								
B00D - R1003 - Seminar/Study - 8.8 m2								
No Asbestos								

B00D - R1004 - Seminar/Study - 7.65 m2							
No Asbestos							
B00D - R1005 - Library Office/Workroom - 8.06 m2							
No Asbestos							
B00D - R1006 - Communications Room - 12.8 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1007 - K.L.A. Store - 20.27 m2							
Floor Coverings Res/Textile	Vinyl Tiles	21m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1008 - Cleaning Distributed Store - 3.03 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R1009 - Toilets - Girls - 3.64 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Incinerator	Insulation Material - Door Seal		South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R1010 - Movement - 10.4 m2							
No Asbestos							
B00D - R1011 - Distribution Board - 3.05 m2							
Note: No inspection of live electrical installation							
Ceiling Structures/Linings	Flat AC Sheeting	3.00m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R1012 - Toilets - Boys - 3.62 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - General Learning - 1977 - Brick/Block							
Exterior							
Gable Verge Lining	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	25m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00E - R0001 - Practical Activities - 1hb - 14.16 m2							
Floor Coverings Res/Textile	Vinyl Tiles	15m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0002 - Home Base - 75.28 m2							
No Asbestos							
B00E - R0003 - Movement - 35.83 m2							
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0004 - Distribution Board - 1.5 m2							
Note: No inspection of live electrical installation							
Ceiling Structures/Linings	Flat AC Sheeting	1.50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0005 - Practical Activities - 1hb - 14.13 m2							
Floor Coverings Res/Textile	Vinyl Tiles	15m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0006 - Home Base - 75.65 m2							
No Asbestos							
B00E - R0007 - Home Base Store - 3.04 m2							
No Asbestos							
B00E - R0008 - Home Base Store - 3.04 m2							

No Asbestos							
B00F - General Learning - 1933 - Brick/Block							
Exterior							
Gable Verge Lining	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	35m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Non Accessible Area						
External Wall Structure	Flat AC Sheeting	2.00	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00F - R0001 - External Movement - 53.4 m2							
Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0010 - General Storeroom - 9.19 m2							
No Asbestos							
B00F - R0011 - General Storeroom - 7.28 m2							
No Asbestos							
B00F - R0012 - Practical Activities - 1hb - 14.26 m2							
No Asbestos							
B00F - R0013 - Movement - 1.5 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0014 - Toilet - Lobby - 1.61 m2							
No Asbestos							
B00F - R0015 - Staff Toilet - 1.91 m2							
Wall Linings Internal	Flat AC Sheeting	2.00m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0016 - Movement - 8.17 m2							
No Asbestos							
B00F - R0017 - Home Base - 78.85 m2							
No Asbestos							
B00F - R0018 - Practical Activities - 1hb - 16.94 m2							
No Asbestos							
B00F - R0019 - Home Base Store - 6.75 m2							
No Asbestos							
B00F - R0020 - Withdrawal Space - 2hb - 17.15 m2							
No Asbestos							
B00F - R0021 - Home Base - 65.43 m2							
No Asbestos							
B00F - R0022 - Practical Activities - 1hb - 17.1 m2							
No Asbestos							
B00F - R0023 - Home Base Store - 5.56 m2							
No Asbestos							
B00F - R0024 - Movement - 9.58 m2							
No Asbestos							
B00F - R0025 - General Storeroom - 13.22 m2							
No Asbestos							
B00F - R0026 - General Storeroom - 16.55 m2							
No Asbestos							
B00G - Pupil Facilities - 1976 - Brick/Block							
Exterior							

Gable Verge Lining	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	5m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00G- R0001 - Toilets - Girls - 21.71 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	9m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G- R0002 - Toilets - Boys - 24.9 m2							
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G- R0003 - Movement - 16.9 m2							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - Support Unit - 1966 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	AC Fragments/Debris	2.00	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	Non Accessible Area						
External Wall Structure	Flat AC Sheeting	20.00	Infills above windows, north and south	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B00H - R0001 - Movement - 5.37 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0002 - Staff Room Annexe - 8.55 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0003 - Home Base Store - S - 7.68 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0004 - Home Base - S - 58.28 m2							
No Asbestos							
B00H - R0005 - Home Base - M - 58.74 m2							
No Asbestos							
B00H - R0006 - Home Base Store - M - 7.31 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	10.00m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00H - R0007 - Personal Effects - M - 2.74 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	2.00m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0008 - Movement - 29.52 m2							
No Asbestos							
B00H - R0009 - Practical Activities - S - 1hb - 30.77 m2							
No Asbestos							
B00H - R0010 - Cleaning Distributed Store - 1 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0011 - Distribution Board - .8 m2 Note: No inspection of live electrical installation							
Ceiling Structures/Linings	Flat AC Sheeting	1.50m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	6.00m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0012 - Personal Effects - M - 2.7 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0013 - Home Base Store - M - 7.39 m2							
Wall Linings Internal	Flat AC Sheeting	10.00m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0014 - Home Base - M - 58.9 m2							
No Asbestos							
B00H - R0015 - Toilet - S - 7.47 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0016 - Staff Toilet - 3.11 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0017 - Staff Toilet - 3.11 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0018 - Toilet - P - 6.91 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0019 - Movement - 74.31 m2							
Ceiling Structures/Linings	Flat AC Sheeting	75.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0020 - General Storeroom - .99 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - Other-After School Care - 1976 - Fibre Cement Clad							
Exterior							
Eaves Linings	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00I - R0001 - Out Of School Hours Care Centre - 59.14 m2							

No Asbestos		
B00I - R0002 - Out Of School Hours Care Centre - 2.49 m2		
No Asbestos		
B00I - R0003 - Out Of School Hours Care Centre - 6.57 m2		
No Asbestos		
B00I - R0004 - Out Of School Hours Care Centre - 1.97 m2		
No Asbestos		
B00J - General Learning - 2010 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	Non Accessible Area	
Interior		
B00J - R0001 - External Movement - 45.17 m2		
No Asbestos		
B00J - R0002 - Main Switch Board - .43 m2		
No Asbestos		
B00J - R0003 - Practical Activities - 1hb - 18.67 m2		
No Asbestos		
B00J - R0004 - Home Base Store - 6.3 m2		
No Asbestos		
B00J - R0005 - Home Base - 61.11 m2		
No Asbestos		
B00J - R0006 - Withdrawal Space - 2hb - 11.78 m2		
No Asbestos		
B00J - R0007 - Practical Activities - 1hb - 19.24 m2		
No Asbestos		
B00J - R0008 - Home Base - 61.1 m2		
No Asbestos		
B00J - R0009 - Home Base Store - 6.3 m2		
No Asbestos		
B00K - Storage - 2014 - Metal Shed		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Underfloor Voids - Slab on Ground	Non Accessible Area	
Ceiling Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00K - R0001 - General Storeroom - 35.95 m2		
No Asbestos		

Demountables

OS 603 14405 - Learning Unit - Standard With P.A.A. A/C - Placement Date : 21-JAN-2005

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 16148 - Learning Unit - Standard With P.A.A. - Placement Date : 25-FEB-2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found