

# Asbestos Register


(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Hazelbrook Public School (3854)</b>
<b>Region:</b>	<b>Western Sydney AMU</b>
<b>State Electorate:</b>	<b>Blue Mountains</b>
<b>Local Government Area:</b>	<b>Blue Mountains</b>

<b>Last Reviewed By:</b>	<b>WSP 14-MAY-2015</b>
<b>Last Revised By:</b>	

<b>Historical Fibro In Grounds Investigations/Events</b>	<b>Yes</b>
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

3854 - Hazelbrook Public School  
Site Plan (11615)

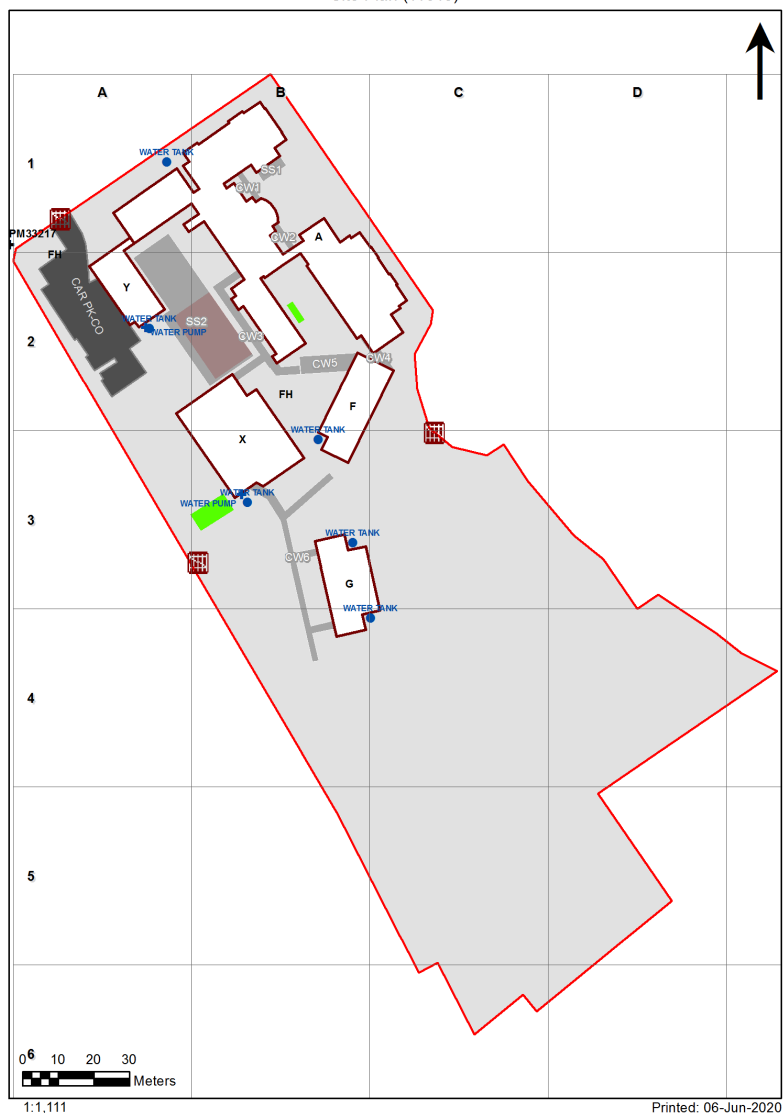

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - General Learning/Administration - 1987 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	300m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00A - R0002 - Cleaning Distributed Store - 3.56 m2</b>							
No Asbestos							
<b>B00A - R0003 - Movement - 25.93 m2</b>							
No Asbestos							
<b>B00A - R0004 - Distribution Board - 1.34 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00A - R0005 - Movement - 56.43 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R0006 - Practical Activities - 1hb - 12.8 m2</b>							
No Asbestos							
<b>B00A - R0007 - Movement - 8.12 m2</b>							
No Asbestos							
<b>B00A - R0008 - Security Store - 2.43 m2</b>							
No Asbestos							
<b>B00A - R0009 - Home Base Store - 3.67 m2</b>							
No Asbestos							
<b>B00A - R0010 - Home Base - 58.47 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R0011 - Outdoor Learning Area - 14.64 m2</b>							
No Asbestos							
<b>B00A - R0012 - Withdrawal Space - 1hb - 9.43 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R0013 - Outdoor Learning Area - 15.34 m2</b>							
No Asbestos							
<b>B00A - R0014 - Home Base - 59.21 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R0015 - Home Base Store - 3.35 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R0016 - Security Store - 2.53 m2</b>							
No Asbestos							
<b>B00A - R0017 - Practical Activities - 1hb - 41.79 m2</b>							
No Asbestos							
<b>B00A - R0018 - Security Store - 2.47 m2</b>							
No Asbestos							
<b>B00A - R0019 - Withdrawal Space - 1hb - 9.36 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						

<b>B00A - R0020 - Outdoor Learning Area - 14.56 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00A - R0021 - Home Base - 58.32 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R0022 - Home Base Store - 3.36 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R0023 - Special Programs Room - 46.77 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R0024 - Special Programs Store - 4.05 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R0025 - Movement - 44.19 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R0026 - Outdoor Learning Area - 20.64 m2</b>							
No Asbestos							
<b>B00A - R0027 - Reading Area - 171.34 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R0028 - Library Office/Workroom - 17.83 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R0029 - Security Store - 11.05 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R0030 - General Assistant/Bulk Store - 43.92 m2</b>							
No Asbestos							
<b>B00A - R0031 - Cleaning Distributed Store - 4.11 m2</b>							
No Asbestos							
<b>B00A - R0033 - Toilets - Girls - 19.04 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0034 - Sports Store - 9.46 m2</b>							
No Asbestos							
<b>B00A - R0035 - Toilets - Boys - 19.07 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0036 - Movement - 16.37 m2</b>							
No Asbestos							
<b>B00A - R0037 - Movement - 7.92 m2</b>							
No Asbestos							
<b>B00A - R0038 - Movement - 21.68 m2</b>							
No Asbestos							
<b>B00A - R0039 - Lift - 2.1 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R0040 - Stairs - 15.82 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0041 - Stairs - 12.95 m2</b>							
No Asbestos							
<b>B00A - R0042 - Staff Toilet - 10.5 m2</b>							
No Asbestos							

<b>B00A - R1004 - Movement - 8.26 m2</b>							
No Asbestos							
<b>B00A - R1005 - Movement - 1.8 m2</b>							
No Asbestos							
<b>B00A - R1006 - Community Clinic - 15.84 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R1007 - Community Clinic - 12.13 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R1008 - Staff Toilet - 3.75 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B00A - R1009 - Movement - 2.92 m2</b>							
No Asbestos							
<b>B00A - R1010 - Movement - 6.26 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R1011 - Personal Effects Storage - 3.7 m2</b>							
No Asbestos							
<b>B00A - R1012 - Home Base - 57.15 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R1013 - Home Base Store - 6.4 m2</b>							
No Asbestos							
<b>B00A - R1014 - Home Base - 57.23 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R1015 - Home Base Store - 5.51 m2</b>							
No Asbestos							
<b>B00A - R1016 - Personal Effects Storage - 8.59 m2</b>							
No Asbestos							
<b>B00A - R1017 - Movement - 2.62 m2</b>							
No Asbestos							
<b>B00A - R1031 - Practical Activities - 1hb - 19.68 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1032 - Home Base - 51.11 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R1033 - Home Base - 76.48 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R1034 - Practical Activities - 1hb - 15.08 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1035 - Toilets - Boys/Girls - 4.3 m2</b>							
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1036 - Movement - 87.29 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	60m2	South, East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1037 - Plant - 2.1 m2</b>							
No Asbestos							
<b>B00A - R1038 - Lift - 4.44 m2</b>							

Floor Coverings Res/Textile	No Asbestos Found							
<b>B00A - R1039 - Stairs - 20.86 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R1040 - Stairs - 12.95 m2</b>								
No Asbestos								
<b>B00A - R1041 - Special Programs Room - 22.54 m2</b>								
No Asbestos								
<b>B00A - R1042 - Home Base Store - 7.98 m2</b>								
No Asbestos								
<b>B00A - R1043 - Home Base - 60.03 m2</b>								
No Asbestos								
<b>B00A - R1044 - Practical Activities - 1hb - 15.27 m2</b>								
No Asbestos								
<b>B00A - R1045 - Withdrawal Space - 2hb - 14.69 m2</b>								
No Asbestos								
<b>B00A - R1046 - Practical Activities - 1hb - 15.06 m2</b>								
No Asbestos								
<b>B00A - R1047 - Home Base - 58.89 m2</b>								
Ceiling Structures/Linings - Access Hatch	Flat AC Sheeting	1m2	Middle portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R1048 - Home Base Store - 6.17 m2</b>								
No Asbestos								
<b>B00A - R1049 - Distribution Board - .11 m2</b>								
No Asbestos								
<b>B00A - R1050 - Special Programs Room - 23.49 m2</b>								
No Asbestos								
<b>B00A - R9001 - Security Store - 2.28 m2</b>								
No Asbestos								
<b>B00A - R9002 - Practical Activities - 1hb - 19.29 m2</b>								
No Asbestos								
<b>B00A - R9003 - Distribution Board - 1.14 m2</b>								
No Asbestos								
<b>B00A - R9004 - No Access - 27.28 m2</b>								
No Asbestos								
<b>B00A - R9005 - Home Base Store - 2.32 m2</b>								
No Asbestos								
<b>B00A - R9006 - Cleaning Distributed Store - 4.36 m2</b>								
No Asbestos								
<b>B00A - R9007 - Withdrawal Space - 1hb - 7.29 m2</b>								
No Asbestos								
<b>B00A - R9008 - Home Base - 60.04 m2</b>								
No Asbestos								
<b>B00A - R9009 - Outdoor Learning Area - 20.47 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting							
<b>B00A - R9010 - Home Base - 60.04 m2</b>								
No Asbestos								
<b>B00A - R9011 - Home Base Store - 3.43 m2</b>								
No Asbestos								

<b>B00A - R9012 - Withdrawal Space - 1hb - 12.58 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00A - R9013 - Home Base - 60.42 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00A - R9014 - Home Base Store - 3.43 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00A - R9015 - Outdoor Learning Area - 9.24 m2</b>		
Ceiling Structures/Linings	Flat AC Sheeting	
<b>B00A - R9016 - Movement - 9.36 m2</b>		
Ceiling Structures/Linings	Flat AC Sheeting	
<b>B00A - R9017 - Practical Activities - 1hb - 37.39 m2</b>		
No Asbestos		
<b>B00A - R9018 - Movement - 22.2 m2</b>		
Ceiling Structures/Linings	Flat AC Sheeting	
<b>B00A - R9019 - Toilets - Boys - 8.63 m2</b>		
Ceiling Structures/Linings	Flat AC Sheeting	
<b>B00A - R9020 - Cleaning Distributed Store - 2.34 m2</b>		
No Asbestos		
<b>B00A - R9021 - Movement - 25.85 m2</b>		
No Asbestos		
<b>B00A - R9022 - Distribution Board - 1.37 m2</b>		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00A - R9023 - Movement - 56.44 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00A - R9024 - Practical Activities - 1hb - 12.63 m2</b>		
No Asbestos		
<b>B00A - R9025 - Movement - 7.51 m2</b>		
No Asbestos		
<b>B00A - R9026 - Security Store - 2.44 m2</b>		
No Asbestos		
<b>B00A - R9027 - Home Base Store - 3.66 m2</b>		
No Asbestos		
<b>B00A - R9028 - Home Base - 58.46 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00A - R9029 - Outdoor Learning Area - 14.64 m2</b>		
No Asbestos		
<b>B00A - R9030 - Withdrawal Space - 1hb - 9.3 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00A - R9031 - Home Base - 59.2 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00A - R9032 - Home Base Store - 3.34 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00A - R9033 - Outdoor Learning Area - 15.17 m2</b>		
No Asbestos		
<b>B00A - R9034 - Withdrawal Space - 1hb - 9.36 m2</b>		

Floor Coverings Res/Textile	No Asbestos Found	
<b>B00A - R9035 - Security Store - 2.52 m2</b>		
No Asbestos		
<b>B00A - R9036 - Practical Activities - 1hb - 41.8 m2</b>		
No Asbestos		
<b>B00A - R9037 - Security Store - 2.33 m2</b>		
No Asbestos		
<b>B00A - R9038 - Home Base Store - 3.36 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00A - R9039 - Home Base - 58.31 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00A - R9040 - Outdoor Learning Area - 14.56 m2</b>		
No Asbestos		
<b>B00A - R9041 - Plant - 8.01 m2</b>		
No Asbestos		
<b>B00A - R9042 - Movement - 12.27 m2</b>		
No Asbestos		
<b>B00A - R9043 - Movement - 45.25 m2</b>		
No Asbestos		
<b>B00A - R9044 - Movement - 11.62 m2</b>		
No Asbestos		
<b>B00A - R9045 - Movement - 20.64 m2</b>		
No Asbestos		
<b>B00A - R9046 - Movement - 4.28 m2</b>		
Ceiling Structures/Linings	Flat AC Sheeting	
<b>B00A - R9047 - Movement - 4.32 m2</b>		
Ceiling Structures/Linings	Flat AC Sheeting	
<b>B00A - R9048 - General Assistant/Bulk Store - 3.74 m2</b>		
No Asbestos		
<b>B00A - R9049 - Stairs - .58 m2</b>		
No Asbestos		
<b>B00F - Administration/Staff Facilities - 2010 - Brick/Veneer</b>		
<b>Exterior</b>		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00F - R0001 - External Movement - 25.22 m2</b>		
No Asbestos		
<b>B00F - R0002 - External Movement - 21.56 m2</b>		
No Asbestos		
<b>B00F - R0003 - Lift - 2.24 m2</b>		
No Asbestos		
<b>B00F - R0004 - Entry Vestibule - 33.44 m2</b>		
No Asbestos		
<b>B00F - R0005 - Interview - 13.12 m2</b>		
No Asbestos		
<b>B00F - R0006 - Principal - 17.24 m2</b>		
No Asbestos		



<b>B00F - R0007 - Security Store - 15.12 m2</b>	
No Asbestos	
<b>B00F - R0008 - Staff Toilet - 5.31 m2</b>	
No Asbestos	
<b>B00F - R0009 - Staff Toilet - 5.12 m2</b>	
No Asbestos	
<b>B00F - R0010 - Stairs - 15.55 m2</b>	
No Asbestos	
<b>B00F - R0011 - Movement - 44.04 m2</b>	
No Asbestos	
<b>B00F - R0012 - Access Shower/Toilet - 5.6 m2</b>	
No Asbestos	
<b>B00F - R0013 - Sick Bay - 8.98 m2</b>	
No Asbestos	
<b>B00F - R0014 - Distribution Board - .18 m2</b>	
No Asbestos	<b>Note: No inspection of live electrical installation</b>
<b>B00F - R0015 - Duplicating Workroom - 24.5 m2</b>	
No Asbestos	
<b>B00F - R0016 - Clerical Office - 33.7 m2</b>	
No Asbestos	
<b>B00F - R0017 - Movement - 6.15 m2</b>	
No Asbestos	
<b>B00F - R1001 - External Movement - 24.97 m2</b>	
No Asbestos	
<b>B00F - R1002 - External Movement - 21.56 m2</b>	
No Asbestos	
<b>B00F - R1003 - Movement - 5.59 m2</b>	
No Asbestos	
<b>B00F - R1004 - Staff Kitchen - 10.17 m2</b>	
No Asbestos	
<b>B00F - R1005 - Staff Room - 56.63 m2</b>	
No Asbestos	
<b>B00F - R1006 - Staff Room Annexe - 27.61 m2</b>	
No Asbestos	
<b>B00F - R1007 - Cleaning Distributed Store - 7.02 m2</b>	
No Asbestos	
<b>B00F - R1008 - Stairs - 16.21 m2</b>	
No Asbestos	
<b>B00F - R1009 - Movement - 42.02 m2</b>	
No Asbestos	
<b>B00F - R1010 - Distribution Board - .8 m2</b>	
No Asbestos	<b>Note: No inspection of live electrical installation</b>
<b>B00F - R1011 - Staff Toilet - 5.89 m2</b>	
No Asbestos	
<b>B00F - R1012 - Staff Toilet - 5.85 m2</b>	
No Asbestos	
<b>B00F - R1013 - Deputy Principal - Type 1 - 13.13 m2</b>	
No Asbestos	
<b>B00F - R1014 - Deputy Principal - Type 1 - 12.94 m2</b>	
No Asbestos	
<b>B00F - R1015 - Interview/Office - Type 3 - 19.41 m2</b>	

No Asbestos		
<b>B00F - R1016 - Movement - 6.86 m2</b>		
No Asbestos		
<b>B00G - General Learning - 2011 - Brick/Veneer</b>		
<b>Exterior</b>		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00G - R0001 - Practical Activities - 1hb - 17.43 m2</b>		
No Asbestos		
<b>B00G - R0002 - Home Base Store - 6.19 m2</b>		
No Asbestos		
<b>B00G - R0003 - Home Base - 59.77 m2</b>		
No Asbestos		
<b>B00G - R0004 - Withdrawal Space - 2hb - 11.15 m2</b>		
No Asbestos		
<b>B00G - R0005 - Home Base - 60.12 m2</b>		
No Asbestos		
<b>B00G - R0006 - Home Base Store - 6.19 m2</b>		
No Asbestos		
<b>B00G - R0007 - Practical Activities - 1hb - 18.28 m2</b>		
No Asbestos		
<b>B00G - R0008 - Distribution Board - .62 m2</b>		
		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00G - R0009 - External Movement - 69.63 m2</b>		
No Asbestos		
<b>B00G - R0010 - External Stairs - 18.96 m2</b>		
No Asbestos		
<b>B00G - R0011 - External Stairs - 18.96 m2</b>		
No Asbestos		
<b>B00G - R1001 - Practical Activities - 1hb - 17.43 m2</b>		
No Asbestos		
<b>B00G - R1002 - Home Base Store - 6.19 m2</b>		
No Asbestos		
<b>B00G - R1003 - Home Base - 59.77 m2</b>		
No Asbestos		
<b>B00G - R1004 - Withdrawal Space - 2hb - 11.15 m2</b>		
No Asbestos		
<b>B00G - R1005 - Home Base - 60.12 m2</b>		
No Asbestos		
<b>B00G - R1006 - Home Base Store - 6.19 m2</b>		
No Asbestos		
<b>B00G - R1007 - Practical Activities - 1hb - 18.28 m2</b>		
No Asbestos		
<b>B00G - R1008 - Distribution Board - .62 m2</b>		
		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00G - R1009 - External Movement - 69.63 m2</b>		
No Asbestos		
<b>B00G - R1010 - External Stairs - 25.81 m2</b>		
No Asbestos		

<b>B00G - R1011 - External Stairs - 25.81 m2</b>							
No Asbestos							
<b>B00X - Communal Facilities/Pupil Facilities - 1989 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00X - R0001 - Communal Space - 206.28 m2</b>							
No Asbestos							
<b>B00X - R0002 - Hall Chair Store - 14.01 m2</b>							
No Asbestos							
<b>B00X - R0003 - Staff Kitchen - 9.61 m2</b>							
No Asbestos							
<b>B00X - R0004 - Movement - 7.26 m2</b>							
No Asbestos							
<b>B00X - R0005 - General Storeroom - 17.68 m2</b>							
No Asbestos							
<b>B00X - R0006 - Raised Platform - 48.86 m2</b>							
No Asbestos							
<b>B00X - R0007 - Movement - 8.18 m2</b>							
No Asbestos							
<b>B00X - R0008 - Movement - 1.39 m2</b>							
No Asbestos							
<b>B00X - R0009 - Shower/Change - 3.57 m2</b>							
No Asbestos							
<b>B00X - R0010 - Garden Store - 14.55 m2</b>							
No Asbestos							
<b>B00X - R0011 - Toilets - Boys - 26.01 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00X - R0012 - Toilets - Girls - 28.04 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00X - R0013 - Cleaning Distributed Store - 2.67 m2</b>							
No Asbestos							
<b>B00X - R0014 - Disabled Toilet - 6.44 m2</b>							
No Asbestos							
<b>B00X - R0015 - Movement - 24.55 m2</b>							
No Asbestos							
<b>B00X - R0016 - External Movement - 77.19 m2</b>							
No Asbestos							
<b>B00X - R0017 - Distribution Board - 5.22 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Electrical - Backing Board	Resinous Board						
<b>B00X - R0018 - Plant - .44 m2</b>							
No Asbestos							
<b>B00X - R0019 - External Movement - 97.66 m2</b>							
No Asbestos							
<b>B00Y - Communal Facilities/Pupil Facilities - 1987 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	50m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Gable Verge Lining	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00Y - R0001 - Movement - 59 m2</b>							
No Asbestos							
<b>B00Y - R0002 - Toilets - Boys - 7.99 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00Y - R0003 - Toilets - Girls - 8.21 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00Y - R0004 - General Storeroom - 9.53 m2</b>							
Ceiling Structures/Linings - Access Hatch	Flat AC Sheeting	1m2	Middle portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00Y - R0005 - Communal Space - 85.41 m2</b>							
No Asbestos							
<b>B00Y - R0006 - Canteen - 30.65 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00Y - R0007 - Canteen Office/Store - 3.33 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00Y - R0008 - Movement - 3.26 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00Y - R0009 - Staff Toilet - 1.68 m2</b>							
No Asbestos							
<b>B00Y - R0010 - Main Switch Board - .98 m2</b>							
Door - Infill	Flat AC Sheeting						
Wall Linings Internal - Electrical Box/ Cabinet	Flat AC Sheeting	1m2	South	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)

## Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020