


# Asbestos Register

(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Heaton Public School (4129)</b>
<b>Region:</b>	<b>Hunter/Central Coast AMU</b>
<b>State Electorate:</b>	<b>Wallsend</b>
<b>Local Government Area:</b>	<b>Newcastle</b>

<b>Last Reviewed By:</b>	AECOM 29-APR-2016
<b>Last Revised By:</b>	

<b>Historical Fibro In Grounds Investigations/Events</b>	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

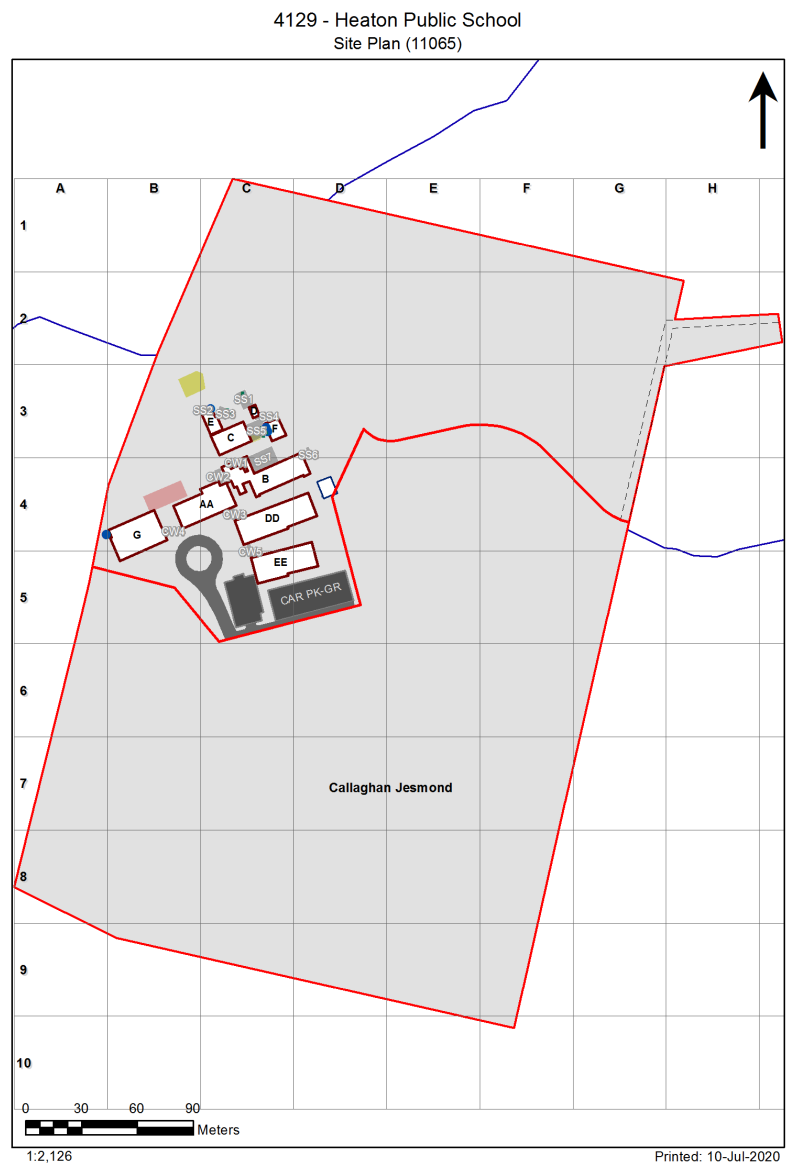

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00B - Library/Pupil Facilities - 1967 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Crocidolite (blue asbestos)
<b>Interior</b>							
<b>B00B - R0001 - Toilets - Boys/Girls - 3.78 m2</b>							
Wall Linings Internal	Flat AC Sheeting	6m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Compressed AC Sheet	1m2	All surfaces, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0013 - General Assistant/Bulk Store - 14.46 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B00B - R0015 - Sports Store - 18.45 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B00B - R0016 - Canteen - 15.67 m2</b>							
No Asbestos							
<b>B00B - R0017 - Staff Toilet - 2.88 m2</b>							
Wall Linings Internal - Infill	Compressed AC Sheet	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0018 - Canteen Office/Store - 9.53 m2</b>							
No Asbestos							
<b>B00B - R0019 - Movement - 1.65 m2</b>							
No Asbestos							
<b>B00B - R0020 - Movement - 5.94 m2</b>							
No Asbestos							
<b>B00B - R0021 - Movement - 4.5 m2</b>							
No Asbestos							
<b>B00B - R0022 - Movement - 7.05 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B00B - R0023 - Movement - 7.96 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B00B - R0024 - Canteen Covered Area - 19.84 m2</b>							
Wall Linings Internal - Infill	Compressed AC Sheet	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0025 - Communications Room - 16.9 m2</b>							
No Asbestos							
<b>B00B - R0026 - Library Office/Workroom - 23.11 m2</b>							
No Asbestos							
<b>B00B - R0027 - Reading Area - 84.22 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting						
<b>B00B - R0028 - Special Programs Room - 41.09 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting						
<b>B00B - R0029 - Home Base - 69.49 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting						

B00B - R0030 - Distribution Board - .87 m2							Note: No inspection of live electrical installation
No Asbestos							
B00B - R0032 - Movement - 127.99 m2							
Wall Linings Internal - Infill	Compressed AC Sheet	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - Pupil Facilities/Library - 1967 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	22m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Crocidolite (blue asbestos)
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Wall Linings Internal - Infill	Flat AC Sheeting	50	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00C - R0001 - Other-Non Government Pre-Sch - 57.6 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0002 - Other-Non Government Pre-Sch - 4.21 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0003 - Other-Non Government Pre-Sch - 6.53 m2							
No Asbestos							
B00C - R0004 - Other-Non Government Pre-Sch - 6.14 m2							
Wall Linings Internal	Flat AC Sheeting						
B00C - R0005 - Other-Non Government Pre-Sch - 6.14 m2							
Wall Linings Internal	Flat AC Sheeting						
B00C - R0006 - Other-Non Government Pre-Sch - 4.18 m2							
No Asbestos							
B00C - R0007 - Other-Non Government Pre-Sch - 57.52 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0008 - Other-Non Government Pre-Sch - 60.23 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - Other-Non-Govt Pre-School - 1967 - Metal Shed							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00D - R0001 - Other-Non Government Pre-Sch - 19.93 m2							
No Asbestos							
B00E - Other-Non-Govt Pre-School - 1967 - Timber							
Exterior							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Interior							
B00E - R0001 - Other-Non Government Pre-Sch - 22.57 m2							
No Asbestos							

<b>B00E - R0002 - Other-Non Government Pre-Sch - 8.13 m2</b>		
No Asbestos		
<b>B00E - R0003 - Other-Non Government Pre-Sch - 5.69 m2</b>		
No Asbestos		
<b>B00E - R0004 - Other-Non Government Pre-Sch - 16.73 m2</b>		
No Asbestos		
<b>B00E - R0005 - Other-Non Government Pre-Sch - 4.04 m2</b>		
No Asbestos		
<b>B00E - R0006 - Other-Non Government Pre-Sch - 15.41 m2</b>		
No Asbestos		
<b>B00E - R0007 - Other-Non Government Pre-Sch - 2.28 m2</b>		
No Asbestos		
<b>B00F - Building Services - 2004 - Steel</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00F - R0001 - General Assistant/Bulk Store - 78.7 m2</b>		
No Asbestos		
<b>B00G - Communal Facilities/General Learning - 2010 - Brick/Veneer</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	Non Accessible Area	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00G - R0001 - Covered Outdoor Learning Area - 148.92 m2</b>		
No Asbestos		
<b>B00G - R0002 - Communal Space - 142.49 m2</b>		
No Asbestos		
<b>B00G - R0003 - Movement - 5.94 m2</b>		
No Asbestos		
<b>B00G - R0004 - Raised Platform - 60.47 m2</b>		
No Asbestos		
<b>B00G - R0005 - Movement - 11.15 m2</b>		
No Asbestos		
<b>B00G - R0006 - Movement - 13.51 m2</b>		
No Asbestos		
<b>B00G - R0007 - Hall Chair Store - 9.3 m2</b>		
No Asbestos		
<b>B00G - R0008 - Communal/Performance Store - 9.38 m2</b>		
No Asbestos		
<b>B00G - R0009 - P.E Store - 13.42 m2</b>		
No Asbestos		
<b>B00G - R0010 - Toilet - Lobby - 2.37 m2</b>		
No Asbestos		
<b>B00G - R0011 - Toilets - Girls - 7.31 m2</b>		
No Asbestos		
<b>B00G - R0012 - Sound Cupboard - 2.06 m2</b>		
No Asbestos		

<b>B00G - R0013 - Toilet - Lobby - 3.3 m2</b>		
No Asbestos		
<b>B00G - R0014 - Toilets - Boys - 5.71 m2</b>		
No Asbestos		
<b>B00G - R0015 - Cleaning Distributed Store - 3.51 m2</b>		
No Asbestos		
<b>B00G - R0016 - General Storeroom - 1.6 m2</b>		
No Asbestos		
<b>B00G - R0017 - Main Switch Board - 6.87 m2</b>		
No Asbestos		
<b>B00G - R0018 - Access Shower/Toilet - 3.31 m2</b>		
No Asbestos		
<b>B0AA - Administration - 2002 - Brick/Veneer</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	Non Accessible Area	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B0AA - R0001 - Toilets - Girls - 21.09 m2</b>		
No Asbestos		
<b>B0AA - R0002 - Access Shower/Toilet - 4.56 m2</b>		
No Asbestos		
<b>B0AA - R0003 - Toilets - Boys - 18.11 m2</b>		
No Asbestos		
<b>B0AA - R0004 - Staff Room Annexe - 13.22 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0AA - R0005 - Staff Room - 32.77 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0AA - R0006 - Cleaning Distributed Store - 3.05 m2</b>		
No Asbestos		
<b>B0AA - R0007 - Distribution Board - 2.88 m2</b>		
		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B0AA - R0008 - Staff Toilet - 4.84 m2</b>		
No Asbestos		
<b>B0AA - R0009 - Staff Toilet - 4.84 m2</b>		
No Asbestos		
<b>B0AA - R0010 - Deputy Principal - 12.88 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0AA - R0011 - Security Store - 17.83 m2</b>		
No Asbestos		
<b>B0AA - R0012 - Duplicating Workroom - 20.94 m2</b>		
No Asbestos		
<b>B0AA - R0013 - Clerical Office - 17.69 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0AA - R0014 - Sick Bay - 8.23 m2</b>		
No Asbestos		
<b>B0AA - R0015 - Disabled Toilet - 5.77 m2</b>		
No Asbestos		

<b>B0AA - R0016 - Principal - 12.56 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0AA - R0017 - Interview - 12.45 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0AA - R0018 - Movement - 47.73 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0AA - R0019 - Movement - 91.04 m2</b>		
No Asbestos		
<b>B0AA - R0021 - Covered Outdoor Learning Area - 14.81 m2</b>		
No Asbestos		
<b>B0AA - R0022 - External Movement - 26.76 m2</b>		
No Asbestos		
<b>B0DD - General Learning - 2002 - Brick/Veneer</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	Non Accessible Area	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B0DD - R0001 - Practical Activities - 1hb - 20.29 m2</b>		
No Asbestos		
<b>B0DD - R0002 - Home Base Store - 5.77 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0DD - R0003 - Home Base - 59.49 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0DD - R0004 - Withdrawal Space - 2hb - 11.47 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0DD - R0005 - Home Base - 58.45 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0DD - R0006 - Practical Activities - 1hb - 20.11 m2</b>		
No Asbestos		
<b>B0DD - R0007 - Home Base Store - 5.78 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0DD - R0008 - Home Base Store - 5.78 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0DD - R0009 - Practical Activities - 1hb - 20.18 m2</b>		
No Asbestos		
<b>B0DD - R0010 - Home Base - 59.27 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0DD - R0011 - Withdrawal Space - 2hb - 11.47 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0DD - R0012 - Home Base - 59.69 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0DD - R0013 - Practical Activities - 1hb - 20.38 m2</b>		

No Asbestos		
<b>B0DD - R0014 - Home Base Store - 5.77 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0DD - R0015 - Distribution Board - .64 m2</b>		
<b>Note: No inspection of live electrical installation</b>		
No Asbestos		
<b>B0DD - R0016 - Movement - 169.5 m2</b>		
No Asbestos		
<b>B0EE - General Learning - 2002 - Brick/Veneer</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	Non Accessible Area	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B0EE - R0001 - Practical Activities - 1hb - 20.29 m2</b>		
No Asbestos		
<b>B0EE - R0002 - Home Base Store - 6.11 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0EE - R0003 - Home Base - 59.38 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0EE - R0004 - Withdrawal Space - 2hb - 11.44 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0EE - R0005 - Home Base - 58.21 m2</b>		
No Asbestos		
<b>B0EE - R0006 - Practical Activities - 1hb - 20.19 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0EE - R0007 - Home Base Store - 6.15 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0EE - R0008 - Home Base Store - 6.11 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0EE - R0009 - Home Base Store - 20.42 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0EE - R0010 - Home Base - 59.31 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0EE - R0011 - Withdrawal Space - 1hb - 5.6 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0EE - R0012 - Distribution Board - .66 m2</b>		
<b>Note: No inspection of live electrical installation</b>		
No Asbestos		
<b>B0EE - R0013 - Movement - 96.17 m2</b>		
No Asbestos		
<b>B0EE - R0014 - Movement - 49.06 m2</b>		
No Asbestos		



**Demountables**

**OS 602 13289 - Learning Unit - Standard With P.A.A. - Placement Date : 18-OCT-2016**

**Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.**

No Asbestos Found