

# Asbestos Register


(Hazardous Materials and Risk Assessment)

School:	Hayes Park Public School (4399)
Region:	Southern NSW AMU
State Electorate:	Shellharbour
Local Government Area:	Wollongong

Last Reviewed By:	AECOM 18-JUN-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

4399 - Hayes Park Public School  
Site Plan (11007)

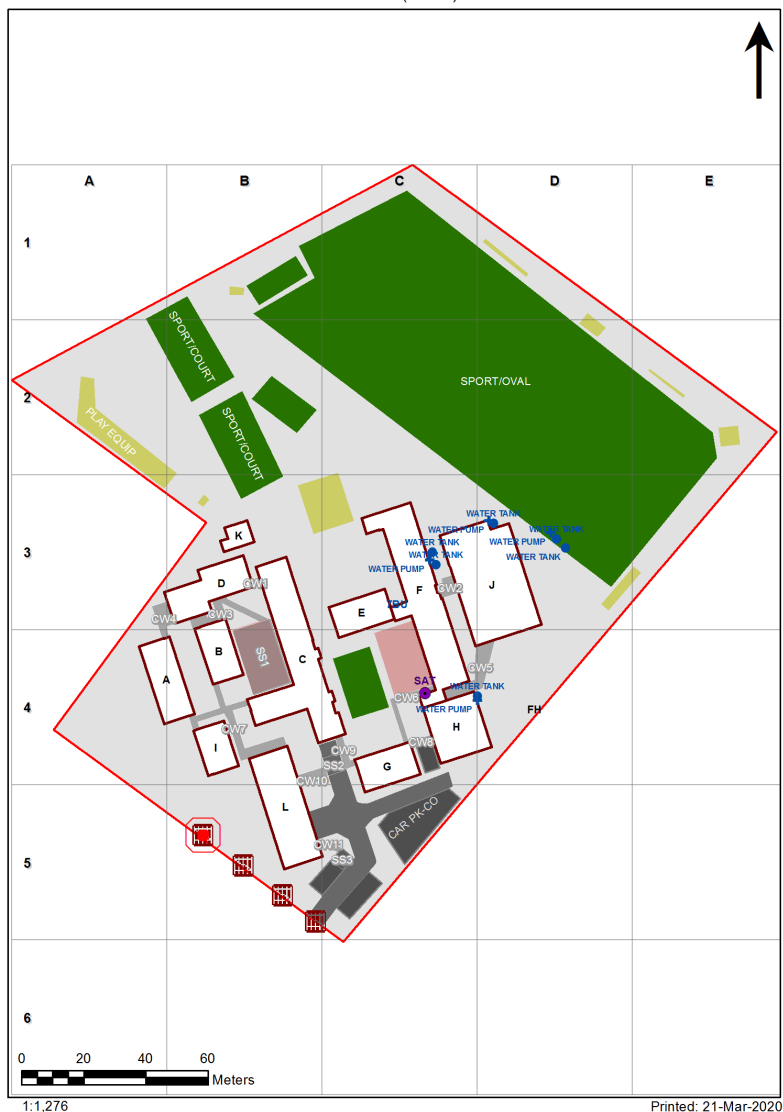

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

### Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

### Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

### Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

#### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - General Learning - 1969 - Brick/Veneer</b>							
<b>Exterior</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	13	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	40m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Gable Verge Lining	Flat AC Sheeting	6m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>Interior</b>							
<b>B00A - R0001 - Personal Effects Storage - 7.15 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	At sink	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0002 - Home Base Store - 2.86 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0003 - Toilets - Boys/Girls - 3.92 m2</b>							
No Asbestos							
<b>B00A - R0004 - Home Base - 85.67 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R0005 - Home Base - 85.68 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00A - R0006 - Toilets - Boys/Girls - 3.9 m2</b>							
No Asbestos							
<b>B00A - R0007 - Home Base Store - 2.79 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0008 - Personal Effects Storage - 7.09 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	At sink	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0009 - External Movement - 47.62 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	13m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - General Learning - 1969 - Brick/Veneer</b>							
<b>Exterior</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	8	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Eaves Linings	Flat AC Sheeting	40m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	6m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00B - R0001 - Home Base - 57.03 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00B - R0002 - Home Base Store - 4.09 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0003 - Movement - 18.75 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00B - R0004 - Distribution Board - .18 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
No Asbestos							
<b>B00B - R0005 - Home Base Store - 4.12 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0006 - Home Base - 56.81 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00B - R0007 - External Movement - 34.67 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - Pupil Facilities/General Learning - 1969 - Brick/Block</b>							
<b>Exterior</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	18	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	150m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	18m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00C - R0001 - Canteen - 26.72 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0002 - Canteen Office/Store - 3.68 m2</b>							

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0003 - Staff Toilet - 3.24 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0004 - Main Switch Board - 7.17 m2</b>							
No Asbestos							
<b>B00C - R0007 - Home Base - 57.04 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00C - R0008 - Home Base Store - 4.1 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0009 - Movement - 18.74 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00C - R0010 - Distribution Board - .19 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
No Asbestos							
<b>B00C - R0011 - Home Base Store - 4.11 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0012 - Home Base - 56.73 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00C - R0013 - Home Base - 56.72 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00C - R0014 - Home Base Store - 4.25 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0015 - Movement - 9.56 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - ( X3 )						
<b>B00C - R0016 - Plant - 1.32 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0017 - Cleaning Distributed Store - 4.45 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0018 - External Movement - 26.85 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0019 - External Movement - 3.38 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

<b>B00C - R0020 - External Movement - 3.36 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0021 - Hall Chair Store - 7.88 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0022 - Garden Store - 9.75 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0023 - External Movement - 3.44 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0024 - Toilets - Boys - 32.5 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0025 - General Storeroom - 4.03 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0026 - Toilets - Girls - 32.62 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0028 - External Movement - 3.48 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0030 - External Movement - 106.05 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	13m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	107m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0031 - Disabled Shower/Toilet - 7.49 m2</b>							
No Asbestos							
<b>B00C - R0032 - Home Base - 77.89 m2</b>							
No Asbestos							
<b>B00C - R0033 - Home Base/Practical Activities - 103.83 m2</b>							
No Asbestos							
<b>B00D - General Learning - 1969 - Brick/Veneer</b>							
<b>Exterior</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	6	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	40m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						

Underfloor Voids - Slab on Ground	No Asbestos Found							
Gable Verge Lining	Flat AC Sheeting	6m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>Interior</b>								
<b>B00D - R0001 - Practical Activities - 1hb - 11.13 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles							
Ceiling Structures/Linings	Non Accessible Area	m2						
<b>B00D - R0002 - Toilets - Boys/Girls - 3.28 m2</b>								
No Asbestos								
<b>B00D - R0004 - General Storeroom - 18.92 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00D - R0005 - Craft Store - 12.82 m2</b>								
No Asbestos								
<b>B00D - R0006 - Home Base - 58.43 m2</b>								
No Asbestos								
<b>B00D - R0007 - Practical Activities - 1hb - 11.56 m2</b>								
Ceiling Structures/Linings	Non Accessible Area	m2						
<b>B00D - R0008 - External Movement - 68.58 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Wall Linings Internal - Infill	Flat AC Sheeting	8m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00D - R0009 - Home Base - 72.47 m2</b>								
No Asbestos								
<b>B00D - R0010 - Withdrawal Space - 1hb - 7.05 m2</b>								
No Asbestos								
<b>B00E - Support Unit - 1969 - Brick/Veneer</b>								
<b>Exterior</b>								
Wall Linings Internal - Infill	Flat AC Sheeting	9	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	30m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found							
Underfloor Voids - Slab on Ground	No Asbestos Found							
Gable Verge Lining	Flat AC Sheeting	10m2	Upper portion	Good Condition (1)	Medium (2)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>Interior</b>								
<b>B00E - R0001 - Home Base - M - 56.88 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
<b>B00E - R0002 - Home Base Store - M - 6.04 m2</b>								

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0003 - Practical Activities - M - 1hb - 14.53 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00E - R0004 - Distribution Board - .45 m2</b> <span style="float: right;"><b>Note: No inspection of live electrical installation</b></span>							
No Asbestos							
<b>B00E - R0005 - Home Base Store - M - 5.99 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0006 - Home Base - M - 56.88 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00E - R0007 - External Movement - 34.48 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	9m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - General Learning/Pupil Facilities - 1969 - Brick/Block</b>							
<b>Exterior</b>							
Gable Verge Lining	Flat AC Sheeting	12m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	23	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	100m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00F - R0001 - Special Programs Room - 58.92 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00F - R0002 - Home Base Store - 6.81 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0003 - Movement - 13.14 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0004 - Distribution Board - .73 m2</b> <span style="float: right;"><b>Note: No inspection of live electrical installation</b></span>							
Electrical - Mounting Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00F - R0005 - Home Base Store - 7.64 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						



Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0006 - Home Base - 59.02 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00F - R0007 - Toilets - Boys - 29.31 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00F - R0008 - Cleaning Distributed Store - 1.77 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00F - R0009 - Toilets - Girls - 27.82 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00F - R0010 - Toilets - Boys/Girls - 3.85 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00F - R0011 - External Movement - 18.64 m2</b>							
No Asbestos							
<b>B00F - R0013 - Sports Store - 4.72 m2</b>							
No Asbestos							
<b>B00F - R0014 - Toilets - Girls - 17.06 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00F - R0015 - Staff Toilet - 1.75 m2</b>							
No Asbestos							
<b>B00F - R0016 - Distribution Board - 1.4 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Wall Linings Internal	Flat AC Sheeting	1m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0017 - Cleaning Supplies - 15.94 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00F - R0018 - Movement - 4.68 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00F - R0019 - Sports Store - 14.3 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00F - R0020 - Practical Activities - 1hb - 12.46 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						

Floor Coverings Res/Textile	Vinyl Tiles							
<b>B00F - R0021 - Home Base - 55.83 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
<b>B00F - R0022 - Home Base - 54.99 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
<b>B00F - R0023 - Practical Activities - 1hb - 15.22 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles							
<b>B00F - R0024 - External Movement - 134.55 m2</b>								
Wall Linings Internal - Infill	Flat AC Sheeting	13m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00F - R0025 - Garden Store - 6.01 m2</b>								
No Asbestos								
<b>B00F - R0026 - General Storeroom - 5.87 m2</b>								
No Asbestos								
<b>B00F - R0027 - General Storeroom - 6.89 m2</b>								
No Asbestos								
<b>B00F - R0028 - Movement - 4.17 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00F - R0029 - Movement - 4.03 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00F - R0030 - Movement - 10.39 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00F - R0031 - External Movement - 11.58 m2</b>								
No Asbestos								
<b>B00F - R0032 - Stairs - .61 m2</b>								
No Asbestos								
<b>B00F - R0033 - Stairs - .55 m2</b>								
No Asbestos								
<b>B00F - R0034 - Stairs - 12.12 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00F - R0035 - Sports Store - 6.51 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00F - R0036 - Disabled Shower/Toilet - 14.72 m2</b>								
No Asbestos								
<b>B00F - R1001 - Home Base - 59 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
<b>B00F - R1002 - Home Base Store - 6.8 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R1003 - Movement - 13.14 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R1004 - Distribution Board - .83 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Ceiling Structures/Linings	Flat AC Sheeting	0.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00F - R1005 - Home Base Store - 7.67 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R1006 - Home Base - 59.49 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00F - R1007 - Home Base - 59.35 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00F - R1008 - Home Base Store - 6.76 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00F - R1009 - Movement - 6.83 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R1010 - General Storeroom - 12.72 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00F - R1011 - General Storeroom - 14.55 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00F - R1012 - Movement - 4.57 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00F - R1013 - Home Base - 55.46 m2</b>							
No Asbestos							
<b>B00F - R1014 - Practical Activities - 1hb - 13.58 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00F - R1015 - Practical Activities - 1hb - 18.1 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00F - R1016 - Home Base - 50.46 m2</b>							
No Asbestos							
<b>B00F - R1017 - Home Base - 52.58 m2</b>							
No Asbestos							
<b>B00F - R1018 - Practical Activities - 1hb - 18.18 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles							
<b>B00F - R1019 - Movement - 128.32 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	122m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Wall Linings Internal - Infill	Flat AC Sheeting	15m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00F - R1020 - Stairs - 6.46 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00F - R1021 - General Storeroom - 7.92 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00F - R1022 - Stairs - 20.95 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00F - R1023 - Stairs - 24.64 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00G - Administration - 1969 - Brick/Block</b>								
<b>Exterior</b>								
Wall Linings Internal - Infill	Flat AC Sheeting	8	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	30m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	12m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found							
Underfloor Voids - Slab on Ground	No Asbestos Found							
<b>Interior</b>								
<b>B00G - R0001 - General Storeroom - 1.64 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00G - R0002 - Staff Toilet - 1.71 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00G - R0003 - Interview - 13.7 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00G - R0004 - General Storeroom - 2.67 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	

<b>B00G - R0007 - Entry Vestibule - 11.92 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0008 - Main Switch Board - .75 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Mounting Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00G - R0009 - Deputy Principal - 12.49 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00G - R0010 - Special Programs Room - 28.04 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00G - R0011 - Sick Bay - 4.07 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00G - R0012 - Staff Toilet - 4.06 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00G - R0013 - Staff Toilet - 5.52 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00G - R0014 - General Storeroom - 7.53 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00G - R0015 - General Assistant/Bulk Store - 12.06 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0016 - Cleaning Distributed Store - .29 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0017 - External Movement - 33.94 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	8m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0018 - Movement - 14.72 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00G - R0019 - Special Programs Room - 25.57 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00H - Library - 1969 - Brick/Block</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids - Raked Ceiling	Non Accessible Area						
<b>Interior</b>							

<b>B00H - R0001 - Seminar/Study - 8.62 m2</b>							
No Asbestos							
<b>B00H - R0002 - K.L.A. Store - 8.41 m2</b>							
No Asbestos							
<b>B00H - R0003 - Reading Area - 179.42 m2</b>							
No Asbestos							
<b>B00H - R0004 - Library Office/Workroom - 6.7 m2</b>							
No Asbestos							
<b>B00H - R0005 - Security Store - 12.15 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00H - R0006 - Library Office/Workroom - 16.46 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00H - R0007 - Cleaning Distributed Store - 1.83 m2</b>							
No Asbestos							
<b>B00H - R0008 - Toilets - Boys - 3.09 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0009 - Movement - 9.8 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00H - R0010 - Distribution Board - 1.85 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Electrical - Mounting Board	Resinous Board	2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00H - R0011 - Toilets - Girls - 3.04 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0012 - External Movement - 34.32 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00I - Staff Facilities - 1969 - Brick/Veneer</b>							
<b>Exterior</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	5	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	30m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Gable Verge Lining	Flat AC Sheeting	40m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00I - R0001 - General Storeroom - 9.67 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
Floor Coverings Res/Textile	Vinyl Tiles	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00I - R0002 - Seminar/Study - 20 m2</b>							

Ceiling Structures/Linings	Non Accessible Area	m2					
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00I - R0003 - Movement - 16.17 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00I - R0004 - Staff Toilet - 3.87 m2</b>							
No Asbestos							
<b>B00I - R0005 - Cleaning Distributed Store - .24 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00I - R0006 - Distribution Board - .71 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00I - R0007 - Staff Toilet - 4.31 m2</b>							
No Asbestos							
<b>B00I - R0008 - General Storeroom - 4.06 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00I - R0009 - Home Base - 45.6 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00I - R0010 - External Movement - 33.68 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - Communal Facilities - 2004 - Brick/Veneer</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00J - R0001 - Communal Space - 425.02 m2</b>							
No Asbestos							
<b>B00J - R0002 - External Movement - 22.27 m2</b>							
No Asbestos							
<b>B00J - R0003 - Distribution Board - .24 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
No Asbestos							
<b>B00J - R0004 - Communications Cupboard - .84 m2</b>							
No Asbestos							

<b>B00J - R0005 - Hall Chair Store - 63.77 m2</b>		
No Asbestos		
<b>B00J - R0006 - External Movement - 10.52 m2</b>		
No Asbestos		
<b>B00J - R0007 - Movement - 84.76 m2</b>		
No Asbestos		
<b>B00J - R0009 - Canteen Covered Area - 28.01 m2</b>		
No Asbestos		
<b>B00J - R0010 - Toilets - Boys - 22.47 m2</b>		
No Asbestos		
<b>B00J - R0011 - Cleaning Supplies - .91 m2</b>		
No Asbestos		
<b>B00J - R0012 - Disabled Toilet - 4.1 m2</b>		
No Asbestos		
<b>B00J - R0013 - Toilets - Girls - 22.86 m2</b>		
No Asbestos		
<b>B00J - R0015 - Staff Room - 29.74 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00J - R0016 - Staff Kitchen - 9.84 m2</b>		
No Asbestos		
<b>B00J - R0017 - Raised Platform - 53.99 m2</b>		
No Asbestos		
<b>B00J - R0018 - Lift - 1.72 m2</b>		
No Asbestos		
<b>B00K - General Learning - 2004 - Timber</b>		
<b>Exterior</b>		
Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00K - R0001 - Seminar/Study - 38.07 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00K - R0002 - Home Base Store - M - 8.52 m2</b>		
No Asbestos		
<b>B00K - R0003 - External Movement - 13.6 m2</b>		
No Asbestos		
<b>B00L - Administration - 2010 - Brick/Veneer</b>		
<b>Exterior</b>		
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
<b>Interior</b>		
<b>B00L - R0001 - Entry Vestibule - 24.46 m2</b>		
No Asbestos		
<b>B00L - R0002 - Clerical Office - 34.29 m2</b>		
No Asbestos		
<b>B00L - R0003 - Duplicating Workroom - 24.49 m2</b>		
No Asbestos		
<b>B00L - R0004 - Sick Bay - 9.03 m2</b>		
No Asbestos		



<b>B00L - R0005 - Access Shower/Toilet - 5.25 m2</b>	
No Asbestos	
<b>B00L - R0006 - Cleaning Distributed Store - 4.3 m2</b>	
No Asbestos	
<b>B00L - R0007 - Staff Toilet - 5.3 m2</b>	
No Asbestos	
<b>B00L - R0008 - Staff Toilet - 5.3 m2</b>	
No Asbestos	
<b>B00L - R0009 - Staff Toilet - 5.3 m2</b>	
No Asbestos	
<b>B00L - R0010 - Movement - 68.16 m2</b>	
No Asbestos	
<b>B00L - R0011 - Deputy Principal - 17.29 m2</b>	
No Asbestos	
<b>B00L - R0012 - Security Store - 14.14 m2</b>	
No Asbestos	
<b>B00L - R0013 - Staff Room Annexe - 27.88 m2</b>	
No Asbestos	
<b>B00L - R0014 - Staff Room - 57.41 m2</b>	
No Asbestos	
<b>B00L - R0015 - Deputy Principal - 13.61 m2</b>	
No Asbestos	
<b>B00L - R0016 - Deputy Principal - 13 m2</b>	
No Asbestos	
<b>B00L - R0017 - Principal - 17.33 m2</b>	
No Asbestos	
<b>B00L - R0018 - Interview - 13.34 m2</b>	
No Asbestos	
<b>B00L - R0019 - Staff Kitchen - 7.46 m2</b>	
No Asbestos	
<b>B00L - R0020 - Main Switch Board - 2.39 m2</b>	
No Asbestos	
<b>B00L - R0021 - External Movement - 7.12 m2</b>	
No Asbestos	
<b>B00L - R0022 - External Movement - 68.57 m2</b>	
No Asbestos	

## Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020