


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Hebersham Public School (4447)
Region:	Western Sydney AMU
State Electorate:	Mount Druiitt
Local Government Area:	Blacktown

Last Reviewed By:	WSP 07-FEB-2017
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

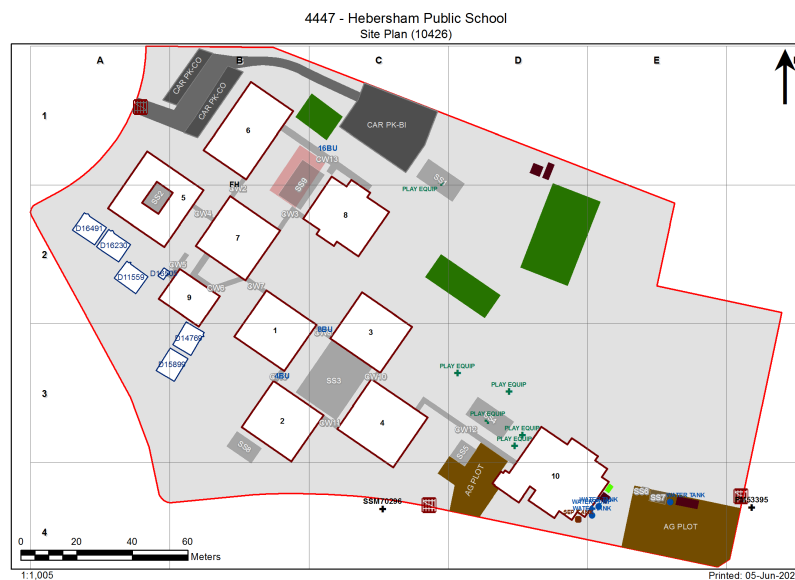

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B001 - General Learning - 1971 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B001 - R0001 - Movement - 86.45 m2							
No Asbestos							
B001 - R0002 - Home Base Store - 7.46 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0003 - Personal Effects Storage - 6.84 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0004 - Home Base Store - 7.4 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0005 - Distribution Board - .31 m2							
						Note: No inspection of live electrical installation	
Electrical - Backing Board	Resinous Board	0.3	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0006 - Personal Effects Storage - 6.38 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0007 - Home Base - 57.47 m2							
No Asbestos							
B001 - R0008 - Home Base - 57.63 m2							
No Asbestos							
B001 - R0009 - Personal Effects Storage - 6.92 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0010 - Home Base Store - 7.44 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0011 - Personal Effects Storage - 6.92 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0012 - Home Base Store - 7.44 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0013 - Home Base - 57.71 m2							
No Asbestos							
B001 - R0014 - Home Base - 57.47 m2							
No Asbestos							
B002 - General Learning/Communal Facilities - 1971 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B002 - R0001 - Movement - 86.39 m2							
No Asbestos							
B002 - R0002 - Toilets - Girls - 23.73 m2							
No Asbestos							

B002 - R0005 - Personal Effects Storage - 6.91 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0006 - Home Base Store - 6.91 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0007 - Home Base - 59.9 m2							
No Asbestos							
B002 - R0008 - Home Base - 60.19 m2							
No Asbestos							
B002 - R0009 - Home Base Store - 7.46 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0010 - Personal Effects Storage - 6.71 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0011 - Distribution Board - .27 m2						Note: No inspection of live electrical installation	
Electrical - Backing Board	Resinous Board	0.3	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0012 - Toilets - Boys - 18.38 m2							
No Asbestos							
B002 - R0013 - Special Programs Room - 77.02 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B002 - R0014 - Uniform Shop - 30.99 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B003 - General Learning/Pupil Facilities - 1971 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B003 - R0001 - Movement - 86.38 m2							
No Asbestos							
B003 - R0002 - Movement - 7.47 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0003 - Distribution Board - .27 m2						Note: No inspection of live electrical installation	
Electrical - Backing Board	Resinous Board	0.3	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0004 - Personal Effects Storage - 7.33 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0005 - Home Base - 60.95 m2							
No Asbestos							
B003 - R0006 - Home Base - 60.47 m2							
No Asbestos							
B003 - R0007 - Home Base Store - 7.44 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0008 - Personal Effects Storage - 6.89 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0009 - Toilets - Boys/Girls - 3.11 m2							
No Asbestos							

B003 - R0010 - General Storeroom - 4.02 m2							
No Asbestos							
B003 - R0011 - Personal Effects Storage - 7.01 m2							
No Asbestos							
B003 - R0012 - Home Base - 92.2 m2							
No Asbestos							
B003 - R0013 - Toilets - Girls - 12.54 m2							
No Asbestos							
B003 - R0015 - Toilets - Boys - 19.07 m2							
No Asbestos							
B003 - R0017 - General Assistant/Bulk Store - 9.69 m2							
No Asbestos							
B004 - General Learning/Pupil Facilities - 1971 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B004 - R0001 - Movement - 95.72 m2							
No Asbestos							
B004 - R0002 - Home Base - 95.03 m2							
No Asbestos							
B004 - R0003 - Toilets - Boys/Girls - 3.56 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B004 - R0004 - Home Base Store - 6.71 m2							
No Asbestos							
B004 - R0005 - Personal Effects Storage - 9.16 m2							
No Asbestos							
B004 - R0006 - Distribution Board - .79 m2							
Note: No inspection of live electrical installation							
No Asbestos							
B004 - R0007 - Personal Effects Storage - 8.67 m2							
No Asbestos							
B004 - R0008 - Home Base Store - 5.8 m2							
No Asbestos							
B004 - R0009 - Toilets - Boys/Girls - 3.57 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B004 - R0010 - Home Base - 92.21 m2							
No Asbestos							
B004 - R0011 - Home Base - 92.59 m2							
No Asbestos							
B004 - R0012 - Home Base Store - 6.79 m2							
No Asbestos							
B004 - R0013 - Personal Effects Storage - 9.72 m2							
No Asbestos							
B004 - R0014 - Toilets - Boys/Girls - 2.82 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B004 - R0015 - Toilets - Boys - 16.32 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B004 - R0016 - Toilets - Girls - 20.28 m2							

No Asbestos							
B004 - R0017 - Cleaning Distributed Store - 47 m2							
No Asbestos							
B005 - Administration/Staff Facilities - 1971 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B005 - R0001 - Movement - 102.69 m2							
No Asbestos							
B005 - R0002 - Community Clinic - 20.64 m2							
No Asbestos							
B005 - R0003 - Staff Toilet - 6.22 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B005 - R0004 - Movement - 15.22 m2							
No Asbestos							
B005 - R0005 - Staff Toilet - 6.51 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B005 - R0006 - Staff Room - 89.1 m2							
No Asbestos							
B005 - R0007 - Staff Room Annexe - 11.05 m2							
No Asbestos							
B005 - R0008 - Movement - 4.79 m2							
No Asbestos							
B005 - R0009 - General Assistant/Bulk Store - 18.83 m2							
No Asbestos							
B005 - R0010 - Duplicating Workroom - 15.59 m2							
No Asbestos							
B005 - R0011 - General Assistant/Bulk Store - .96 m2							
No Asbestos							
B005 - R0012 - General Assistant/Bulk Store - 2.39 m2							
No Asbestos							
B005 - R0013 - Staff Toilet - 1.94 m2							
No Asbestos							
B005 - R0014 - Deputy Principal - 18.8 m2							
No Asbestos							
B005 - R0015 - Interview - 8.18 m2							
No Asbestos							
B005 - R0016 - Movement - 15.31 m2							
No Asbestos							
B005 - R0017 - Clerical Office - 9.22 m2							
No Asbestos							
B005 - R0018 - Clerical Office - 13.98 m2							
No Asbestos							
B005 - R0019 - Entry Vestibule - 18.75 m2							
No Asbestos							
B005 - R0020 - Sick Bay - 7.3 m2							
No Asbestos							
B005 - R0021 - General Storeroom - 3.05 m2							
No Asbestos							

B005 - R0022 - Staff Toilet - 4.46 m2							
No Asbestos							
B005 - R0023 - Principal - 15.45 m2							
No Asbestos							
B005 - R0024 - Movement - 6.84 m2							
No Asbestos							
B005 - R0025 - Interview - 15.45 m2							
No Asbestos							
B005 - R0027 - Cleaning Distributed Store - 4.42 m2							
No Asbestos							
B005 - R0028 - Main Switch Board - 7.96 m2							
Electrical - Backing Board	Resinous Board	3	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B005 - R0029 - Staff Room Annexe - 8.39 m2							
No Asbestos							
B005 - R0030 - Cleaning Supplies - 5.79 m2							
No Asbestos							
B006 - Communal Facilities/Pupil Facilities - 1971 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B006 - R0001 - Movement - 100.34 m2							
No Asbestos							
B006 - R0002 - Toilets - Girls - 55.6 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting						
B006 - R0003 - Toilets - Boys - 54.21 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B006 - R0004 - Cleaning Distributed Store - .91 m2							
No Asbestos							
B006 - R0007 - P.E. Store - 16.17 m2							
No Asbestos							
B006 - R0008 - Canteen - 25.25 m2							
Floor Coverings Res/Textile	Vinyl Tiles	26m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B006 - R0009 - Distribution Board - .29 m2							
Note: No inspection of live electrical installation							
No Asbestos							
B006 - R0010 - Movement - 3.58 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B006 - R0011 - Canteen Office/Store - 5.25 m2							
No Asbestos							
B006 - R0012 - Uniform Shop - 4 m2							
No Asbestos							
B006 - R0013 - Staff Toilet - 2.16 m2							
No Asbestos							
B006 - R0014 - Hall Chair Store - 8.34 m2							

No Asbestos							
B006 - R0015 - Communal Space - 210.58 m2							
Wall Linings Internal	Flat AC Sheeting						
B007 - Library - 1971 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B007 - R0001 - Movement - 89.94 m2							
No Asbestos							
B007 - R0002 - Toilets - Boys - 3.43 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B007 - R0003 - Distribution Board - .81 m2							
Note: No inspection of live electrical installation							
Electrical - Backing Board	Resinous Board	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B007 - R0004 - Cleaning Distributed Store - 1.82 m2							
No Asbestos							
B007 - R0005 - Toilets - Girls - 3.43 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B007 - R0008 - Reading Area - 199.51 m2							
No Asbestos							
B007 - R0009 - Communications Room - 52.8 m2							
No Asbestos							
B007 - R0010 - Library Office/Workroom - 6.34 m2							
No Asbestos							
B007 - R0011 - Library Office/Workroom - 19.01 m2							
No Asbestos							
B007 - R0012 - Movement - 14.72 m2							
No Asbestos							
B007 - R0013 - Aboriginal Resource Centre - 26.01 m2							
No Asbestos							
B008 - General Learning - 1971 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B008 - R0002 - Home Base - 69.34 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B008 - R0003 - Security Store - 9.63 m2							
No Asbestos							
B008 - R0004 - Movement - 13.06 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B008 - R0007 - Home Base - 69 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B008 - R0008 - Home Base - 69.01 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B008 - R0009 - External Movement - 39.45 m2							

No Asbestos							
B008 - R0010 - General Storeroom - 5.68 m2							
No Asbestos							
B008 - R0011 - Distribution Board - .93 m2							
Note: No inspection of live electrical installation							
Door - Lining	Flat AC Sheeting	2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B008 - R0012 - Home Base - 69.08 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B008 - R0013 - Movement - 11.22 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B008 - R0015 - Movement - 55.77 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B008 - R0016 - External Movement - 26.88 m2							
Require Inspection							
B008 - R1001 - Home Base - 69.08 m2							
No Asbestos							
B008 - R1005 - Home Base - 68.74 m2							
No Asbestos							
B008 - R1006 - Home Base - 68.92 m2							
No Asbestos							
B008 - R1008 - Home Base - 68.93 m2							
No Asbestos							
B008 - R1009 - Movement - 55.74 m2							
No Asbestos							
B009 - General Learning - 2004 - Fibre Cement Clad							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B009 - R0001 - Movement - 34.75 m2							
No Asbestos							
B009 - R0002 - Practical Activities - 1hb - 19.99 m2							
No Asbestos							
B009 - R0003 - Home Base Store - 5.48 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B009 - R0004 - Home Base - 59.04 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B009 - R0005 - Withdrawal Space - 2hb - 11.64 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B009 - R0006 - Home Base - 59.05 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B009 - R0007 - Home Base Store - 5.48 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B009 - R0008 - Practical Activities - 1hb - 19.98 m2							
No Asbestos							
B010 - Pupil Facilities/Communal Facilities - 2010 - Brick/Veneer							

Exterior	
Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found
Interior	
B010 - R0001 - Communal Space - 201.46 m2	
No Asbestos	
B010 - R0002 - Raised Platform - 64.68 m2	
No Asbestos	
B010 - R0003 - Movement - 11.23 m2	
No Asbestos	
B010 - R0004 - Movement - 5.89 m2	
No Asbestos	
B010 - R0005 - Hall Chair Store - 11.61 m2	
No Asbestos	
B010 - R0006 - Movement - 3 m2	
No Asbestos	
B010 - R0007 - Cleaning Distributed Store - 8.46 m2	
No Asbestos	
B010 - R0008 - Plant - .81 m2	
No Asbestos	
B010 - R0009 - Main Switch Board - 3.09 m2	
No Asbestos	
B010 - R0010 - Toilet - Lobby - 3.71 m2	
No Asbestos	
B010 - R0011 - Toilets - Girls - 10.41 m2	
No Asbestos	
B010 - R0012 - Sound Cupboard - 2.77 m2	
No Asbestos	
B010 - R0013 - Toilet - P - 7.35 m2	
No Asbestos	
B010 - R0014 - Toilet - Lobby - 1.81 m2	
No Asbestos	
B010 - R0015 - Toilets - Boys - 7.79 m2	
No Asbestos	
B010 - R0016 - P.E. Store - 15.92 m2	
No Asbestos	
B010 - R0017 - Communal/Performance Store - 11.02 m2	
No Asbestos	
B010 - R0018 - Movement - 2.17 m2	
No Asbestos	
B010 - R0019 - Covered Outdoor Learning Area - 238.34 m2	
No Asbestos	
B010 - R0020 - Ramp - 12.06 m2	
No Asbestos	
B010 - R0021 - External Movement - 59.63 m2	
No Asbestos	
B010 - R0022 - Canteen Office/Store - 10.38 m2	
No Asbestos	
B010 - R0023 - Canteen - 41.49 m2	
No Asbestos	
B010 - R0024 - External Movement - 5.28 m2	
No Asbestos	

Demountables

OS 602 11559 - Learning Unit - Standard With P.A.A. - Placement Date : 19-OCT-2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 14769 - Learning Unit - Standard With P.A.A. - Placement Date : 01-MAY-2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 606 15899 - Learning Unit - Standard With P.A.A A/C - Placement Date : 01-MAY-2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 16230 - Learning Unit - Standard With P.A.A. - Placement Date : 22-OCT-1996

Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- Learning space/withdrawal/entry

Ceiling Structures/Linings	Flat AC Sheeting	70m2	Assumed Asbestos
----------------------------	------------------	------	------------------

R2- Home Base Store

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Assumed Asbestos

OS 602 16491 - Learning Unit - Standard With P.A.A. - Placement Date : 24-SEP-1996

Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- Learning space/withdrawal/entry

Ceiling Structures/Linings	Flat AC Sheeting	70m2	Assumed Asbestos
----------------------------	------------------	------	------------------

R2- Home Base Store

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Assumed Asbestos

OS 837 16505 - Hcap Shower/Change/Toilet - Placement Date : 26-JAN-2009

No Asbestos Found