

Asbestos Register


(Hazardous Materials and Risk Assessment)

School:	Hobartville Public School (4452)
Region:	Western Sydney AMU
State Electorate:	Hawkesbury
Local Government Area:	Hawkesbury

Last Reviewed By:	WSP 07-FEB-2017
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

4452 - Hobartville Public School
Site Plan (10431)

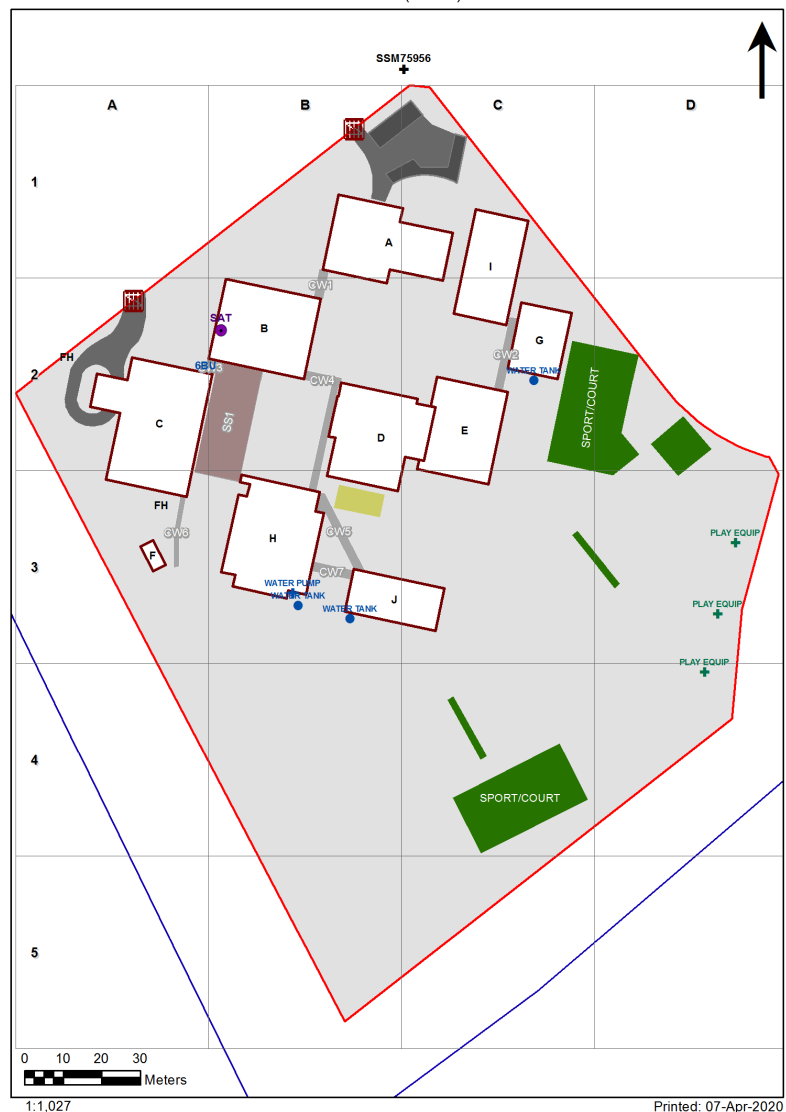

1:1,027

Printed: 07-Apr-2020

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Pupil Facilities/Building Services - 1971 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00A - R0001 - Movement - 187.4 m2							
No Asbestos							
B00A - R0002 - Movement - 76.19 m2							
Ceiling Structures/Linings	Flat AC Sheeting	78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0003 - Toilets - Girls - 12.21 m2							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0004 - General Storeroom - 10.98 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0005 - Sports Store - 9.73 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0006 - Staff Toilet - 3 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0007 - Movement - 2.3 m2							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0008 - Canteen - 36.23 m2							
Floor Coverings Res/Textile	Vinyl Tiles	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0009 - Canteen Office/Store - 3.9 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0010 - Garden Store - 10.29 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0011 - Craft Store - 13.33 m2							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0012 - General Assistant/Bulk Store - 15.55 m2							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0013 - Toilets - Boys - 12.61 m2							

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0014 - Movement - 76.03 m2							
No Asbestos							
B00B - Administration/Staff Facilities - 1971 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00B - R0001 - Principal - 16.08 m2							
No Asbestos							
B00B - R0002 - Staff Toilet - 2.31 m2							
No Asbestos							
B00B - R0003 - General Storeroom - 2.18 m2							
No Asbestos							
B00B - R0004 - Staff Toilet - 6.19 m2							
No Asbestos							
B00B - R0005 - Staff Toilet - 6.23 m2							
No Asbestos							
B00B - R0006 - Movement - 20.5 m2							
Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0007 - Staff Room - 71.05 m2							
No Asbestos							
B00B - R0008 - General Storeroom - 8.21 m2							
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0009 - Cleaning Supplies - 9.88 m2							
No Asbestos							
B00B - R0010 - General Storeroom - 18.87 m2							
No Asbestos							
B00B - R0011 - Community Clinic - 20.52 m2							
No Asbestos							
B00B - R0012 - Community Clinic - 3.18 m2							
No Asbestos							
B00B - R0013 - Community Clinic - 8.19 m2							
No Asbestos							
B00B - R0014 - Staff Room Annexe - 14.78 m2							
No Asbestos							
B00B - R0015 - Staff Toilet - 2.15 m2							
No Asbestos							
B00B - R0016 - General Storeroom - 2.12 m2							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0017 - Clerical Office - 25.2 m2							
No Asbestos							
B00B - R0018 - Movement - 5.93 m2							

No Asbestos							
B00B - R0019 - Cleaning Distributed Store - .45 m2							
No Asbestos							
B00B - R0020 - Sick Bay - 14.2 m2							
No Asbestos							
B00B - R0021 - Distribution Board - .67 m2							
Note: No inspection of live electrical installation							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	4m2	On inside panel of door	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0022 - Entry Vestibule - 29.41 m2							
No Asbestos							
B00B - R0023 - Deputy Principal - 11.25 m2							
No Asbestos							
B00B - R0024 - Movement - 11.28 m2							
No Asbestos							
B00B - R0025 - Duplicating Workroom - 11.86 m2							
No Asbestos							
B00B - R0026 - Movement - 143.12 m2							
No Asbestos							
B00C - General Learning/Pupil Facilities - 1971 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00C - R0001 - Movement - 253.31 m2							
No Asbestos							
B00C - R0002 - Toilets - Boys - 23.66 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0003 - Toilets - Girls - 76.08 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0004 - Cleaning Distributed Store - 1.69 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0005 - Cleaning Supplies - 14.69 m2							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Kiln	Encapsulated Asbestos material within unit						
B00C - R0006 - Personal Effects Storage - 7.31 m2							

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0007 - Home Base - 88.76 m2							
Floor Coverings Res/Textile	Vinyl Tiles	60m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0008 - Home Base Store - 3.97 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0009 - Toilets - Boys/Girls - 3.24 m2							
No Asbestos							
B00C - R0010 - Toilets - Boys/Girls - 3.18 m2							
No Asbestos							
B00C - R0011 - Home Base Store - 3.97 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0012 - Home Base - 88.76 m2							
Floor Coverings Res/Textile	Vinyl Tiles	60m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0013 - Personal Effects Storage - 14.58 m2							
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0014 - Distribution Board - .47 m2 Note: No inspection of live electrical installation							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	4m2	Inside of door	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0015 - Home Base - 88.13 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0016 - Home Base Store - 4.22 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0017 - Toilets - Boys/Girls - 3.39 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0018 - Covered Vehicle Area/Porte Cochere - 68.46 m2							
No Asbestos							
B00D - General Learning - 1971 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						

Ceiling Voids	No Asbestos Found							
Interior								
B00D - R0001 - Movement - 29.64 m2								
No Asbestos								
B00D - R0004 - P.E Store - 7.45 m2								
No Asbestos								
B00D - R0005 - Movement - 46.99 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00D - R0006 - Staff Toilet - 2.07 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00D - R0007 - Toilets - Boys - 44.75 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Partition Walls (Cubides)	Compressed AC Sheet	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R0009 - Cleaning Distributed Store - 2.7 m2								
No Asbestos								
B00D - R0013 - Withdrawal Space - 1hb - 15.2 m2								
No Asbestos								
B00D - R0014 - Distribution Board - .53 m2								
Note: No inspection of live electrical installation								
Wall Linings Internal	Flat AC Sheeting	6m2	Inside of door	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R0015 - Movement - 4.76 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00D - R0016 - Movement - 10.5 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0017 - General Storeroom - 7.45 m2								
No Asbestos								
B00D - R0018 - Home Base - M - 65.65 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00D - R0019 - Home Base - M - 65.64 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00D - R0020 - Movement - 44.85 m2								
Wall Linings Internal	Flat AC Sheeting							
B00D - R0021 - Stairs - 9.66 m2								
No Asbestos								
B00D - R0022 - Stairs - 9.55 m2								
No Asbestos								
B00D - R0024 - Toilets - Girls - 34.54 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0025 - Access Shower/Toilet/Change - 17.44 m2								
No Asbestos								
B00D - R0026 - Toilets - Boys - 8.11 m2								
No Asbestos								
B00D - R0027 - Special Programs Room - 31.43 m2								
No Asbestos								

B00D - R0028 - General Storeroom - 2.06 m2							
No Asbestos							
B00D - R0029 - Movement - 24.41 m2							
No Asbestos							
B00D - R1001 - Movement - 44.23 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R1002 - Movement - 3.95 m2							
No Asbestos							
B00D - R1003 - Home Base - 65.86 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1004 - Communications Room - 66.16 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1005 - Movement - 27.17 m2							
No Asbestos							
B00D - R1012 - Stairs - 17.5 m2							
No Asbestos							
B00D - R1013 - Stairs - 16.53 m2							
No Asbestos							
B00D - R1014 - Withdrawal Space - 2hb - 12.33 m2							
No Asbestos							
B00D - R1015 - Home Base Store - 3.74 m2							
No Asbestos							
B00D - R1016 - Home Base Store - 3.88 m2							
No Asbestos							
B00D - R1017 - Home Base - 83.33 m2							
No Asbestos							
B00D - R1018 - Home Base - 84.13 m2							
No Asbestos							
B00E - General Learning/Building Services - 1971 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00E - R0001 - Movement - 73.75 m2							
No Asbestos							
B00E - R0002 - Home Base - 65.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R0003 - Cleaning Distributed Store - .52 m2							
Wall Linings Internal	Flat AC Sheeting	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0004 - Distribution Board - .53 m2							
Note: No inspection of live electrical installation							
Wall Linings Internal	Flat AC Sheeting	8m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0005 - Staff Room Annexe - 16.34 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0006 - Home Base - 65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R0007 - Home Base - 64.91 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R0008 - Movement - 34.84 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0009 - Home Base - 65.87 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1001 - Home Base - 65.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1002 - Cleaning Distributed Store - .32 m2							
Wall Linings Internal	Flat AC Sheeting	3m2	Inside of door	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1003 - Withdrawal Space - 1hb - 16.98 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R1004 - Home Base - 65.82 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1005 - Home Base - 65.81 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1006 - Movement - 34.77 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R1007 - Home Base - 65.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00F - Building Services - 1971 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting						
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00F - R0001 - General Assistant/Bulk Store - 24.39 m2							
No Asbestos							
B00G - General Learning - 2004 - Fibre Cement Clad							
Exterior							
Ceiling Voids	No Asbestos Found						

Underfloor Voids	No Asbestos Found	
Interior		
B00G - R0001 - Movement - 38.48 m2		
No Asbestos		
B00G - R0002 - Practical Activities - 1hb - 19.4 m2		
No Asbestos		
B00G - R0003 - Home Base Store - 6.02 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0004 - Home Base - 59.2 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0005 - Withdrawal Space - 2hb - 11.35 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0006 - Home Base - 59.18 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0007 - Home Base Store - 6.02 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0008 - Practical Activities - 1hb - 19.4 m2		
No Asbestos		
B00H - Communal Facilities - 2007 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00H - R0001 - Communal Space - 213.64 m2		
No Asbestos		
B00H - R0002 - Access Shower/Toilet - 6.73 m2		
No Asbestos		
B00H - R0003 - Toilets - Boys - 7.98 m2		
No Asbestos		
B00H - R0004 - Sound Cupboard - 2.03 m2		
No Asbestos		
B00H - R0005 - General Assistant/Bulk Store - 15.85 m2		
No Asbestos		
B00H - R0006 - Garden Store - 11.74 m2		
No Asbestos		
B00H - R0007 - Movement - 6.79 m2		
No Asbestos		
B00H - R0008 - Hall Chair Store - 10.89 m2		
No Asbestos		
B00H - R0009 - Cleaning Supplies - 6.9 m2		
No Asbestos		
B00H - R0010 - Ramp - 8.51 m2		
No Asbestos		
B00H - R0011 - Raised Platform - 61.01 m2		
No Asbestos		
B00H - R0012 - Communal/Performance Store - 10.93 m2		

No Asbestos		
B00H - R0013 - Main Switch Board - 2.57 m2		
No Asbestos		
B00H - R0014 - Cleaning Distributed Store - 3.92 m2		
No Asbestos		
B00H - R0015 - Seminar/Study - 15.98 m2		
No Asbestos		
B00H - R0016 - Communal/Performance Store - 16.94 m2		
No Asbestos		
B00H - R0017 - Toilets - Girls - 12.33 m2		
No Asbestos		
B00H - R0018 - External Movement - 97.23 m2		
No Asbestos		
B00H - R0019 - External Movement - 23.11 m2		
No Asbestos		
B00H - R0020 - Movement - 15.45 m2		
No Asbestos		
B00H - R0021 - External Movement - 28.9 m2		
No Asbestos		
B00I - General Learning - 2010 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00I - R0001 - Home Base - 59.57 m2		
No Asbestos		
B00I - R0002 - Practical Activities - 1hb - 19.62 m2		
No Asbestos		
B00I - R0003 - Home Base Store - 5.49 m2		
No Asbestos		
B00I - R0004 - Withdrawal Space - 1hb - 9.11 m2		
No Asbestos		
B00I - R0005 - Home Base - 61.11 m2		
No Asbestos		
B00I - R0006 - Home Base Store - 6.25 m2		
No Asbestos		
B00I - R0007 - Practical Activities - 1hb - 18.89 m2		
No Asbestos		
B00I - R0008 - Withdrawal Space - 2hb - 11.48 m2		
No Asbestos		
B00I - R0009 - Home Base - 60.98 m2		
No Asbestos		
B00I - R0010 - Home Base Store - 6.23 m2		
No Asbestos		
B00I - R0011 - Practical Activities - 1hb - 19.02 m2		
No Asbestos		
B00I - R0012 - External Movement - 72.72 m2		
No Asbestos		
B00J - Library - 2010 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	

Underfloor Voids	No Asbestos Found	
Interior		
B00J - R0001 - Reading Area - 166.67 m2		
No Asbestos		
B00J - R0002 - Library Office/Workroom - 22.68 m2		
No Asbestos		
B00J - R0003 - Communications Room - 8.08 m2		
No Asbestos		
B00J - R0004 - K.L.A. Store - 14.39 m2		
No Asbestos		
B00J - R0005 - Toilet - Lobby - 2.29 m2		
No Asbestos		
B00J - R0006 - Staff Toilet - 4.46 m2		
No Asbestos		
B00J - R0007 - Cleaning Distributed Store - 3.57 m2		
No Asbestos		
B00J - R0008 - Main Switch Board - .93 m2		
No Asbestos		
B00J - R0009 - External Movement - 23.21 m2		
No Asbestos		

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020