


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Hurlstone Agricultural High School (8121)
Region:	South Western Sydney AMU
State Electorate:	Macquarie Fields
Local Government Area:	Campbelltown

Last Reviewed By:	Greencap 14-DEC-2017
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

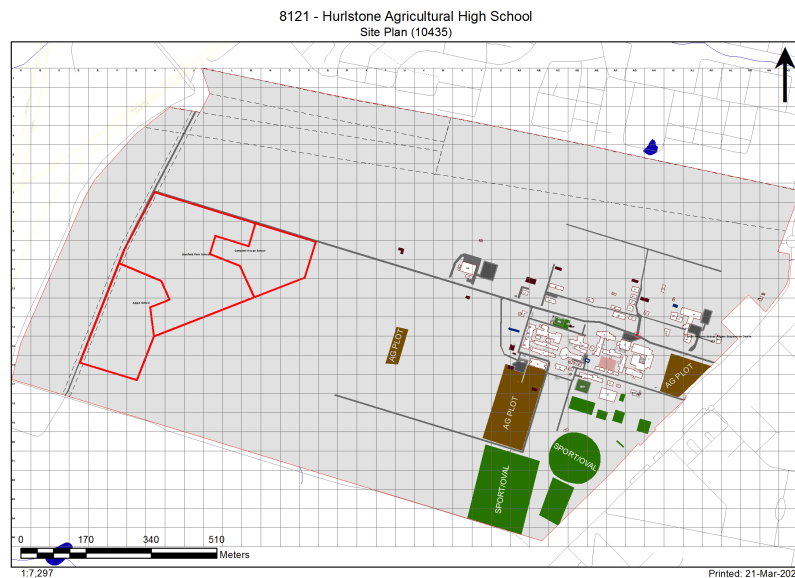

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B003 - Agricultural Science/Multi Purpose Facilities - 2019 - Brick/Veneer							
Exterior							
	Require Inspection						
Interior							
	B003 - R0001 - Movement - 250.08 m2						
	Require Inspection						
	B003 - R0002 - Botany/Zoology - 15.05 m2						
	Require Inspection						
	B003 - R0003 - Laboratory L.S. - 114.61 m2						
	Require Inspection						
	B003 - R0004 - Preparation - Science - 72.92 m2						
	Require Inspection						
	B003 - R0005 - Apparatus Store - 17.75 m2						
	Require Inspection						
	B003 - R0006 - Plant - 1.26 m2						
	Require Inspection						
	B003 - R0007 - Chemical Store - 15.18 m2						
	Require Inspection						
	B003 - R0008 - Laboratory L.S. - 114.61 m2						
	Require Inspection						
	B003 - R0009 - Laboratory L.S. - 114.61 m2						
	Require Inspection						
	B003 - R0010 - Laboratory L.S. - 113.38 m2						
	Require Inspection						
	B003 - R0011 - Laboratory L.S. - 114.09 m2						
	Require Inspection						
	B003 - R0012 - Seminar - Type 2 - 20.22 m2						
	Require Inspection						
	B003 - R0013 - Communication Space - 9.17 m2						
	Require Inspection						
	B003 - R0014 - Cleaning Store - Distributed - 4.5 m2						
	Require Inspection						
	B003 - R0015 - Distribution Board Cupboard - 6.55 m2						Note: No inspection of live electrical installation
	Require Inspection						
	B003 - R0016 - Movement - 58.37 m2						
	Require Inspection						
	B003 - R0017 - Plant - 1.02 m2						
	Require Inspection						
	B003 - R0018 - Staff Study - 58.23 m2						
	Require Inspection						
	B003 - R0019 - Toilets-Disabled - 3.14 m2						
	Require Inspection						
	B003 - R0020 - Toilets-Disabled - 3.15 m2						
	Require Inspection						
	B003 - R0021 - Access Student Shower/Toilet - Type 2 - 8.27 m2						
	Require Inspection						
	B003 - R0022 - Toilet - Lobby - 6.09 m2						
	Require Inspection						
	B003 - R0023 - Kitchen - Type 1 - 102.16 m2						
	Require Inspection						

B003 - R0024 - Preparation - 31.68 m2	
Require Inspection	
B003 - R0025 - Pantry - 5.17 m2	
Require Inspection	
B003 - R0026 - Plant - .71 m2	
Require Inspection	
B003 - R0027 - Store - 10.12 m2	
Require Inspection	
B003 - R0028 - Materials Store - 9.17 m2	
Require Inspection	
B003 - R0029 - General Learning Space - 60.19 m2	
Require Inspection	
B003 - R0030 - General Learning Space - 60.19 m2	
Require Inspection	
B003 - R0031 - Shared Learning Space - 74.25 m2	
Require Inspection	
B003 - R0032 - Communication Space - 10.35 m2	
Require Inspection	
B003 - R0033 - Distribution Board Cupboard - 1.57 m2	Note: No inspection of live electrical installation
Require Inspection	
B003 - R0034 - Cleaning Supplies Store - 6.14 m2	
Require Inspection	
B003 - R0035 - Plant - .54 m2	
Require Inspection	
B003 - R0036 - Materials Workshop - Type 2 - 108.27 m2	
Require Inspection	
B003 - R0037 - Project Store - Type 1 - 11.67 m2	
Require Inspection	
B003 - R0038 - Workshop Area - 17.18 m2	
Require Inspection	
B003 - R0039 - General Learning Space - 64.68 m2	
Require Inspection	
B003 - R0040 - Computer Learning Space - 59.8 m2	
Require Inspection	
B003 - R0041 - Movement - 74.67 m2	
Require Inspection	
B003 - R0042 - General Learning Space - 64.62 m2	
Require Inspection	
B003 - R0043 - General Learning Space - 60.11 m2	
Require Inspection	
B003 - R0044 - Materials Workshop - Type 2 - 96.49 m2	
Require Inspection	
B003 - R0045 - Materials Store - 20.59 m2	
Require Inspection	
B003 - R0046 - Plant - .61 m2	
Require Inspection	
B003 - R0047 - Toilets-Boys - 3.15 m2	
Require Inspection	
B003 - R0048 - Toilets-Boys - 3.2 m2	
Require Inspection	
B003 - R0049 - Access Student Shower/Toilet - Type 2 - 7.01 m2	
Require Inspection	

B003 - R0050 - Toilets-Disabled - 3.3 m2	
Require Inspection	
B003 - R0051 - Toilets-Disabled - 3.21 m2	
Require Inspection	
B003 - R0052 - Toilets-Girls - 4.02 m2	
Require Inspection	
B003 - R0053 - Toilets-Girls - 3.4 m2	
Require Inspection	
B003 - R0054 - Toilets-Girls - 3.4 m2	
Require Inspection	
B003 - R0055 - Toilets-Boys - 3.79 m2	
Require Inspection	
B003 - R0056 - Toilets-Boys - 3.31 m2	
Require Inspection	
B003 - R0057 - Toilets-Boys - 3.31 m2	
Require Inspection	
B003 - R0058 - Toilets-Girls - 3.31 m2	
Require Inspection	
B003 - R0059 - Toilets-Girls - 3.31 m2	
Require Inspection	
B003 - R0060 - Lift - 1.5 m2	
Require Inspection	
B003 - R0061 - External Movement - 253.49 m2	
Require Inspection	
B003 - R0062 - External Movement - 1.97 m2	
Require Inspection	
B004 - Technological & Applied Studies/Art - 2019 - Brick/Veneer	
Exterior	
Require Inspection	
Interior	
B004 - R0001 - Workshop Area - 176.49 m2	
Require Inspection	
B004 - R0002 - Materials Store - 36.2 m2	
Require Inspection	
B004 - R0003 - Project Store - Type 1 - 37 m2	
Require Inspection	
B004 - R0004 - Kiln Space - 13.16 m2	
Require Inspection	
B004 - R0005 - Visual Arts Workshop - 62.19 m2	
Require Inspection	
B004 - R0006 - Distribution Board Cupboard - .9 m2	Note: No inspection of live electrical installation
Require Inspection	
B004 - R0007 - General Learning Space - Type 4 - 93.07 m2	
Require Inspection	
B004 - R0008 - Project Store - Type 3 - 19.45 m2	
Require Inspection	
B004 - R0009 - Communications Cupboard - 1.58 m2	
Require Inspection	
B004 - R0010 - General Learning Space - Type 4 - 85.27 m2	
Require Inspection	
B004 - R0011 - Store - 4.17 m2	

Require Inspection							
B004 - R0012 - Dust Extraction Space - 15.37 m2							
Require Inspection							
B004 - R0013 - External Movement - 14.82 m2							
Require Inspection							
B004 - R0014 - Movement - 6.49 m2							
Require Inspection							
B004 - R0015 - External Movement - 81.26 m2							
Require Inspection							
B00A - Dormitory - 1929 - Brick/Block							
Exterior							
Eaves Linings	No Asbestos Found						
Eaves Linings	No Asbestos Found						
Gable Verge Lining	Flat AC Sheeting	40m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00A - R0001 - Staff - Toilet - 1.58 m2							
No Asbestos							
B00A - R0002 - Staff Shower - 1.36 m2							
No Asbestos							
B00A - R0003 - Staff Shower - 3.27 m2							
No Asbestos							
B00A - R0004 - Residential Laundry - 3.85 m2							
No Asbestos							
B00A - R0005 - Movement - 6.69 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0006 - Staff - Toilet - 3.88 m2							
No Asbestos							
B00A - R0007 - Cleaning Store - Distributed - 3.6 m2							
No Asbestos							
B00A - R0008 - Staff - Toilet - 1.35 m2							
No Asbestos							
B00A - R0009 - General Storeroom - 9.03 m2							
No Asbestos							
B00A - R0010 - Teacher Living Quarters - 13.11 m2							
No Asbestos							
B00A - R0011 - Teacher Living Quarters - 13.14 m2							
No Asbestos							
B00A - R0012 - Staff Kitchen - 8.57 m2							
No Asbestos							
B00A - R0013 - Staff Shower - 2.16 m2							
No Asbestos							
B00A - R0014 - Movement - 19.79 m2							
No Asbestos							
B00A - R0015 - Commonroom - 40.11 m2							
No Asbestos							

B00A - R0016 - Movement - 16.42 m2							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0017 - Computer Room - 12.05 m2							
No Asbestos							
B00A - R0018 - Dormitory - 11.88 m2							
No Asbestos							
B00A - R0019 - Movement - 10.17 m2							
No Asbestos							
B00A - R0020 - Senior Dormitory - 12.09 m2							
No Asbestos							
B00A - R0021 - Dormitory - 12.16 m2							
No Asbestos							
B00A - R0022 - Movement - 120.56 m2							
Ceiling Structures/Linings	Flat AC Sheeting	121m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0023 - Dormitory - 53.81 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0024 - Dorm Monitors Room - 5.11 m2							
No Asbestos							
B00A - R0025 - Res. Locker Area - 23.38 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R0026 - Movement - 6.73 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6.73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0027 - Residential Showers - 68.74 m2							
No Asbestos							
B00A - R0028 - Residential Laundry - 15.01 m2							
No Asbestos							
B00A - R0029 - Dormitory - 53.64 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0030 - Dorm Monitors Room - 5.13 m2							
No Asbestos							
B00A - R0031 - Dormitory - 53.43 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0032 - Dorm Monitors Room - 5.29 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0033 - Dormitory - 53.27 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0034 - Dorm Monitors Room - 5.2 m2							
No Asbestos							
B00A - R0035 - Dormitory - 53.62 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0036 - Dorm Monitors Room - 5.15 m2							
No Asbestos							
B00A - R0037 - Res. Locker Area - 23.39 m2							
Ceiling Structures/Linings	Flat AC Sheeting						

B00A - R0038 - Movement - 6.81 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0039 - Residential Showers - 68.32 m2							
No Asbestos							
B00A - R0040 - Residential Laundry - 14.89 m2							
No Asbestos							
B00A - R0041 - Movement - 6.07 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0042 - Dormitory - 53.63 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0043 - Dorm Monitors Room - 5.15 m2							
No Asbestos							
B00A - R0044 - Dormitory - 53.61 m2							
No Asbestos							
B00A - R0045 - Dorm Monitors Room - 5.15 m2							
No Asbestos							
B00A - R0046 - Res. Locker Area - 23.39 m2							
No Asbestos							
B00A - R0047 - Movement - 11.21 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	11.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R0048 - Dorm Monitors Room - 5.58 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5.58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0049 - Dormitory - 58.9 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58.88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0050 - Res. Locker Area - 29.19 m2							
No Asbestos							
B00A - R0051 - Dorm Monitors Room - 5 m2							
No Asbestos							
B00A - R0052 - Dormitory - 53.72 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0053 - Res. Common Room - 58.83 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58.82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0054 - Movement - 135.07 m2							
Ceiling Structures/Linings	Flat AC Sheeting	136m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R9001 - Movement - 18.36 m2							
No Asbestos							
B00A - R9002 - Res. Common Room - 70.84 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00A - R9003 - Multi-Purpose Space - 149.36 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00A - R9004 - Res. Common Room - 57.84 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R9005 - Cleaning Supplies Store - 3.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R9006 - Cleaning Supplies Store - 5.64 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R9007 - Staff Kitchen - 13.48 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R9008 - Staff Kitchen - 16.5 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R9009 - Gymnasium - 58.39 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R9010 - No Access - 122.5 m2							
No Asbestos							
B00B - Dormitory - 1962 - Brick/Block							
Exterior							
Underfloor Voids	Packing	60	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Eaves Linings	Non Accessible Area						
Interior							
B00B - R0001 - Dormitory - 66.84 m2							
No Asbestos							
B00B - R0003 - Toilets-Girls - 7.89 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0004 - Residential Showers - 25.6 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	25m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0005 - General Storeroom - 4.85 m2							
No Asbestos							
B00B - R0006 - Toilets-Girls - 9.07 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0007 - Residential Showers - 18.69 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	25m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0008 - Distribution Board Cupboard - .96 m2							
							Note: No inspection of live electrical installation
No Asbestos							

B00B - R0010 - Dormitory - 12.64 m2							
No Asbestos							
B00B - R0011 - Dormitory - 12.89 m2							
No Asbestos							
B00B - R0012 - Dormitory - 12.88 m2							
No Asbestos							
B00B - R0016 - Movement - 2.78 m2							
No Asbestos							
B00B - R0018 - Dormitory - 18.83 m2							
No Asbestos							
B00B - R0019 - Multi-Purpose Space - 65.84 m2							
No Asbestos							
B00B - R0020 - General Storeroom - 4.97 m2							
No Asbestos							
B00B - R0021 - Residential Showers - 25.78 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	25m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0023 - Distribution Board Cupboard - .9 m2						Note: No inspection of live electrical installation	
No Asbestos							
B00B - R0024 - Residential Showers - 18.85 m2							
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	25m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0025 - Toilets-Boys - 8.97 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0026 - Movement - 2.67 m2							
No Asbestos							
B00B - R0028 - Toilets-Boys - 7.83 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0029 - Dormitory - 8.62 m2							
No Asbestos							
B00B - R0030 - Dormitory - 8.61 m2							
No Asbestos							
B00B - R0031 - Dormitory - 8.61 m2							
No Asbestos							
B00B - R0032 - Movement - 12.26 m2							
No Asbestos							
B00B - R0033 - Dormitory - 8.61 m2							
No Asbestos							
B00B - R0034 - Dormitory - 8.61 m2							
No Asbestos							
B00B - R0035 - Dormitory - 8.61 m2							
No Asbestos							
B00B - R0036 - Movement - .8 m2							

No Asbestos							
B00B - R0037 - Stairs - 2.37 m2							
No Asbestos							
B00B - R0038 - Movement - 36.59 m2							
No Asbestos							
B00B - R0039 - Movement - 11.16 m2							
No Asbestos							
B00B - R0040 - Dormitory - 10.46 m2							
No Asbestos							
B00B - R0041 - Dormitory - 10.68 m2							
No Asbestos							
B00B - R0042 - Dormitory - 10.83 m2							
No Asbestos							
B00B - R0043 - Dormitory - .3 m2							
No Asbestos							
B00B - R0044 - Movement - 23.15 m2							
No Asbestos							
B00B - R0045 - Stairs - 2.37 m2							
No Asbestos							
B00B - R0046 - Movement - 36.81 m2							
No Asbestos							
B00B - R0047 - Stairs - 2.38 m2							
No Asbestos							
B00B - R1001 - Dormitory - 8.58 m2							
No Asbestos							
B00B - R1002 - Dormitory - 8.48 m2							
No Asbestos							
B00B - R1003 - Dormitory - 8.52 m2							
No Asbestos							
B00B - R1004 - Movement - 12.15 m2							
No Asbestos							
B00B - R1005 - Dormitory - 8.75 m2							
No Asbestos							
B00B - R1006 - Dormitory - 8.68 m2							
No Asbestos							
B00B - R1007 - Dormitory - 8.85 m2							
No Asbestos							
B00B - R1008 - Toilets-Boys - 8.12 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1009 - Residential Showers - 25.87 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	25m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1010 - Cleaning Store - Distributed - 5.36 m2							
No Asbestos							
B00B - R1011 - Dormitory - 11.96 m2							
No Asbestos							
B00B - R1012 - Dormitory - 12.83 m2							
No Asbestos							
B00B - R1013 - Dormitory - 13.14 m2							
No Asbestos							
B00B - R1015 - Cleaning Store - Distributed - 1.41 m2							

No Asbestos							
B00B - R1019 - Movement - 31.08 m2							
No Asbestos							
B00B - R1020 - Distribution Board Cupboard - 1.18 m2							Note: No inspection of live electrical installation
No Asbestos							
B00B - R1021 - Teacher Living Quarters - 10.47 m2							
No Asbestos							
B00B - R1022 - Teacher Bathroom - 2.81 m2							
No Asbestos							
B00B - R1023 - Staff - Toilet - 1.51 m2							
No Asbestos							
B00B - R1024 - Movement - 3.53 m2							
No Asbestos							
B00B - R1025 - Teacher Bedroom - 8.71 m2							
No Asbestos							
B00B - R1028 - Movement - 30.37 m2							
No Asbestos							
B00B - R1029 - Distribution Board Cupboard - 1.35 m2							Note: No inspection of live electrical installation
No Asbestos							
B00B - R1030 - Teacher Living Quarters - 10.31 m2							
No Asbestos							
B00B - R1031 - Movement - 3.4 m2							
No Asbestos							
B00B - R1032 - Teacher Bathroom - 2.77 m2							
No Asbestos							
B00B - R1033 - Staff - Toilet - 1.51 m2							
No Asbestos							
B00B - R1034 - Teacher Bedroom - 8.67 m2							
No Asbestos							
B00B - R1036 - Dormitory - 13.02 m2							
No Asbestos							
B00B - R1037 - Dormitory - 12.83 m2							
No Asbestos							
B00B - R1038 - Dormitory - 12.36 m2							
No Asbestos							
B00B - R1039 - Cleaning Store - Distributed - 4.95 m2							
No Asbestos							
B00B - R1040 - Residential Showers - 25.46 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	25m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1041 - Toilets-Girls - 8.01 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1049 - Movement - 2.59 m2							
No Asbestos							
B00B - R1050 - Dormitory - 7.89 m2							
No Asbestos							
B00B - R1051 - Dormitory - 23.75 m2							
No Asbestos							
B00B - R1052 - Dormitory - 23.23 m2							
No Asbestos							
B00B - R1053 - Dormitory - 7.75 m2							

No Asbestos							
B00B - R1054 - Stairs - 11.46 m2							
No Asbestos							
B00B - R1055 - Movement - 11.34 m2							
No Asbestos							
B00B - R1056 - Dormitory - 10.64 m2							
No Asbestos							
B00B - R1057 - Dormitory - 10.72 m2							
No Asbestos							
B00B - R1058 - Dormitory - 11.09 m2							
No Asbestos							
B00B - R1059 - Plant - .67 m2							
No Asbestos							
B00B - R1060 - Movement - 14.29 m2							
No Asbestos							
B00B - R1061 - Stairs - 10.67 m2							
No Asbestos							
B00B - R1062 - Dormitory - 10.97 m2							
No Asbestos							
B00B - R1063 - Dormitory - 10.4 m2							
No Asbestos							
B00B - R1064 - Dormitory - 10.12 m2							
No Asbestos							
B00B - R1065 - Movement - 12.04 m2							
No Asbestos							
B00B - R1066 - Stairs - 11.93 m2							
No Asbestos							
B00C - Dormitory - 1962 - Brick/Block							
Exterior							
Eaves Linings	Non Accessible Area						
Underfloor Voids	Packing	60	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)
Underfloor Voids	Packing	60	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00C - R0001 - Dormitory - 67.18 m2							
No Asbestos							
B00C - R0002 - Toilets-Girls - 9.07 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0003 - Residential Showers - 18.79 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0004 - Distribution Board Cupboard - 1.04 m2						Note: No inspection of live electrical installation	
No Asbestos							

B00C - R0005 - Distribution Board Cupboard - .99 m2							Note: No inspection of live electrical installation
No Asbestos							
B00C - R0006 - Residential Showers - 18.79 m2							
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubides)	Compressed AC Sheet	25m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0007 - Toilets-Girls - 9.2 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubides)	Compressed AC Sheet	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0008 - Dormitory - 8.61 m2							
No Asbestos							
B00C - R0009 - Dormitory - 8.68 m2							
No Asbestos							
B00C - R0010 - Dormitory - 8.58 m2							
No Asbestos							
B00C - R0011 - Dormitory - 8.52 m2							
No Asbestos							
B00C - R0012 - Dormitory - 8.59 m2							
No Asbestos							
B00C - R0013 - Dormitory - 8.65 m2							
No Asbestos							
B00C - R0014 - Movement - 12.54 m2							
No Asbestos							
B00C - R0015 - Toilets-Girls - 8.01 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubides)	Compressed AC Sheet	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0016 - Residential Showers - 25.7 m2							
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubides)	Compressed AC Sheet	25m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0017 - Shower/Change - 4.76 m2							
Partition Walls (Cubides)	Compressed AC Sheet	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0024 - Movement - 2.1 m2							
No Asbestos							
B00C - R0031 - Cleaning Store - Distributed - 4.75 m2							
No Asbestos							
B00C - R0032 - Residential Showers - 25.63 m2							
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubides)	Compressed AC Sheet	15m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0033 - Toilets-Girls - 7.84 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubides)	Compressed AC Sheet	5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0035 - Movement - 2.59 m2							
No Asbestos							
B00C - R0036 - Movement - .78 m2							

No Asbestos	
B00C - R0037 - Movement - 2.59 m2	
No Asbestos	
B00C - R0038 - Stairs - 2.37 m2	
No Asbestos	
B00C - R0039 - Movement - 37.83 m2	
No Asbestos	
B00C - R0040 - Movement - 11.42 m2	
No Asbestos	
B00C - R0041 - Dormitory - 10.59 m2	
No Asbestos	
B00C - R0042 - Dormitory - 10.77 m2	
No Asbestos	
B00C - R0043 - Dormitory - 10.9 m2	
No Asbestos	
B00C - R0044 - Dormitory - 11.41 m2	
No Asbestos	
B00C - R0045 - Dormitory - 12.78 m2	
No Asbestos	
B00C - R0046 - Dormitory - 12.87 m2	
No Asbestos	
B00C - R0047 - Movement - 21.27 m2	
No Asbestos	
B00C - R0048 - Plant - .72 m2	
No Asbestos	
B00C - R0049 - Stairs - 2.37 m2	
No Asbestos	
B00C - R0050 - Movement - 11.54 m2	
No Asbestos	
B00C - R0051 - Dormitory - 11.1 m2	
No Asbestos	
B00C - R0052 - Dormitory - 10.79 m2	
No Asbestos	
B00C - R0053 - Dormitory - 10.68 m2	
No Asbestos	
B00C - R0054 - Dormitory - 12.7 m2	
No Asbestos	
B00C - R0055 - Dormitory - 12.75 m2	
No Asbestos	
B00C - R0056 - Dormitory - 12.3 m2	
No Asbestos	
B00C - R0057 - Movement - 37.05 m2	
No Asbestos	
B00C - R0058 - Stairs - 2.37 m2	
No Asbestos	
B00C - R1001 - Dormitory - 8.66 m2	
No Asbestos	
B00C - R1002 - Dormitory - 8.54 m2	
No Asbestos	
B00C - R1003 - Dormitory - 8.54 m2	
No Asbestos	
B00C - R1004 - Dormitory - 8.75 m2	

No Asbestos							
B00C - R1005 - Dormitory - 8.75 m2							
No Asbestos							
B00C - R1006 - Dormitory - 8.65 m2							
No Asbestos							
B00C - R1007 - Movement - 12.34 m2							
No Asbestos							
B00C - R1008 - Toilets-Girls - 8.01 m2							
Partition Walls (Cubides)	Compressed AC Sheet	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R1009 - Residential Showers - 25.84 m2							
Partition Walls (Cubides)	Compressed AC Sheet	25m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R1010 - Other-Vacant - 4.93 m2							
No Asbestos							
B00C - R1023 - Cleaning Store - Distributed - 4.88 m2							
No Asbestos							
B00C - R1024 - Residential Showers - 25.79 m2							
Partition Walls (Cubides)	Compressed AC Sheet	25m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R1025 - Toilets-Girls - 8.07 m2							
Partition Walls (Cubides)	Compressed AC Sheet	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R1034 - Distribution Board Cupboard - 1.35 m2						Note: No inspection of live electrical installation	
No Asbestos							
B00C - R1035 - Distribution Board Cupboard - 1.35 m2						Note: No inspection of live electrical installation	
No Asbestos							
B00C - R1036 - Cleaning Store - Distributed - 1.45 m2							
No Asbestos							
B00C - R1037 - Teacher Living Quarters - 10.47 m2							
No Asbestos							
B00C - R1038 - Teacher Bathroom - 2.74 m2							
No Asbestos							
B00C - R1039 - Movement - 3.38 m2							
No Asbestos							
B00C - R1040 - Staff - Toilet - 1.55 m2							
No Asbestos							
B00C - R1041 - Teacher Living Quarters - 8.85 m2							
No Asbestos							
B00C - R1042 - Teacher Living Quarters - 10.52 m2							
No Asbestos							
B00C - R1043 - Teacher Bathroom - 2.81 m2							
No Asbestos							
B00C - R1044 - Staff - Toilet - 1.57 m2							
No Asbestos							
B00C - R1045 - Movement - 3.37 m2							
No Asbestos							
B00C - R1046 - Teacher Bedroom - 8.88 m2							
No Asbestos							
B00C - R1047 - Stairs - 11.61 m2							
No Asbestos							
B00C - R1048 - Movement - 30.12 m2							
No Asbestos							

B00C - R1049 - Movement - 11.44 m2							
No Asbestos							
B00C - R1050 - Dormitory - 10.74 m2							
No Asbestos							
B00C - R1051 - Dormitory - 10.87 m2							
No Asbestos							
B00C - R1052 - Dormitory - 11.02 m2							
No Asbestos							
B00C - R1053 - Dormitory - 12.2 m2							
No Asbestos							
B00C - R1054 - Dormitory - 12.75 m2							
No Asbestos							
B00C - R1055 - Dormitory - 12.9 m2							
No Asbestos							
B00C - R1056 - Movement - 14.45 m2							
No Asbestos							
B00C - R1057 - Plant - .53 m2							
No Asbestos							
B00C - R1058 - Stairs - 11.19 m2							
No Asbestos							
B00C - R1059 - Movement - 12.28 m2							
No Asbestos							
B00C - R1060 - Dormitory - 11.05 m2							
No Asbestos							
B00C - R1061 - Dormitory - 10.8 m2							
No Asbestos							
B00C - R1062 - Dormitory - 10.62 m2							
No Asbestos							
B00C - R1063 - Dormitory - 12.96 m2							
No Asbestos							
B00C - R1064 - Dormitory - 12.72 m2							
No Asbestos							
B00C - R1065 - Dormitory - 12.17 m2							
No Asbestos							
B00C - R1066 - Movement - 30.21 m2							
No Asbestos							
B00C - R1067 - Stairs - 12.08 m2							
No Asbestos							
B00C - R1068 - Movement - 2.78 m2							
No Asbestos							
B00C - R1069 - Dormitory - 7.61 m2							
No Asbestos							
B00C - R1070 - Dormitory - 23.5 m2							
No Asbestos							
B00C - R1071 - Dormitory - 7.5 m2							
No Asbestos							
B00C - R1072 - Dormitory - 23.59 m2							
No Asbestos							
B00D - Dormitory - 1962 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	60m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Underfloor Voids	Packing	200	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00D - R0001 - Movement - 33.67 m2							
Ceiling Structures/Linings	Flat AC Sheeting	33.66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0002 - Stage - 28.16 m2							
No Asbestos							
B00D - R0003 - Residential Dining Room - 418.22 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - (X25)						
B00D - R0004 - Stage - 28.17 m2							
No Asbestos							
B00D - R0005 - Movement - 4.28 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0006 - Movement - 4.28 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0007 - Staff - Toilet - 3.82 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0008 - Residential Kitchen - 203.75 m2							
No Asbestos							
B00D - R0009 - Preparation - 15.27 m2							
No Asbestos							
B00D - R0010 - Distribution Board Cupboard - 1.17 m2						Note: No inspection of live electrical installation	
No Asbestos							
B00D - R0011 - Administration - Clerical - 14.96 m2							
No Asbestos							
B00D - R0012 - Commonroom - 16.56 m2							
No Asbestos							
B00D - R0013 - Staff - Toilet - 6.87 m2							
No Asbestos							
B00D - R0014 - Staff - Toilet - 15.94 m2							
No Asbestos							
B00D - R0015 - Movement - 7.09 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0016 - Residential Pantry - 15.14 m2							
No Asbestos							
B00D - R0017 - Residential Pantry - 15.91 m2							
No Asbestos							
B00D - R0018 - Residential Coolroom - 8.87 m2							
No Asbestos							
B00D - R0019 - General Storeroom - 5.34 m2							
No Asbestos							
B00D - R0020 - Residential Coolroom - 2.34 m2							
No Asbestos							
B00D - R0021 - Movement - 4.58 m2							
No Asbestos							

B00D - R0022 - Residential Coolroom - 2.89 m2							
No Asbestos							
B00D - R0023 - Residential Coolroom - 6.46 m2							
No Asbestos							
B00D - R0024 - Residential Coolroom - 4.67 m2							
No Asbestos							
B00D - R0025 - Movement - 39.41 m2							
No Asbestos							
B00D - R9001 - General Storeroom - 114.78 m2							
Plumbing / Pipework	Insulation Material						
B00D - R9002 - General Assistants - 24.16 m2							
No Asbestos							
B00D - R9003 - Plant - 22.69 m2							
Electrical - Backing Board	Resinous Board	2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R9004 - Plant - 38.37 m2							
No Asbestos							
B00E - Dormitory - 1926 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00E - R0001 - Movement - 49.1 m2							
Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0002 - Teacher Living Quarters - 21.39 m2							
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0003 - Teacher Living Quarters - 25.58 m2							
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0004 - Movement - 6.91 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0005 - Movement - 23.74 m2							
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0006 - General Storeroom - .9 m2							
No Asbestos							
B00E - R0007 - Teacher Living Quarters - 23.28 m2							
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0008 - Teacher Living Quarters - 32.41 m2							
No Asbestos							
B00E - R0009 - Dormitory - 13.2 m2							
No Asbestos							
B00E - R0010 - Residential Laundry - 5.04 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0011 - Teacher Living Quarters - 2.18 m2							

Floor Coverings Res/Textile	Vinyl Tiles							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0012 - Movement - 10.01 m2								
Floor Coverings Res/Textile	Vinyl Tiles							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0013 - Staff Kitchen - 8.46 m2								
Floor Coverings Res/Textile	Vinyl Tiles							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0015 - Dormitory - 32.02 m2								
No Asbestos								
B00E - R0016 - Dorm Monitors Room - 6.49 m2								
No Asbestos								
B00E - R0017 - Dormitory - 35.35 m2								
No Asbestos								
B00E - R0018 - Dorm Monitors Room - 5.76 m2								
No Asbestos								
B00E - R0019 - Dormitory - 27.7 m2								
No Asbestos								
B00E - R0020 - Dorm Monitors Room - 6.38 m2								
No Asbestos								
B00E - R0021 - Dormitory - 31.21 m2								
No Asbestos								
B00E - R0022 - Dorm Monitors Room - 6.49 m2								
No Asbestos								
B00E - R0024 - Residential Showers - 49.52 m2								
No Asbestos								
B00E - R0026 - Dormitory - 29.29 m2								
No Asbestos								
B00E - R0027 - Dorm Monitors Room - 6.49 m2								
No Asbestos								
B00E - R0028 - Dormitory - 37.13 m2								
No Asbestos								
B00E - R0029 - Dorm Monitors Room - 6.43 m2								
No Asbestos								
B00E - R0031 - Residential Showers - 3.37 m2								
No Asbestos								
B00E - R0032 - Movement - 4.08 m2								
No Asbestos								
B00E - R0033 - Dormitory - 11.35 m2								
No Asbestos								
B00E - R0035 - Plant - 16.43 m2								
No Asbestos								
B00E - R0036 - Teacher Bathroom - 3.52 m2								
No Asbestos								
B00E - R0037 - Teacher Living Quarters - 6.45 m2								
No Asbestos								

B00E - R0038 - Teacher Bathroom - 9.05 m2							
No Asbestos							
B00E - R0039 - Teacher Bathroom - 1.74 m2							
No Asbestos							
B00E - R0040 - Movement - 3.59 m2							
No Asbestos							
B00E - R0042 - Movement - 8.14 m2							
No Asbestos							
B00E - R0043 - Movement - 3.56 m2							
No Asbestos							
B00E - R0044 - Distribution Board Cupboard - .95 m2						Note: No inspection of live electrical installation	
No Asbestos							
B00E - R0045 - Movement - 1.32 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00E - R0046 - Movement - 100.7 m2							
Ceiling Structures/Linings	Flat AC Sheeting	101m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	North, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0047 - Movement - 1.35 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00E - R0048 - Dormitory - 56.46 m2							
No Asbestos							
B00E - R0049 - Movement - 13.35 m2							
No Asbestos							
B00E - R0050 - General Storeroom - 7.84 m2							
No Asbestos							
B00E - R0051 - Movement - 6.25 m2							
No Asbestos							
B00E - R0052 - Movement - 7.17 m2							
No Asbestos							
B00E - R0053 - Stairs - 2.55 m2							
No Asbestos							
B00E - R0054 - Study Space - 7.25 m2							
No Asbestos							
B00E - R1001 - Teacher Living Quarters - 32.5 m2							
Ceiling Structures/Linings	Flat AC Sheeting	32.49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1002 - Teacher Bathroom - 7.09 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7.08m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1004 - Movement - 48.7 m2							
Ceiling Structures/Linings	Flat AC Sheeting	46.68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1005 - Teacher Living Quarters - 21.6 m2							
Ceiling Structures/Linings	Flat AC Sheeting	21.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1006 - Teacher Living Quarters - 17.4 m2							
Ceiling Structures/Linings	Flat AC Sheeting	17.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1007 - Teacher Bathroom - 3.12 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3.12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00E - R1008 - Teacher Living Quarters - 23.62 m2							
Ceiling Structures/Linings	Flat AC Sheeting	23.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1009 - Senior Dormitory - 9.44 m2							
No Asbestos							
B00E - R1010 - Senior Dormitory - 9.38 m2							
No Asbestos							
B00E - R1013 - Senior Dormitory - 9.33 m2							
No Asbestos							
B00E - R1014 - Movement - 4.22 m2							
No Asbestos							
B00E - R1015 - Movement - 2.39 m2							
No Asbestos							
B00E - R1016 - Senior Dormitory - 12.21 m2							
No Asbestos							
B00E - R1017 - Senior Dormitory - 7.34 m2							
No Asbestos							
B00E - R1018 - Senior Dormitory - 11.04 m2							
No Asbestos							
B00E - R1019 - Senior Dormitory - 9.42 m2							
No Asbestos							
B00E - R1020 - Movement - 3.92 m2							
No Asbestos							
B00E - R1021 - Residential Showers - 19.12 m2							
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1022 - Senior Dormitory - 9.16 m2							
No Asbestos							
B00E - R1023 - Senior Dormitory - 9.33 m2							
No Asbestos							
B00E - R1024 - Senior Dormitory - 11.47 m2							
No Asbestos							
B00E - R1025 - Senior Dormitory - 9.49 m2							
No Asbestos							
B00E - R1026 - Movement - 21.33 m2							
No Asbestos							
B00E - R1027 - Movement - 1.51 m2							
No Asbestos							
B00E - R1028 - Movement - 3.19 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R1029 - Distribution Board Cupboard - .39 m2						Note: No inspection of live electrical installation	
No Asbestos							
B00E - R1030 - Stairs - 6.27 m2							
No Asbestos							
B00E - R1031 - Stairs - 5.66 m2							
No Asbestos							
B00E - R1032 - Movement - 18.36 m2							
Ceiling Structures/Linings	Flat AC Sheeting	18.35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1033 - Movement - 3.96 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

Wall Linings Internal	Flat AC Sheeting						
B00E - R1034 - Stairs - 5.29 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00E - R1035 - Adjoining School - 9.13 m2							
No Asbestos							
B00E - R1036 - Movement - 11.62 m2							
No Asbestos							
B00E - R9001 - General Storeroom - 7.25 m2							
No Asbestos							
B00E - R9002 - General Storeroom - 11.1 m2							
No Asbestos							
B00E - R9003 - Movement - 4.44 m2							
No Asbestos							
B00E - R9004 - General Storeroom - 10.53 m2							
No Asbestos							
B00E - R9005 - General Assistants - 10.85 m2							
No Asbestos							
B00E - R9006 - General Storeroom - 18.24 m2							
No Asbestos							
B00E - R9007 - General Storeroom - 18.54 m2							
No Asbestos							
B00E - R9008 - General Storeroom - 27.23 m2							
No Asbestos							
B00E - R9009 - General Storeroom - 22.3 m2							
No Asbestos							
B00E - R9010 - General Storeroom - 21.8 m2							
No Asbestos							
B00E - R9011 - General Storeroom - 22.73 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	South East corner	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00F - Various - 1964 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00F - R0001 - General Learning Space - 47.69 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00F - R0002 - Study Space - 14.24 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00F - R0003 - Security Store - 5.36 m2							
No Asbestos							
B00F - R0004 - General Learning Space - 47.75 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00F - R0005 - Staff Study - 30.45 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00F - R0006 - Darkroom Space - 10.95 m2							
No Asbestos							
B00F - R0007 - General Storeroom - 1.27 m2							

No Asbestos		
B00F - R0008 - Darkroom Space - 16.15 m2		
No Asbestos		
B00F - R0009 - Movement - 106.66 m2		
No Asbestos		
B00F - R0010 - Distribution Board Cupboard - .72 m2		Note: No inspection of live electrical installation
No Asbestos		
B00F - R0011 - Administration - Clerical - 35.59 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R0012 - Public Entry - 40.04 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R0013 - Security Store - 18.66 m2		
No Asbestos		
B00F - R0014 - Interview/Office - Type 1 - 13.92 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R0015 - Movement - 20.74 m2		
No Asbestos		
B00F - R0016 - Interview/Office - Type 1 - 13.99 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R0017 - Principal Office - 18.83 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R0018 - Movement - 13.16 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R0019 - Administration - Clerical - 35.97 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R0020 - Self Help Toilet - 10.62 m2		
No Asbestos		
B00F - R0021 - Cleaning Store - Distributed - 2.31 m2		
No Asbestos		
B00F - R0022 - Ancillary Staff - 22.32 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R0023 - Administration - Clerical - 14.2 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R0024 - Duplicating Workroom - 12.87 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R0025 - Clinic-Toilets - 2.1 m2		
No Asbestos		
B00F - R0026 - Clinic-Toilets - 2.1 m2		
No Asbestos		
B00F - R0027 - Administration - Clerical - 14.36 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R0028 - Pupil Entry - 70.68 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R1001 - General Learning Space - 48.62 m2		

Floor Coverings Res/Textile	No Asbestos Found	
B00F - R1002 - General Learning Space - 48.69 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R1003 - Careers Advisers Office - 17.18 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R1004 - Security Store - 11.34 m2		
No Asbestos		
B00F - R1005 - General Learning Space - 47.21 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R1006 - Seminar - 86.46 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R1007 - General Storeroom - 13.32 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R1008 - Security Store - 12.73 m2		
No Asbestos		
B00F - R1009 - Movement - 113.54 m2		
No Asbestos		
B00F - R1010 - Movement - 65.23 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R1011 - Distribution Board Cupboard - .6 m2		
		Note: No inspection of live electrical installation
No Asbestos		
B00F - R1012 - Seminar - 17.81 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R1013 - Computer Learning Space - 46.51 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R1014 - General Learning Space - 46.95 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R1015 - General Learning Space - 49.94 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R1016 - Staff Study - 28.71 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - General Learning - 1935 - Brick/Block		
Exterior		
Ceiling Voids	Non Accessible Area	
Underfloor Voids - Slab on Ground	Non Accessible Area	
Interior		
B00G - R0001 - Movement - 158.69 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00G - R0002 - Staff Study - 19.71 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00G - R0003 - Staff Study - 19.93 m2		

Ceiling Structures/Linings	Flat AC Sheeting	
B00G - R0004 - General Storeroom - 16.33 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00G - R0005 - General Learning Space - 54.1 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
Floor Coverings Res/Textile	Vinyl Sheet	
B00G - R0006 - General Storeroom - 3.4 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00G - R0007 - Entry - 3.6 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00G - R0008 - Duplicating Workroom - 16.02 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00G - R0009 - General Learning Space - 47.15 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
Floor Coverings Res/Textile	Vinyl Sheet	
B00G - R0010 - Movement - 21.13 m2		
Wall Linings Internal	Flat AC Sheeting	
Ceiling Structures/Linings	Flat AC Sheeting	
B00G - R0011 - Movement - 8.6 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00G - R0012 - Staff Change - 8.92 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00G - R0013 - General Learning Space - 46.89 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
Floor Coverings Res/Textile	Vinyl Sheet	
B00G - R0014 - General Learning Space - 46.62 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
Floor Coverings Res/Textile	Vinyl Sheet	
B00G - R0015 - General Learning Space - 47.29 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
Floor Coverings Res/Textile	Vinyl Sheet	
B00G - R0016 - Staff - Toilet - 1.38 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00H - Science/Library - 1970 - Brick/Block		
Exterior		
Underfloor Voids - Slab on Ground	Non Accessible Area	

Ceiling Voids - Raked Ceiling	Non Accessible Area							
Interior								
B00H - M1001 - Seminar - 14.9 m2								
No Asbestos								
B00H - M1002 - Main Area - 64.74 m2								
No Asbestos								
B00H - M1003 - Workroom - 38.03 m2								
No Asbestos								
B00H - R0001 - Laboratory L.S. - 90.68 m2								
Floor Coverings Res/Textile	Vinyl Tiles	91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00H - R0002 - Preparation - 30.99 m2								
Floor Coverings Res/Textile	Vinyl Tiles	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00H - R0003 - General Storeroom - 3.05 m2								
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00H - R0004 - Apparatus Store - 12.79 m2								
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00H - R0005 - Laboratory L.S. - 91.05 m2								
Floor Coverings Res/Textile	Vinyl Tiles	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00H - R0006 - Movement - 2.99 m2								
No Asbestos								
B00H - R0007 - Movement - 40.47 m2								
Floor Coverings Res/Textile	Vinyl Tiles	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00H - R0008 - Distribution Board Cupboard - .28 m2								
						Note: No inspection of live electrical installation		
No Asbestos								
B00H - R0009 - Chemical Store - 16.96 m2								
Floor Coverings Res/Textile	Vinyl Tiles	16.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00H - R0010 - Laboratory L.S. - 90.69 m2								
Floor Coverings Res/Textile	Vinyl Tiles	91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00H - R0011 - Preparation - 31.04 m2								
Floor Coverings Res/Textile	Vinyl Tiles	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00H - R0012 - General Storeroom - 3.05 m2								
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00H - R0013 - General Storeroom - 12.79 m2								
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00H - R0014 - General Learning Space - 91.14 m2								

Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00H - R0015 - Cleaning Supplies Store - 3.6 m2							
No Asbestos							
B00H - R0016 - Distribution Board Cupboard - 10.68 m2							
No Asbestos							
B00H - R0017 - Movement - 59.47 m2							
No Asbestos							
B00H - R1001 - Seminar - 12.74 m2							
No Asbestos							
B00H - R1002 - Seminar - 11.92 m2							
No Asbestos							
B00H - R1003 - Cleaning Store - Distributed - .34 m2							
No Asbestos							
B00H - R1004 - Movement - 4.49 m2							
No Asbestos							
B00H - R1005 - Distribution Board Cupboard - .22 m2							
No Asbestos							
B00H - R1006 - Seminar - 11.85 m2							
No Asbestos							
B00H - R1007 - Seminar - 12.74 m2							
No Asbestos							
B00H - R1008 - Main Area - 329.56 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - (X25)						
B00H - R1009 - Librarian - 11.22 m2							
No Asbestos							
B00H - R1010 - Workroom - 17.74 m2							
No Asbestos							
B00H - R1011 - Staff - Toilet - 3.04 m2							
No Asbestos							
B00H - R1012 - Movement - 1.56 m2							
No Asbestos							
B00H - R1013 - Staff - Toilet - 3.06 m2							
No Asbestos							
B00H - R1014 - Main Area - 70.91 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00H - R1015 - No Access - 12.44 m2							
No Asbestos							
B00H - R1016 - No Access - 27.92 m2							
No Asbestos							
B00H - R1017 - Movement - 15.74 m2							
No Asbestos							
B00H - R1018 - Movement - 25.97 m2							
No Asbestos							
B00J - Science Learning - 1964 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Eaves Linings	Non Accessible Area						

Ceiling Voids	No Asbestos Found							
Ceiling Voids	No Asbestos Found							
Underfloor Voids	No Asbestos Found							
Underfloor Voids	No Asbestos Found							
Interior								
B00J - R0001 - Laboratory L.S. - 101.41 m2								
No Asbestos								
B00J - R0002 - Preparation - 21.12 m2								
Plant / Equipment - Flue	Fibre Cement Pipe	2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)	
B00J - R0003 - Staff Study - 52.44 m2								
No Asbestos								
B00J - R0004 - Preparation - 14.66 m2								
Floor Coverings Res/Textile	Vinyl Sheet							
B00J - R0005 - Preparation - 23.76 m2								
Plant / Equipment - Fume Cupboard	Flat AC Sheeting	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)	
B00J - R0006 - Laboratory L.S. - 93.48 m2								
Furniture / Fixtures	Compressed AC Sheet	1.5	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)	
B00J - R0007 - Cleaning Store - Distributed - 8.92 m2								
No Asbestos								
B00J - R0008 - Movement - 101.1 m2								
Floor Coverings Res/Textile	Vinyl Tiles							
B00J - R0009 - Cleaning Store - Distributed - .32 m2								
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)	
B00J - R0010 - Cleaning Store - Distributed - .28 m2								
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)	
B00J - R0011 - Distribution Board Cupboard - .38 m2								
						Note: No inspection of live electrical installation		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)	
B00J - R0012 - General Storeroom - 5.36 m2								
Wall Linings Internal - Infill	Flat AC Sheeting	6m2	Part of door	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00J - R0013 - Movement - 5.06 m2								
No Asbestos								
B00J - R1001 - Staff - Toilet - 7.14 m2								
No Asbestos								
B00J - R1002 - General Learning Space - 53.3 m2								
No Asbestos								
B00J - R1003 - General Learning Space - 52.57 m2								
No Asbestos								
B00J - R1004 - General Learning Space - 52.58 m2								
No Asbestos								
B00J - R1005 - General Learning Space - 52.57 m2								
No Asbestos								
B00J - R1006 - Preparation - 8.62 m2								
No Asbestos								
B00J - R1007 - Preparation - 16.55 m2								
No Asbestos								

B00J - R1008 - Laboratory L.S. - 84.19 m2							
Plant / Equipment - Fume Cupboard	Flat AC Sheeting	2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Furniture / Fixtures	Compressed AC Sheet	2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00J - R1009 - Movement - 64.43 m2							
No Asbestos							
B00J - R1010 - Cleaning Store - Distributed - .31 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00J - R1011 - Distribution Board Cupboard - .32 m2							
						Note: No inspection of live electrical installation	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00J - R1012 - Cleaning Store - Distributed - .28 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00J - R1013 - Cleaning Store - Distributed - 3.41 m2							
No Asbestos							
B00J - R9001 - Student Canteen - 57.17 m2							
No Asbestos							
B00J - R9002 - Staff - Toilet - 3.37 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - R9003 - Cleaning Store - Distributed - 4.73 m2							
No Asbestos							
B00J - R9004 - No Access - 10.33 m2							
No Asbestos							
B00J - R9005 - Pupil Entry - 30.39 m2							
No Asbestos							
B00J - R9006 - No Access - 34.66 m2							
Electrical - Backing Board	Resinous Board	0.5	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	0.5	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - Music - 1937 - Brick/Block							
Exterior							
External Wall Structure - Awnings	Flat AC Sheeting	2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Non Accessible Area						
Interior							
B00K - R0001 - Music Learning Space - 75.52 m2							
Ceiling Structures/Linings	Flat AC Sheeting	76m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
B00K - R0002 - Music Store - 5.57 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
B00K - R0003 - Distribution Board Cupboard - 5.08 m2							
						Note: No inspection of live electrical installation	
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0004 - Music Store - 23.04 m2							

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
B00K - R0005 - Music Learning Space - 73.18 m2							
Ceiling Structures/Linings	Flat AC Sheeting	74m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
B00L - Pupil Facilities - 1962 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00L - R0001 - Toilets-Girls - 64.07 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Partition Walls (Cubicles)	Compressed AC Sheet	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R0002 - Shower/Change - 17.93 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting	5m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R0003 - Toilets-Boys - 100.76 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Partition Walls (Cubicles)	Compressed AC Sheet	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00M - Technological & Applied Studies - 1959 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	60m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	Non Accessible Area						
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Interior							
B00M - R0005 - Welding Area - 6 m2							
No Asbestos							
B00M - R0007 - Dust Extraction Space - 7.62 m2							
No Asbestos							
B00M - R0009 - Materials Technology L.S. - 102.82 m2							
Ceiling Structures/Linings	Flat AC Sheeting	102.78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Packing	10m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00M - R0010 - Welding Store - 16.9 m2							
No Asbestos							
B00M - R0011 - T.A.S. Entry/Display - 18.64 m2							

Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00M - R0012 - Cleaning Store - Distributed - 2.81 m2							
No Asbestos							
B00M - R0013 - Staff Change - 3.63 m2							
No Asbestos							
B00M - R0014 - Staff - Toilet - 3.86 m2							
No Asbestos							
B00M - R0015 - Staff Kitchen - 8.95 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8.95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00M - R0016 - Staff Study - 16.47 m2							
No Asbestos							
B00M - R0017 - Resource/Project Store - 4.74 m2							
No Asbestos							
B00M - R0018 - Resource/Project Store - 12.64 m2							
No Asbestos							
B00M - R0019 - Design L.S. - 77.46 m2							
Ceiling Structures/Linings	Flat AC Sheeting	77.43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Packing	12m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00M - R0023 - Materials Technology L.S. - 104.89 m2							
Ceiling Structures/Linings	Packing	12m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	104.86m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00M - R0024 - Metal Technology Bay - 45.48 m2							
Wall Linings Internal	Flat AC Sheeting	15m2	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	45.47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Packing	12m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00M - R0025 - Materials Technology L.S. - 99.66 m2							
Ceiling Structures/Linings	Flat AC Sheeting	99.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Packing	12m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00M - R0026 - Wood Technology Bay - 35.13 m2							
Ceiling Structures/Linings	Flat AC Sheeting	35.11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Packing	12m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00M - R0027 - Materials Store - 21.51 m2							
Ceiling Structures/Linings	Flat AC Sheeting	21.51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Packing	12m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00M - R0028 - Movement - 21.22 m2							
No Asbestos							
B00N - Dormitory - 1990 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							

B00N - R0001 - Teacher Bedroom - 9.3 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0002 - Teacher Bathroom - 4.69 m2		
No Asbestos		
B00N - R0003 - Teacher Living Quarters - 24.28 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0004 - Teacher Living Quarters - 24.15 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0005 - Teacher Bedroom - 9.3 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0006 - Teacher Bathroom - 4.72 m2		
No Asbestos		
B00N - R0007 - Teacher Bathroom - 4.72 m2		
No Asbestos		
B00N - R0008 - Teacher Bathroom - 9.24 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0009 - Teacher Living Quarters - 24.09 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0010 - Movement - 19.12 m2		
No Asbestos		
B00N - R0011 - Senior Dormitory - 9.72 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0012 - Senior Dormitory - 9.78 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0013 - Senior Dormitory - 9.91 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0014 - Senior Dormitory - 9.72 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0015 - Senior Dormitory - 9.72 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0016 - Teacher Bathroom - 2.64 m2		
No Asbestos		
B00N - R0017 - Duty Room - 9.72 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0018 - Duty Room - 9.66 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0019 - Teacher Bathroom - 2.71 m2		
No Asbestos		
B00N - R0020 - Cleaning Supplies Store - 9.69 m2		
No Asbestos		
B00N - R0021 - Movement - 16.65 m2		
No Asbestos		
B00N - R0022 - Movement - 55.08 m2		

No Asbestos		
B00N - R0023 - Teacher Bathroom - 4.72 m2		
No Asbestos		
B00N - R0024 - Teacher Bedroom - 8.95 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0025 - Teacher Living Quarters - 23.92 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0026 - Teacher Living Quarters - 23.94 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0027 - Teacher Bedroom - 9.22 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0028 - Teacher Bathroom - 4.67 m2		
No Asbestos		
B00N - R0029 - Teacher Bathroom - 4.67 m2		
No Asbestos		
B00N - R0030 - Teacher Bedroom - 9.16 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0031 - Teacher Living Quarters - 24.18 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0032 - Res. Common Room - 59.43 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0033 - Dorm Monitors Room - 8.05 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0034 - Dormitory - 50.63 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0035 - Res. Locker Area - 13.2 m2		
No Asbestos		
B00N - R0036 - Distribution Board Cupboard - .84 m2		Note: No inspection of live electrical installation
No Asbestos		
B00N - R0037 - Teacher Bathroom - 4.72 m2		
No Asbestos		
B00N - R0038 - Teacher Bedroom - 9.31 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0039 - Teacher Living Quarters - 26.46 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0040 - Teacher Living Quarters - 25.78 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0041 - Teacher Bedroom - 9.27 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0042 - Teacher Bathroom - 4.72 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0043 - Res. Locker Area - 14.26 m2		

No Asbestos		
B00N - R0044 - Dormitory - 51.07 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0045 - Dorm Monitors Room - 7.67 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0046 - Dorm Monitors Room - 7.67 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0047 - Dormitory - 51.31 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0048 - Movement - 184.32 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R1001 - Dormitory - 51.18 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R1002 - Dorm Monitors Room - 7.56 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R1003 - Distribution Board Cupboard - .9 m2		Note: No inspection of live electrical installation
No Asbestos		
B00N - R1004 - Residential Showers - 45.12 m2		
No Asbestos		
B00N - R1005 - Dormitory - 51.18 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R1006 - Dorm Monitors Room - 7.61 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R1007 - Dorm Monitors Room - 7.5 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R1008 - Dormitory - 51.18 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R1009 - Movement - 5.52 m2		
No Asbestos		
B00N - R1010 - Senior Dormitory - 9.72 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R1011 - Senior Dormitory - 10.08 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R1012 - Senior Dormitory - 9.78 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R1013 - Senior Dormitory - 9.73 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R1014 - Senior Dormitory - 9.72 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R1015 - Senior Dormitory - 10.05 m2		

Floor Coverings Res/Textile	No Asbestos Found						
B00N - R1016 - Senior Dormitory - 9.84 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00N - R1017 - Senior Dormitory - 9.6 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00N - R1018 - Movement - 93.55 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00N - R1019 - Plant - 11.16 m2							
No Asbestos							
B00O - Pupil Facilities - 1990 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	15m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Eaves Linings	Flat AC Sheeting						
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00O - R0001 - Clinic - Girls - 53.95 m2							
No Asbestos							
B00O - R0002 - Administration - Clerical - 6.42 m2							
No Asbestos							
B00O - R0003 - Movement - 3.53 m2							
No Asbestos							
B00O - R0004 - Staff Kitchen - 4.98 m2							
No Asbestos							
B00O - R0005 - Shower/Change - 6.39 m2							
No Asbestos							
B00O - R0006 - Movement - 2.8 m2							
No Asbestos							
B00O - R0007 - No Access - 7.21 m2							
No Asbestos							
B00O - R0008 - Teacher Bedroom - 12.39 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00O - R0009 - Teacher Bathroom - 3.94 m2							
No Asbestos							
B00O - R0010 - Teacher Living Quarters - 23.91 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00O - R0011 - Residential Kitchen - 9.99 m2							
No Asbestos							
B00O - R0012 - Residential Laundry - 4.65 m2							
No Asbestos							
B00O - R0013 - Distribution Board Cupboard - .71 m2							
No Asbestos							Note: No inspection of live electrical installation
No Asbestos							
B00O - R0014 - Clinic-Waiting - 19.29 m2							
No Asbestos							
B00O - R0015 - Movement - 8.4 m2							

No Asbestos							
B00O - R0016 - Clinic - Boys - 64.51 m2							
No Asbestos							
B00O - R0017 - Clinic - Boys - 5 m2							
No Asbestos							
B00O - R0018 - Teacher Living Quarters - 24 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00O - R0019 - General Storeroom - 5.86 m2							
No Asbestos							
B00O - R0020 - Movement - 2.87 m2							
No Asbestos							
B00O - R0021 - Shower/Change - 6.44 m2							
No Asbestos							
B00O - R0022 - Teacher Bedroom - 12.27 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00O - R0023 - Teacher Bathroom - 3.9 m2							
No Asbestos							
B00Q - Multi Purpose Facilities - 1981 - Brick/Veneer							
Exterior							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00Q - R0001 - Shower/Change - 33.79 m2							
Wall Linings Internal	Flat AC Sheeting	25m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00Q - R0002 - Movement - 5.53 m2							
No Asbestos							
B00Q - R0003 - General Storeroom - 55.45 m2							
No Asbestos							
B00Q - R0004 - Stage - 65.82 m2							
No Asbestos							
B00Q - R0005 - Movement - 5.52 m2							
No Asbestos							
B00Q - R0006 - Shower/Change - 33.66 m2							
Wall Linings Internal	Flat AC Sheeting	20m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubides)	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00Q - R0007 - Toilets-Girls - 14.97 m2							
Partition Walls (Cubides)	Compressed AC Sheet	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	15m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00Q - R0008 - No Access - 3.46 m2							
Wall Linings Internal	Flat AC Sheeting	10m2	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00Q - R0009 - Movement - 3.07 m2							
Wall Linings Internal	Flat AC Sheeting	15m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00Q - R0010 - Entry - 15.53 m2							

Floor Coverings Res/Textile	Vinyl Tiles						
B00Q - R0011 - Staff Kitchen - 15.02 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00Q - R0012 - Staff Shower - 9.05 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00Q - R0013 - Staff Shower - 8.98 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00Q - R0014 - No Access - 19.59 m2							
No Asbestos							
B00Q - R0015 - Multi-Purpose Space - 483.99 m2							
No Asbestos							
B00Q - R0016 - Sport Equipment Store - 23.49 m2							
No Asbestos							
B00Q - R0017 - Chair Store - 30.84 m2							
No Asbestos							
B00Q - R0018 - Entry - 15.53 m2							
No Asbestos							
B00Q - R0019 - Distribution Board Cupboard - 3.53 m2							
						Note: No inspection of live electrical installation	
No Asbestos							
B00Q - R0020 - Movement - 2.89 m2							
Wall Linings Internal	Flat AC Sheeting	10m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00Q - R0021 - Toilets-Boys - 15.11 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00Q - R0022 - Movement - 192.49 m2							
No Asbestos							
B00R - Agricultural Science - 1987 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	Surrounding	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
Interior							
B00R - R0004 - Performance Workspace - 142.34 m2							
No Asbestos							
B00S - Staff Facilities - 1926 - Timber							
Exterior							
Underfloor Voids	Non Accessible Area						
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00S - R0001 - Staff Study - 18.91 m2							
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00S - R0002 - Pupil Entry - 24.41 m2							
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00S - R0003 - Staff Study - 18.73 m2							

Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00S - R0004 - Staff Study - 9.18 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Compressed AC Sheet	15m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00S - R0005 - Staff Kitchen - 14.67 m2							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles						
B00S - R0006 - General Storeroom - 4.13 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00S - R0007 - Staff - Toilet - 2.04 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00S - R0008 - Movement - 9.59 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00Y - Other - Vacant - 1950 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Wall Cladding	Flat AC Sheeting						
Underfloor Voids	AC Fragments/Debris	110	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)
Interior							
B00Y - R0001 - Other-Vacant - 25.5 m2							
No Asbestos							
B00Y - R0002 - Other-Vacant - 9.34 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9.33m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00Y - R0003 - Other-Vacant - 18.92 m2							
No Asbestos							
B00Y - R0004 - Other-Vacant - 9.49 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9.49m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00Z - Dormitory - 2000 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00Z - R0001 - Dormitory - 8.29 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00Z - R0002 - Dormitory - 8.26 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00Z - R0003 - Movement - 2.16 m2							
Floor Coverings Res/Textile	No Asbestos Found						

B00Z - R0004 - Dormitory - 59.01 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00Z - R0005 - Dormitory - 7.5 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00Z - R0006 - Movement - 7.23 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00Z - R0007 - Movement - 5.4 m2		
No Asbestos		
B00Z - R0008 - Toilets - Girls - 26.33 m2		
No Asbestos		
B00Z - R0009 - Movement - 7.07 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00Z - R0010 - Dormitory - 7.44 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00Z - R0011 - Dormitory - 59.39 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00Z - R0012 - Dormitory - 8.25 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00Z - R0013 - Dormitory - 8.19 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00Z - R0014 - Movement - 2.24 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00Z - R0015 - Movement - 7.77 m2		
No Asbestos		
B00Z - R0016 - Multi-Purpose Space - 98.11 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00Z - R0017 - Office/Store - 7.8 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00Z - R0018 - Staff Kitchen - 4.75 m2		
No Asbestos		
B00Z - R0019 - Distribution Board Cupboard - .99 m2		Note: No inspection of live electrical installation
No Asbestos		
B00Z - R0020 - Dormitory - 9.69 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00Z - R0021 - Teacher Living Quarters - 17.63 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00Z - R0022 - Teacher Living Quarters - 11.43 m2		
No Asbestos		
B00Z - R0023 - Teacher Living Quarters - 13.93 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00Z - R0024 - Movement - 8.25 m2		
Floor Coverings Res/Textile	No Asbestos Found	

B00Z - R0025 - Residential Showers - 5.05 m2							
No Asbestos							
B00Z - R0026 - Dormitory - 7.53 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00Z - R0027 - Movement - 7.11 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00Z - R0028 - Movement - 5.45 m2							
No Asbestos							
B00Z - R0029 - Toilets - Girls - 26.43 m2							
No Asbestos							
B00Z - R0030 - Dormitory - 59.54 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00Z - R0031 - Dormitory - 8.18 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00Z - R0032 - Dormitory - 8.33 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00Z - R0033 - Movement - 2.37 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00Z - R0034 - Movement - 7.12 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00Z - R0035 - Dormitory - 7.52 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00Z - R0036 - Dormitory - 59.3 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00Z - R0037 - Dormitory - 8.27 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00Z - R0038 - Dormitory - 8.24 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00Z - R0039 - Movement - 2.39 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00Z - R0040 - Movement - 7.3 m2							
No Asbestos							
B00Z - R0041 - Movement - 27.53 m2							
No Asbestos							
B00Z - R0042 - Movement - 27.53 m2							
No Asbestos							
B0A1 - Staff Facilities - 1960 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	80m2	surrounding	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids	No Asbestos Found						

Ceiling Voids	No Asbestos Found						
Interior							
B0A1 - R0001 - Staff Kitchen - 20.49 m2							
Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A1 - R0002 - General Assistants - 10.5 m2							
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A1 - R0003 - General Storeroom - 10.43 m2							
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A1 - R0004 - General Storeroom - 10.43 m2							
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A1 - R0005 - Movement - 8.96 m2							
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A1 - R0006 - Movement - 1.83 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A1 - R0007 - No Access - 12.29 m2							
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A1 - R0008 - Cleaning Store - Distributed - 2.46 m2							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A1 - R0009 - No Access - 11.44 m2							
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A1 - R0010 - General Storeroom - 27.96 m2							
No Asbestos							
B0A1 - R0011 - L.P.G Store - .59 m2							
No Asbestos							
B0A1 - R0012 - Distribution Board Cupboard - 12.12 m2						Note: No inspection of live electrical installation	
No Asbestos							
B0A1 - R0013 - No Access - 13.1 m2							
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A1 - R0014 - No Access - 15.14 m2							
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A1 - R0015 - No Access - 63.91 m2							
Floor Coverings Res/Textile	Vinyl Tiles	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A1 - R0016 - Staff Shower - 8.53 m2							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A1 - R0017 - Staff Shower - 10.51 m2							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A1 - R0018 - Movement - 16.25 m2							
Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0AA - Building Services - 1960 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						

Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	60m2	Surrounding	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B0AA - R0001 - No Access - 8.73 m2							
No Asbestos							
B0AA - R0002 - Other-Vacant - .53 m2							
No Asbestos							
B0AA - R0003 - Staff - Toilet - 4.05 m2							
No Asbestos							
B0AA - R0004 - Movement - .86 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B0AA - R0005 - General Storeroom - 15.38 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B0AA - R0006 - General Storeroom - 9.44 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B0AA - R0007 - General Storeroom - 9.58 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B0AA - R0008 - General Storeroom - 9.54 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B0AA - R0009 - General Storeroom - 12.97 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B0AA - R0010 - General Storeroom - 9.69 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B0AA - R0011 - General Storeroom - 47.35 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B0B1 - Agricultural Science - 1950 - Steel							
Exterior							
Furniture / Fixtures - Cistern	Fibre Cement Casting (Monocrete)	2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	30m2	South & East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B0B1 - R0001 - Other-Vacant - 28.18 m2							
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0B1 - R0002 - Ancillary Staff - 307.76 m2							
Wall Linings Internal	Flat AC Sheeting	15m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0BB - Building Services - 1985 - Steel							
Exterior							
Plumbing / Pipework	Fibre Cement Pipe	25	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

External Roof Structure	Corrugated AC Sheeting	470	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B0BB - R0001 - General Storeroom - 468.08 m2							
No Asbestos							
B0BB - R0002 - Chair Store - 391.19 m2							
No Asbestos							
B0BB - R0003 - Chair Storeroom - 35.39 m2							
No Asbestos							
B0BB - R0004 - Chair Store - 8.51 m2							
No Asbestos							
B0BB - R0005 - Chair Store - 13.44 m2							
No Asbestos							
B0C1 - Dormitory/Agricultural Science - 1987 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	Surrounding	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B0C1 - R0001 - Dormitory - 8.62 m2							
No Asbestos							
B0C1 - R0002 - Res. Common Room - 16.11 m2							
No Asbestos							
B0C1 - R0003 - Dormitory - 7.82 m2							
No Asbestos							
B0C1 - R0004 - Dormitory - 7.16 m2							
No Asbestos							
B0C1 - R0005 - Seminar - Type 1 - 25.7 m2							
Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C1 - R0006 - General Storeroom - 16.22 m2							
Wall Linings Internal	Flat AC Sheeting						
B0C1 - R0007 - Residential Coolroom - 4.15 m2							
No Asbestos							
B0C1 - R0008 - Security Store - 2.85 m2							
No Asbestos							
B0C1 - R0009 - General Storeroom - 22.16 m2							
Wall Linings Internal	Flat AC Sheeting						
B0C1 - R0010 - Staff - Toilet - 3.46 m2							
No Asbestos							
B0C1 - R0011 - Staff - Toilet - 3.49 m2							
No Asbestos							
B0C1 - R0012 - Movement - 10.79 m2							

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C1 - R0013 - Residential Showers - 1.43 m2							
No Asbestos							
B0C1 - R0014 - Dorm Monitors Room - 6.47 m2							
No Asbestos							
B0CC - Building Services - 1950 - Steel							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	0.2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids - Slab on Ground	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B0CC - R0001 - General Storeroom - 32.46 m2							
Non Accessible							
B0CC - R0002 - General Storeroom - 16.19 m2							
Non Accessible							
B0CC - R0003 - Staff - Toilet - 16.05 m2							
Non Accessible							
B0D1 - Electrical Services - 1968 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B0D1 - R0001 - Main Switchroom - 1.52 m2							
Electrical - Backing Board	Resinous Board	3	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	3	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0DD - Other-Vacant - 1950 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	25m2	Surrounding	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						
Ceiling Voids - Flat Roof	No Asbestos Found						
New XYZ	Flat AC Sheeting	15	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						

Interior							
B0DD - R0001 - Other-Vacant - 3.51 m2							
No Asbestos							
B0DD - R0002 - Other-Vacant - 6.15 m2							
No Asbestos							
B0DD - R0003 - Other-Vacant - 9 m2							
No Asbestos							
B0DD - R0004 - Other-Vacant - 3.26 m2							
No Asbestos							
B0DD - R0005 - Other-Vacant - 10.53 m2							
Plant / Equipment - Heater Bank	Millboard	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B0DD - R0006 - Other-Vacant - 5.83 m2							
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0E1 - Agricultural Science - 1960 - Steel							
Exterior							
Underfloor Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B0E1 - R0001 - Animal Space - 119.3 m2							
No Asbestos							
B0E1 - R0002 - Ancillary Staff - 40.07 m2							
No Asbestos							
B0F1 - General Learning - 1964 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	80.m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids	Flat AC Sheeting	40	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Interior							
B0F1 - R0001 - Staff - Toilet - 4.16 m2							
No Asbestos							
B0F1 - R0002 - Staff - Toilet - 2.22 m2							
No Asbestos							
B0F1 - R0003 - General Storeroom - 1.81 m2							
No Asbestos							
B0F1 - R0004 - Deputy Principal Office - 17.96 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B0F1 - R0005 - General Storeroom - 13.39 m2							
No Asbestos							
B0F1 - R0006 - General Storeroom - 8.69 m2							
No Asbestos							
B0F1 - R0007 - Staff - Toilet - 4.08 m2							
No Asbestos							

B0F1 - R0008 - Movement - 37.82 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	37.81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B0F1 - R0009 - Duplicating Workroom - 27.51 m2							
No Asbestos							
B0F1 - R0010 - Movement - 3.82 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B0F1 - R0011 - Administration - Clerical - 4.25 m2							
No Asbestos							
B0F1 - R0012 - Movement - 104.61 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0F1 - R0013 - General Storeroom - 4.08 m2							
No Asbestos							
B0F1 - R0014 - Distribution Board Cupboard - .34 m2							
						Note: No inspection of live electrical installation	
No Asbestos							
B0F1 - R0015 - Cleaning Store - Distributed - .27 m2							
No Asbestos							
B0F1 - R0016 - Cleaning Supplies Store - 6.2 m2							
No Asbestos							
B0F1 - R0018 - General Learning Space - 52.57 m2							
No Asbestos							
B0F1 - R0019 - General Learning Space - 52.57 m2							
No Asbestos							
B0F1 - R0020 - Senior Study - 25.7 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B0F1 - R0022 - Movement - 22.62 m2							
No Asbestos							
B0F1 - R0023 - Commonroom - 79.2 m2							
No Asbestos							
B0F1 - R1001 - Staff - Toilet - 1.5 m2							
No Asbestos							
B0F1 - R1002 - Cleaning Store - Distributed - 4.25 m2							
No Asbestos							
B0F1 - R1003 - Movement - 69.38 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B0F1 - R1004 - General Learning Space - 52.57 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B0F1 - R1005 - General Learning Space - 52.57 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B0F1 - R1006 - General Learning Space - 52.58 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B0F1 - R1007 - General Learning Space - 52.58 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B0F1 - R1008 - Cleaning Store - Distributed - .31 m2							

No Asbestos							
B0F1 - R1009 - Distribution Board Cupboard - .31 m2							Note: No inspection of live electrical installation
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0F1 - R1010 - Movement - 33.64 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B0F1 - R1011 - Movement - 4.06 m2							
No Asbestos							
B0F1 - R1012 - General Storeroom - 9.69 m2							
No Asbestos							
B0F1 - R1013 - Staff Study - 10.52 m2							
No Asbestos							
B0F1 - R1014 - Computer Learning Space - 79.52 m2							
No Asbestos							
B0F1 - R1015 - General Storeroom - 10.83 m2							
No Asbestos							
B0F1 - R1016 - Security Store - 14.6 m2							
No Asbestos							
B0F1 - R9001 - Staff Study - 10.21 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0F1 - R9002 - Movement - 5.1 m2							
No Asbestos							
B0F1 - R9003 - Movement - 1.3 m2							
No Asbestos							
B0F1 - R9004 - General Storeroom - 13.84 m2							
Electrical - Backing Board	Resinous Board	0.2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	0.2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0FF - Agricultural Science - 1970 - Steel							
Exterior							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B0FF - R0001 - Movement - 2.24 m2							
Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Flat AC Sheeting	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Flat AC Sheeting	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0FF - R0002 - Ancillary Staff - 157.5 m2							
Wall Linings Internal	Flat AC Sheeting	25m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0FF - R0003 - General Storeroom - 13.18 m2							
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0FF - R0004 - Other-Vacant - 13.07 m2							
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0G1 - Agricultural Science - 1975 - Steel							
Exterior							
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Non Accessible Area						
Interior							
B0G1 - R0001 - Ancillary Staff - 233.54 m2							
No Asbestos							
B0G1 - R0002 - Machine Storage - 105.97 m2							
No Asbestos							
B0G1 - R0003 - General Storeroom - 15.8 m2							
No Asbestos							
B0G1 - R0004 - General Storeroom - 30.61 m2							
Ceiling Structures/Linings	Flat AC Sheeting	30.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting						
B0G1 - R0005 - General Storeroom - 6.82 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6.82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting						
B0G1 - R0006 - General Storeroom - 6.56 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	6.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0G1 - R0007 - Movement - 3.23 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3.23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting						
B0H1 - Agricultural Science - 1948 - Steel							
Exterior							
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B0H1 - R0001 - Machine Storage - 166.56 m2							
Wall Linings Internal	Flat AC Sheeting	10m2	South, West, Lower portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0I1 - Agricultural Science - 1930 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							

B011 - R0001 - Other-Vacant - 50.27 m2							
No Asbestos							
B011 - R0002 - Ancillary Staff - 17.07 m2							
No Asbestos							
B011 - R0003 - Movement - 13.57 m2							
No Asbestos							
B011 - R0004 - Ancillary Staff - 8.16 m2							
No Asbestos							
B011 - R0005 - Other-Vacant - 16.94 m2							
No Asbestos							
B011 - R0006 - Other-Vacant - 50.37 m2							
No Asbestos							
B011 - R0007 - Movement - 20.5 m2							
Wall Linings Internal	Flat AC Sheeting	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0J1 - Staff Facilities - 1975 - Brick/Block							
Exterior							
Eaves Linings	Insulation Material	24.m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B0J1 - R0001 - Ancillary Staff - 27.64 m2							
Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0J1 - R0002 - Ancillary Staff - 27.4 m2							
Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0J1 - R0003 - Ancillary Staff - 62.89 m2							
Ceiling Structures/Linings	Flat AC Sheeting	63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0J1 - R0004 - Machine Storage - 13.07 m2							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0K1 - Agricultural Science - 1948 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	15m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B0K1 - R0001 - Ancillary Staff - 54.81 m2							
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0K1 - R0002 - Movement - 23.14 m2							
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0K1 - R0003 - Ancillary Staff - 53.49 m2							
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B0L1 - Agricultural Science - 1950 - Steel

Exterior

Ceiling Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	Non Accessible Area	

Interior

B0L1 - R0001 - Machine Storage - 83.1 m2

No Asbestos

B0L1 - R0002 - General Storeroom - 34.81 m2

No Asbestos

B0L1 - R0003 - General Storeroom - 28 m2

No Asbestos

B0L1 - R0004 - Other-Vacant - 5.5 m2

No Asbestos

B0L1 - R0005 - Machine Storage - 67.81 m2

No Asbestos

B0N1 - Agricultural Science - 1950 - Steel

Exterior

Wall Cladding	Corrugated AC Sheeting	
Material - Stored / Debris Material	Corrugated AC Sheeting	
Ceiling Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	Non Accessible Area	

Interior

B0N1 - R0001 - Movement - 9.51 m2

Wall Linings Internal	Flat AC Sheeting	8m2	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------	------------------	-----	------	--------------------	---------	--------------------	-----------------------------

B0N1 - R0002 - Movement - 8.7 m2

No Asbestos

B0N1 - R0003 - Ancillary Staff - 19.81 m2

No Asbestos

B0N1 - R0004 - Ancillary Staff - 20.03 m2

No Asbestos

B0N3 - Pupil Facilities - 1964 - Brick/Block

Exterior

Ceiling Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	

Interior

B0N3 - R0001 - Residential Laundry - 63.18 m2

Wall Linings Internal	Flat AC Sheeting	
-----------------------	------------------	--

B0N3 - R0002 - Cleaning Store - Distributed - 4 m2

No Asbestos

B0N3 - R0003 - Staff - Toilet - 1.5 m2

No Asbestos

B0N3 - R0004 - Residential Laundry - 3.96 m2

No Asbestos

B0N3 - R0005 - General Storeroom - 4.84 m2		
Wall Linings Internal	Flat AC Sheeting	
B0N3 - R0006 - No Access - 14.65 m2		
No Asbestos		
B0N4 - Pupil Facilities - 1913 - Timber		
Exterior		
Wall Cladding	Flat AC Sheeting	
Ceiling Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B0N4 - R0001 - General Storeroom - 46.74 m2		
Floor Coverings Res/Textile	Vinyl Tiles	
B0N4 - R0002 - Movement - 12.48 m2		
No Asbestos		
B0O1 - Agricultural Science - 1975 - Steel		
Exterior		
Ceiling Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	Non Accessible Area	
Interior		
B0O1 - R0001 - Machine Storage - 128.13 m2		
No Asbestos		
B0P1 - Building Services - 1968 - Brick/Block		
Exterior		
Ceiling Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	Non Accessible Area	
Interior		
B0P1 - R0001 - General Storeroom - 20.62 m2		
No Asbestos		
B0P1 - R0002 - No Access - 5.42 m2		
No Asbestos		
B0P1 - R0003 - No Access - 5.76 m2		
No Asbestos		
B0Q1 - Agricultural Science - 1985 - Steel		
Exterior		
Ceiling Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	Non Accessible Area	
Interior		
B0Q1 - R0001 - Other-Vacant - 68.75 m2		
No Asbestos		
B0Q1 - R0002 - Movement - 32.95 m2		
No Asbestos		

B0R1 - Administration - 1948 - Brick/Block

Exterior

Eaves Linings	Flat AC Sheeting	40m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found						

Interior

B0R1 - R0001 - General Storeroom - 2.83 m2

Non Accessible							
----------------	--	--	--	--	--	--	--

B0R1 - R0002 - General Assistants - 21.55 m2

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	------------------	------	------------	--------------------	---------	--------------------	---

B0R1 - R0003 - No Access - 3.4 m2

Non Accessible							
----------------	--	--	--	--	--	--	--

B0R1 - R0004 - Other - D.E.T. Admin - 49.78 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

B0R1 - R0005 - Other - D.E.T. Admin - 26.7 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

B0R1 - R0006 - General Storeroom - 19.76 m2

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	------------------	------	------------	--------------------	---------	--------------------	---

B0R1 - R0007 - Other - D.E.T. Admin - 26.64 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

B0R1 - R0008 - Movement - 25.57 m2

Ceiling Structures/Linings	Flat AC Sheeting	1m2	North-West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------	-----------------------------

B0R1 - R0009 - Movement - 1.36 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

B0R1 - R0011 - Movement - 2.11 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

B0R1 - R0012 - Movement - 14.01 m2

Floor Coverings Res/Textile	Vinyl Sheet						
-----------------------------	-------------	--	--	--	--	--	--

B0R1 - R0013 - Staff - Toilet - 9.24 m2

Non Accessible							
----------------	--	--	--	--	--	--	--

B0R1 - R0014 - Other-Vacant - 15.11 m2

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	------	------------	--------------------	---------	--------------------	-----------------------------

Floor Coverings Res/Textile	Vinyl Tiles						
-----------------------------	-------------	--	--	--	--	--	--

B0R1 - R0015 - Other-Vacant - 2.31 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

B0R1 - R0016 - Movement - 1.04 m2

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------	---

B0R1 - R0017 - Movement - 5.85 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

B0R1 - R0018 - Lift - 1.04 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

B0R1 - R0019 - Movement - 42.95 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

B0R1 - R1001 - Other-Vacant - 13.06 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

B0R1 - R1002 - Other-Vacant - 9.16 m2

No Asbestos							
B0R1 - R1003 - Lift - 1.04 m2							
No Asbestos							
B0R1 - R1004 - Other-Vacant - 10.26 m2							
No Asbestos							
B0R1 - R1005 - General Storeroom - 13.38 m2							
No Asbestos							
B0R1 - R1006 - Movement - 2.81 m2							
No Asbestos							
B0R1 - R1007 - Other-Vacant - 26.45 m2							
No Asbestos							
B0R1 - R1008 - General Storeroom - 28.35 m2							
Wall Linings Internal	Compressed AC Sheet	1m2	Adjacent Fume Cupboard	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0R1 - R1009 - Other - D.E.T. Admin - 29.12 m2							
No Asbestos							
B0R1 - R1010 - Movement - 11.65 m2							
No Asbestos							
B0R1 - R1011 - Movement - 29.45 m2							
No Asbestos							
B0R1 - R1012 - Music Store - 26.39 m2							
No Asbestos							
B0R1 - R1013 - No Access - 12.29 m2							
No Asbestos							
B0R1 - R1014 - Other-Vacant - 14.36 m2							
Material - Stored / Debris Material	AC Fragments/Debris	1	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B0R1 - R1015 - Other-Vacant - 1.6 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B0S1 - Administration - 1968 - Brick/Block							
Exterior							
Gable Verge Lining	Flat AC Sheeting	40m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found						
External Wall Structure - Awnings	Flat AC Sheeting						
Window	Mastic	500	Throughout	Friable Asbestos (5)	Low (1)	High Priority (6-8)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Interior							
B0S1 - R0001 - Other - D.E.T. Admin - .48 m2							
No Asbestos							
B0S1 - R0002 - Other - D.E.T. Admin - 7.43 m2							
No Asbestos							
B0S1 - R0003 - Other - D.E.T. Admin - 3.85 m2							
No Asbestos							
B0S1 - R0004 - Other - D.E.T. Admin - 6.17 m2							
No Asbestos							
B0S1 - R0005 - Other - D.E.T. Admin - 5.86 m2							
No Asbestos							

B0S1 - R0006 - Other - D.E.T. Admin - 22.52 m2							
Window	Mastic		Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0S1 - R0007 - Other - D.E.T. Admin - 15.54 m2							
Window	Mastic		Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0S1 - R0008 - Other - D.E.T. Admin - 15.3 m2							
Window	Mastic		Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0S1 - R0009 - Other - D.E.T. Admin - 15.39 m2							
Window	Mastic		Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0S1 - R0010 - Other - D.E.T. Admin - 18.51 m2							
Window	Mastic		Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0S1 - R0011 - Other - D.E.T. Admin - 12.9 m2							
Window	Mastic		Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0S1 - R0012 - Other - D.E.T. Admin - 93.95 m2							
No Asbestos							
B0S1 - R0013 - Other - D.E.T. Admin - .83 m2							
No Asbestos							
B0S1 - R0014 - Other - D.E.T. Admin - 5.22 m2							
No Asbestos							
B0S1 - R0015 - Other - D.E.T. Admin - 16.41 m2							
No Asbestos							
B0S1 - R0016 - Other - D.E.T. Admin - 2.83 m2							
No Asbestos							
B0S1 - R0017 - Other - D.E.T. Admin - 2.32 m2							
No Asbestos							
B0S1 - R1001 - Other - D.E.T. Admin - 152.45 m2							
No Asbestos							
B0S1 - R1002 - Other - D.E.T. Admin - 9.44 m2							
No Asbestos							
B0S1 - R1003 - Other - D.E.T. Admin - 43.09 m2							
No Asbestos							
B0S1 - R1004 - Other - D.E.T. Admin - 5 m2							
No Asbestos							
B0S1 - R1005 - Other - D.E.T. Admin - 8.31 m2							
No Asbestos							
B0S1 - R1006 - Other - D.E.T. Admin - 11.04 m2							
No Asbestos							
B0S1 - R1007 - Other - D.E.T. Admin - 2.95 m2							
No Asbestos							
B0S1 - R1008 - Other - D.E.T. Admin - .87 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Reinspect / Delete	AC Fragments/Debris	1	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	1	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0S1 - R1009 - Other - D.E.T. Admin - 17.26 m2							
No Asbestos							

B0S1 - R1010 - Other - D.E.T. Admin - 17.24 m2							
No Asbestos							
B0T1 - Library - 1969 - Brick/Block							
Exterior							
Window	Mastic						
Ceiling Voids - Pitched Roof	No Asbestos Found						
Underfloor Voids	AC Fragments/Debris	0.5	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B0T1 - R0001 - Librarian - 14.38 m2							
No Asbestos							
B0T1 - R0002 - No Access - 18.17 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B0T1 - R0003 - Main Area - 82.09 m2							
No Asbestos							
B0T1 - R0004 - Movement - 141.09 m2							
Ceiling Structures/Linings	Flat AC Sheeting	142m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	80m2	Upper Portion, North	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B0T1 - R0005 - Other - Regional Use - 16.03 m2							
No Asbestos							
B0T1 - R0006 - Other - Regional Use - 22.98 m2							
No Asbestos							
B0T1 - R0007 - Other - Regional Use - 13.06 m2							
No Asbestos							
B0T1 - R0008 - Other - Regional Use - 35.53 m2							
No Asbestos							
B0T1 - R0009 - Other - Regional Use - 14.07 m2							
No Asbestos							
B0T1 - R0010 - Other - Regional Use - 86.47 m2							
No Asbestos							
B0T1 - R0011 - Other - Regional Use - 12.29 m2							
No Asbestos							
B0T1 - R0012 - Other - Regional Use - 6.11 m2							
No Asbestos							
B0T1 - R0013 - Other - Regional Use - 12.27 m2							
No Asbestos							
B0T1 - R0014 - Other - Regional Use - 4.55 m2							
No Asbestos							
B0T1 - R0015 - Other - Regional Use - 29.51 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B0T1 - R0016 - No Access - 5.19 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B0T1 - R0017 - No Access - 1.58 m2							
Non Accessible							
B0T1 - R0018 - Movement - 80.69 m2							
Ceiling Structures/Linings	Flat AC Sheeting	81m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)

Wall Linings Internal	Flat AC Sheeting	60m2	Upper portion, South	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B0T1 - R0019 - Other - D.E.T. Admin - 51.05 m2							
No Asbestos							
B0T1 - R0020 - Other - Regional Use - 3.2 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0T1 - R0021 - Other - D.E.T. Admin - 1.33 m2							
No Asbestos							
B0T1 - R0022 - Other - D.E.T. Admin - 5.68 m2							
No Asbestos							
B0T1 - R0023 - Other - D.E.T. Admin - 2.07 m2							
No Asbestos							
B0T1 - R0024 - Other - D.E.T. Admin - 1.13 m2							
No Asbestos							
B0T1 - R0025 - Other - D.E.T. Admin - 13.03 m2							
No Asbestos							
B0T1 - R0026 - Other - D.E.T. Admin - 7.33 m2							
No Asbestos							
B0T1 - R0027 - Other - D.E.T. Admin - 5.91 m2							
No Asbestos							
B0T1 - R0028 - Other - D.E.T. Admin - 3.2 m2							
No Asbestos							
B0T1 - R0029 - Other - D.E.T. Admin - 6.65 m2							
No Asbestos							
B0T1 - R0030 - Other - D.E.T. Admin - 10.45 m2							
No Asbestos							
B0T1 - R0031 - Other - D.E.T. Admin - 6.58 m2							
No Asbestos							
B0T1 - R0032 - Other - D.E.T. Admin - 41.36 m2							
No Asbestos							
B0T1 - R0033 - No Access - 7.24 m2							
No Asbestos							
B0T1 - R0034 - Other - D.E.T. Admin - 1.57 m2							
No Asbestos							
B0T1 - R0035 - Other - D.E.T. Admin - 13.23 m2							
No Asbestos							
B0T1 - R0036 - Other - D.E.T. Admin - 10.95 m2							
No Asbestos							
B0T1 - R0037 - Other - D.E.T. Admin - 1.82 m2							
No Asbestos							
B0T1 - R0038 - Other - D.E.T. Admin - 10.12 m2							
No Asbestos							
B0T1 - R0039 - Other - D.E.T. Admin - 45.94 m2							
No Asbestos							
B0T1 - R0040 - Other - D.E.T. Admin - 26.45 m2							
No Asbestos							
B0T1 - R0041 - Other - D.E.T. Admin - 13.23 m2							
No Asbestos							
B0T1 - R0042 - Other - D.E.T. Admin - 13.22 m2							
No Asbestos							
B0T1 - R0043 - Other - Regional Use - 6.75 m2							

No Asbestos							
B0T1 - R0044 - Other - D.E.T. Admin - 106 m2							
No Asbestos							
B0T1 - R0045 - Other - D.E.T. Admin - 27.88 m2							
No Asbestos							
B0V1 - Other-Vacant - 1969 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	Non Accessible Area						
Interior							
B0V1 - R0001 - Distribution Board Cupboard - 2.48 m2							
Note: No inspection of live electrical installation							
No Asbestos							
B0V1 - R0002 - Other-Vacant - 31.42 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Middle portion	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Plant / Equipment - Boiler		1	West	Friable Asbestos (5)	Low (1)	High Priority (6-8)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Plant / Equipment - Air Conditioning Unit	Mastic	50	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
B0V1 - R0003 - Other-Vacant - 8.15 m2							
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0V1 - R0004 - Other-Vacant - 16.63 m2							
Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0V1 - R0005 - Movement - 1.95 m2							
No Asbestos							
B0V1 - R0006 - Other-Vacant - 1.99 m2							
No Asbestos							
B0V1 - R0007 - Staff Shower - 6.5 m2							
No Asbestos							
B0V1 - R0008 - Staff - Toilet - 3.71 m2							
Non Accessible							
B0V1 - R0009 - Other-Vacant - 6.93 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0V1 - R0010 - Other-Vacant - 6.9 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0V1 - R0011 - Other-Vacant - 5.47 m2							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0V1 - R0012 - Other-Vacant - 4.62 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B0V1 - R0013 - Movement - 14.68 m2							

Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0V1 - R0014 - Other-Vacant - 40.7 m2							
Floor Coverings Res/Textile	Vinyl Tiles	41m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0V1 - R0015 - Residential Coolroom - 5.47 m2							
No Asbestos							
B0V1 - R0016 - Movement - 3.22 m2							
No Asbestos							
B0V1 - R0017 - Residential Coolroom - 5.47 m2							
No Asbestos							
B0W1 - Other-D.E.C. Admin - 1969 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	Non Accessible Area						
Interior							
B0W1 - R0001 - Other - D.E.T. Admin - 27.89 m2							
Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0W1 - R0002 - Other - D.E.T. Admin - 16.94 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B0W1 - R0003 - Other - D.E.T. Admin - 4.58 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B0W1 - R0004 - Other - D.E.T. Admin - 3.3 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B0W1 - R0005 - Other - D.E.T. Admin - 1.4 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0W1 - R0006 - Other - D.E.T. Admin - 4.94 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0W1 - R0007 - Other - D.E.T. Admin - 3.03 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0W1 - R0008 - Other - D.E.T. Admin - 22.77 m2							
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0W1 - R0009 - Other - D.E.T. Admin - 12.85 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B0W1 - R0010 - Other - D.E.T. Admin - 12.85 m2							
No Asbestos							
B0W1 - R0011 - Other - D.E.T. Admin - 5.14 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0W1 - R0012 - Other - D.E.T. Admin - 19.3 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B0W1 - R0013 - Other - D.E.T. Admin - 9.18 m2							
No Asbestos							

B0W1 - R0014 - Other - D.E.T. Admin - 22.03 m2							
No Asbestos							
B0W1 - R0015 - Other - D.E.T. Admin - 92.03 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B0W1 - R0016 - Other - D.E.T. Admin - 11.08 m2							
No Asbestos							
B0W1 - R0017 - Other - D.E.T. Admin - 1.74 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0W1 - R0018 - Other - D.E.T. Admin - 9.18 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B0XX - Pupil Facilities - 1991 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids - Flat Roof	Non Accessible Area						
Interior							
B0XX - R0001 - Shower/Change - 26.57 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0XX - R0002 - Shower/Change - 26.57 m2							
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0Y1 - Other-D.E.C. Admin - 1975 - Fibre Cement Clad							
Exterior							
Underfloor Voids	AC Fragments/Debris	0.5	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting						
Wall Cladding	Flat AC Sheeting						
Ceiling Voids - Pitched Roof	No Asbestos Found						
Underfloor Voids	Flat AC Sheeting	0.5	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B0Y1 - R0001 - Other - D.E.T. Admin - 5.94 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting						
B0Y1 - R0002 - Other - D.E.T. Admin - 14.07 m2							
No Asbestos							
B0Y1 - R0003 - Other - D.E.T. Admin - 24.5 m2							
No Asbestos							
B0Y1 - R0004 - Other - D.E.T. Admin - 15.01 m2							
No Asbestos							

B0Y1 - R0005 - Other - D.E.T. Admin - 39.15 m2							
No Asbestos							
B0Y1 - R0006 - Other - D.E.T. Admin - 11.6 m2							
No Asbestos							
B0Y1 - R0007 - Other - D.E.T. Admin - 11.6 m2							
No Asbestos							
B0Y1 - R0008 - Other - D.E.T. Admin - 11.6 m2							
No Asbestos							
B0Y1 - R0009 - Other - D.E.T. Admin - 11.61 m2							
No Asbestos							
B0Y1 - R0010 - Other - D.E.T. Admin - 11.56 m2							
No Asbestos							
B0Y1 - R0011 - Other - D.E.T. Admin - 3.78 m2							
No Asbestos							
B0YY - Pupil Facilities - 1957 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B0YY - R0001 - Shower/Change - 49.29 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B0Z2 - Other - 2015 - Metal Shed							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B0Z2 - R0001 - Maintenance Bulk Store - 74.85 m2							
No Asbestos							
B0Z3 - Other - 2015 - Metal Shed							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B0Z3 - R0001 - Maintenance Bulk Store - 81.03 m2							
No Asbestos							
BMSW - Electrical Services - 1955 - Brick/Block							
Exterior							
Wall Cladding	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	15m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						

Ceiling Voids	No Asbestos Found						
Interior							
BMSW - R0001 - Main Switchroom - 8.05 m2							
Wall Linings Internal	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
BRR1 - Residential Facilities - 1970 - Brick/Veneer							
Exterior							
Require Inspection							
Interior							
BRR1 - R0001 - Residence - Garage - 23.13 m2							
Require Inspection							
BRR1 - R0002 - Residence - Movement - 14.55 m2							
Require Inspection							
BRR1 - R0003 - Residence - Laundry - 4.88 m2							
Require Inspection							
BRR1 - R0004 - Residence - Kitchen - 8.67 m2							
Require Inspection							
BRR1 - R0005 - Residence - Dining - 34.1 m2							
Require Inspection							
BRR1 - R0006 - Residence - Movement - 6.25 m2							
Require Inspection							
BRR1 - R0007 - Residence - Bedroom - 9.63 m2							
Require Inspection							
BRR1 - R0008 - Residence - Bedroom - 11.72 m2							
Require Inspection							
BRR1 - R0009 - Residence - Bedroom - 12.7 m2							
Require Inspection							
BRR1 - R0010 - Residence - Bathroom - 4.77 m2							
Require Inspection							
BRR1 - R0011 - Residence - Toilet - 2.49 m2							
Require Inspection							
BRR1 - R0012 - Residence - Bedroom - 9.01 m2							
Require Inspection							
BRR1 - R0013 - Residence - Movement - 5.2 m2							
Require Inspection							
BRR4 - Residential Facilities - 1970 - Brick/Veneer							
Exterior							
Require Inspection							
Interior							
BRR4 - R0001 - Residence - Living - 17.59 m2							
Require Inspection							
BRR4 - R0002 - Residence - Bedroom - 4.73 m2							
Require Inspection							
BRR4 - R0003 - Residence - Bedroom - 8.22 m2							
Require Inspection							
BRR4 - R0004 - Residence - Bedroom - 8.19 m2							
Require Inspection							
BRR4 - R0005 - Residence - Bedroom - 11.82 m2							
Require Inspection							
BRR4 - R0006 - Residence - Bedroom - 9.91 m2							

Require Inspection
BRR4 - R0007 - Residence - Bathroom - 5.32 m2
Require Inspection
BRR4 - R0008 - Residence - Movement - 9.18 m2
Require Inspection
BRR4 - R0009 - Residence - Toilet - 1.57 m2
Require Inspection
BRR4 - R0010 - Residence - Laundry - 4.45 m2
Require Inspection
BRR4 - R0011 - Residence - Kitchen - 7.02 m2
Require Inspection
BRR4 - R0012 - Residence - Dining - 15.02 m2
Require Inspection
BRR4 - R0013 - Residence - Lounge - 26.37 m2
Require Inspection
BRR4 - R0014 - Residence - Toilet - 2.34 m2
Require Inspection
BRR4 - R0015 - Residence - Movement - 4.43 m2
Require Inspection
BRR4 - R0016 - Residence - Movement - 9 m2
Require Inspection
BRR4 - R0017 - Residence - Movement - 4.37 m2
Require Inspection
BRR4 - R0018 - Residence - Movement - 5.28 m2
Require Inspection
BRR5 - Residential Facilities - 1970 - Brick Shed
Exterior
Require Inspection
Interior
BRR5 - R0001 - Residence - Garage - 30.78 m2
Require Inspection
BRR6 - Residential Facilities - 1940 - Brick/Block
Exterior
Require Inspection
Interior
BRR6 - R0001 - Residence - Movement - 13.78 m2
Require Inspection
BRR6 - R0002 - Residence - Living - 46.46 m2
Require Inspection
BRR6 - R0003 - Residence - Movement - 14.04 m2
Require Inspection
BRR6 - R0004 - Residence - Bedroom - 13.4 m2
Require Inspection
BRR6 - R0005 - Residence - Bedroom - 10.56 m2
Require Inspection
BRR6 - R0006 - Residence - Movement - 15.4 m2
Require Inspection
BRR6 - R0007 - Residence - Bedroom - 22.82 m2
Require Inspection
BRR6 - R0008 - Residence - Movement - 10.54 m2
Require Inspection

BRR6 - R0009 - Residence - Toilet - 1.63 m2
Require Inspection
BRR6 - R0010 - Residence - Bathroom - 5.42 m2
Require Inspection
BRR6 - R0011 - Residence - Dining - 10.66 m2
Require Inspection
BRR6 - R0012 - Residence - Bedroom - 11.15 m2
Require Inspection
BRR6 - R0013 - Residence - Movement - 4.98 m2
Require Inspection
BRR6 - R0014 - Residence - Movement - 2.35 m2
Require Inspection
BRR6 - R0015 - Residence - Laundry - 7.4 m2
Require Inspection
BRR6 - R0016 - Residence - Kitchen - 15.51 m2
Require Inspection
BRR6 - R0017 - Residence - Toilet - 2.74 m2
Require Inspection
BRR6 - R0018 - Residence - Pantry - 3.77 m2
Require Inspection
BRR7 - Residential Facilities - 1970 - Fibre Clad Shed
Exterior
Require Inspection
Interior
BRR7 - R0001 - Residence - Garage - 21.71 m2
Require Inspection
BRR8 - Residential Facilities - 1970 - Brick/Veneer
Exterior
Require Inspection
Interior
BRR8 - R0001 - Residence - Kitchen - 8.26 m2
Require Inspection
BRR8 - R0002 - Residence - Laundry - 4.34 m2
Require Inspection
BRR8 - R0003 - Residence - Bathroom - 4.34 m2
Require Inspection
BRR8 - R0004 - Residence - Bedroom - 8.69 m2
Require Inspection
BRR8 - R0005 - Residence - Bedroom - 8.58 m2
Require Inspection
BRR8 - R0006 - Residence - Movement - 4.35 m2
Require Inspection
BRR8 - R0007 - Residence - Bedroom - 11.62 m2
Require Inspection
BRR8 - R0008 - Residence - Living - 28.48 m2
Require Inspection
BRR9 - Residential Facilities - 1970 - Brick Shed
Exterior
Require Inspection
Interior

BRR9 - R0001 - Residence - Garage - 23.07 m2

Require Inspection

Demountables**OS 903 10252 - Dormitory - Teacher Accommodation. - Placement Date : 30-JUN-1995****Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Teacher Living Quarters**

End Wall Panel	Flat AC Sheeting	36m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	73m2	Assumed Asbestos

OS 903 10255 - Dormitory - Teacher Accommodation. - Placement Date : 30-JUN-1995**Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Teacher Living Quarters**

End Wall Panel	Flat AC Sheeting	36m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	73m2	Assumed Asbestos

OS 903 10308 - Dormitory - Teacher Accommodation. - Placement Date : 30-JUN-1995**Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Teacher Living Quarters**

End Wall Panel	Flat AC Sheeting	36m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	73m2	Assumed Asbestos

OS 972 10314 - Shed - Lightweight Shutter(Garden/Sport) - Placement Date : 09-OCT-1996**Exterior**

Eaves Linings	Flat AC Sheeting	2.88m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Garden Store**

End Wall Panel	Flat AC Sheeting	36m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Assumed Asbestos

OS 972 10322 - Shed - Lightweight Shutter(Garden/Sport) - Placement Date : 09-OCT-1996**Exterior**

Eaves Linings	Flat AC Sheeting	2.88m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Garden Store**

End Wall Panel	Flat AC Sheeting	36m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Assumed Asbestos

OS 972 10330 - Shed - Lightweight Shutter(Garden/Sport) - Placement Date : 09-OCT-1996**Exterior**

Eaves Linings	Flat AC Sheeting	2.88m2	Assumed Asbestos
---------------	------------------	--------	------------------

Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos
Interior			
R1- Garden Store			
End Wall Panel	Flat AC Sheeting	36m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Assumed Asbestos
OS 601 11737 - Learning Unit - Standard/Withdrawal - Placement Date : 30-JUN-1995			
Exterior			
Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos
Interior			
R1- Entry			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos
R2- General Learning Space			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos
R3- Store			
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos