


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Hunters Hill High School (8207)
Region:	Northern Sydney AMU
State Electorate:	Lane Cove
Local Government Area:	Hunters Hill

Last Reviewed By:	WSP 10-APR-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

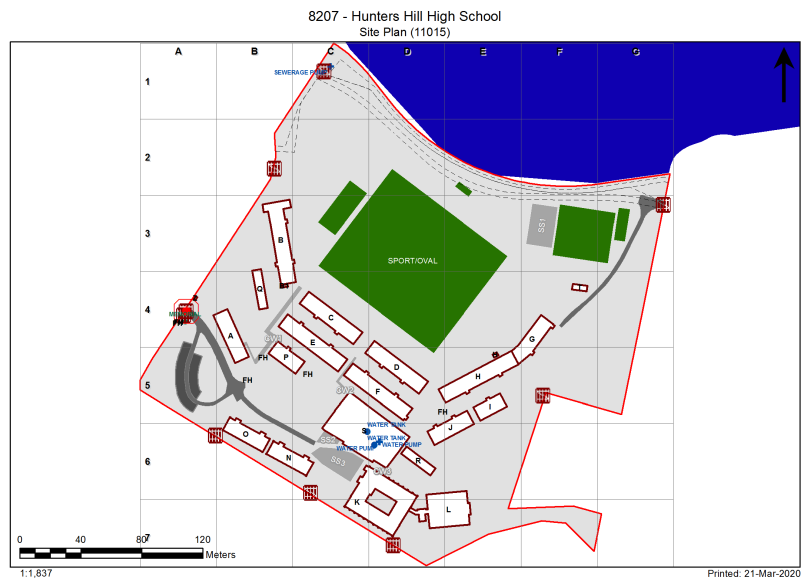

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration - 1957 - Steel							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00A - R0006 - Cleaning Store - Distributed - 1.39 m2							
No Asbestos							
B00A - R0008 - Staff - Toilet - 7.27 m2							
No Asbestos							
B00A - R0013 - Staff - Toilet - 7.27 m2							
No Asbestos							
B00A - R0018 - General Storeroom - 2.76 m2							
No Asbestos							
B00A - R0020 - Deputy Principal Office - 24.1 m2							
No Asbestos							
B00A - R0021 - Deputy Principal Office - 23.16 m2							
No Asbestos							
B00A - R0022 - Interview/Office - Type 1 - 7.56 m2							
No Asbestos							
B00A - R0023 - Interview/Meeting - 10.89 m2							
No Asbestos							
B00A - R0024 - General Storeroom - 1.54 m2							
No Asbestos							
B00A - R0025 - Clinic - 8.08 m2							
No Asbestos							
B00A - R0026 - Student Reception - 32.89 m2							
No Asbestos							
B00A - R0027 - Administration - Clerical - 53.4 m2							
No Asbestos							
B00A - R0028 - Ancillary Staff - 16.78 m2							
No Asbestos							
B00A - R0029 - Administration - Clerical - 27.73 m2							
No Asbestos							
B00A - R0030 - Principal Office - 27.11 m2							
No Asbestos							
B00A - R0031 - Interview/Meeting - 14.15 m2							
No Asbestos							
B00A - R0032 - Public Reception - 31.05 m2							
No Asbestos							
B00A - R0033 - Printing/Photocopying - 18.69 m2							
No Asbestos							
B00A - R0034 - General Storeroom - 7.15 m2							
No Asbestos							
B00B - Music/Performance Learning - 1957 - Steel							
Exterior							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							

B00B - R0002 - Multi-Purpose Space - 58.15 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0005 - General Storeroom - 13.03 m2							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0006 - Music Learning Space - 71.3 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0007 - Music Store - 7.05 m2							
No Asbestos							
B00B - R0008 - Resources Store - 8.46 m2							
No Asbestos							
B00B - R0009 - Music Store - 6.37 m2							
No Asbestos							
B00B - R0010 - Cleaning Store - Distributed - 1.38 m2							
No Asbestos							
B00B - R0011 - Staff Study - 26.42 m2							
No Asbestos							
B00B - R0014 - Music Store - 8.64 m2							
No Asbestos							
B00B - R0015 - Movement - 41.94 m2							
No Asbestos							
B00B - R0016 - External Movement - 3.12 m2							
No Asbestos							
B00B - R0017 - External Movement - 3.14 m2							
No Asbestos							
B00B - R0018 - External Movement - 3.12 m2							
No Asbestos							
B00B - R0019 - Practice/Seminar - 13.6 m2							
No Asbestos							
B00B - R0020 - Music Learning Space - 90.41 m2							
No Asbestos							
B00B - R0021 - Performance Store - 9.07 m2							
No Asbestos							
B00B - R0022 - Performance Store - 4.43 m2							
No Asbestos							
B00B - R0023 - Chair Store - 26.3 m2							
No Asbestos							
B00B - R0024 - Multi-Purpose Space - 133 m2							
No Asbestos							
B00B - R0025 - Change - 19.23 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0026 - Toilets-Girls - 1.25 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0027 - Change - 12.4 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0028 - Toilets-Boys - 1.25 m2							
Wall Linings Internal	Flat AC Sheeting						
B00C - General Learning - 1957 - Steel							
Exterior							
Ceiling Voids	No Asbestos Found						

Underfloor Voids	No Asbestos Found							
Interior								
B00C - R0001 - General Learning Space - 95.59 m2								
Wall Linings Internal	Flat AC Sheeting	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R0002 - General Storeroom - 8.82 m2								
No Asbestos								
B00C - R0003 - Resources Store - 8.6 m2								
No Asbestos								
B00C - R0004 - Cleaning Store - Distributed - 1.33 m2								
No Asbestos								
B00C - R0005 - Study Space - 26.47 m2								
No Asbestos								
B00C - R0006 - Staff Study - 53.09 m2								
Wall Linings Internal	Flat AC Sheeting	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R0007 - Resources Store - 2.83 m2								
No Asbestos								
B00C - R0008 - General Learning Space - 53.24 m2								
Wall Linings Internal	Flat AC Sheeting	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R0009 - Resources Store - 17.6 m2								
No Asbestos								
B00C - R0010 - General Learning Space - 95.3 m2								
Wall Linings Internal	Flat AC Sheeting	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R0011 - Movement - 61.8 m2								
No Asbestos								
B00C - R0012 - External Movement - 3.14 m2								
No Asbestos								
B00C - R0013 - External Movement - 3.14 m2								
No Asbestos								
B00C - R0014 - Handwashing Facilities - .6 m2								
No Asbestos								
B00D - Physical Education - 1957 - Steel								
Exterior								
Ceiling Voids	No Asbestos Found							
Underfloor Voids	No Asbestos Found							
Interior								
B00D - R0001 - General Storeroom - 100.38 m2								
Wall Linings Internal	Flat AC Sheeting	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
Plant / Equipment - Flue	Fibre Cement Pipe	2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	No Result	
B00D - R0002 - Sport Equipment Store - 25.96 m2								
Plant / Equipment - Flue	Fibre Cement Pipe	2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	No Result	
B00D - R0003 - General Storeroom - 14.58 m2								
No Asbestos								
B00D - R0004 - Sport Equipment Store - 44.18 m2								

Wall Linings Internal	Flat AC Sheeting	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0005 - Student Lounge - 44.25 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0006 - Staff Study - 25.92 m2							
Plant / Equipment - Flue	Fibre Cement Pipe	2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	No Result
B00D - R0007 - Resources Store - 14.61 m2							
No Asbestos							
B00D - R0008 - Fitness Laboratory - 100.4 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Plant / Equipment - Flue	Fibre Cement Pipe	2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	No Result
B00D - R0009 - Movement - 55.79 m2							
Wall Linings Internal	Flat AC Sheeting						
B00D - R0010 - External Movement - 3.13 m2							
No Asbestos							
B00D - R0011 - External Movement - 3.14 m2							
No Asbestos							
B00E - General Learning - 1957 - Steel							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00E - R0001 - General Learning Space - 71.52 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0002 - General Learning Space - 48.93 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0003 - General Learning Space - 71.2 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0005 - General Learning Space - 71.23 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0006 - General Learning Space - 48.93 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0007 - Cleaning Store - Distributed - 1.37 m2							
No Asbestos							
B00E - R0008 - Resources Store - 23.58 m2							
No Asbestos							
B00E - R0009 - General Learning Space - 71.5 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0011 - External Movement - 3.11 m2							

No Asbestos							
B00E - R0012 - External Movement - 3.11 m2							
No Asbestos							
B00E - R0013 - Movement - 21.06 m2							
No Asbestos							
B00E - R0014 - Handwashing Facilities - .74 m2							
No Asbestos							
B00E - R0015 - Movement - 43.24 m2							
No Asbestos							
B00E - R0016 - Handwashing Facilities - .55 m2							
No Asbestos							
B00F - General Learning - 1957 - Steel							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00F - R0001 - General Learning Space - 71.42 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0002 - General Learning Space - 48.87 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0003 - General Learning Space - 70.84 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0005 - General Learning Space - 71.03 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0006 - General Learning Space - 48.8 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0007 - Staff - Toilet - 2.44 m2							
No Asbestos							
B00F - R0008 - Cleaning Store - Distributed - 1.4 m2							
No Asbestos							
B00F - R0009 - Interview/Meeting - 17.59 m2							
No Asbestos							
B00F - R0010 - Careers Advisers Office - 23.43 m2							
Plant / Equipment - Flue		2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	No Result
B00F - R0011 - General Learning Space - 71.35 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Plant / Equipment - Fume Cupboard	Flat AC Sheeting	1	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0012 - Movement - 23.85 m2							
No Asbestos							
B00F - R0013 - External Movement - 3.15 m2							
No Asbestos							
B00F - R0014 - External Movement - 3.15 m2							

No Asbestos		
B00F - R0015 - Movement - 21.05 m2		
No Asbestos		
B00F - R0016 - Handwashing Facilities - .62 m2		
No Asbestos		
B00F - R0017 - External Movement - 2.92 m2		
No Asbestos		
B00G - Technological & Applied Studies - 1957 - Steel		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00G - R0001 - Movement - 5.83 m2		
No Asbestos		
B00G - R0002 - Materials Store - 17.67 m2		
No Asbestos		
B00G - R0006 - Class Tools Storage - 17.67 m2		
No Asbestos		
B00G - R0007 - Movement - 5.78 m2		
No Asbestos		
B00G - R0008 - External Movement - 3.11 m2		
No Asbestos		
B00G - R0009 - External Movement - 3.1 m2		
No Asbestos		
B00G - R0010 - Garden Store Room - 78.34 m2		
No Asbestos		
B00G - R0011 - Materials Technology L.S. - 171.02 m2		
No Asbestos		
B00G - R0012 - Materials Store - 8.57 m2		
No Asbestos		
B00G - R0013 - Welding Area - 3.12 m2		
No Asbestos		
B00G - R0014 - Welding Area - 3.1 m2		
No Asbestos		
B00G - R0015 - Welding Area - 3.3 m2		
No Asbestos		
B00H - Technological & Applied Studies - 1957 - Steel		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00H - R0001 - Materials Technology L.S. - 83.27 m2		
No Asbestos		
B00H - R0002 - Materials Store - 35.59 m2		
No Asbestos		
B00H - R0003 - Class Tools Storage - 17.5 m2		
No Asbestos		
B00H - R0004 - Movement - 17.53 m2		
No Asbestos		
B00H - R0005 - Materials Technology L.S. - 83.16 m2		
No Asbestos		

B00H - R0006 - Design/Technology L.S. - 53.09 m2							
No Asbestos							
B00H - R0007 - Project Store - Type 1 - 5.71 m2							
No Asbestos							
B00H - R0008 - Resources Store - 5.69 m2							
No Asbestos							
B00H - R0009 - Design/Technology L.S. - 53.09 m2							
No Asbestos							
B00H - R0010 - Resources Store - 5.83 m2							
No Asbestos							
B00H - R0011 - Design/Technology L.S. - 53.09 m2							
No Asbestos							
B00H - R0014 - Movement - 58.48 m2							
No Asbestos							
B00H - R0015 - External Movement - 3.12 m2							
No Asbestos							
B00H - R0016 - External Movement - 3.1 m2							
No Asbestos							
B00H - R0017 - General Storeroom - 4.36 m2							
No Asbestos							
B00H - R0018 - Staff - Toilet - 2.09 m2							
No Asbestos							
B00H - R0019 - Staff Study - 38.46 m2							
No Asbestos							
B00H - R0020 - Tea Room - 1.99 m2							
No Asbestos							
B00H - R0021 - Dust Extraction Space - 6.08 m2							
No Asbestos							
B00I - Technological & Applied Studies/Building Services - 1957 - Steel							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00I - R0001 - General Assistants - 71.59 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00I - R0002 - General Storeroom - 5.76 m2							
No Asbestos							
B00I - R0003 - General Storeroom - 5.74 m2							
No Asbestos							
B00I - R0004 - Resources Store - 11.5 m2							
No Asbestos							
B00I - R0005 - Design L.S. - 71.42 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00I - R0006 - Resources Store - 5.76 m2							
No Asbestos							
B00I - R0007 - Resources Store - 5.71 m2							
No Asbestos							
B00I - R0008 - Movement - 11.66 m2							

No Asbestos							
B00I - R0009 - External Movement - 3.12 m2							
No Asbestos							
B00J - Technological & Applied Studies - 1957 - Steel							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00J - R0001 - Food Technology L.S. - 71.52 m2							
Floor Coverings Res/Textile	Vinyl Tiles	72m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	1m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00J - R0002 - Preparation - 12.93 m2							
Plant / Equipment - Flue		2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - R0003 - Staff Study - 13.07 m2							
Furniture / Fixtures	Vinyl Lining						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - R0004 - Movement - 8.58 m2							
No Asbestos							
B00J - R0006 - Laundry - 12.86 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
B00J - R0007 - Staff - Toilet - 2.71 m2							
No Asbestos							
B00J - R0008 - Change - 17.36 m2							
No Asbestos							
B00J - R0010 - External Movement - 3.12 m2							
No Asbestos							
B00J - R0012 - Food Technology L.S. - 143.43 m2							
No Asbestos							
B00J - R0014 - External Movement - 2.87 m2							
No Asbestos							
B00K - General Learning/Science Learning/Pupil Facilities - 1972 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00K - R0001 - Art Learning Space - 52.94 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00K - R0002 - Resources Store - 6.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0003 - Resources Store - 12.75 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						

Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0004 - General Learning Space - 52 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00K - R0005 - Resources Store - 6.16 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00K - R0006 - Art Learning Space - 52.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00K - R0007 - Kiln Space - 28.48 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0008 - Resources Store - 9.81 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0009 - Staff Study - 39.44 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00K - R0010 - Distribution Board Cupboard - .89 m2							
Note: No inspection of live electrical installation							
No Asbestos							
B00K - R0011 - Resources Store - 24.4 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0012 - Office/Store - 17.88 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0013 - Uniform Shop - 18.11 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00K - R0019 - Resources Store - 39.47 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0020 - Staff - Toilet - 5.41 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00K - R0021 - Cleaning Store - Distributed - 5.44 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0022 - Art Entry/Display - 5.59 m2							
No Asbestos							
B00K - R0025 - General Storeroom - 6.05 m2							
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (< 10 m2) - (X2)						

B00K - R0026 - General Storeroom - .94 m2							
No Asbestos							
B00K - R0027 - Distribution Board Cupboard - 1.24 m2							Note: No inspection of live electrical installation
Electrical - Backing Board	Encapsulated Asbestos material within unit	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00K - R0030 - Uniform Shop - 10.68 m2							
No Asbestos							
B00K - R0031 - General Learning Space - 42.27 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
Floor Coverings Res/Textile	Vinyl Tiles	43m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0032 - Science Laboratory - 50.53 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
Floor Coverings Res/Textile	Vinyl Tiles	51m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0033 - Preparation - Science - 39.4 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
Floor Coverings Res/Textile	Vinyl Tiles	40m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0034 - Science Laboratory - 49.06 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0035 - General Learning Space - 42.33 m2							
Floor Coverings Res/Textile	Vinyl Tiles	43m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00K - R0036 - Staff Study - 18.29 m2							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00K - R0037 - External Movement - 6.93 m2							
No Asbestos							
B00K - R0038 - External Stairs - 2.86 m2							
No Asbestos							
B00K - R0039 - External Stairs - 5.69 m2							
No Asbestos							
B00K - R0040 - External Movement - 209.36 m2							
No Asbestos							
B00K - R1001 - General Learning Space - 39.4 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00K - R1002 - General Learning Space - 52.94 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00K - R1003 - Resources Store - 6.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00K - R1004 - General Learning Space - 52.27 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00K - R1005 - Resources Store - 6.41 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00K - R1006 - General Learning Space - 51.98 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00K - R1007 - General Learning Space - 52.15 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00K - R1008 - Staff - Toilet - 5.9 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00K - R1009 - Distribution Board Cupboard - .96 m2							
Note: No inspection of live electrical installation							
Electrical - Backing Board	Encapsulated Asbestos material within unit	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00K - R1010 - Cleaning Store - Distributed - 2.48 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R1011 - Resources Store - 15.29 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R1012 - General Learning Space - 36.3 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00K - R1013 - Resources Store - 7.81 m2							
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00K - R1014 - Art Learning Space - 66.11 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00K - R1016 - Senior Study - 25.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00K - R1017 - Computer Store - 12.47 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R1018 - Computer Learning Space - 52.8 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00K - R1019 - Computer Learning Space - 52.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00K - R1020 - System Administrators Office - 25.91 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R1021 - Staff - Toilet - 5.39 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						

B00K - R1022 - General Storeroom - 5.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R1024 - Staff Study - 15.4 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00K - R1026 - Distribution Board Cupboard - 1.21 m2				Note: No inspection of live electrical installation			
Electrical - Backing Board	Encapsulated Asbestos material within unit	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00K - R1028 - Darkroom Space - 2.16 m2							
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00K - R1029 - Dark Room - 23.02 m2							
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00K - R1030 - Resources Store - 5.82 m2							
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00K - R1031 - External Movement - 187.33 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00K - R1032 - Computer Store - 11.91 m2							
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00K - R1033 - Computer Store - 5.79 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00K - R1034 - External Stairs - 17.96 m2							
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00K - R1035 - External Stairs - 5.04 m2							
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00K - R8001 - External Movement - 5.42 m2							
No Asbestos							
B00K - R8002 - External Stairs - 3.44 m2							
No Asbestos							
B00K - R8003 - Other-Vacant - 4.56 m2							
No Asbestos							
B00K - R9004 - Plant - .92 m2							
No Asbestos							
B00K - R9005 - Cleaning Supplies Store - 15.8 m2							
No Asbestos							
B00K - R9006 - Student Canteen - 42.42 m2							

Ceiling Structures/Linings	Non Accessible Area	m2					
Floor Coverings Res/Textile	Vinyl Tiles	42m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
Electrical - Backing Board	Encapsulated Asbestos material within unit	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00K - R9008 - Staff - Toilet - 3.5 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00K - R9010 - Staff - Toilet - 5.16 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00K - R9011 - Pantry - 19.54 m2							
No Asbestos							
B00K - R9012 - Store - Coolroom - 5.15 m2							
No Asbestos							
B00K - R9013 - Toilets-Girls - 28.86 m2							
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00K - R9014 - Cleaning Store - Distributed - 3.68 m2							
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00K - R9015 - Toilets-Boys - 16.62 m2							
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00K - R9016 - Cleaning Store - Distributed - 1.24 m2							
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00K - R9017 - Covered Area - 222.09 m2							
No Asbestos							
B00K - R9018 - External Movement - 66.5 m2							
No Asbestos							
B00K - R9019 - External Stairs - 6.58 m2							
No Asbestos							
B00K - R9020 - Main Switchroom - 4.95 m2							
No Asbestos							
B00L - Library/Science Learning - 1972 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00L - M1001 - Archive Store - 38.09 m2							
No Asbestos							
B00L - M1002 - Plant - 54.46 m2							
No Asbestos							
B00L - M1003 - Seminar - 67.39 m2							
No Asbestos							
B00L - M1004 - Study Space - 14.95 m2							
No Asbestos							
B00L - M1005 - Plant - 18.95 m2							

No Asbestos							
B00L - M1006 - Plant - 19.07 m2							
No Asbestos							
B00L - M1007 - Stairs - 1.92 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00L - M1008 - Stairs - 1.91 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00L - R0001 - Laboratory L.S. - 91.34 m2							
Floor Coverings Res/Textile	Vinyl Tiles	92m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Non Accessible Area	m2					
B00L - R0003 - Apparatus Store - 3.44 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R0005 - Laboratory L.S. - 91.15 m2							
Floor Coverings Res/Textile	Vinyl Tiles	93m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Non Accessible Area	m2					
B00L - R0006 - Resources Store - 16.72 m2							
Floor Coverings Res/Textile	Vinyl Tiles	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R0007 - Distribution Board Cupboard - .58 m2						Note: No inspection of live electrical installation	
Electrical - Backing Board	Resinous Board	1	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Encapsulated Asbestos material within unit	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00L - R0008 - Laboratory L.S. - 91.16 m2							
Floor Coverings Res/Textile	Vinyl Tiles	93m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Non Accessible Area	m2					
B00L - R0012 - Laboratory L.S. - 91.24 m2							
Floor Coverings Res/Textile	Vinyl Tiles	93m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Non Accessible Area	m2					
B00L - R0013 - Movement - 40.71 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B00L - R0014 - Plant - 8.62 m2							
Plant / Equipment - Flue	Fibre Cement Pipe	3	West	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00L - R0015 - Distribution Board Cupboard - 1.67 m2						Note: No inspection of live electrical installation	
Electrical - Backing Board	Encapsulated Asbestos material within unit	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00L - R0017 - Stairs - 7.85 m2							
No Asbestos							
B00L - R0018 - Cleaning Store - Distributed - 7.73 m2							
No Asbestos							
B00L - R0019 - Staff Study - 40.96 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00L - R0020 - Tea Room - 3.34 m2								
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00L - R0021 - Preparation - Science - 38.66 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00L - R0022 - Chemical Store - 9.12 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00L - R0023 - External Movement - 40.03 m2								
No Asbestos								
B00L - R1001 - Main Entry - 34.09 m2								
No Asbestos								
B00L - R1002 - Staff - Toilet - 3.1 m2								
No Asbestos								
B00L - R1003 - Senior Study - 70.77 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00L - R1005 - General Storeroom - 12.84 m2								
No Asbestos								
B00L - R1006 - General Storeroom - 11.66 m2								
No Asbestos								
B00L - R1008 - Distribution Board Cupboard - .24 m2								
Note: No inspection of live electrical installation								
Electrical - Backing Board	Resinous Board	1	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Electrical - Backing Board	Encapsulated Asbestos material within unit	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00L - R1009 - Tutorial Centre - 11.69 m2								
No Asbestos								
B00L - R1010 - Tutorial Centre - 12.69 m2								
No Asbestos								
B00L - R1011 - Library Administration - 27.99 m2								
No Asbestos								
B00L - R1012 - Interview/Office - Type 1 - 11.19 m2								
No Asbestos								
B00L - R1013 - Workroom - 17.74 m2								
No Asbestos								
B00L - R1014 - Resources Store - 12.37 m2								
No Asbestos								
B00L - R1015 - Staff - Toilet - 2.99 m2								
No Asbestos								
B00L - R1016 - Plant - 5.31 m2								
No Asbestos								
B00L - R1017 - Plant - 4.87 m2								
No Asbestos								
B00L - R1018 - Cleaning Store - Distributed - .37 m2								
No Asbestos								
B00L - R1020 - External Movement - 35 m2								

No Asbestos							
B00L - R1021 - Stairs - 16.44 m2							
No Asbestos							
B00L - R1022 - Main Area - 288.37 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - (X25)						
B00L - R1023 - Stairs - 1.1 m2							
No Asbestos							
B00L - R1024 - Stairs - 1.1 m2							
No Asbestos							
B00L - R1025 - Movement - 4.15 m2							
No Asbestos							
B00L - R1026 - Handwashing Facilities - .33 m2							
No Asbestos							
B00L - R1027 - Movement - 1.77 m2							
No Asbestos							
B00N - General Learning - 1957 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	50	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00N - R0001 - General Learning Space - 52.35 m2							
No Asbestos							
B00N - R0002 - General Learning Space - 52.08 m2							
No Asbestos							
B00N - R0003 - General Learning Space - 52 m2							
No Asbestos							
B00N - R0004 - General Learning Space - 52.49 m2							
No Asbestos							
B00N - R0005 - Resources Store - 6.3 m2							
No Asbestos							
B00N - R0006 - Movement - 44.73 m2							
No Asbestos							
B00N - R0007 - External Movement - 6.08 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00N - R0008 - External Movement - 6.12 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00O - General Learning - 1957 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	50	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						

Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B00O - R0001 - Staff - Toilet - 4.52 m2							
No Asbestos							
B00O - R0004 - Resources Store - 38.7 m2							
No Asbestos							
B00O - R0005 - General Learning Space - 51.86 m2							
No Asbestos							
B00O - R0006 - General Learning Space - 52.28 m2							
No Asbestos							
B00O - R0007 - General Storeroom - 6.23 m2							
No Asbestos							
B00O - R0009 - External Movement - 6.33 m2							
No Asbestos							
B00O - R0010 - External Movement - 6 m2							
No Asbestos							
B00O - R0011 - Movement - 19.03 m2							
No Asbestos							
B00O - R0012 - Movement - 20.84 m2							
No Asbestos							
B00O - R0013 - Staff Study - 65.19 m2							
No Asbestos							
B00P - Staff - 1957 - Steel							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00P - R0001 - Staff Kitchen - 26.51 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
B00P - R0002 - General Storeroom - 8.76 m2							
No Asbestos							
B00P - R0003 - General Storeroom - 8.52 m2							
No Asbestos							
B00P - R0004 - Commonroom - 110.45 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
B00P - R0005 - Leading Teacher - 8.63 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
B00P - R0006 - Office/Store - 17.6 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
B00P - R0007 - Movement - 23.33 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
B00P - R0008 - Cleaning Store - Distributed - 8.92 m2							
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00P - R0009 - External Movement - 3.11 m2							
No Asbestos							

B00Q - Pupil Facilities - 1957 - Brick/Block

Exterior

Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	5m2	North & South	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B00Q - R0001 - General Storeroom - 9.69 m2

Wall Linings Internal - Infill	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

B00Q - R0002 - Chair Store - 21.83 m2

Wall Linings Internal - Infill	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

B00Q - R0004 - Student Drinking Facilities - 6.94 m2

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

B00Q - R0005 - Cleaning Store - Distributed - 2.91 m2

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	------------------	-----	--------------	--------------------	---------	--------------------	--

B00Q - R0006 - Toilets-Boys - 82.66 m2

No Asbestos

B00Q - R0007 - Other-Vacant - 1.91 m2

No Asbestos

B00R - Pupil Facilities - 1957 - Brick/Block

Exterior

Eaves Linings	Flat AC Sheeting	30m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Gable Verge Lining	Flat AC Sheeting	5m2	East & West	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B00R - R0001 - Student Drinking Facilities - 10.8 m2

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

B00R - R0002 - Toilets-Girls - 71.5 m2

Ceiling Structures/Linings	Flat AC Sheeting	74m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00R - R0003 - Cleaning Store - Distributed - 1.51 m2							
No Asbestos							
B00R - R0004 - Cleaning Store - Distributed - 1.52 m2							
No Asbestos							
B00R - R0005 - Movement - 6.48 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00R - R0006 - Garden Store Room - 2.77 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00R - R0007 - Garden Store Room - 21.95 m2							
Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Material - Stored / Debris Material	Flat AC Sheeting						
Wall Linings Internal - Infill	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00S - Multi Purpose Facilities/Movement Complex - 2006 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00S - R0001 - Multi-Purpose Space - 619.59 m2							
No Asbestos							
B00S - R0002 - Plant - .61 m2							
No Asbestos							
B00S - R0003 - General Storeroom - 14.06 m2							
No Asbestos							
B00S - R0004 - Control Room - 10.85 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00S - R0005 - Cleaning Store - Distributed - 3.2 m2							
No Asbestos							
B00S - R0006 - Movement - 8.42 m2							
No Asbestos							
B00S - R0007 - Access Student Shower/Toilet/Change - 6.8 m2							
No Asbestos							
B00S - R0008 - Staff Shower - 2.44 m2							
No Asbestos							
B00S - R0009 - Staff - Toilet - 2.45 m2							
No Asbestos							
B00S - R0012 - Sport Equipment Store - 26.59 m2							
No Asbestos							

B00S - R0013 - Plant - .63 m2	
No Asbestos	
B00S - R0014 - Distribution Board Cupboard - .69 m2	
No Asbestos	
B00S - R0015 - Chair Store - 32.45 m2	
No Asbestos	
B00S - R0016 - Movement - 15.53 m2	
No Asbestos	
B00S - R0017 - Stage - 107.59 m2	
No Asbestos	
B00S - R0018 - Movement - 16.13 m2	
No Asbestos	
B00S - R0019 - External Movement - 347.53 m2	
No Asbestos	
B00S - R0020 - External Movement - 49.35 m2	
No Asbestos	
B00S - R0021 - External Stairs - 24.85 m2	
No Asbestos	
B00S - R0022 - Lift - 2.1 m2	
No Asbestos	
B00S - R0023 - Toilet - Lobby - 2.94 m2	
No Asbestos	
B00S - R0024 - Toilets-Boys - 14.21 m2	
No Asbestos	
B00S - R0025 - Toilet - Lobby - 3.01 m2	
No Asbestos	
B00S - R0026 - Toilets-Girls - 18.17 m2	
No Asbestos	
B00S - R9001 - Movement Studio - 159.73 m2	
No Asbestos	
B00S - R9002 - Performance Store - 33.57 m2	
No Asbestos	
B00S - R9003 - Control Room - 10.72 m2	
Floor Coverings Res/Textile	No Asbestos Found
B00S - R9004 - Music Store - 19.32 m2	
No Asbestos	
B00S - R9006 - Access Student Shower/Toilet/Change - 5.06 m2	
No Asbestos	
B00S - R9008 - Change - 48.18 m2	
No Asbestos	
B00S - R9009 - Cleaning Store - Distributed - 4 m2	
No Asbestos	
B00S - R9010 - Shower - 14.46 m2	
No Asbestos	
B00S - R9011 - Change - 48.1 m2	
No Asbestos	
B00S - R9012 - Shower - 14.51 m2	
No Asbestos	
B00S - R9013 - Cleaning Store - Distributed - 4.01 m2	
No Asbestos	
B00S - R9014 - Distribution Board Cupboard - .63 m2	
Note: No inspection of live electrical installation	

No Asbestos							
B00S - R9015 - Plant - .66 m2							
No Asbestos							
B00S - R9016 - Movement - 5.9 m2							
No Asbestos							
B00S - R9017 - External Movement - 233.93 m2							
No Asbestos							
B00S - R9019 - External Stairs - 17.7 m2							
No Asbestos							
B00S - R9020 - Toilet - Lobby - 3.13 m2							
No Asbestos							
B00S - R9021 - Toilets-Girls - 8.95 m2							
No Asbestos							
B00S - R9022 - Toilets-Boys - 8.4 m2							
No Asbestos							
B00S - R9023 - Toilets-Boys - 2.2 m2							
No Asbestos							
B00T - Physical Education - 1980 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00T - R0001 - External Movement - 1.2 m2							
No Asbestos							
B00T - R0002 - Toilets-Unisex - 3.12 m2							
No Asbestos							
B00T - R0003 - Sport Equipment Store - 2.56 m2							
No Asbestos							
B00T - R0004 - External Movement - 24.65 m2							
No Asbestos							
B00Z - Building Services - 1947 - Brick/Block							
Exterior							
No Asbestos							
Interior							
B00Z - R0001 - Plant - 2.45 m2							
No Asbestos							
B0B1 - Staff Facilities - 1968 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B0B1 - R0001 - Staff - Toilet - 3.36 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

Demountables**OS 971 10460 - Shed - Container (Garden/Sports/Bulk) - Placement Date : 28-SEP-2017****Exterior**

Eaves Linings	Flat AC Sheeting	2.88m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Garden Store**

End Wall Panel	Flat AC Sheeting	36m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Assumed Asbestos

OS 971 10563 - Shed - Container (Garden/Sports/Bulk) - Placement Date : 28-SEP-2017**Exterior**

Eaves Linings	Flat AC Sheeting	2.88m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Garden Store**

End Wall Panel	Flat AC Sheeting	36m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Assumed Asbestos

OS 971 10566 - Shed - Container (Garden/Sports/Bulk) - Placement Date : 28-SEP-2017**Exterior**

Eaves Linings	Flat AC Sheeting	2.88m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Garden Store**

End Wall Panel	Flat AC Sheeting	36m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Assumed Asbestos