


# Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Hunter River High School (8219)
Region:	Hunter/Central Coast AMU
State Electorate:	Port Stephens
Local Government Area:	Port Stephens

Last Reviewed By:	Greencap 10-FEB-2015
Last Revised By:	Greencap 25-JUL-2020

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

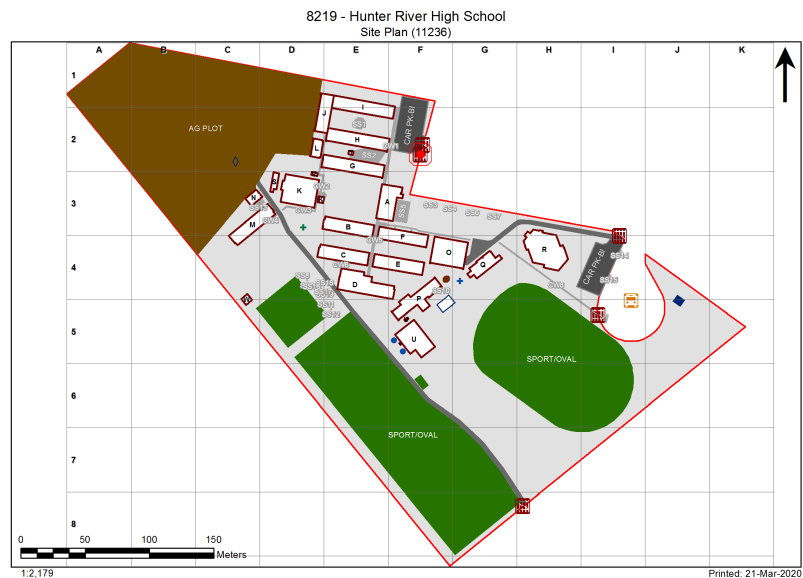

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - Administration - 1956 - Brick/Veneer</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00A - R0001 - Leading Teacher - 17.84 m2</b>							
No Asbestos							
<b>B00A - R0002 - Administration - Clerical - 9.82 m2</b>							
No Asbestos							
<b>B00A - R0004 - Staff - Toilet - 2.88 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00A - R0006 - Administration - Clerical - 33.34 m2</b>							
No Asbestos							
<b>B00A - R0007 - Interview/Office - Type 1 - 10.74 m2</b>							
No Asbestos							
<b>B00A - R0008 - Leading Teacher - 10.46 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00A - R0009 - Deputy Principal Office - 13.04 m2</b>							
No Asbestos							
<b>B00A - R0010 - Staff - Toilet - 2.11 m2</b>							
No Asbestos							
<b>B00A - R0011 - Clinic-Toilets - 2.11 m2</b>							
No Asbestos							
<b>B00A - R0012 - Clinic - Boys - 12.73 m2</b>							
No Asbestos							
<b>B00A - R0013 - General Storeroom - 7.5 m2</b>							
No Asbestos							
<b>B00A - R0014 - Distribution Board Cupboard - .45 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Electrical - Backing Board	Resinous Board	1.00	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00A - R0015 - Staff - Toilet - 4.57 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00A - R0016 - Cleaning Store - Distributed - 4.58 m2</b>							
No Asbestos							
<b>B00A - R0017 - Duplicating Workroom - 25.38 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00A - R0018 - External Movement - 96.35 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00A - R0019 - External Movement - 15.01 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00A - R0021 - Principal Office - 23.32 m2</b>							

No Asbestos							
<b>B00A - R0022 - Movement - 61.79 m2</b>							
No Asbestos							
<b>B00B - General Learning - 1956 - Timber</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	15m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00B - R0004 - Interview/Office - Type 1 - 22.55 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vynl Tiles	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Minimal Damage (2)	Low (1)	Low Priority (2-3)	
<b>B00B - R0005 - General Learning Space - 53.78 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0006 - General Learning Space - 53.77 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0007 - Office/Store - 22.34 m2</b>							
Floor Coverings Res/Textile	Vynl Sheet	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vynl Tiles - Adhesive						
<b>B00B - R0008 - Cleaning Store - Distributed - 3.12 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0009 - General Storeroom - 2.64 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0010 - External Movement - 84.51 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	85m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
				Minimal Damage (2)	Low (1)	Low Priority (2-3)	
<b>B00B - R0014 - Interview/Office - Type 1 - 25.57 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0015 - General Learning Space - 54.21 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0016 - Store - 21.24 m2</b>							

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0017 - Staff Study - 27 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - Technological &amp; Applied Studies - 1956 - Timber</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00C - R0001 - Secure Storeroom - 11.59 m2</b>							
No Asbestos							
<b>B00C - R0002 - Materials Store - 5.11 m2</b>							
No Asbestos							
<b>B00C - R0003 - Materials Store - 4.89 m2</b>							
No Asbestos							
<b>B00C - R0006 - Pantry - 11.16 m2</b>							
No Asbestos							
<b>B00C - R0007 - Food/Research Space - 12.8 m2</b>							
No Asbestos							
<b>B00C - R0008 - Food Technology L.S. - 84.47 m2</b>							
No Asbestos							
<b>B00C - R0009 - Laundry - 8.52 m2</b>							
No Asbestos							
<b>B00C - R0010 - Materials Store - 13.36 m2</b>							
No Asbestos							
<b>B00C - R0011 - External Movement - 89.63 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	90m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0012 - Staff Study - 58.02 m2</b>							
No Asbestos							
<b>B00C - R0013 - General Learning Space - Type 1 - 68.83 m2</b>							
No Asbestos							
<b>B00C - R0014 - Movement - 2.65 m2</b>							
No Asbestos							
<b>B00D - Technological &amp; Applied Studies - 1956 - Timber</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00D - R0001 - Design L.S. - 74.43 m2</b>							
No Asbestos							

B00D - R0002 - Materials Technology L.S. - 79.12 m2							
No Asbestos							
B00D - R0009 - Movement - 37.15 m2							
Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0010 - Computer Room - 24.54 m2							
No Asbestos							
B00D - R0011 - Store - 9.7 m2							
No Asbestos							
B00D - R0012 - Design L.S. - 57.96 m2							
No Asbestos							
B00D - R0013 - Wood Technology Bay - 109.27 m2							
No Asbestos							
B00D - R0014 - Project Store - Type 1 - 18.12 m2							
No Asbestos							
B00D - R0015 - Materials Store - 14.26 m2							
No Asbestos							
B00D - R0016 - Materials Store - 7.29 m2							
No Asbestos							
B00D - R0017 - Dust Extraction Space - 4.08 m2							
No Asbestos							
B00D - R0018 - Covered Outdoor Space - 122.38 m2							
No Asbestos							
B00E - Technological & Applied Studies - 1956 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00E - R0001 - External Movement - 13.89 m2							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0002 - Commonroom - 152.24 m2							
No Asbestos							
B00E - R0003 - Cleaning Store - Distributed - 2.6 m2							
No Asbestos							
B00E - R0004 - Movement - 26.46 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0005 - Staff - Toilet - 7.61 m2							
No Asbestos							
B00E - R0006 - Staff - Toilet - 7.53 m2							
No Asbestos							
B00E - R0007 - Staff Study - 24.91 m2							
No Asbestos							
B00E - R0008 - Materials Technology L.S. - 67.5 m2							
No Asbestos							

<b>B00E - R0009 - Materials Store - 6.36 m2</b>							
No Asbestos							
<b>B00E - R0010 - Resource/Project Store - 6.36 m2</b>							
No Asbestos							
<b>B00E - R0011 - Staff Study - 26.45 m2</b>							
No Asbestos							
<b>B00E - R0012 - Movement - 33.5 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00F - General Learning - 1956 - Timber</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00F - R0001 - General Learning Space - 67.03 m2</b>							
No Asbestos							
<b>B00F - R0002 - General Learning Space - 66.6 m2</b>							
No Asbestos							
<b>B00F - R0003 - Movement - 15.44 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting						
<b>B00F - R0005 - General Learning Space - 66.24 m2</b>							
No Asbestos							
<b>B00F - R0009 - Administration - Clerical - 18.03 m2</b>							
No Asbestos							
<b>B00F - R0010 - Security Store - 12.43 m2</b>							
No Asbestos							
<b>B00F - R0011 - Staff - Toilet - 6.18 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting						
<b>B00F - R0012 - Deputy Principal Office - 16.2 m2</b>							
No Asbestos							
<b>B00F - R0013 - Interview/Office - Type 1 - 12.8 m2</b>							
No Asbestos							
<b>B00F - R0014 - Interview/Office - Type 1 - 11.72 m2</b>							
No Asbestos							
<b>B00F - R0015 - Interview/Office - Type 1 - 12.8 m2</b>							
No Asbestos							
<b>B00F - R0016 - Pupil Entry - 21.45 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting						
<b>B00F - R0017 - Movement - 15.61 m2</b>							
No Asbestos							
<b>B00G - Various - 1969 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	50m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						

Underfloor Voids	No Asbestos Found							
<b>Interior</b>								
<b>B00G- R0001 - Cleaning Store - Distributed - 11.14 m2</b>								
No Asbestos								
<b>B00G- R0002 - Resources Store - 9.3 m2</b>								
No Asbestos								
<b>B00G- R0003 - Resources Store - 9.32 m2</b>								
Window	Compressed AC Sheet							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00G- R0004 - Art Learning Space - 60.24 m2</b>								
Window	Compressed AC Sheet							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00G- R0005 - Art Learning Space - 59.43 m2</b>								
Window	Compressed AC Sheet							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
				Good Condition (1)	Low (1)	Low Priority (2-3)		
<b>B00G- R0006 - Resources Store - 10.33 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
				Good Condition (1)	Low (1)	Low Priority (2-3)		
<b>B00G- R0007 - Kiln Space - 21.11 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00G- R0008 - Laboratory L.S. - 93.08 m2</b>								
No Asbestos								
<b>B00G- R0009 - Apparatus Store - 7.52 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00G- R0010 - Preparation - 17.87 m2</b>								
Window	Compressed AC Sheet							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00G- R0011 - Cleaning Store - Distributed - 10.26 m2</b>								
No Asbestos								
<b>B00G- R0012 - External Movement - 102.16 m2</b>								
No Asbestos								
<b>B00G- R0013 - Distribution Board Cupboard - .56 m2</b>								
<b>Note: No inspection of live electrical installation</b>								



Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00G- R0014 - Stairs - 9.26 m2</b>							
No Asbestos							
<b>B00G- R0015 - Stairs - 9.26 m2</b>							
No Asbestos							
<b>B00G- R1001 - Cleaning Store - Distributed - 5.39 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00G- R1002 - Staff Study - 26.15 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Window	Compressed AC Sheet						
<b>B00G- R1003 - General Learning Space - 53.19 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Window	Compressed AC Sheet						
<b>B00G- R1004 - Distribution Board Cupboard - .56 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00G- R1005 - General Storeroom - 5.6 m2</b>							
Ceiling Structures/Linings	No Asbestos Found						
<b>B00G- R1006 - General Storeroom - 6.25 m2</b>							
Window	Compressed AC Sheet						
Ceiling Structures/Linings	No Asbestos Found						
<b>B00G- R1007 - General Learning Space - 52.82 m2</b>							
Window	Compressed AC Sheet						
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00G- R1008 - General Learning Space - 66.63 m2</b>							
Window	Compressed AC Sheet						
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00G- R1009 - General Storeroom - 6.25 m2</b>							
Ceiling Structures/Linings	No Asbestos Found						
<b>B00G- R1010 - General Storeroom - 6.22 m2</b>							
Window	Compressed AC Sheet						
Ceiling Structures/Linings	No Asbestos Found						
<b>B00G- R1011 - General Learning Space - 66.31 m2</b>							
Window	Compressed AC Sheet						
Ceiling Structures/Linings	No Asbestos Found						
<b>B00G- R1012 - Cleaning Store - Distributed - 5.31 m2</b>							
No Asbestos							

<b>B00G- R1013 - Movement - 96.55 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	97m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00G- R1014 - Stairs - 16.87 m2</b>							
No Asbestos							
<b>B00G- R1015 - Stairs - 16.87 m2</b>							
No Asbestos							
<b>B00H - Various - 1969 - Brick/Block</b>							
<b>Exterior</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	30	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00H - R0001 - Garden Store Room - 16.58 m2</b>							
No Asbestos							
<b>B00H - R0002 - Laboratory L.S. - 93.89 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
Window	Compressed AC Sheet						
<b>B00H - R0006 - Distribution Board Cupboard - .97 m2</b>						<b>Note: No inspection of live electrical installation</b>	
No Asbestos							
<b>B00H - R0008 - Staff Study - 36 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Window	Compressed AC Sheet						
<b>B00H - R0009 - Cleaning Store - Distributed - 7.98 m2</b>							
No Asbestos							
<b>B00H - R0010 - Main Switchroom - 7.44 m2</b>							
No Asbestos							
<b>B00H - R0011 - External Movement - 95.57 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00H - R0012 - Stairs - 6.53 m2</b>							
No Asbestos							
<b>B00H - R0013 - Stairs - 5.78 m2</b>							
No Asbestos							
<b>B00H - R0014 - Food/Research Space - 42.02 m2</b>							
No Asbestos							
<b>B00H - R0015 - Food Technology L.S. - 89.2 m2</b>							
No Asbestos							
<b>B00H - R0016 - Preparation - Materials - 21.24 m2</b>							
No Asbestos							
<b>B00H - R0017 - Pantry - 2.46 m2</b>							
No Asbestos							
<b>B00H - R0018 - Laundry - 4.49 m2</b>							
No Asbestos							
<b>B00H - R1001 - Music Store - 2.83 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00H - R1002 - Staff - Toilet - 4.83 m2</b>							

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00H - R1003 - General Storeroom - 9.12 m2</b>							
No Asbestos							
<b>B00H - R1007 - Computer Learning Space - 52.6 m2</b>							
Window	Compressed AC Sheet						
<b>B00H - R1008 - Computer Learning Space - 39.74 m2</b>							
Window	Compressed AC Sheet						
<b>B00H - R1009 - Computer Store - 12.54 m2</b>							
Window	Compressed AC Sheet						
<b>B00H - R1010 - Computer Resource - 12.68 m2</b>							
Window	Compressed AC Sheet						
<b>B00H - R1011 - General Learning Space - 52.83 m2</b>							
Window	Compressed AC Sheet						
<b>B00H - R1012 - Distribution Board Cupboard - .95 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00H - R1013 - General Storeroom - 5.93 m2</b>							
No Asbestos							
<b>B00H - R1014 - General Storeroom - 5.72 m2</b>							
Window	Compressed AC Sheet						
<b>B00H - R1015 - General Learning Space - 53.62 m2</b>							
Window	Compressed AC Sheet						
<b>B00H - R1016 - General Storeroom - 7.21 m2</b>							
Window	Compressed AC Sheet						
<b>B00H - R1017 - External Movement - 91.17 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00H - R1018 - Staff Study - 43.33 m2</b>							
Window	Compressed AC Sheet						
<b>B00H - R1019 - Stairs - 13.04 m2</b>							
No Asbestos							
<b>B00H - R1020 - Stairs - 11.77 m2</b>							
No Asbestos							
<b>B00I - Various - 1969 - Brick/Block</b>							
<b>Exterior</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	30	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00I - R0001 - Cleaning Store - Distributed - 5.03 m2</b>							
No Asbestos							
<b>B00I - R0002 - General Storeroom - 7.21 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
<b>B00I - R0003 - General Learning Space - 53.34 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Window	Compressed AC Sheet						
<b>B00I - R0004 - General Learning Space - 52.82 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B001 - R0005 - Distribution Board Cupboard - .84 m2</b>							<b>Note: No inspection of live electrical installation</b>
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B001 - R0006 - General Storeroom - 5.56 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B001 - R0007 - General Storeroom - 5.79 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B001 - R0008 - General Learning Space - 52.97 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B001 - R0009 - Art Learning Space - 66.13 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B001 - R0010 - General Learning Space - 53.56 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B001 - R0011 - Cleaning Store - Distributed - 5.08 m2</b>							
No Asbestos							
<b>B001 - R0012 - Staff - Toilet - 2 m2</b>							
No Asbestos							
<b>B001 - R0013 - Staff Change - 4.88 m2</b>							
No Asbestos							
<b>B001 - R0014 - External Movement - 102.9 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B001 - R0015 - Stairs - 9.45 m2</b>							
No Asbestos							
<b>B001 - R0016 - Stairs - 9.57 m2</b>							
No Asbestos							
<b>B001 - R1001 - Music Store - 6.98 m2</b>							
No Asbestos							
<b>B001 - R1002 - Music Learning Space - 52.82 m2</b>							
Window	Compressed AC Sheet						
<b>B001 - R1003 - General Learning Space - 52.01 m2</b>							
Window	Compressed AC Sheet						
<b>B001 - R1004 - Distribution Board Cupboard - .81 m2</b>							<b>Note: No inspection of live electrical installation</b>
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B001 - R1005 - General Storeroom - 25.11 m2</b>							
Window	Compressed AC Sheet						
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

<b>B00I - R1006 - General Learning Space - 52.82 m2</b>							
No Asbestos							
<b>B00I - R1007 - General Learning Space - 52.89 m2</b>							
No Asbestos							
<b>B00I - R1008 - Staff Study - 53.78 m2</b>							
No Asbestos							
<b>B00I - R1009 - Staff - Toilet - 2.02 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00I - R1010 - Staff Change - 4.84 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00I - R1011 - External Movement - 97.83 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	98m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00I - R1012 - Stairs - 13.1 m2</b>							
No Asbestos							
<b>B00I - R1013 - Stairs - 13.08 m2</b>							
No Asbestos							
<b>B00J - Various - 1969 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00J - R0001 - General Learning Space - 53.19 m2</b>							
Window	Compressed AC Sheet						
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00J - R0002 - General Storeroom - 4.3 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Window	Compressed AC Sheet						
<b>B00J - R0003 - General Storeroom - 4.23 m2</b>							
Window	Compressed AC Sheet						
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00J - R0004 - Distribution Board Cupboard - .98 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00J - R0005 - General Learning Space - 53.19 m2</b>							
Window	Compressed AC Sheet						
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00J - R0006 - Staff Study - 65.74 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Window	Compressed AC Sheet						
<b>B00J - R0007 - Staff - Toilet - 3.56 m2</b>							
Window	Compressed AC Sheet						
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						

Partition Walls (Cubicles)	Compressed AC Sheet	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0008 - Staff - Toilet - 4.03 m2</b>							
Window	Compressed AC Sheet						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0009 - General Storeroom - 6.88 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
Window	Compressed AC Sheet						
<b>B00J - R0010 - Cleaning Supplies Store - 12.65 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00J - R0011 - External Movement - 59.53 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00J - R1001 - Seminar - 25.85 m2</b>							
Window	Compressed AC Sheet						
<b>B00J - R1004 - Performing Arts Store - 7.77 m2</b>							
No Asbestos							
<b>B00J - R1005 - Performance Workshop - 25.52 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting						
Window	Compressed AC Sheet						
<b>B00J - R1008 - Staff Study - 25.89 m2</b>							
Window	Compressed AC Sheet						
<b>B00J - R1009 - Movement - 55.39 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal - Infill	Flat AC Sheeting						
<b>B00J - R1010 - Distribution Board Cupboard - .98 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00J - R1011 - General Storeroom - 4.79 m2</b>							
No Asbestos							
<b>B00J - R1012 - Plant - 12.69 m2</b>							
Window	Compressed AC Sheet						
<b>B00J - R1013 - Performance Workspace - 105.8 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting						
<b>B00K - Library/Science - 1970 - Brick/Block</b>							
<b>Exterior</b>							
Gable Verge Lining	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting						
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids	No Asbestos Found						

<b>Interior</b>							
<b>B00K - M1001 - General Storeroom - 9.28 m2</b>							
No Asbestos							
<b>B00K - M1002 - Plant - 35.12 m2</b>							
No Asbestos							
<b>B00K - M1005 - System Administrators Office - 19.2 m2</b>							
No Asbestos							
<b>B00K - M1006 - System Administrators Office - 5.93 m2</b>							
No Asbestos							
<b>B00K - M1007 - Garden Store Room - 12.28 m2</b>							
No Asbestos							
<b>B00K - M1008 - Computer Learning Space - 118.64 m2</b>							
No Asbestos							
<b>B00K - R0001 - Laboratory L.S. - 91.72 m2</b>							
No Asbestos							
<b>B00K - R0002 - External Movement - 3.83 m2</b>							
No Asbestos							
<b>B00K - R0003 - Movement - 42.16 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00K - R0004 - Laboratory L.S. - 92.51 m2</b>							
No Asbestos							
<b>B00K - R0005 - Preparation - 48.11 m2</b>							
No Asbestos							
<b>B00K - R0006 - Laboratory L.S. - 92.52 m2</b>							
No Asbestos							
<b>B00K - R0007 - Apparatus Store - 15.26 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00K - R0008 - Main Switchroom - 14.08 m2</b>							
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00K - R0009 - Laboratory L.S. - 92.21 m2</b>							
No Asbestos							
<b>B00K - R0010 - Preparation - 47.77 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00K - R0011 - Distribution Board Cupboard - .73 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00K - R0012 - General Storeroom - 7.71 m2</b>							
No Asbestos							
<b>B00K - R0013 - External Stairs - 8.15 m2</b>							
No Asbestos							
<b>B00K - R1001 - Movement - 2.36 m2</b>							
No Asbestos							
<b>B00K - R1002 - Staff - Toilet - 1.89 m2</b>							
No Asbestos							
<b>B00K - R1003 - Staff Change - 4.15 m2</b>							

No Asbestos							
<b>B00K - R1004 - Main Area - 366.58 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - (X25)						
<b>B00K - R1005 - Seminar - 12.67 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
<b>B00K - R1006 - Seminar - 12.33 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
<b>B00K - R1007 - Distribution Board Cupboard - 2.93 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Electrical - Backing Board	Resinous Board	2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00K - R1008 - Cleaning Store - Distributed - 3.32 m2</b>							
Ceiling Structures/Linings	No Asbestos Found						
<b>B00K - R1009 - Seminar - 12.33 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
<b>B00K - R1010 - Seminar - 12.66 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
<b>B00K - R1011 - Audio Visual Workroom - 36.77 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
<b>B00K - R1012 - Librarian - 11.41 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
<b>B00K - R1013 - Workroom - 47.74 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
<b>B00K - R1014 - Staff Change - 4.07 m2</b>							
No Asbestos							
<b>B00K - R1015 - Staff - Toilet - 1.87 m2</b>							
No Asbestos							
<b>B00K - R1016 - Stairs - 17.53 m2</b>							
No Asbestos							
<b>B00L - Pupil Facilities - 1956 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00L - R0001 - External Movement - 1.47 m2</b>							
No Asbestos							
<b>B00L - R0002 - Student Drinking Facilities - 3.87 m2</b>							
No Asbestos							
<b>B00L - R0003 - External Movement - 1.47 m2</b>							
No Asbestos							
<b>B00L - R0004 - Student Drinking Facilities - 3.29 m2</b>							
No Asbestos							
<b>B00L - R0005 - Toilets-Boys - 38.36 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						



Partition Walls (Cubicles)	Compressed AC Sheet							
<b>B00L - R0006 - Plant - 3.09 m2</b>								
No Asbestos								
<b>B00L - R0007 - Toilets-Girls - 41.84 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting							
Partition Walls (Cubicles)	Compressed AC Sheet							
<b>B00L - R0008 - Plant - 3.33 m2</b>								
No Asbestos								
<b>B00M - Various - 1956 - Timber</b>								
<b>Exterior</b>								
Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found							
Underfloor Voids	No Asbestos Found							
<b>Interior</b>								
<b>B00M - R0001 - General Learning Space - 46.42 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00M - R0002 - General Learning Space - 54.51 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00M - R0003 - Darkroom Space - 22.55 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00M - R0004 - No Access - 54.14 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00M - R0005 - Performing Arts Store - 18.07 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00M - R0006 - Performance Workspace - 89.92 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	90m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
				Good Condition (1)	Low (1)	Low Priority (2-3)		
<b>B00M - R0007 - External Movement - 94.11 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00N - Agricultural Science - 1956 - Timber</b>								
<b>Exterior</b>								
Ceiling Voids - Raked Ceiling	No Asbestos Found							
Underfloor Voids	No Asbestos Found							
<b>Interior</b>								
<b>B00N - R0001 - Office/Store - 8.08 m2</b>								

Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00N - R0002 - External Movement - 18.33 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00N - R0003 - Class Tools Storage - 9.41 m2</b>							
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00N - R0004 - Machine Storage - 41.39 m2</b>							
Wall Linings Internal	Flat AC Sheeting	12m2	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00O - Pupil Facilities - 1969 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00O - R0001 - Cleaning Store - Distributed - 8.75 m2</b>							
No Asbestos							
<b>B00O - R0002 - Sport Equipment Store - 18.07 m2</b>							
No Asbestos							
<b>B00O - R0003 - Garden Store Room - 12.72 m2</b>							
No Asbestos							
<b>B00O - R0004 - Staff - Toilet - 2.8 m2</b>							
No Asbestos							
<b>B00O - R0005 - Pantry - 2.8 m2</b>							
No Asbestos							
<b>B00O - R0006 - Student Canteen - 58.53 m2</b>							
No Asbestos							
<b>B00O - R0007 - Distribution Board Cupboard - .68 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Electrical - Backing Board	Resinous Board	2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00O - R0008 - General Storeroom - 18.3 m2</b>							
No Asbestos							
<b>B00O - R0009 - Cleaning Store - Distributed - 8.81 m2</b>							
No Asbestos							
<b>B00O - R0010 - Movement - 343.16 m2</b>							
No Asbestos							
<b>B00O - R0011 - External Movement - 15.31 m2</b>							
No Asbestos							
<b>B00O - R0012 - Stairs - 7.59 m2</b>							
No Asbestos							
<b>B00O - R0013 - Stairs - 7.59 m2</b>							
No Asbestos							
<b>B00O - R1001 - Movement - 10.54 m2</b>							
No Asbestos							

<b>B00O - R1002 - Plant - 4.18 m2</b>							
Furniture / Fixtures - Cistern	Fibre Cement Casting (Monocrete)	10	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00O - R1003 - Toilets-Girls - 60.71 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00O - R1004 - Plant - 6.98 m2</b>							
No Asbestos							
<b>B00O - R1005 - Toilets-Boys - 58.99 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00O - R1006 - Movement - 10.51 m2</b>							
No Asbestos							
<b>B00O - R1007 - Stairs - 15.41 m2</b>							
No Asbestos							
<b>B00O - R1008 - Stairs - 15.41 m2</b>							
No Asbestos							
<b>B00P - Various - 1984 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	50	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00P - R0001 - Staff Shower - 4.5 m2</b>							
No Asbestos							
<b>B00P - R0002 - Staff - Toilet - 3.04 m2</b>							
No Asbestos							
<b>B00P - R0003 - Staff Change - 15 m2</b>							
No Asbestos							
<b>B00P - R0005 - Plant - 3.8 m2</b>							
No Asbestos							
<b>B00P - R0010 - Materials Technology L.S. - 80.66 m2</b>							
No Asbestos							
<b>B00P - R0011 - T.A.S. Outdoor Area - 26.92 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00P - R0014 - Welding Area - 4.24 m2</b>							
No Asbestos							
<b>B00P - R0015 - Materials Store - 22.31 m2</b>							
No Asbestos							

<b>B00P - R0016 - Project Store - Type 1 - 22.32 m2</b>							
No Asbestos							
<b>B00P - R0017 - Welding Area - 4.22 m2</b>							
No Asbestos							
<b>B00P - R0018 - Materials Store - 7.57 m2</b>							
No Asbestos							
<b>B00P - R0019 - Materials Store - 12.5 m2</b>							
No Asbestos							
<b>B00P - R0020 - Workshop Area - 33.28 m2</b>							
No Asbestos							
<b>B00P - R0021 - Workshop - 143.38 m2</b>							
No Asbestos							
<b>B00Q - Pupil Facilities - 1969 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	15.00m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00Q - R0001 - External Movement - 5.03 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00Q - R0003 - External Movement - 11.21 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00Q - R0010 - General Storeroom - 12.12 m2</b>							
No Asbestos							
<b>B00Q - R0011 - Toilets-Unisex - 3.06 m2</b>							
No Asbestos							
<b>B00Q - R0012 - Distribution Board Cupboard - 2.24 m2</b>							
No Asbestos							
<b>B00Q - R0013 - Toilets-Unisex - 9.54 m2</b>							
No Asbestos							
<b>B00Q - R0014 - General Learning Space - 55.29 m2</b>							
No Asbestos							
<b>B00Q - R0015 - Staff Kitchen - 10.57 m2</b>							
No Asbestos							
<b>B00Q - R0016 - Staff Kitchen - 13.23 m2</b>							
No Asbestos							
<b>B00Q - R0017 - Staff Study - 12.61 m2</b>							
No Asbestos							
<b>B00Q - R0018 - Staff - Toilet - 5.08 m2</b>							
No Asbestos							
<b>B00Q - R0019 - External Movement - 58.4 m2</b>							

No Asbestos							
<b>B00Q - R0020 - External Movement - 11.96 m2</b>							
No Asbestos							
<b>B00Q - R0021 - External Movement - 12.54 m2</b>							
No Asbestos							
<b>B00R - Multi Purpose Facilities - 1971 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting						
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00R - M0001 - Control Room - 4.36 m2</b>							
No Asbestos							
<b>B00R - M0002 - Staff - Toilet - 3.48 m2</b>							
No Asbestos							
<b>B00R - M0003 - Staff - Toilet - 3.48 m2</b>							
No Asbestos							
<b>B00R - M0004 - Control Room - 4.36 m2</b>							
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00R - R0001 - External Movement - 4.2 m2</b>							
No Asbestos							
<b>B00R - R0002 - Movement - 1.61 m2</b>							
No Asbestos							
<b>B00R - R0003 - Movement - 4.95 m2</b>							
No Asbestos							
<b>B00R - R0004 - Stage - 87.7 m2</b>							
No Asbestos							
<b>B00R - R0005 - Movement - 4.95 m2</b>							
No Asbestos							
<b>B00R - R0006 - Movement - 1.62 m2</b>							
No Asbestos							
<b>B00R - R0007 - External Movement - 4.2 m2</b>							
No Asbestos							
<b>B00R - R0008 - Multi-Purpose Space - 440.28 m2</b>							
No Asbestos							
<b>B00R - R0009 - External Movement - 3.92 m2</b>							
No Asbestos							
<b>B00R - R0010 - Staff - Toilet - 8.69 m2</b>							
No Asbestos							
<b>B00R - R0011 - Cleaning Store - Distributed - 1.81 m2</b>							
No Asbestos							
<b>B00R - R0012 - Staff - Toilet - 4.51 m2</b>							
No Asbestos							
<b>B00R - R0013 - Entry - 22.83 m2</b>							
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00R - R0014 - External Movement - 10.09 m2</b>							
No Asbestos							
<b>B00R - R0015 - Staff Kitchen - 16.02 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00R - R0016 - External Movement - 3.93 m2</b>							
No Asbestos							
<b>B00R - R9001 - Movement - 3.02 m2</b>							
No Asbestos							
<b>B00R - R9002 - General Storeroom - 5.54 m2</b>							
No Asbestos							
<b>B00R - R9003 - Performing Arts Changeroom - 11.48 m2</b>							
No Asbestos							
<b>B00R - R9004 - Performing Arts Changeroom - 11.48 m2</b>							
No Asbestos							
<b>B00R - R9005 - General Storeroom - 5.61 m2</b>							
No Asbestos							
<b>B00R - R9006 - Movement - 2.99 m2</b>							
No Asbestos							
<b>B00R - R9007 - Performing Arts Chair Store - 40.46 m2</b>							
No Asbestos							
<b>B00S - Agricultural Science - 1956 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00S - R0001 - Garden Store Room - 7.74 m2</b>							
No Asbestos							
<b>B00S - R0002 - Class Tools Storage - 12.91 m2</b>							
No Asbestos							
<b>B00S - R0003 - Machine Storage - 31.85 m2</b>							
No Asbestos							
<b>B00S - R0004 - Materials Store - 5.98 m2</b>							
No Asbestos							
<b>B00T - Technological &amp; Applied Studies - 2006 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00T - R0001 - Kiln Space - 7.93 m2</b>							
Plant / Equipment - Kiln	Insulation Material						
<b>B00U - Technological &amp; Applied Studies - 2009 - Brick/Veneer</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00U - R0001 - Entry - 13.8 m2</b>							
No Asbestos							
<b>B00U - R0002 - Store - 3.99 m2</b>							

No Asbestos	
<b>B00U - R0003 - Toilets-Disabled - 6.08 m2</b>	
No Asbestos	
<b>B00U - R0004 - Distribution Board Cupboard - .93 m2</b>	<b>Note: No inspection of live electrical installation</b>
No Asbestos	
<b>B00U - R0005 - Materials Technology L.S. - 43.39 m2</b>	
No Asbestos	
<b>B00U - R0006 - Store - 21.63 m2</b>	
No Asbestos	
<b>B00U - R0007 - Teachers Aides - 11.09 m2</b>	
No Asbestos	
<b>B00U - R0008 - Workshop Area - 219.49 m2</b>	
No Asbestos	
<b>B00U - R0009 - External Movement - 12.1 m2</b>	
No Asbestos	
<b>B00U - R0010 - Outdoor Workshop - 106.11 m2</b>	
No Asbestos	
<b>B00U - R0011 - Plant - 1.54 m2</b>	
No Asbestos	
<b>B00U - R0012 - Plant - 1.54 m2</b>	
No Asbestos	
<b>B00V - Art/General Learning - 2011 - Brick/Veneer</b>	
<b>Exterior</b>	
Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found
<b>Interior</b>	
<b>B00V - R0001 - Movement - 4.31 m2</b>	
No Asbestos	
<b>B00V - R0002 - Lift - 2.31 m2</b>	
No Asbestos	
<b>B00V - R1001 - Movement - 4.31 m2</b>	
No Asbestos	
<b>B00W - Storage - 2018 - Metal Shed</b>	
<b>Exterior</b>	
No Asbestos	
<b>Interior</b>	
<b>B00W - R0001 - General Storeroom - 32.68 m2</b>	
No Asbestos	

## Demountables

### OS 711 10619 - Home Science/Art/Science Dem/Computer - Placement Date : 20-MAR-2002

#### Exterior

Eaves Linings	Flat AC Sheeting	14.4m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

#### Interior

##### R1- Computer Room

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	m2	Assumed Asbestos

##### R2- Food Technology L.S.

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	73m2	Assumed Asbestos

##### R3- Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	m2	Assumed Asbestos
----------------------------	------------------	----	------------------

### OS 837 14954 - Hcap Shower/Change/Toilet - Placement Date : 10-FEB-2012

No Asbestos Found