

Asbestos Register


(Hazardous Materials and Risk Assessment)

School:	Hastings Secondary College Port Macquarie Campus (8364)
Region:	North Coast AMU
State Electorate:	Port Macquarie
Local Government Area:	Port Macquarie-Hastings

Last Reviewed By:	Greencap 14-APR-2016
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.	

8364 - Hastings Secondary College Port Macquarie Campus
Site Plan (13448)

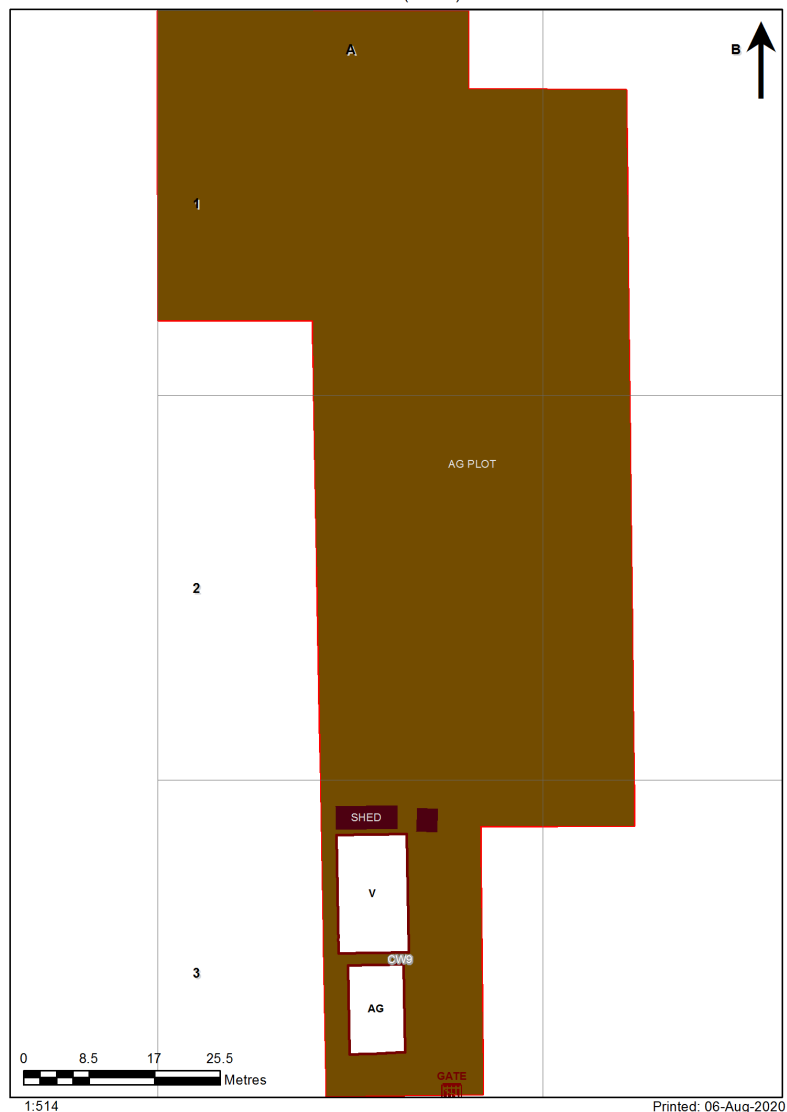

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - General Learning/Administration - 1962 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	75m2	North South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	Non Accessible Area						
Wall Linings Internal - Infill	Compressed AC Sheet						
Underfloor Voids	No Asbestos Found						
Interior							
B00A - R0001 - Movement - 4.75 m2							
No Asbestos							
B00A - R0002 - Movement - 14.44 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0003 - Cleaning Store - Distributed - 4.73 m2							
No Asbestos							
B00A - R0013 - Secure Storeroom - 11.84 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0014 - Distribution Board Cupboard - .33 m2							
Note: No inspection of live electrical installation							
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0015 - Principal Office - 18.5 m2							
Wnindow	Compressed AC Sheet	5	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R0016 - Staff - Toilet - 5.05 m2							
No Asbestos							
B00A - R0019 - Administration - Clerical - 16.26 m2							
No Asbestos							
B00A - R0020 - Clinic - Boys - 10.61 m2							
No Asbestos							
B00A - R0021 - Interview/Office - Type 1 - 8.41 m2							
No Asbestos							
B00A - R0022 - Movement - 37.57 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0024 - General Storeroom - 4.84 m2							
No Asbestos							
B00A - R0028 - General Storeroom - 11.1 m2							
No Asbestos							
B00A - R0029 - Cleaning Store - Distributed - 2.27 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0033 - Main Switchroom - 5.74 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Electrical - Backing Board	Resinous Board	5	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0034 - General Storeroom - 12.47 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						

Window	Compressed AC Sheet	5	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0035 - Food Technology L.S. - 101.64 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Window	Compressed AC Sheet	10	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0036 - Interview/Office - Type 1 - 12.12 m2							
No Asbestos							
B00A - R0037 - Movement - 79.66 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00A - R0040 - Administration - Clerical - 13.05 m2							
Window	Compressed AC Sheet	5	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0042 - Movement - 19.59 m2							
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0043 - Covered Area - 2.57 m2							
No Asbestos							
B00A - R0044 - Stairs - 3.37 m2							
No Asbestos							
B00A - R0045 - Stairs - 4.35 m2							
No Asbestos							
B00A - R0046 - Movement - 70.05 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00A - R0047 - Administration - Clerical - 63.43 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0048 - Store - 20.95 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0049 - Deputy Principal Office - 13.31 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Window	Compressed AC Sheet	5	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0050 - Interview/Office - Type 2 - 11.7 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0051 - Toilet - Lobby - 3.42 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0052 - Staff - Toilet - 2.05 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Window	Compressed AC Sheet	2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0053 - Toilet - Lobby - 1.64 m2							
No Asbestos							
B00A - R0054 - Staff - Toilet - 1.64 m2							
No Asbestos							
B00A - R0055 - Access Student Shower/Toilet - Type 2 - 9.22 m2							
No Asbestos							

B00A - R0056 - Toilet - Lobby - 2.56 m2							
No Asbestos							
B00A - R0057 - Staff - Toilet - 2.36 m2							
No Asbestos							
B00A - R0058 - Kitchen - Type 1 - 108.21 m2							
No Asbestos							
B00A - R0059 - Pantry - 13.48 m2							
No Asbestos							
B00A - R0060 - Laundry - 1.05 m2							
No Asbestos							
B00A - R0061 - Preparation - 18.66 m2							
No Asbestos							
B00A - R0062 - Kitchen - Type 2 - 14.62 m2							
No Asbestos							
B00A - R0063 - Food/Research Space - 25.07 m2							
No Asbestos							
B00A - R0064 - Staff Change - 5.16 m2							
No Asbestos							
B00A - R0065 - No Access - 4.04 m2							
No Asbestos							
B00A - R0066 - No Access - 1.53 m2							
No Asbestos							
B00A - R0067 - Commonroom - 68.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Window	Compressed AC Sheet	6	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0068 - Staff Kitchen - 5.33 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R1001 - Cleaning Store - Distributed - 1.39 m2							
No Asbestos							
B00A - R1002 - General Storeroom - 1.39 m2							
No Asbestos							
B00A - R1003 - Materials Technology L.S. - 59.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Window	Compressed AC Sheet	5	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1004 - Seminar/Technology Space - 12.09 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R1005 - General Storeroom - 11.37 m2							
Window	Compressed AC Sheet	5	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1006 - Materials Technology L.S. - 56.14 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Window	Compressed AC Sheet	5	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1007 - General Learning Space - 37.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Window	Compressed AC Sheet	5	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00A - R1008 - General Learning Space - 50.4 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Wndow	Compressed AC Sheet	5	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1009 - General Learning Space - 50.9 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Wndow	Compressed AC Sheet	5	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1010 - General Learning Space - 51.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Wndow	Compressed AC Sheet	10	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1011 - Staff Study - 43.86 m2							
Wndow	Compressed AC Sheet	5	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1012 - Staff - Toilet - 5.73 m2							
Wndow	Compressed AC Sheet	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1013 - Distribution Board Cupboard - .73 m2							
							Note: No inspection of live electrical installation
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R1014 - General Storeroom - 12.27 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1015 - Seminar - 24.82 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Wndow	Compressed AC Sheet	5	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1016 - Staff Study - 12.02 m2							
Wndow	Compressed AC Sheet	5	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1017 - Movement - 20.9 m2							
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1018 - General Learning Space - 50.47 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Wndow	Compressed AC Sheet	5	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1019 - General Learning Space - 51.11 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Wndow	Compressed AC Sheet	5	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1020 - Movement - 89.58 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	90m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						

B00A - R1021 - Movement - 11.63 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1022 - Stairs - 13.47 m2							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1023 - Stairs - 10.85 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - Art/Music - 1966 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	50m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Interior							
B00B - R0001 - Staff Study - 25.85 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R0002 - General Learning Space - 52.42 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0003 - General Learning Space - 52.57 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0004 - Laboratory L.S. - 78.89 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00B - R0005 - Preparation - 12.62 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0006 - Preparation - 12.66 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0007 - Movement - 2.72 m2							
No Asbestos							
B00B - R0008 - Resources Store - 13.81 m2							
No Asbestos							
B00B - R0009 - Laboratory L.S. - 92.16 m2							
No Asbestos							
B00B - R0010 - Resources Store - 6.47 m2							
No Asbestos							
B00B - R0011 - Preparation - 18.85 m2							
No Asbestos							
B00B - R0012 - General Learning Space - 52.35 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0013 - Resources Store - 6.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0014 - Apparatus Store - 3.67 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0015 - Distribution Board Cupboard - .49 m2				Note: No inspection of live electrical installation			
Electrical - Backing Board	Resinous Board	2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Linings Internal	Flat AC Sheeting	2m2	North	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0016 - Movement - 2.87 m2							
No Asbestos							
B00B - R0017 - General Storeroom - 13.67 m2							
No Asbestos							
B00B - R0018 - Movement - 98.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00B - R0019 - Movement - 14.77 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0020 - Movement - 19.03 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0021 - Stairs - 4.6 m2							
No Asbestos							
B00B - R0022 - Stairs - 4.6 m2							
No Asbestos							
B00B - R1001 - Resources Store - 9.79 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1002 - Staff Study - 26.73 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1003 - Movement - 5.43 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1004 - Distribution Board Cupboard - .41 m2				Note: No inspection of live electrical installation			
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles						
B00B - R1005 - Distribution Board Cupboard - 7.83 m2				Note: No inspection of live electrical installation			
No Asbestos							
B00B - R1006 - General Learning Space - 52.28 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1007 - General Learning Space - 52.28 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						

Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1008 - Music Learning Space - 65.54 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1009 - Resources Store - 6.15 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1010 - Music Store - 6.21 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1011 - Cleaning Store - Distributed - 1.83 m2							
No Asbestos							
B00B - R1012 - Staff - Toilet - 5.98 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1013 - Resources Store - 6.16 m2							
No Asbestos							
B00B - R1014 - Art Learning Space - 59.35 m2							
No Asbestos							
B00B - R1015 - Resources Store - 6.15 m2							
No Asbestos							
B00B - R1016 - Art Learning Space - 52.63 m2							
Plumbing / Pipework	Fibre Cement Pipe	3	North	Good Condition (1)	Low (1)	Low Priority (2-3)	, Amosite (brown asbestos)
B00B - R1017 - Kiln Space - 21.74 m2							
No Asbestos							
B00B - R1018 - Resources Store - 10.07 m2							
No Asbestos							
B00B - R1019 - Staff Study - 25.84 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1020 - Staff - Toilet - 5.91 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1021 - Cleaning Store - Distributed - 1.84 m2							
No Asbestos							
B00B - R1022 - Movement - 95.31 m2							
No Asbestos							
B00B - R1023 - Movement - 15.39 m2							
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1024 - Stairs - 4.48 m2							
No Asbestos							
B00B - R1025 - Stairs - 5.24 m2							
No Asbestos							

B00C - Pupil Facilities - 1962 - Brick/Block

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	Non Accessible Area						

Interior

B00C - R0001 - Administration - Clerical - 35.06 m2

Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos

B00C - R0002 - Staff - Toilet - 3.46 m2

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00C - R0003 - General Storeroom - 3.66 m2

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00C - R0004 - General Storeroom - 13.01 m2

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00C - R0005 - Toilets-Boys - 40.18 m2

Partition Walls (Cubicles)	Compressed AC Sheet	30m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00C - R0006 - Materials Store - 23.83 m2

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	------	------------	--------------------	---------	--------------------	-----------------------------

B00C - R0007 - Cleaning Store - Distributed - 5.46 m2

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00C - R0009 - General Storeroom - 5.43 m2

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------	-----------------------------

B00C - R0010 - Toilets-Girls - 40.14 m2

Partition Walls (Cubicles)	Compressed AC Sheet	40m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0011 - Cleaning Store - Distributed - .76 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0012 - Sport Equipment Store - 23.1 m2							
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0013 - Movement - 125.2 m2							
No Asbestos							
B00C - R0014 - Covered Area - 79.16 m2							
No Asbestos							
B00C - R0015 - Seminar - 70.71 m2							
Ceiling Structures/Linings	Flat AC Sheeting	71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting						
B00C - R0016 - Careers Advisers Office - 43.36 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - Science/Library - 1966 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	70m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00L - R0001 - General Storeroom - 2.76 m2							
No Asbestos							
B00L - R0004 - Cleaning Store - Distributed - 5.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00L - R0005 - General Learning Space - 52.79 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00L - R0006 - Resources Store - 5.97 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00L - R0007 - General Learning Space - 52.86 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00L - R0008 - General Storeroom - 6.18 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00L - R0009 - Resources Store - 6.2 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00L - R0010 - General Learning Space - 51.47 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00L - R0012 - General Storeroom - 6.45 m2							
No Asbestos							
B00L - R0013 - Toilets-Boys - 26.29 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Partition Walls (Cubides)	Compressed AC Sheet						
B00L - R0014 - Toilets-Girls - 26.3 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Partition Walls (Cubides)	Compressed AC Sheet						
B00L - R0015 - Serviced Learning Space - 53.87 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00L - R0016 - Cleaning Store - Distributed - 2.71 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00L - R0017 - Staff Study - 41.3 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00L - R0018 - General Storeroom - 6.54 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00L - R0019 - Distribution Board Cupboard - 2.55 m2							
Note: No inspection of live electrical installation							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00L - R0021 - Laboratory L.S. - 92.54 m2							
No Asbestos							
B00L - R0024 - Laboratory L.S. - 93.03 m2							
Wall Linings Internal	Flat AC Sheeting						

B00L - R0025 - Apparatus Store - 38.37 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Plant / Equipment - Fume Cupboard	Flat AC Sheeting	2	East and West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R0026 - Distribution Board Cupboard - .83 m2							
Note: No inspection of live electrical installation							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00L - R0027 - Staff Study - 25.95 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00L - R0028 - Movement - 95.84 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00L - R0029 - Staff Study - 24.77 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00L - R0030 - Staff - Toilet - 8.97 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R0033 - Movement - 69.88 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00L - R0035 - Movement - 4.99 m2							
No Asbestos							
B00L - R0036 - General Learning Space - 52.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00L - R0037 - Preparation - 39.31 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00L - R0038 - Growing/Breeding - 24.52 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00L - R0039 - Movement - 33.24 m2								
No Asbestos								
B00L - R0040 - Performing Arts Store - 14.6 m2								
No Asbestos								
B00L - R0041 - Performance Workspace - 117.72 m2								
No Asbestos								
B00L - R0042 - Movement - 137.38 m2								
No Asbestos								
B00L - R0043 - Stairs - 20.3 m2								
No Asbestos								
B00L - R0044 - Stairs - 16.04 m2								
No Asbestos								
B00L - R0045 - Stairs - 4.63 m2								
No Asbestos								
B00L - R1002 - Computer Learning Space - 52.64 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	53m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00L - R1003 - Computer Store - 5.17 m2								
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	6m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00L - R1004 - Resources Store - 6.2 m2								
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	7m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00L - R1005 - General Learning Space - 39.33 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	40m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00L - R1006 - Distribution Board Cupboard - .84 m2								
						Note: No inspection of live electrical installation		
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00L - R1007 - Careers Advisers Office - 24.9 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	25m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	25m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00L - R1008 - Computer Learning Space - 51.39 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00L - R1009 - Movement - 53.78 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	41m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	41m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00L - R1016 - Movement - 51.52 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R1017 - General Learning Space - 54 m2							
No Asbestos							
B00L - R1018 - General Storeroom - 3.17 m2							
No Asbestos							
B00L - R1019 - Movement - 7.11 m2							
No Asbestos							
B00L - R1021 - Resources Store - 3.15 m2							
No Asbestos							
B00L - R1022 - Interview/Office - Type 1 - 14.26 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	15m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R1023 - Deputy Principal Office - 14.19 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	15m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R1024 - Deputy Principal Office - 12.02 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	12m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R1025 - Movement - 26.66 m2							
Floor Coverings Res/Textile	Vinyl Tiles	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R1027 - Distribution Board Cupboard - 2.48 m2							
						Note: No inspection of live electrical installation	
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00L - R1028 - Cleaning Store - Distributed - 4.26 m2							
No Asbestos							
B00L - R1029 - General Learning Space - 54.16 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	55m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R1031 - General Learning Space - 54.02 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	54m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R1032 - Resources Store - 6.8 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	7m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R1033 - General Learning Space - 52.73 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	53m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R1034 - Resources Store - 5.77 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00L - R1036 - Movement - 122.54 m2							
Ceiling Structures/Linings	Flat AC Sheeting	112m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R1041 - Audio Visual Workroom - 5.91 m2							
No Asbestos							
B00L - R1042 - Stairs - 3.96 m2							
No Asbestos							
B00L - R1043 - Stairs - 16.04 m2							
No Asbestos							
B00L - R1044 - Stairs - 3.71 m2							
No Asbestos							
B00L - R1045 - Staff Kitchen - 6.69 m2							
No Asbestos							
B00L - R1050 - Staff - Toilet - 4.15 m2							
No Asbestos							
B00L - R1051 - Toilet - Lobby - 4.32 m2							
No Asbestos							
B00L - R1052 - Toilet - Lobby - 4.5 m2							
No Asbestos							
B00L - R1053 - Staff - Toilet - 4.37 m2							
No Asbestos							
B00L - R1054 - Main Area - 345.21 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	345m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	345m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R1055 - Staff Study - 72.99 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	73m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	73m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R1056 - Computer Store - 8.77 m2							
No Asbestos							
B00L - R1057 - Staff Study - 15.36 m2							
No Asbestos							
B00S - Pupil Facilities - 1962 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00S - R0001 - Senior Study - 47.13 m2							
No Asbestos							
B00S - R0002 - Senior Study - 47.12 m2							
No Asbestos							
B00S - R0004 - Covered Area - 55.7 m2							

No Asbestos							
B00T - Technological & Applied Studies - 1962 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	20m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	20m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	20m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00T - R0002 - Distribution Board Cupboard - .44 m2					Note: No inspection of live electrical installation		
Electrical - Backing Board	Resinous Board	3	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00T - R0006 - Materials Store - 15.71 m2							
No Asbestos							
B00T - R0008 - Seminar/Technology Space - 25.98 m2							
No Asbestos							
B00T - R0009 - Design L.S. - 52.71 m2							
No Asbestos							
B00T - R0010 - Resources Store - 2.86 m2							
No Asbestos							
B00T - R0011 - Staff - Toilet - 3.48 m2							
No Asbestos							
B00T - R0012 - Staff Study - 28 m2							
No Asbestos							
B00T - R0014 - Materials Technology L.S. - 103.24 m2							
Floor Coverings Res/Textile	Vinyl Tiles	104m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00T - R0015 - Workshop Area - 27.63 m2							
No Asbestos							
B00T - R0016 - Movement - 55.46 m2							
Ceiling Structures/Linings	Flat AC Sheeting	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00T - R0017 - Materials Store - 19.74 m2							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00T - R0018 - Design/Technology L.S. - 66.11 m2							
No Asbestos							
B00T - R9001 - General Assistants - 12.62 m2							
No Asbestos							
B00T - R9002 - Cleaning Supplies Store - 25.88 m2							
No Asbestos							
B00T - R9003 - Workshop - 44.6 m2							
No Asbestos							
B00T - R9004 - L.P.G Store - 1.51 m2							
No Asbestos							
B00T - R9005 - Movement - 28.32 m2							
No Asbestos							
B00T - R9006 - General Storeroom - 12.97 m2							
No Asbestos							

B00U - Pupil Facilities - 1998 - Brick/Veneer**Exterior**

Eaves Linings	Flat AC Sheeting	
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	

Interior**B00U - R0001 - Student Canteen - 50.09 m2**

No Asbestos

B00U - R0002 - Pantry - 4.98 m2

No Asbestos

B00U - R0003 - Staff - Toilet - 3.67 m2

Wall Linings Internal	Flat AC Sheeting	
-----------------------	------------------	--

B00U - R0004 - Office/Store - 3.93 m2

No Asbestos

B00U - R0005 - Office/Store - 1.77 m2

No Asbestos

B00U - R0006 - Movement - 15.12 m2

No Asbestos

B00V - Agricultural Science - 1999 - Brick/Veneer**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	

Interior**B00V - R0001 - Machine Storage - 36.67 m2**

No Asbestos

B00V - R0002 - Agriculture Covered Area - 94.39 m2

No Asbestos

B00W - Technological & Applied Studies - 2003 - Metal Shed**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	

Interior**B00W - R0001 - Materials Store - 33.98 m2**

No Asbestos

B00X - Storage - 2010 - Brick/Veneer**Exterior**

Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	

Interior**B00X - R0001 - Large Equipment Store - 52.17 m2**

No Asbestos

B0AG - Agricultural Science - 1962 - Timber**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	

Interior							
B0AG - R0001 - Shower/Change - 5.84 m2							
No Asbestos							
B0AG - R0002 - Staff - Toilet - 2.39 m2							
No Asbestos							
B0AG - R0003 - Class Tools Storage - 21 m2							
Electrical - Backing Board	Resinous Board	2	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B0AG - R0004 - Agriculture Covered Area - 15.75 m2							
No Asbestos							
B0AG - R0005 - General Storeroom - 12.57 m2							
No Asbestos							
B0AG - R0006 - Machine Storage - 10.94 m2							
No Asbestos							
B0AG - R0007 - Growing/Breeding - 5.84 m2							
No Asbestos							
B0AG - R0008 - Staff - Toilet - 2.39 m2							
No Asbestos							
BMPC - Multi Purpose Facilities - 1985 - Brick/Veneer							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Wall Cladding	Flat AC Sheeting						
Interior							
BMPC - M0001 - Performing Arts Store - 7.79 m2							
No Asbestos							
BMPC - M0002 - Performing Arts Store - 2.84 m2							
No Asbestos							
BMPC - M0003 - Performing Arts Store - 3.42 m2							
No Asbestos							
BMPC - R0001 - Shower/Change - 33.61 m2							
Wall Linings Internal	Flat AC Sheeting						
Partition Walls (Cubicles)	Compressed AC Sheet						
BMPC - R0002 - Toilets-Girls - 17.95 m2							
Wall Linings Internal	Flat AC Sheeting						
Partition Walls (Cubicles)	Compressed AC Sheet						
BMPC - R0003 - Cleaning Store - Distributed - 3.67 m2							
No Asbestos							
BMPC - R0005 - Multi-Purpose Space - 484.04 m2							
No Asbestos							
BMPC - R0006 - Staff Kitchen - 15.4 m2							
Wall Linings Internal	Flat AC Sheeting						
BMPC - R0007 - Staff Change - 5.68 m2							
Wall Linings Internal	Flat AC Sheeting						
BMPC - R0008 - Staff Study - 12.3 m2							
Wall Linings Internal	Flat AC Sheeting						
BMPC - R0009 - Staff Study - 21.15 m2							
No Asbestos							
BMPC - R0010 - Sport Equipment Store - 30.59 m2							

No Asbestos							
BMPC - R0011 - Chair Store - 19.81 m2							
No Asbestos							
BMPC - R0012 - Toilets-Disabled - 4.19 m2							
Wall Linings Internal	Flat AC Sheeting						
BMPC - R0013 - Public Entry - 16.04 m2							
No Asbestos							
BMPC - R0014 - Main Switchroom - 3.82 m2							
No Asbestos							
BMPC - R0015 - Toilets-Boys - 17.92 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
Wall Linings Internal	Flat AC Sheeting						
BMPC - R0016 - Shower/Change - 33.94 m2							
Wall Linings Internal	Flat AC Sheeting						
Partition Walls (Cubicles)	Compressed AC Sheet						
BMPC - R0017 - General Storeroom - 5.82 m2							
No Asbestos							
BMPC - R0018 - Sport Equipment Store - 57.93 m2							
Wall Linings Internal	Flat AC Sheeting						
BMPC - R0019 - General Storeroom - 5.76 m2							
No Asbestos							
BMPC - R0022 - Stage - 68.12 m2							
No Asbestos							
BMPC - R0023 - Pupil Entry - 16.07 m2							
No Asbestos							
BMPC - R0024 - Sport Equipment Store - 18.75 m2							
No Asbestos							
BMPC - R0025 - Movement - 209.85 m2							
No Asbestos							
BTAS - Technological & Applied Studies - 1962 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	20m2	Surround	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	20m2	Surround	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	20m2	Surround	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
BTAS - R0001 - Materials Technology L.S. - 95.79 m2							
Window	Compressed AC Sheet	10	North and South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
BTAS - R0002 - Dust Extraction Space - 8.17 m2							
No Asbestos							
BTAS - R0005 - Materials Store - 4.42 m2							
No Asbestos							
BTAS - R0006 - Distribution Board Cupboard - .42 m2							
Note: No inspection of live electrical installation							
Electrical - Backing Board	Resinous Board	3	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
BTAS - R0007 - Cleaning Store - Distributed - .43 m2							

No Asbestos							
BTAS - R0008 - General Storeroom - 16.25 m2							
Window	Compressed AC Sheet	5	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
BTAS - R0009 - Materials Technology L.S. - 96.95 m2							
Window	Compressed AC Sheet	20	North and south	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
BTAS - R0010 - Movement - 21.84 m2							
Window	Compressed AC Sheet	4	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
BTAS - R0011 - Movement - 10.72 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
BTAS - R0012 - Staff - Toilet - 3.09 m2							
No Asbestos							
BTAS - R0013 - Staff Study - 59.91 m2							
No Asbestos							
BTAS - R0014 - General Storeroom - 3.12 m2							
No Asbestos							
BTAS - R0015 - Movement - 6.37 m2							
No Asbestos							
BTAS - R0016 - Interview/Office - Type 1 - 4.1 m2							
No Asbestos							
BTAS - R0017 - L.P.G. Store - .94 m2							
No Asbestos							
BTAS - R0018 - Materials Store - 42.58 m2							
Window	Compressed AC Sheet	5	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
BTAS - R0019 - Dust Extraction Space - 8.57 m2							
No Asbestos							

Demountables

OS 720 10506 - Science Laboratory/Prep Room - Placement Date : 30-JUN-2009

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 11040 - Learning Unit - Standard/Withdrawal - Placement Date : 28-JAN-2020

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 12782 - Learning Unit - Standard/Withdrawal - Placement Date : 08-APR-2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 13043 - Learning Unit - Standard/Withdrawal - Placement Date : 28-JAN-2020

No Asbestos Found

OS 601 15677 - Learning Unit - Standard/Withdrawal - Placement Date : 13-JUN-2020

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found