


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Hastings Secondary College Westport Campus (8554)
Region:	North Coast AMU
State Electorate:	Port Macquarie
Local Government Area:	Port Macquarie-Hastings

Last Reviewed By:	Greencap 14-APR-2016
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

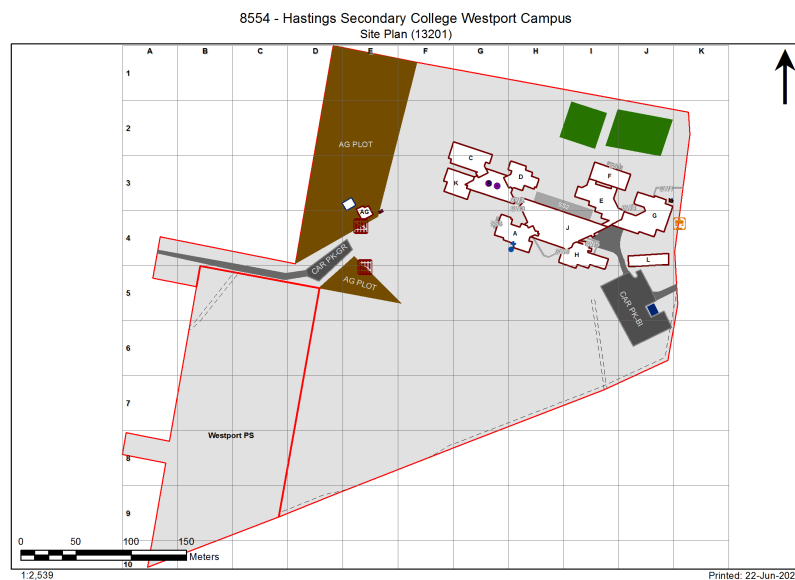

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration/Technological & Applied Studies - 1981 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00A - R0001 - Seminar/Technology Space - 16.81 m2							
No Asbestos							
B00A - R0002 - Movement - 111.56 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0003 - Food Technology L.S. - 101.89 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R0004 - Preparation - 17.42 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R0005 - Pantry - 5.47 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R0006 - Laundry - 12.16 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R0007 - Food Technology L.S. - 101.79 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R0008 - Distribution Board Cupboard - 1.03 m2							
						Note: No inspection of live electrical installation	
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0009 - Materials Technology L.S. - 68.61 m2							
No Asbestos							
B00A - R0010 - Resources Store - 5.58 m2							
No Asbestos							
B00A - R0011 - Resources Store - 12.23 m2							
No Asbestos							
B00A - R0012 - Materials Technology L.S. - 69.25 m2							
No Asbestos							
B00A - R0013 - Cleaning Store - Distributed - 6.2 m2							
No Asbestos							
B00A - R0014 - Movement - 15.54 m2							
No Asbestos							
B00A - R0015 - Staff Study - 18.49 m2							
No Asbestos							
B00A - R0016 - Movement - 59.37 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0017 - General Storeroom - 4.46 m2							
No Asbestos							
B00A - R1001 - Administration - Clerical - 11.58 m2							

No Asbestos							
B00A - R1002 - Movement - 55.41 m2							
No Asbestos							
B00A - R1003 - Administration - Clerical - 31.25 m2							
No Asbestos							
B00A - R1004 - Duplicating Workroom - 29.57 m2							
Floor Coverings Res/Textile	Vinyl Tiles	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1005 - Distribution Board Cupboard - .93 m2							
						Note: No inspection of live electrical installation	
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R1006 - Staff - Toilet - 9.04 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1007 - Cleaning Store - Distributed - 3.62 m2							
No Asbestos							
B00A - R1008 - Staff - Toilet - 9.63 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1009 - Security Store - 17.84 m2							
No Asbestos							
B00A - R1010 - Interview/Office - Type 1 - 18.52 m2							
No Asbestos							
B00A - R1011 - Movement - 17.1 m2							
No Asbestos							
B00A - R1012 - Deputy Principal Office - 17.57 m2							
No Asbestos							
B00A - R1013 - Principal Office - 24.37 m2							
No Asbestos							
B00A - R1014 - Movement - 48.42 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - Library - 1981 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00B - R0001 - Cleaning Store - Distributed - 3.86 m2							
No Asbestos							
B00B - R0002 - Toilets-Boys - 8.79 m2							
No Asbestos							
B00B - R0003 - Toilets-Girls - 9.58 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0004 - Movement - 15.06 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0005 - Workroom - 41.66 m2							
No Asbestos							
B00B - R0006 - Main Area - 307.85 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0007 - Librarian - 14.05 m2							
No Asbestos							
B00B - R0008 - Seminar - 12.13 m2							

Wall Linings Internal	Flat AC Sheeting							
B00B - R0009 - Seminar - 12.13 m2								
No Asbestos								
B00B - R0010 - Audio Visual Workroom - 37.26 m2								
No Asbestos								
B00B - R0011 - Distribution Board Cupboard - .5 m2								
Note: No inspection of live electrical installation								
Electrical - Backing Board	Resinous Board	2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00B - R0012 - Movement - 14.61 m2								
No Asbestos								
B00B - R0013 - Staff - Toilet - 8.8 m2								
No Asbestos								
B00B - R0014 - Staff - Toilet - 8.39 m2								
No Asbestos								
B00B - R0015 - Cleaning Store - Distributed - 3.81 m2								
No Asbestos								
B00B - R0016 - External Movement - 51.88 m2								
No Asbestos								
B00B - R0017 - Movement - 121.24 m2								
No Asbestos								
B00B - R1001 - Cleaning Store - Distributed - 1.96 m2								
No Asbestos								
B00B - R1002 - General Storeroom - 11.13 m2								
No Asbestos								
B00B - R1003 - Staff - Toilet - 7.48 m2								
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1004 - Staff - Toilet - 7.5 m2								
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1005 - Darkroom Space - 21.8 m2								
Floor Coverings Res/Textile	Vinyl Tiles	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1006 - Deputy Principal Office - 13.98 m2								
No Asbestos								
B00B - R1007 - Movement - 21.16 m2								
No Asbestos								
B00B - R1010 - Study Space - 102.17 m2								
No Asbestos								
B00B - R1014 - Study Space - 30.69 m2								
No Asbestos								
B00B - R1015 - No Access - 1.33 m2								
No Asbestos								
B00B - R1016 - Darkroom Space - 2.03 m2								
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1017 - Movement - 14.68 m2								
No Asbestos								
B00B - R1018 - Movement - 9.11 m2								
No Asbestos								
B00B - R1019 - Student Waiting - 12.79 m2								
No Asbestos								
B00B - R1020 - Deputy Principal Office - 19.68 m2								

No Asbestos							
B00B - R1021 - Library Administration - 13.56 m2							
No Asbestos							
B00B - R1022 - Computer Learning Space - 49.94 m2							
No Asbestos							
B00B - R1023 - Careers Advisers Office - 12.34 m2							
No Asbestos							
B00B - R1024 - Movement - 40.39 m2							
No Asbestos							
B00B - R1025 - Careers Advisers Office - 12.37 m2							
No Asbestos							
B00C - General Learning - 1981 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00C - R0001 - Toilets-Boys - 24.52 m2							
No Asbestos							
B00C - R0002 - Toilets-Girls - 18.74 m2							
No Asbestos							
B00C - R0003 - General Learning Space - 46.65 m2							
No Asbestos							
B00C - R0004 - General Learning Space - 47.28 m2							
No Asbestos							
B00C - R0005 - General Learning Space - 47.29 m2							
No Asbestos							
B00C - R0006 - General Learning Space - 47.29 m2							
No Asbestos							
B00C - R0007 - General Learning Space - 47.76 m2							
No Asbestos							
B00C - R0008 - General Learning Space - 52.57 m2							
No Asbestos							
B00C - R0009 - General Learning Space - 51.91 m2							
No Asbestos							
B00C - R0010 - Staff Study - 25.44 m2							
No Asbestos							
B00C - R0011 - Resources Store - 20.42 m2							
No Asbestos							
B00C - R0012 - Study Space - 13.74 m2							
No Asbestos							
B00C - R0013 - Interview/Office - Type 1 - 14.49 m2							
No Asbestos							
B00C - R0014 - Movement - 168.25 m2							
No Asbestos							
B00C - R0015 - Cleaning Store - Distributed - 3.73 m2							
No Asbestos							
B00C - R0016 - Distribution Board Cupboard - .3 m2							
Note: No inspection of live electrical installation							
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00C - R0017 - Chair Store - 4.26 m2							
No Asbestos							

B00C - R0018 - Chair Storeroom - 3.5 m2							
No Asbestos							
B00C - R0019 - Stairs - 6.77 m2							
No Asbestos							
B00C - R0020 - External Movement - 1.28 m2							
No Asbestos							
B00C - R1001 - General Learning Space - 47.91 m2							
No Asbestos							
B00C - R1002 - General Learning Space - 47.34 m2							
No Asbestos							
B00C - R1003 - General Learning Space - 47.28 m2							
No Asbestos							
B00C - R1004 - General Learning Space - 47.28 m2							
No Asbestos							
B00C - R1005 - General Learning Space - 47.26 m2							
No Asbestos							
B00C - R1006 - General Learning Space - 47.91 m2							
No Asbestos							
B00C - R1007 - General Learning Space - 52.28 m2							
No Asbestos							
B00C - R1008 - Study Space - 51.7 m2							
No Asbestos							
B00C - R1010 - Resources Store - 19.79 m2							
No Asbestos							
B00C - R1013 - Cleaning Store - Distributed - 3.79 m2							
No Asbestos							
B00C - R1014 - Distribution Board Cupboard - .28 m2							
							Note: No inspection of live electrical installation
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00C - R1015 - Movement - 162.12 m2							
No Asbestos							
B00C - R1016 - Commonroom - 55 m2							
No Asbestos							
B00C - R1017 - External Stairs - 4.06 m2							
No Asbestos							
B00C - R1018 - Stairs - 10.8 m2							
No Asbestos							
B00D - General Learning - 1981 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00D - R0001 - General Learning Space - 54.74 m2							
No Asbestos							
B00D - R0002 - Movement - 5.79 m2							
No Asbestos							
B00D - R0004 - Resources Store - 22.79 m2							
No Asbestos							
B00D - R0005 - Staff Study - 33.66 m2							
No Asbestos							
B00D - R0006 - Resources Store - 6.16 m2							

No Asbestos							
B00D - R0007 - Distribution Board Cupboard - .98 m2							Note: No inspection of live electrical installation
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R0008 - General Learning Space - 54.74 m2							
No Asbestos							
B00D - R0009 - General Learning Space - 54.74 m2							
No Asbestos							
B00D - R0010 - General Learning Space - 54.75 m2							
No Asbestos							
B00D - R0011 - Movement - 94.16 m2							
Wall Linings Internal	Flat AC Sheeting						
B00D - R0013 - Store - 5.22 m2							
No Asbestos							
B00D - R0014 - Movement - 55.35 m2							
No Asbestos							
B00D - R0015 - External Stairs - 3.26 m2							
No Asbestos							
B00D - R1001 - General Learning Space - 53.75 m2							
No Asbestos							
B00D - R1002 - Movement - 5.96 m2							
No Asbestos							
B00D - R1003 - Staff Study - 22.72 m2							
No Asbestos							
B00D - R1004 - Staff Study - 33.66 m2							
No Asbestos							
B00D - R1005 - Resources Store - 6.32 m2							
No Asbestos							
B00D - R1006 - Distribution Board Cupboard - .94 m2							Note: No inspection of live electrical installation
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R1007 - General Learning Space - 54.9 m2							
No Asbestos							
B00D - R1008 - General Learning Space - 54.74 m2							
No Asbestos							
B00D - R1009 - General Learning Space - 54.68 m2							
No Asbestos							
B00D - R1010 - Movement - 95.69 m2							
Wall Linings Internal	Flat AC Sheeting						
B00D - R1011 - Movement - 54.9 m2							
No Asbestos							
B00D - R1012 - Stairs - 9.4 m2							
No Asbestos							
B00E - General Learning - 1981 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00E - R0001 - Staff Study - 28.94 m2							
No Asbestos							
B00E - R0002 - Resources Store - 7.81 m2							

No Asbestos							
B00E - R0003 - Movement - 168.05 m2							
Wall Linings Internal	Flat AC Sheeting	30m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	168m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0004 - Computer Learning Space - 61.81 m2							
No Asbestos							
B00E - R0005 - General Learning Space - 62.87 m2							
No Asbestos							
B00E - R0006 - Special Learning Space - 62.86 m2							
No Asbestos							
B00E - R0007 - Toilets-Disabled - 4.81 m2							
No Asbestos							
B00E - R0008 - Serviced Learning Space - 44.68 m2							
No Asbestos							
B00E - R0010 - Special Learning Space - 62.91 m2							
No Asbestos							
B00E - R0012 - Movement - 43.43 m2							
No Asbestos							
B00E - R0013 - Interview/Office - Type 1 - 15.35 m2							
No Asbestos							
B00E - R0014 - General Storeroom - 21.24 m2							
No Asbestos							
B00E - R0015 - Distribution Board Cupboard - .81 m2							
						Note: No inspection of live electrical installation	
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00E - R0016 - Movement - 49.16 m2							
No Asbestos							
B00E - R0017 - Movement - 216.08 m2							
No Asbestos							
B00E - R0018 - Toilets-Disabled - 11.97 m2							
No Asbestos							
B00F - General Learning - 1981 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Interior							
B00F - R0001 - General Storeroom - 8.63 m2							
No Asbestos							
B00F - R0002 - Resources Store - 7.59 m2							
No Asbestos							
B00F - R0003 - General Storeroom - 7.13 m2							
No Asbestos							
B00F - R0004 - Cleaning Store - Distributed - 3.6 m2							
No Asbestos							
B00F - R0005 - Distribution Board Cupboard - .45 m2							
						Note: No inspection of live electrical installation	
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00F - R0006 - Toilets-Disabled - 4.74 m2							
No Asbestos							
B00F - R0007 - Special Learning Space - 63.28 m2							

No Asbestos	
B00F - R0008 - Special Learning Space - 53.44 m2	
No Asbestos	
B00F - R0009 - Toilets-Disabled - 24.82 m2	
No Asbestos	
B00F - R0010 - Laundry - 10.86 m2	
No Asbestos	
B00F - R0011 - Toilets-Disabled - 24.9 m2	
No Asbestos	
B00F - R0012 - Special Learning Space - 63.2 m2	
No Asbestos	
B00F - R0013 - Resources Store - 8.46 m2	
No Asbestos	
B00F - R0014 - Resources Store - 8.72 m2	
No Asbestos	
B00F - R0015 - Cleaning Supplies Store - 11.74 m2	
No Asbestos	
B00F - R0016 - Toilets-Girls - 12.17 m2	
No Asbestos	
B00F - R0017 - Toilets-Boys - 12.2 m2	
No Asbestos	
B00F - R0018 - Movement - 178.9 m2	
No Asbestos	
B00G - Technological & Applied Studies - 1981 - Brick/Block	
Exterior	
Ceiling Voids - Raked Ceiling	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found
Interior	
B00G - M0001 - Materials Store - 47.77 m2	
No Asbestos	
B00G - M0002 - Stairs - 3.05 m2	
No Asbestos	
B00G - R0004 - Materials Technology L.S. - 103.44 m2	
No Asbestos	
B00G - R0005 - Wood Technology Bay - 25.56 m2	
No Asbestos	
B00G - R0006 - Materials Technology L.S. - 110.39 m2	
No Asbestos	
B00G - R0007 - Materials Store - 26.5 m2	
No Asbestos	
B00G - R0008 - Dust Extraction Space - 7.11 m2	
No Asbestos	
B00G - R0009 - Design L.S. - 50.48 m2	
No Asbestos	
B00G - R0010 - Resource/Project Store - 24.74 m2	
No Asbestos	
B00G - R0011 - Design L.S. - 50.41 m2	
No Asbestos	
B00G - R0012 - Staff Study - 21.67 m2	
No Asbestos	
B00G - R0013 - Resources Store - 18.18 m2	

No Asbestos							
B00G - R0014 - Resources Store - 1.79 m2							
No Asbestos							
B00G - R0015 - Distribution Board Cupboard - 1.28 m2						Note: No inspection of live electrical installation	
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00G - R0016 - Movement - 145.23 m2							
Wall Linings Internal	Flat AC Sheeting						
B00G - R0021 - Toilets-Disabled - 2.42 m2							
No Asbestos							
B00G - R0022 - Toilets-Girls - 10.51 m2							
No Asbestos							
B00G - R0023 - Toilets-Boys - 10.6 m2							
No Asbestos							
B00G - R0024 - Movement - 19.62 m2							
No Asbestos							
B00G - R0025 - Movement - 9.66 m2							
No Asbestos							
B00G - R0032 - Materials Technology L.S. - 214.17 m2							
No Asbestos							
B00G - R0033 - Materials Workshop - Type 2 - 91.19 m2							
No Asbestos							
B00G - R0034 - Project Store - Type 1 - 6.7 m2							
No Asbestos							
B00G - R0035 - Project Store - Type 2 - 15.38 m2							
No Asbestos							
B00G - R0036 - Distribution Board Cupboard - 1.62 m2						Note: No inspection of live electrical installation	
No Asbestos							
B00G - R0037 - External Movement - 63.39 m2							
No Asbestos							
B00G - R0038 - Stairs - .25 m2							
No Asbestos							
B00G - R0039 - General Learning Space - 60.21 m2							
No Asbestos							
B00H - Science Learning - 1981 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00H - R0001 - General Learning Space - 98.57 m2							
No Asbestos							
B00H - R0002 - Chair Store - 25.24 m2							
No Asbestos							
B00H - R0003 - Cleaning Store - Distributed - 9.6 m2							
No Asbestos							
B00H - R0004 - Laboratory L.S. - 98.57 m2							
No Asbestos							
B00H - R0005 - Preparation - 48.83 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						

B00H - R0006 - Laboratory L.S. - 98.57 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00H - R0007 - Movement - 116.22 m2							
Wall Linings Internal	Flat AC Sheeting						
B00H - R0008 - Apparatus Store - 33.36 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00H - R0009 - Chair Store - 10.01 m2							
No Asbestos							
B00H - R0010 - Main Switchroom - 7.37 m2							
Floor Coverings Res/Textile	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Mounting Board	Resinous Board	3	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00H - R0011 - Garden Store Room - 17.58 m2							
No Asbestos							
B00H - R0012 - External Movement - 6.98 m2							
No Asbestos							
B00H - R0013 - Lift - 1.43 m2							
No Asbestos							
B00H - R0014 - External Movement - 3.51 m2							
No Asbestos							
B00H - R1001 - Laboratory L.S. - 98.48 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00H - R1002 - Preparation - 25.45 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00H - R1003 - Laboratory L.S. - 98.08 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00H - R1004 - Preparation - 48.83 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00H - R1005 - Laboratory L.S. - 98.38 m2							
No Asbestos							
B00H - R1006 - Movement - 91.93 m2							
Wall Linings Internal	Flat AC Sheeting						
B00H - R1007 - Distribution Board Cupboard - 1.24 m2 Note: No inspection of live electrical installation							
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00H - R1008 - Staff Study - 33.27 m2							
No Asbestos							
B00H - R1010 - Plant Space - .58 m2							
No Asbestos							
B00H - R1011 - Growing/Breeding - 18.52 m2							
Floor Coverings Res/Textile	Vinyl Tiles						

Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00H - R1012 - External Movement - 8.54 m2								
No Asbestos								
B00H - R1013 - Movement - 17.27 m2								
No Asbestos								
B00J - Multi Purpose Facilities/Music - 1992 - Brick/Block								
Exterior								
Underfloor Voids - Slab on Ground	No Asbestos Found							
Ceiling Voids	No Asbestos Found							
Interior								
B00J - R0001 - Movement - 416.57 m2								
No Asbestos								
B00J - R0002 - Cleaning Store - Distributed - 3.61 m2								
No Asbestos								
B00J - R0003 - General Storeroom - 3.09 m2								
No Asbestos								
B00J - R0004 - Student Canteen - 61.96 m2								
No Asbestos								
B00J - R0005 - General Storeroom - 9.56 m2								
No Asbestos								
B00J - R0006 - Movement - 147.39 m2								
Wall Linings Internal - Infill	Flat AC Sheeting							
B00J - R0007 - Toilets-Girls - 8.99 m2								
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00J - R0008 - Toilets-Boys - 10.6 m2								
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00J - R0010 - Movement - 6.92 m2								
No Asbestos								
B00J - R0011 - Movement - 10.57 m2								
No Asbestos								
B00J - R0012 - Multi-Purpose Space - 514.14 m2								
No Asbestos								
B00J - R0013 - Staff Change - 5.91 m2								
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00J - R0014 - Cleaning Store - Distributed - 4.32 m2								
No Asbestos								
B00J - R0015 - Stage - 127.69 m2								
No Asbestos								
B00J - R0016 - Movement - 4.44 m2								
No Asbestos								
B00J - R0017 - Distribution Board Cupboard - .95 m2								
						Note: No inspection of live electrical installation		
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00J - R0018 - Movement - 3.28 m2								
No Asbestos								
B00J - R0019 - Chair Store - 44.92 m2								
No Asbestos								
B00J - R0020 - General Storeroom - 4.45 m2								

No Asbestos							
B00J - R0021 - Sport Equipment Store - 23.37 m2							
No Asbestos							
B00J - R0022 - Movement - 62.35 m2							
No Asbestos							
B00J - R0024 - General Assistants - 11.54 m2							
No Asbestos							
B00J - R0025 - Cleaning Store - Distributed - 8.54 m2							
No Asbestos							
B00J - R0026 - Movement - 31.58 m2							
No Asbestos							
B00J - R0027 - Shower/Change - 20.53 m2							
No Asbestos							
B00J - R0028 - Shower/Change - 24.25 m2							
No Asbestos							
B00J - R0029 - Toilets-Boys - 7.45 m2							
No Asbestos							
B00J - R0030 - Staff Shower - 6.32 m2							
No Asbestos							
B00J - R0032 - Staff Shower - 5.91 m2							
No Asbestos							
B00J - R0033 - Toilets-Girls - 9.78 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - R0034 - Shower/Change - 19.71 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - R0035 - Shower/Change - 19.95 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - R0036 - Cleaning Supplies Store - 12.31 m2							
No Asbestos							
B00J - R0037 - General Storeroom - 6.21 m2							
No Asbestos							
B00J - R1001 - Movement - 5.22 m2							
No Asbestos							
B00J - R1002 - Music Learning Space - 64.76 m2							
No Asbestos							
B00J - R1003 - Movement - 7.06 m2							
Wall Linings Internal - Infill	Flat AC Sheeting						
B00J - R1004 - Movement - 47.45 m2							
Wall Linings Internal - Infill	Flat AC Sheeting						
B00J - R1005 - Movement - 18.83 m2							
Wall Linings Internal	Flat AC Sheeting						
B00J - R1006 - Movement - 48.62 m2							
No Asbestos							
B00J - R1007 - Staff Study - 18.92 m2							
No Asbestos							
B00J - R1008 - Music Store - 23.85 m2							
No Asbestos							
B00J - R1009 - Music Learning Space - 90.77 m2							
No Asbestos							
B00J - R1012 - Cleaning Store - Distributed - 3.74 m2							

Wall Linings Internal	Flat AC Sheeting	1m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - R1013 - Staff - Toilet - 8.91 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - R1014 - Staff - Toilet - 7.49 m2							
Wall Linings Internal	Flat AC Sheeting	5m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - R1015 - General Storeroom - 17.43 m2							
Wall Linings Internal	Flat AC Sheeting	10m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - R1016 - Movement - 46.82 m2							
Wall Linings Internal	Flat AC Sheeting	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - R1017 - Clinic - Girls - 9.64 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00J - R1018 - Clinic-Toilets - 3.04 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00J - R1019 - Clinic - Boys - 9.67 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00J - R1020 - Clinic-Toilets - 3.01 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00J - R1021 - Administration - Clerical - 12.11 m2							
No Asbestos							
B00J - R1022 - Movement - 13.45 m2							
No Asbestos							
B00J - R1023 - Commonroom - 114.01 m2							
No Asbestos							
B00J - R1024 - Staff Study - 24.88 m2							
No Asbestos							
B00J - R1025 - Staff Study - 15.54 m2							
No Asbestos							
B00J - R1026 - Movement - 63.63 m2							
No Asbestos							
B00J - R1027 - Music Learning Space - 49.83 m2							
No Asbestos							
B00K - Art/Technological & Applied Studies - 1981 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							

B00K - R0001 - Art Learning Space - 63.15 m2							
No Asbestos							
B00K - R0002 - Distribution Board Cupboard - .36 m2							Note: No inspection of live electrical installation
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00K - R0003 - Kiln Space - 9.36 m2							
No Asbestos							
B00K - R0004 - Workshop - 51.98 m2							
No Asbestos							
B00K - R0005 - Art Learning Space - 63.22 m2							
No Asbestos							
B00K - R0006 - Movement - 81.79 m2							
No Asbestos							
B00K - R0007 - Tiered Learning Area - 64.8 m2							
No Asbestos							
B00K - R0008 - Computer Learning Space - 60.51 m2							
No Asbestos							
B00K - R0009 - Computer Store - 9.61 m2							
No Asbestos							
B00K - R0010 - Resources Store - 9.03 m2							
No Asbestos							
B00K - R0011 - Resources Store - 17.21 m2							
No Asbestos							
B00K - R0012 - Plant Space - 5.06 m2							
No Asbestos							
B00K - R0013 - General Storeroom - 4.14 m2							
No Asbestos							
B00K - R1001 - Art Learning Space - 62.96 m2							
No Asbestos							
B00K - R1002 - Distribution Board Cupboard - .37 m2							Note: No inspection of live electrical installation
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00K - R1003 - Cleaning Store - Distributed - 1.39 m2							
No Asbestos							
B00K - R1004 - Staff Study - 22.14 m2							
No Asbestos							
B00K - R1005 - Resources Store - 23.31 m2							
No Asbestos							
B00K - R1006 - Resources Store - 6.99 m2							
No Asbestos							
B00K - R1007 - Art Learning Space - 63.06 m2							
No Asbestos							
B00K - R1008 - Movement - 79.57 m2							
No Asbestos							
B00L - Other-D.E.C. Admin - 1997 - Brick/Veneer							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00L - R0001 - Other - D.E.T. Admin - 6.46 m2							
No Asbestos							

B00L - R0002 - Other - D.E.T. Admin - 13.07 m2		
No Asbestos		
B00L - R0004 - Other - D.E.T. Admin - 21.08 m2		
No Asbestos		
B00L - R0005 - Other - D.E.T. Admin - 15.99 m2		
No Asbestos		
B00L - R0007 - Other - D.E.T. Admin - 13.69 m2		
No Asbestos		
B00L - R0008 - Other - D.E.T. Admin - 174.92 m2		
No Asbestos		
B00L - R0009 - Other - D.E.T. Admin - 10.55 m2		
No Asbestos		
B00L - R0010 - Other - D.E.T. Admin - 1.61 m2		
No Asbestos		
B00L - R0011 - Other - D.E.T. Admin - 16.02 m2		
No Asbestos		
B00L - R0012 - Other - D.E.T. Admin - 6.4 m2		
No Asbestos		
B00L - R0013 - Other - D.E.T. Admin - 3.74 m2		
No Asbestos		
B00L - R0014 - No Access - .51 m2		
No Asbestos		
B00L - R0015 - Other - D.E.T. Admin - 4.57 m2		
No Asbestos		
B00L - R0016 - Other - D.E.T. Admin - .51 m2		
No Asbestos		
B00L - R0017 - Other - D.E.T. Admin - 6.58 m2		
No Asbestos		
B00L - R0018 - Public Reception - 9.04 m2		
No Asbestos		
B00L - R0019 - Administration - Clerical - 10.25 m2		
No Asbestos		
B00L - R0020 - Movement - 8.32 m2		
No Asbestos		
B00M - Storage - 2011 - Brick/Block		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00M - R0001 - Welding Store - 1.79 m2		
No Asbestos		
B00M - R0002 - Welding Store - 1.79 m2		
No Asbestos		
B0AG - Agricultural Science - 1981 - Brick/Block		
Exterior		
Ceiling Voids - Raked Ceiling	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Interior		
B0AG - R0001 - General Storeroom - 7.36 m2		
Wall Linings Internal	Flat AC Sheeting	

B0AG - R0003 - Animal Space - 8.81 m2	
No Asbestos	
B0AG - R0004 - Machine Storage - 35.63 m2	
No Asbestos	
B0AG - R0006 - Machine Storage - 30.6 m2	
No Asbestos	
B0AG - R0007 - Movement - 15.98 m2	
No Asbestos	
B0AG - R0008 - Movement - 7.06 m2	
No Asbestos	

Demountables

OS 602 14323 - Learning Unit - Standard With P.A.A. - Placement Date : 16-JAN-2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found