


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Hunter School of Performing Arts (8819)
Region:	Hunter/Central Coast AMU
State Electorate:	Newcastle
Local Government Area:	Newcastle

Last Reviewed By:	Greencap 10-FEB-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

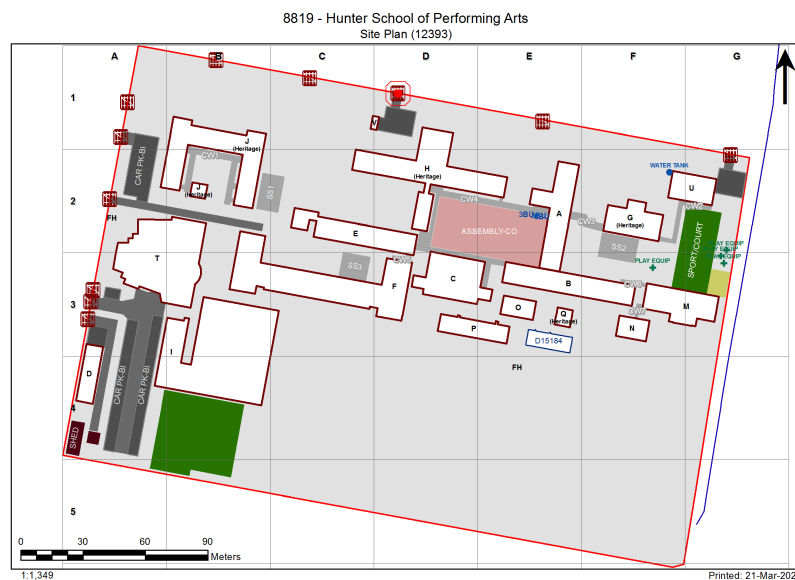

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Performing Arts/General Learning - 1965 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00A - R0001 - Distribution Board - .83 m2						Note: No inspection of live electrical installation	
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0002 - General Assistant/Bulk Store - 7.06 m2							
No Asbestos							
B00A - R0003 - General Assistant/Bulk Store - 13.05 m2							
No Asbestos							
B00A - R0004 - Movement - 6.43 m2							
No Asbestos							
B00A - R0005 - Movement - 48.97 m2							
No Asbestos							
B00A - R0006 - Toilets - Girls - 37.76 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0007 - General Learning Space - 43.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0008 - General Learning Space - 63.2 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0009 - General Storeroom - 6.12 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0010 - General Storeroom - 6.12 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0011 - Movement - 22.5 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0012 - General Storeroom - 29.23 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0013 - Staff Room Annexe - 25.93 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0014 - General Learning Space - 52.24 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0015 - General Learning Space - 68.67 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0016 - Movement - 47.12 m2							
No Asbestos							
B00A - R0017 - Staff - Toilet - 5.56 m2							
No Asbestos							
B00A - R0018 - Toilets - Boys - 32.3 m2							
No Asbestos							
B00A - R0019 - Main Switch Board - 3.85 m2							
No Asbestos							
B00A - R0020 - General Storeroom - 5.92 m2							
No Asbestos							
B00A - R1001 - Performance Workspace - 95.44 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1002 - Performing Arts Changeroom - 10.68 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1003 - Performing Arts Changeroom - 9.98 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1004 - Movement - 6.54 m2							
No Asbestos							
B00A - R1005 - Staff Room Annexe - 17.25 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1006 - Staff Room Annexe - 29.64 m2							
No Asbestos							
B00A - R1007 - Staff Room Annexe - 47.5 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1008 - General Storeroom - 4.86 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1009 - General Learning Space - 39.58 m2							

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1010 - Cleaning Store - Distributed - 2.94 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1011 - General Storeroom - 9.36 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1012 - General Learning Space - 52.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1013 - General Learning Space - 53.33 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1014 - General Storeroom - 9.67 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1015 - Movement - 5.52 m2							
No Asbestos							
B00A - R1016 - Movement - 9.6 m2							
No Asbestos							
B00A - R1017 - Movement - 49.99 m2							
No Asbestos							
B00A - R1018 - Distribution Board - .85 m2							
						Note: No inspection of live electrical installation	
No Asbestos							
B00A - R1019 - Toilets - Boys - 33.07 m2							
No Asbestos							
B00A - R1020 - Staff - Toilet - 5.53 m2							
No Asbestos							
B00A - R1021 - Movement - 22.33 m2							
No Asbestos							
B00A - R1022 - Distribution Board - 1.38 m2							
						Note: No inspection of live electrical installation	
No Asbestos							
B00A - R1023 - General Storeroom - 5.97 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - Computer Learning/General Learning - 1967 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						

Interior							
B00B - R0001 - Staff - Toilet - 4.65 m2							
No Asbestos							
B00B - R0002 - Cleaning Store - Distributed - 6.24 m2							
No Asbestos							
B00B - R0003 - Movement - 24.98 m2							
No Asbestos							
B00B - R0005 - General Learning Space - 52.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0006 - Staff Room Annexe - 21.91 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0007 - Staff Room Annexe - 33.38 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0008 - General Storeroom - 4.82 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0009 - General Storeroom - 39.3 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0010 - General Learning Space - 52.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0011 - General Learning Space - 49.5 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0012 - Cleaning Store - Distributed - 2.94 m2							
No Asbestos							
B00B - R0013 - General Learning Space - 52.97 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0014 - General Learning Space - 54.06 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0015 - Movement - 115.24 m2								
No Asbestos								
B00B - R0016 - General Learning Space - 55.81 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1001 - Staff - Toilet - 4.64 m2								
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1002 - Cleaning Supplies Store - 6.24 m2								
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1003 - General Learning Space - 65.76 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1004 - General Storeroom - 6.13 m2								
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1005 - General Storeroom - 6.13 m2								
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1006 - General Learning Space - 65.91 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1007 - General Storeroom - 9.7 m2								
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1008 - Cleaning Store - Distributed - 2.89 m2								
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Plant / Equipment - Flue	Fibre Cement Pipe	6	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00B - R1009 - General Learning Space - 52.6 m2								

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1010 - General Learning Space - 52.6 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1011 - General Learning Space - 52.61 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1012 - Computer Learning Space - 52.6 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1013 - Computer Learning Space - 76.06 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	76m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1014 - Movement - 126.17 m2								
No Asbestos								
B00C - Library - 1976 - Brick/Block								
Exterior								
Underfloor Voids - Slab on Ground	No Asbestos Found							
Ceiling Voids - Flat Roof	No Asbestos Found							
Interior								
B00C - M0001 - General Storeroom - 6.43 m2								
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - M0002 - Distribution Board - 2.65 m2								
Note: No inspection of live electrical installation								
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Electrical - Backing Board	Resinous Board	2	North East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00C - M0003 - Movement - 10.14 m2								
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - M0004 - Seminar - 28.66 m2								
No Asbestos								
B00C - M0005 - Careers Advisers Office - 14.35 m2								
No Asbestos								
B00C - M0006 - Seminar - 28.98 m2								
No Asbestos								

B00C - M0007 - Seminar - 28.66 m2							
No Asbestos							
B00C - M0008 - Reading Area - 88.19 m2							
No Asbestos							
B00C - M0009 - Movement - 10.17 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - M0010 - General Storeroom - 7.38 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0001 - Cleaning Store - Distributed - 1.82 m2							
No Asbestos							
B00C - R0002 - Staff - Toilet - 3.36 m2							
No Asbestos							
B00C - R0003 - Distribution Board - .19 m2							
							Note: No inspection of live electrical installation
No Asbestos							
B00C - R0004 - Library Office/Workroom - 11.27 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00C - R0005 - Movement - 15.39 m2							
No Asbestos							
B00C - R0006 - General Storeroom - 9.73 m2							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0007 - Librarian - 14.11 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00C - R0008 - Staff - Toilet - 3.67 m2							
No Asbestos							
B00C - R0009 - General Storeroom - 4.41 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0010 - Library Office/Workroom - 51.2 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00C - R0011 - Communications Room - 39.48 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00C - R0012 - Security Store - 1.33 m2							
No Asbestos							
B00C - R0013 - Duplicating Workroom - 18.15 m2							
No Asbestos							
B00C - R0014 - Cleaning Store - Distributed - 1.82 m2							
No Asbestos							
B00C - R0015 - Reading Area - 318.21 m2							
No Asbestos							
B00C - R0016 - Movement - 18.48 m2							
No Asbestos							
B00C - R0017 - Movement - 15.78 m2							
No Asbestos							
B00C - R0018 - Canteen Covered Area - 25.62 m2							

No Asbestos							
B00D - Music - 1976 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00D - R0001 - Music Learning Space - 141.68 m2							
No Asbestos							
B00D - R0002 - Movement - 7.69 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0003 - Staff Room Annexe - 7.17 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0004 - Music Store - 17.84 m2							
Wall Linings Internal	Flat AC Sheeting	20m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0005 - Staff Kitchen - 13.64 m2							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0006 - Staff - Toilet - 1.63 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0007 - Shower/Change - 5.89 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - Technological & Applied Studies - 1967 - Brick/Block							
Exterior							

Ceiling Voids - Raked Ceiling	No Asbestos Found							
Underfloor Voids	Non Accessible Area							
Interior								
B00E - R0001 - Distribution Board - .41 m2						Note: No inspection of live electrical installation		
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00E - R0002 - Cleaning Supplies Store - 9.49 m2								
No Asbestos								
B00E - R0003 - General Assistant/Bulk Store - 15.66 m2								
No Asbestos								
B00E - R0004 - Movement - 8.98 m2								
No Asbestos								
B00E - R0005 - Design L.S. - 84.76 m2								
No Asbestos								
B00E - R0010 - Materials Technology L.S. - 86.58 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B00E - R0011 - Welding Area - 12.63 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R0012 - Materials Store - 11.02 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R0013 - Movement - 99.98 m2								
No Asbestos								
B00E - R0014 - Cleaning Store - Distributed - .56 m2								
No Asbestos								
B00E - R0015 - Distribution Board - 2.43 m2						Note: No inspection of live electrical installation		
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00E - R0016 - Toilets - Boys - 62.27 m2								
No Asbestos								
B00E - R0017 - Office/Store - 13.95 m2								
Ceiling Structures/Linings	No Asbestos Found							
B00E - R0018 - Metal Technology Bay - 90.36 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B00E - R0019 - Photographic Studio - 20.33 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R1001 - Distribution Board - .34 m2						Note: No inspection of live electrical installation		
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00E - R1002 - Materials Technology L.S. - 79.82 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B00E - R1003 - Materials Store - 4.37 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00E - R1004 - Materials Store - 13.44 m2								

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R1005 - Wood Technology Bay - 14.32 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R1006 - Materials Store - 21.42 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R1007 - Materials Technology L.S. - 76.8 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B00E - R1008 - Staff Room Annexe - 28.38 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R1009 - Cleaning Store - Distributed - 4.01 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00E - R1010 - Materials Workshop - Type 2 - 26.12 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R1011 - Design L.S. - 51.86 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00E - R1012 - Movement - 95.24 m2								
No Asbestos								
B00E - R1013 - Movement - 14.92 m2								
No Asbestos								
B00E - R1014 - Art Outdoor Area - 88.07 m2								
No Asbestos								
B00F - General Learning/Science - 1976 - Brick/Block								
Exterior								
Ceiling Voids - Flat Roof	No Asbestos Found							
Underfloor Voids - Slab on Ground	No Asbestos Found							
Interior								
B00F - R0001 - Laboratory L.S. - 90.5 m2								
No Asbestos								
B00F - R0002 - Preparation - 52.67 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00F - R0003 - Laboratory L.S. - 110.49 m2								
No Asbestos								
B00F - R0004 - Cleaning Store - Distributed - 9.95 m2								
No Asbestos								
B00F - R0005 - Distribution Board - .24 m2								
Note: No inspection of live electrical installation								
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00F - R0006 - Staff - Toilet - 4.12 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0007 - Staff - Toilet - 4.1 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0008 - Staff Room Annexe - 36.77 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00F - R0009 - Staff Room Annexe - 27.66 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00F - R0010 - Apparatus Store - 60.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0011 - Laboratory L.S. - 93.93 m2							
No Asbestos							
B00F - R0012 - Preparation - 47.88 m2							
No Asbestos							
B00F - R0013 - Laboratory L.S. - 93.46 m2							
No Asbestos							
B00F - R0014 - Toilets - Girls - 93 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00F - R0015 - Distribution Board - .36 m2 Note: No inspection of live electrical installation							
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00F - R0016 - Cleaning Store - Distributed - 9.95 m2							
No Asbestos							
B00F - R0017 - Laboratory L.S. - 92.07 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Floor Coverings Res/Textile	Vinyl Tiles	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0018 - Preparation - 51.83 m2							
Floor Coverings Res/Textile	Vinyl Tiles	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00F - R0019 - General Learning Space - 34.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0020 - Staff Room Annexe - 29.17 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00F - R0021 - General Storeroom - 10.45 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00F - R0022 - Darkroom Space - 33.15 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00F - R0023 - Movement - 283.47 m2								
No Asbestos								
B00F - R1001 - General Learning Space - 62.77 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00F - R1002 - General Learning Space - 52.24 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00F - R1003 - General Storeroom - 52.24 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00F - R1004 - Staff Room Annexe - 33.74 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00F - R1005 - Staff Room Annexe - 14.2 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00F - R1006 - Staff - Toilet - 5.26 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00F - R1007 - Staff - Toilet - 4.94 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00F - R1008 - Distribution Board - .25 m2								
						Note: No inspection of live electrical installation		
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00F - R1009 - Staff Room Annexe - 33.68 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00F - R1010 - Computer Learning Space - 51.88 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00F - R1011 - General Learning Space - 55.86 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00F - R1012 - General Learning Space - 55.87 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00F - R1013 - General Learning Space - 55.51 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00F - R1014 - General Learning Space - 55.86 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00F - R1015 - General Learning Space - 58 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							

B00F - R1016 - Distribution Board - .36 m2								Note: No inspection of live electrical installation
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00F - R1017 - Cleaning Store - Distributed - 1.46 m2								
No Asbestos								
B00F - R1018 - Laboratory L.S. - 94.85 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00F - R1019 - Preparation - 52.95 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00F - R1020 - Laboratory L.S. - 110.05 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00F - R1021 - Movement - 243.16 m2								
No Asbestos								
B00G - Music - 1922 - Brick/Block								
Exterior								
Ceiling Voids - Raked Ceiling	No Asbestos Found							
Underfloor Voids	Non Accessible Area							
Interior								
B00G - R0001 - Practice/Seminar - 6.83 m2								
No Asbestos								
B00G - R0002 - Movement - 13.38 m2								
No Asbestos								
B00G - R0003 - Music Learning Space - 82.09 m2								
No Asbestos								
B00G - R0004 - Music Learning Space - 82.09 m2								
No Asbestos								
B00G - R0005 - Practice/Seminar - 7.27 m2								
No Asbestos								
B00G - R0006 - Movement - 13.38 m2								
No Asbestos								
B00G - R0007 - Staff Room Annexe - 14.62 m2								
No Asbestos								
B00G - R0008 - Cleaning Store - Distributed - 4.37 m2								
No Asbestos								
B00G - R0009 - Staff - Toilet - 4.57 m2								
Partition Walls (Cubides)	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00G - R0010 - Staff - Toilet - 4.75 m2								
Partition Walls (Cubides)	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00G - R0011 - Movement - 32.84 m2								
No Asbestos								
B00G - R0012 - External Movement - 66.32 m2								
No Asbestos								

B00H - Administration/General Learning - 1922 - Brick/Block

Exterior

Gable Verge Lining	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Ends	Flat AC Sheeting	60m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Non Accessible Area						

Interior

B00H - R0001 - Movement - 6.92 m2

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------	-----------------------------

B00H - R0002 - Cleaning Supplies Store - 16.3 m2

No Asbestos

B00H - R0003 - Movement - 12.54 m2

No Asbestos

B00H - R0004 - Deputy Principal Office - 19.12 m2

No Asbestos

B00H - R0005 - General Storeroom - 8.88 m2

No Asbestos

B00H - R0006 - Movement - 14.85 m2

No Asbestos

B00H - R0007 - Leading Teacher - 15.81 m2

No Asbestos

B00H - R0008 - Leading Teacher - 18.3 m2

No Asbestos

B00H - R0009 - Interview/Office - Type 1 - 18.35 m2

No Asbestos

B00H - R0010 - Ancillary Staff - 29.37 m2

No Asbestos

B00H - R0011 - Careers Advisers Office - 18.37 m2

No Asbestos

B00H - R0012 - Clinic - Boys - 15.74 m2

No Asbestos

B00H - R0013 - Toilets - Boys - 3 m2

No Asbestos

B00H - R0014 - Toilets - Girls - 3 m2

No Asbestos

B00H - R0015 - Movement - 7.3 m2

No Asbestos

B00H - R0016 - Clinic - Girls - 17.34 m2

No Asbestos

B00H - R0017 - Staff - Toilet - 13.24 m2

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	---------------------	-----	-------	--------------------	---------	--------------------	-----------------------------

B00H - R0018 - General Storeroom - 4.91 m2

No Asbestos

B00H - R0019 - Staff - Toilet - 18.37 m2

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	---------------------	-----	-------	--------------------	---------	--------------------	-----------------------------

B00H - R0020 - General Learning Space - 48.54 m2							
No Asbestos							
B00H - R0021 - General Learning Space - 48.21 m2							
No Asbestos							
B00H - R0022 - General Learning Space - 48.88 m2							
No Asbestos							
B00H - R0023 - Staff Room Annexe - 21.12 m2							
No Asbestos							
B00H - R0024 - General Storeroom - 20.27 m2							
No Asbestos							
B00H - R0025 - General Storeroom - 6.24 m2							
No Asbestos							
B00H - R0026 - Materials Store - 23.21 m2							
No Asbestos							
B00H - R0027 - Principal Office - 24.46 m2							
No Asbestos							
B00H - R0028 - Administration - Clerical - 31.85 m2							
Floor Coverings Res/Textile	Vinyl Tiles	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0029 - Administration - Clerical - 30.82 m2							
No Asbestos							
B00H - R0030 - Movement - 45.88 m2							
No Asbestos							
B00H - R0031 - Movement - 69.81 m2							
No Asbestos							
B00H - R0032 - Movement - 69.56 m2							
No Asbestos							
B00H - R0033 - Movement - 101.26 m2							
No Asbestos							
B00H - R0034 - Movement - 9.02 m2							
No Asbestos							
B00H - R0035 - Commonroom - 92.06 m2							
No Asbestos							
B00H - R0036 - Staff Kitchen - 22.46 m2							
No Asbestos							
B00I - Multi Purpose Facilities - 2018 - Steel							
Exterior							
Require Inspection							
Interior							
B00I - M0001 - Movement Studio - 123.29 m2							
Require Inspection							
B00I - M0002 - Movement - 57.82 m2							
Require Inspection							
B00I - M0003 - Stairs - 3.39 m2							
Require Inspection							
B00I - M0004 - Stairs - 3.39 m2							
Require Inspection							
B00I - R0001 - Performance Workspace - 78.73 m2							
Require Inspection							

B001 - R0002 - Performance Workspace - 78.41 m2
Require Inspection
B001 - R0003 - Performance Workshop - 101.77 m2
Require Inspection
B001 - R0004 - Performing Arts Store - 10.45 m2
Require Inspection
B001 - R0005 - Toilets-Disabled - 7.46 m2
Require Inspection
B001 - R0006 - Toilets-Disabled - 7.51 m2
Require Inspection
B001 - R0007 - Cleaning Distributed Store - 3.32 m2
Require Inspection
B001 - R0008 - Performance Workshop - 100.97 m2
Require Inspection
B001 - R0009 - Performing Arts Changeroom - 14.51 m2
Require Inspection
B001 - R0010 - Performing Arts Changeroom - 8.42 m2
Require Inspection
B001 - R0011 - Performing Arts Changeroom - 8.41 m2
Require Inspection
B001 - R0012 - Performing Arts Changeroom - 14.51 m2
Require Inspection
B001 - R0013 - Performance Workspace - 79.15 m2
Require Inspection
B001 - R0014 - Performance Workspace - 78.27 m2
Require Inspection
B001 - R0015 - Performing Arts Changeroom - 12.9 m2
Require Inspection
B001 - R0016 - Performing Arts Changeroom - 9.13 m2
Require Inspection
B001 - R0017 - Shower - 10.95 m2
Require Inspection
B001 - R0018 - Toilets-Boys - 12.25 m2
Require Inspection
B001 - R0019 - Performing Arts Changeroom - 21.72 m2
Require Inspection
B001 - R0020 - Movement - 6.51 m2
Require Inspection
B001 - R0021 - Stage - 75.06 m2
Require Inspection
B001 - R0022 - External Movement - 317.52 m2
Require Inspection
B001 - R0023 - Performing Arts Store - 9.57 m2
Require Inspection
B001 - R0024 - Movement - 6.24 m2
Require Inspection
B001 - R0025 - Performing Arts Changeroom - 11.33 m2
Require Inspection
B001 - R0026 - Performing Arts Changeroom - 11.37 m2
Require Inspection
B001 - R0027 - Performing Arts Changeroom - 12.86 m2
Require Inspection

B00I - R0028 - Shower - 10.86 m2							
Require Inspection							
B00I - R0029 - Performing Arts Changeroom - 22.12 m2							
Require Inspection							
B00I - R0030 - Gymnasium - 667.42 m2							
Require Inspection							
B00I - R0031 - Fitness Laboratory - 57.11 m2							
Require Inspection							
B00I - R0032 - Control Room - 10.73 m2							
Require Inspection							
B00I - R0033 - Communications Room - 9.16 m2							
Require Inspection							
B00I - R0034 - First Aid - 12.93 m2							
Require Inspection							
B00I - R0035 - Performing Arts Store - 10.44 m2							
Require Inspection							
B00I - R0036 - Chair Storeroom - 32.31 m2							
Require Inspection							
B00I - R0037 - Large Equipment Store - 21.07 m2							
Require Inspection							
B00I - R0038 - Distribution Board - 1.54 m2							Note: No inspection of live electrical installation
Require Inspection							
B00I - R0039 - Toilet - Lobby - 4.55 m2							
Require Inspection							
B00I - R0040 - Toilet - Lobby - 5 m2							
Require Inspection							
B00I - R0041 - Lift - 2.41 m2							
Require Inspection							
B00I - R0042 - Stairs - 8.03 m2							
Require Inspection							
B00I - R0043 - Stairs - 8.03 m2							
Require Inspection							
B00I - R0044 - External Movement - 2.24 m2							
Require Inspection							
B00J - Technological & Applied Studies/Art - 1922 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Non Accessible Area						
Interior							
B00J - R0001 - Art Learning Space - 58.18 m2							
Floor Coverings Res/Textile	Vinyl Tiles	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - R0002 - Kiln Space - 6.31 m2							
No Asbestos							
B00J - R0003 - Art Learning Space - 51.25 m2							
No Asbestos							
B00J - R0004 - Art Learning Space - 73.58 m2							
No Asbestos							
B00J - R0005 - Cleaning Supplies Store - 29.26 m2							
Floor Coverings Res/Textile	Vinyl Tiles	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00J - R0006 - Cleaning Supplies Store - 25.24 m2							
Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - R0007 - Art Learning Space - 53.65 m2							
No Asbestos							
B00J - R0008 - Movement - 20.85 m2							
No Asbestos							
B00J - R0009 - Cleaning Store - Distributed - 2.97 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - R0010 - Materials Store - 4.96 m2							
No Asbestos							
B00J - R0011 - Staff - Toilet - 6.8 m2							
No Asbestos							
B00J - R0012 - Art Learning Space - 80.68 m2							
No Asbestos							
B00J - R0013 - Materials Store - 6.25 m2							
No Asbestos							
B00J - R0014 - Materials Technology L.S. - 80.77 m2							
No Asbestos							
B00J - R0015 - Movement - 21.19 m2							
No Asbestos							
B00J - R0016 - Cleaning Store - Distributed - 2.98 m2							
No Asbestos							
B00J - R0017 - Materials Store - 4.94 m2							
No Asbestos							
B00J - R0018 - Staff - Toilet - 6.83 m2							
No Asbestos							
B00J - R0019 - Materials Store - 6.95 m2							
No Asbestos							
B00J - R0020 - Staff Room Annexe - 45.74 m2							
No Asbestos							
B00J - R0021 - Food Technology L.S. - 88.98 m2							
No Asbestos							
B00J - R0026 - Preparation - Materials - 17.43 m2							
No Asbestos							
B00J - R0027 - Pantry - 7.63 m2							
No Asbestos							
B00J - R0028 - Food Technology L.S. - 103.6 m2							
No Asbestos							
B00J - R0029 - Other - 12.65 m2							
No Asbestos							
B00J - R0030 - Food/Research Space - 43.42 m2							
No Asbestos							
B00M - General Learning - 1978 - Brick/Veneer							
Exterior							
Gable Verge Lining	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Ends	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Voids - Raked Ceiling	No Asbestos Found							
Underfloor Voids - Slab on Ground	No Asbestos Found							
Interior								
B00M - R0001 - Home Base - 79.59 m2								
No Asbestos								
B00M - R0002 - Withdrawal Space - 1hb - 5.53 m2								
No Asbestos								
B00M - R0003 - Home Base Store - 5.49 m2								
No Asbestos								
B00M - R0004 - No Access - 10.34 m2								
No Asbestos								
B00M - R0005 - General Storeroom - 5.5 m2								
No Asbestos								
B00M - R0006 - Home Base - 81.86 m2								
No Asbestos								
B00M - R0007 - Home Base Store - 5.51 m2								
No Asbestos								
B00M - R0008 - Withdrawal Space - 1hb - 5.49 m2								
No Asbestos								
B00M - R0009 - General Storeroom - 5.51 m2								
No Asbestos								
B00M - R0010 - Sport Equipment Store - 10.34 m2								
No Asbestos								
B00M - R0011 - Home Base - 79.62 m2								
No Asbestos								
B00M - R0012 - Toilets - Boys - 11.78 m2								
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00M - R0013 - Toilets - Girls - 10.97 m2								
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00M - R0014 - Cleaning Store - Distributed - 3.54 m2								
No Asbestos								
B00M - R0015 - Distribution Board - .55 m2								
						Note: No inspection of live electrical installation		
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00M - R0016 - Movement - 124.29 m2								
Ceiling Structures/Linings	Flat AC Sheeting							
B00N - Performing Arts - 1912 - Timber								
Exterior								
Ceiling Voids - Raked Ceiling	No Asbestos Found							
Underfloor Voids	No Asbestos Found							
Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Interior								
B00N - R0004 - Performance Store - 6.59 m2								

Ceiling Structures/Linings	Flat AC Sheeting							
B00N - R0005 - Performance Workspace - 105.35 m2								
Ceiling Structures/Linings	Flat AC Sheeting							
B00N - R0006 - Movement - 27.91 m2								
Ceiling Structures/Linings	Flat AC Sheeting							
B00O - Pupil Facilities - 1965 - Brick/Block								
Exterior								
Eaves Linings	Flat AC Sheeting	30m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Voids - Flat Roof	No Asbestos Found							
Underfloor Voids - Slab on Ground	No Asbestos Found							
Interior								
B00O - R0001 - Shower/Change - 25.86 m2								
No Asbestos								
B00O - R0002 - Toilets - Boys - 17.13 m2								
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00O - R0003 - Cleaning Store - Distributed - 1.47 m2								
Plant / Equipment - Flue	Fibre Cement Pipe	2	North, Hot water system	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00O - R0004 - Shower/Change - 29.64 m2								
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00O - R0005 - Toilets - Girls - 16.28 m2								
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00O - R0006 - Cleaning Store - Distributed - 1.65 m2								
Plant / Equipment - Flue	Fibre Cement Pipe	2	North, Hot water system	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00O - R0007 - Cleaning Store - Distributed - 1.35 m2								
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00O - R0008 - Movement - 28.53 m2								
Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00P - Performing Arts - 1913 - Timber								
Exterior								

Eaves Linings	Flat AC Sheeting	20m2	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00P - R0008 - Movement - 22.39 m2							
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00P - R0009 - Performance Workspace - 93.8 m2							
No Asbestos							
B00P - R0010 - Performance Workspace - 102.67 m2							
No Asbestos							
B00P - R0011 - Performing Arts Changeroom - 8.72 m2							
No Asbestos							
B00P - R0012 - Performing Arts Changeroom - 12.34 m2							
No Asbestos							
B00P - R0013 - Movement - 26.01 m2							
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00P - R0014 - External Movement - .99 m2							
No Asbestos							
B00P - R0015 - External Movement - 1.53 m2							
No Asbestos							
B00Q - General Learning - 1913 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting	8m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00Q - R0001 - General Storeroom - 47.56 m2							
No Asbestos							
B00Q - R0002 - Movement - 11.53 m2							
No Asbestos							
B00T - Performing Arts - 2007 - Brick/Veneer							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00T - M1001 - Movement - 11.01 m2							
No Asbestos							
B00T - M1002 - Movement - 60.38 m2							
No Asbestos							
B00T - M1003 - Movement - 3 m2							
No Asbestos							
B00T - M1004 - Movement - 3 m2							
No Asbestos							

B00T - R0001 - Performance Store - 28.7 m2	
No Asbestos	
B00T - R0002 - Plant - .9 m2	
No Asbestos	
B00T - R0003 - Distribution Board Cupboard - 1.05 m2	Note: No inspection of live electrical installation
No Asbestos	
B00T - R0004 - Cleaning Store - Distributed - 1.79 m2	
No Asbestos	
B00T - R0005 - Stage - 244.31 m2	
No Asbestos	
B00T - R0006 - Plant - 6.17 m2	
No Asbestos	
B00T - R0007 - Plant - 20.66 m2	
No Asbestos	
B00T - R0008 - Movement - 23.53 m2	
No Asbestos	
B00T - R0009 - Performance Store - 11.47 m2	
No Asbestos	
B00T - R0010 - Stairs - 2.27 m2	
No Asbestos	
B00T - R0011 - Movement - 3.47 m2	
No Asbestos	
B00T - R0012 - Stairs - 18.63 m2	
No Asbestos	
B00T - R0013 - Movement - 2.16 m2	
No Asbestos	
B00T - R0014 - Plant - 5.05 m2	
No Asbestos	
B00T - R0015 - Movement - 65.46 m2	
No Asbestos	
B00T - R0016 - Stairs - 1.58 m2	
No Asbestos	
B00T - R0017 - Movement - 1.25 m2	
No Asbestos	
B00T - R0018 - Stairs - 2.32 m2	
No Asbestos	
B00T - R0019 - Plant - 2.42 m2	
No Asbestos	
B00T - R0021 - Plant - .66 m2	
No Asbestos	
B00T - R0022 - Plant - .69 m2	
No Asbestos	
B00T - R0023 - Performance Workspace - 87.32 m2	
No Asbestos	
B00T - R0024 - Store - 1.74 m2	
No Asbestos	
B00T - R0025 - Performance Store - 14.51 m2	
No Asbestos	
B00T - R0026 - Movement - 3.72 m2	
No Asbestos	
B00T - R0027 - Toilets - Boys - 18.15 m2	
No Asbestos	

B00T - R0028 - Toilets-Disabled - 4.18 m2	
No Asbestos	
B00T - R0029 - Toilets - Girls - 27.46 m2	
No Asbestos	
B00T - R0030 - Canteen - 14.74 m2	
No Asbestos	
B00T - R0031 - Stairs - 5.19 m2	
No Asbestos	
B00T - R0032 - No Access - 4.87 m2	
No Asbestos	
B00T - R0033 - Entry Vestibule - 149.71 m2	
No Asbestos	
B00T - R0034 - Administration - Clerical - 9.59 m2	
No Asbestos	
B00T - R0035 - Stairs - 6.18 m2	
No Asbestos	
B00T - R0036 - Movement - 9.26 m2	
No Asbestos	
B00T - R0037 - No Access - 4.54 m2	
No Asbestos	
B00T - R0038 - Stairs - 6.34 m2	
No Asbestos	
B00T - R0039 - Stairs - 8.43 m2	
No Asbestos	
B00T - R0040 - Movement - 212.96 m2	
No Asbestos	
B00T - R0041 - Special Programs Room - 100.83 m2	
No Asbestos	
B00T - R1001 - Movement - 29.47 m2	
No Asbestos	
B00T - R1002 - Stairs - 9.85 m2	
No Asbestos	
B00T - R1003 - Movement - 28.64 m2	
No Asbestos	
B00T - R1004 - Plant - 6.17 m2	
No Asbestos	
B00T - R1005 - Stairs - 18.63 m2	
No Asbestos	
B00T - R1006 - Stairs - 13.44 m2	
No Asbestos	
B00T - R1007 - Movement - 26.36 m2	
No Asbestos	
B00T - R1008 - Movement - 2.53 m2	
No Asbestos	
B00T - R1009 - Practice/Seminar - 6.91 m2	
No Asbestos	
B00T - R1010 - Practice/Seminar - 37.14 m2	
No Asbestos	
B00T - R1011 - Control Room - 10.36 m2	
No Asbestos	
B00T - R1012 - Movement - 3.76 m2	
No Asbestos	

B00T - R1013 - Movement - 19.37 m2	
No Asbestos	
B00T - R1014 - Movement - 2.48 m2	
No Asbestos	
B00T - R1015 - Performance Store - 11.51 m2	
No Asbestos	
B00T - R1016 - Control Room - 9.42 m2	
No Asbestos	
B00T - R1017 - Control Room - 14.98 m2	
No Asbestos	
B00T - R1018 - Practice/Seminar - 8.1 m2	
No Asbestos	
B00T - R1019 - Movement - 2.48 m2	
No Asbestos	
B00T - R1020 - Distribution Board Cupboard - .77 m2	Note: No inspection of live electrical installation
No Asbestos	
B00T - R1021 - Plant - .54 m2	
No Asbestos	
B00T - R1022 - Movement - 25.28 m2	
No Asbestos	
B00T - R1023 - No Access - 4.87 m2	
No Asbestos	
B00T - R1024 - Stairs - 11.12 m2	
No Asbestos	
B00T - R1025 - Special Programs Room - 153.16 m2	
No Asbestos	
B00T - R1026 - Movement - 8.77 m2	
No Asbestos	
B00T - R9001 - Performing Arts Changeroom - 33.84 m2	
No Asbestos	
B00T - R9002 - Performing Arts Changeroom - 6.75 m2	
No Asbestos	
B00T - R9003 - Disabled Shower/Toilet - 6.09 m2	
No Asbestos	
B00T - R9004 - Performing Arts Changeroom - 33.47 m2	
No Asbestos	
B00T - R9005 - Performance Store - 95.97 m2	
No Asbestos	
B00T - R9006 - Plant - 22.55 m2	
No Asbestos	
B00T - R9007 - Stairs - 2.62 m2	
No Asbestos	
B00T - R9008 - Practice/Seminar - 40.16 m2	
No Asbestos	
B00T - R9009 - Movement - 55.73 m2	
No Asbestos	
B00T - R9010 - Stairs - 8.43 m2	
No Asbestos	
B00T - R9011 - Performance Store - 2.25 m2	
No Asbestos	
B00T - R9012 - Cleaning Store - Distributed - 3.06 m2	

No Asbestos		
B00T - R9013 - No Access - 4.54 m2		
No Asbestos		
B00T - R9014 - Stairs - 6.42 m2		
No Asbestos		
B00T - R9015 - Performing Arts Changeroom - 6.78 m2		
No Asbestos		
B00T - R9016 - Plant - 103.86 m2		
No Asbestos		
B00T - R9017 - Stairs - 1.58 m2		
No Asbestos		
B00U - General Learning - 2010 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Interior		
B00U - R0001 - External Movement - 46.36 m2		
No Asbestos		
B00U - R0002 - Home Base - 68.27 m2		
No Asbestos		
B00U - R0003 - Home Base Store - 5.9 m2		
No Asbestos		
B00U - R0004 - Home Base - 69.85 m2		
No Asbestos		
B00U - R0005 - Home Base - 68.27 m2		
No Asbestos		
B00U - R0006 - Home Base Store - 5.9 m2		
No Asbestos		
B00U - R0007 - No Access - .41 m2		
No Asbestos		
B00V - Electrical Services - 2008 - Brick/Block		
Exterior		
Ceiling Voids - Flat Roof	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Interior		
B00V - R0001 - Distribution Board Cupboard - 7.12 m2		Note: No inspection of live electrical installation
No Asbestos		
B00V - R0002 - Distribution Board Cupboard - 9.54 m2		Note: No inspection of live electrical installation
No Asbestos		

Demountables**OS 902 15184 - Dormitory/Toilet/Shower - Placement Date : 17-NOV-1997****Exterior**

Eaves Linings	Flat AC Sheeting	25.92m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Toilets-Boys**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Assumed Asbestos
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Toilet Partitions	Compressed AC Sheet	6m2	Assumed Asbestos

R2- Change Room

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Assumed Asbestos

R3- Toilets-Girls

Toilet Partitions	Compressed AC Sheet	4m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Assumed Asbestos

R4- Change Room

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Assumed Asbestos
----------------------------	------------------	-----	------------------

R5- Store

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Assumed Asbestos
----------------------------	------------------	-----	------------------

R6- Performance Workshop

Ceiling Structures/Linings	Flat AC Sheeting	128m2	Assumed Asbestos
----------------------------	------------------	-------	------------------

R7- Control porch

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Assumed Asbestos
----------------------------	------------------	-----	------------------

OS 510 70110 - Staff Common Room - Placement Date : 08-JUL-2004**Exterior**

Eaves Linings	Flat AC Sheeting	17.28m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Commonroom/staff room**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	90m2	Assumed Asbestos

R2- Staff Toilet

Toilet Partitions	Compressed AC Sheet	4m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Assumed Asbestos

R3- Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Assumed Asbestos
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Toilet Partitions	Compressed AC Sheet	4m2	Assumed Asbestos

R4- Lobby

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------