


# Asbestos Register

(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Irrawang Public School (4372)</b>
<b>Region:</b>	<b>Hunter/Central Coast AMU</b>
<b>State Electorate:</b>	<b>Port Stephens</b>
<b>Local Government Area:</b>	<b>Port Stephens</b>

<b>Last Reviewed By:</b>	<b>Greencap 10-FEB-2015</b>
<b>Last Revised By:</b>	<b>Greencap 25-JUL-2020</b>

<b>Historical Fibro In Grounds Investigations/Events</b>	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

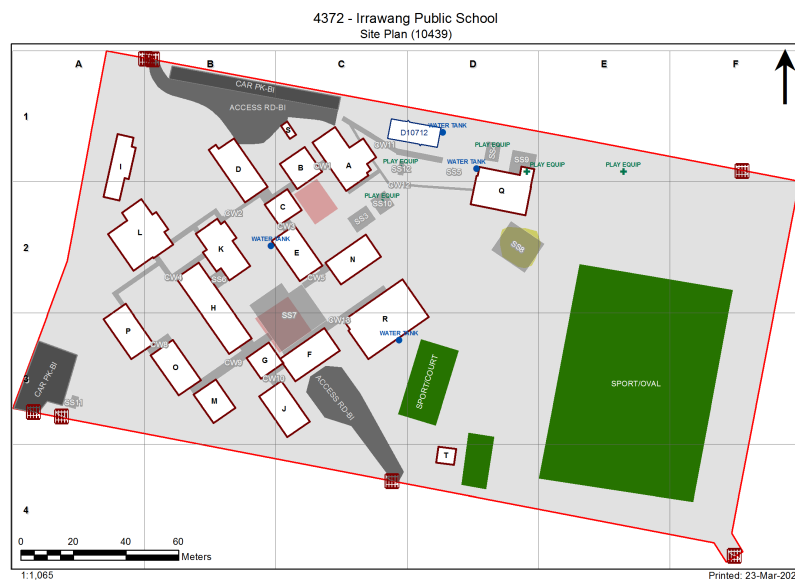

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - General Learning/Pupil Facilities - 1969 - Brick/Block</b>							
<b>Exterior</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	30	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00A - R0001 - Home Base Store - 3.43 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00A - R0002 - Distribution Board - .81 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00A - R0003 - Movement - 9.04 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00A - R0004 - Home Base - 55.66 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	8m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00A - R0005 - Home Base - 86.45 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	87m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	12m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00A - R0006 - Toilets - Boys/Girls - 3.71 m2</b>							
No Asbestos							
<b>B00A - R0007 - Home Base Store - 4.17 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00A - R0008 - Movement - 9.26 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00A - R0009 - Movement - 38.1 m2</b>							
No Asbestos							
<b>B00A - R0010 - Movement - 55.75 m2</b>							
No Asbestos							
<b>B00B - Pupil Facilities/Communal Facilities - 1976 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00B - R0001 - Toilets - Boys - 26.16 m2</b>							

No Asbestos							
<b>B00B - R0002 - Cleaning Distributed Store - 1.33 m2</b>							
No Asbestos							
<b>B00B - R0003 - P.E Store - 49.67 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0004 - Toilets - Girls - 19.46 m2</b>							
No Asbestos							
<b>B00B - R0005 - Movement - 19.68 m2</b>							
No Asbestos							
<b>B00C - General Learning - 1969 - Brick/Block</b>							
<b>Exterior</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	8	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00C - R0001 - Home Base - 57 m2</b>							
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0002 - Home Base Store - 4.17 m2</b>							
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0003 - Movement - 9.24 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00C - R0004 - Movement - 16.73 m2</b>							
No Asbestos							
<b>B00D - General Learning/Administration - 1969 - Brick/Block</b>							
<b>Exterior</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	25	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00D - R0001 - General Storeroom - 20.91 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00D - R0002 - Craft Store - 7.03 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0003 - Cleaning Supplies - 9.67 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00D - R0004 - General Assistant/Bulk Store - 11.65 m2							
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0005 - Movement - 18.34 m2							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	
B00D - R0006 - General Storeroom - 3.42 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0007 - Main Switch Board - 5.61 m2							
Electrical - Backing Board	Resinous Board	2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R0008 - Movement - 40.17 m2							
No Asbestos							
B00D - R0009 - Toilets - Boys/Girls - 3.91 m2							
No Asbestos							
B00D - R0010 - Practical Activities - 1hb - 17.11 m2							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0011 - Home Base - 72.7 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	11m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - General Learning - 1969 - Brick/Veneer							
Exterior							
Wall Linings Internal - Infill	Flat AC Sheeting	18	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00E - R0001 - Movement - 33.06 m2							
No Asbestos							
B00E - R0002 - Movement - 9.07 m2							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
B00E - R0003 - Distribution Board - .81 m2							
							<b>Note: No inspection of live electrical installation</b>
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00E - R0004 - Home Base Store - 3.41 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0005 - Home Base - 55.79 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	8m2	East and West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00E - R0006 - Home Base - 57.7 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	58m2	East and West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00E - R0007 - Home Base Store - 4.21 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0008 - Movement - 9.26 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - Pupil Facilities - 1969 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00F - R0001 - Movement - 40.19 m2</b>							
No Asbestos							
<b>B00F - R0002 - Toilets - Boys - 23.67 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0003 - Toilets - Girls - 2.82 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0004 - Toilets - Girls - 24.22 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0005 - Movement - 41.92 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0006 - Canteen - 43.27 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00F - R0007 - Staff Toilet - 4.76 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00F - R0008 - Canteen Office/Store - 2.74 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	

B00F - R0009 - Uniform Shop - 3.72 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
B00F - R0010 - Drinking Facilities - .72 m2							
No Asbestos							
B00G - General Learning - 1969 - Brick/Block							
Exterior							
Wall Linings Internal - Infill	Flat AC Sheeting	12	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00G - R0001 - Home Base - 56.92 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0002 - Home Base Store - 5.82 m2							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0003 - Kiln Room - 7.66 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	8m2	East and West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
				Good Condition (1)	Low (1)	Low Priority (2-3)	
B00G - R0004 - Movement - 17.05 m2							
No Asbestos							
B00H - Administration/General Learning - 1974 - Brick/Block							
Exterior							
Wall Linings Internal - Infill	Flat AC Sheeting	80	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00H - R0001 - Movement - 64.69 m2							
No Asbestos							
B00H - R0002 - Duplicating Workroom - 14.09 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0003 - General Storeroom - 5.64 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0004 - Clerical Office - 15.22 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0005 - Movement - 16.41 m2							



Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	17m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0006 - General Storeroom - 11.54 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0007 - Staff Toilet - 3.72 m2</b>							
No Asbestos							
<b>B00H - R0008 - Staff Toilet - 3.7 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0009 - Staff Toilet - 3.68 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0010 - Principal - 21.9 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0011 - Interview - 11.59 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0012 - Distribution Board - .4 m2</b> <span style="float: right;"><b>Note: No inspection of live electrical installation</b></span>							
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00H - R0013 - Entry Vestibule - 11.7 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0014 - Home Base - 56.91 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	4m2	East and West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00H - R0015 - Home Base Store - 5.78 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0016 - Movement - 15.85 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00H - R0017 - Home Base - 57.15 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	4m2	East and West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00H - R0018 - Home Base Store - 5.78 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0019 - General Storeroom - .4 m2</b>							
No Asbestos							
<b>B00I - General Learning/Music - 1969 - Timber</b>							



Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Packing	2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Interior							
<b>B00I - R0001 - Movement - 18.74 m2</b>							
No Asbestos							
<b>B00I - R0002 - Uniform Shop - 7.14 m2</b>							
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00I - R0003 - Special Programs Room - 66.32 m2</b>							
No Asbestos							
<b>B00I - R0004 - Special Programs Room - 56.17 m2</b>							
No Asbestos							
<b>B00I - R0005 - Music Store - 7.22 m2</b>							
No Asbestos							
<b>B00I - R0006 - Security Store - 10.43 m2</b>							
No Asbestos							
B00J - General Learning - 1969 - Brick/Veneer							
Exterior							
Wall Linings Internal - Infill	Flat AC Sheeting	20	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
<b>B00J - R0001 - Movement - 32.41 m2</b>							
No Asbestos							
<b>B00J - R0002 - Home Base - 58.1 m2</b>							
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	1	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00J - R0003 - Home Base Store - 5.75 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0004 - Movement - 15.72 m2</b>							
No Asbestos							
<b>B00J - R0005 - Home Base - 58.25 m2</b>							
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	1	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00J - R0006 - Home Base Store - 5.72 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - Staff Facilities/Administration - 1976 - Brick/Block							
Exterior							
Wall Linings Internal - Infill	Flat AC Sheeting	20	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						

Underfloor Voids - Slab on Ground	No Asbestos Found							
<b>Interior</b>								
<b>B00K - R0001 - Movement - 3.89 m2</b>								
No Asbestos								
<b>B00K - R0002 - Duplicating Workroom - 16.19 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00K - R0003 - Movement - 26.49 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00K - R0004 - Staff Room Annexe - 12.61 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00K - R0005 - Staff Toilet - 4.61 m2</b>								
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00K - R0006 - Cleaning Distributed Store - 1.68 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
				Good Condition (1)	Low (1)	Low Priority (2-3)		
<b>B00K - R0007 - Staff Toilet - 4.65 m2</b>								
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
				Good Condition (1)	Low (1)	Low Priority (2-3)		
<b>B00K - R0008 - Deputy Principal - 13.01 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00K - R0009 - Staff Room Annexe - 12.97 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00K - R0010 - General Storeroom - 12.97 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00K - R0011 - Distribution Board - .23 m2</b>								
						<b>Note: No inspection of live electrical installation</b>		
Electrical - Backing Board	Resinous Board	2	East and West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00K - R0012 - Staff Room - 71.96 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Wall Linings Internal - Infill	Flat AC Sheeting	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00K - R0013 - Movement - 37.72 m2</b>								
No Asbestos								
<b>B00L - Library - 1976 - Brick/Block</b>								
<b>Exterior</b>								

Wall Linings Internal - Infill	Flat AC Sheeting	20	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00L - R0001 - Reading Area - 170.76 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00L - R0002 - Seminar/Study - 10.9 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00L - R0003 - Seminar/Study - 10.46 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00L - R0004 - Toilets - Boys - 4.53 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00L - R0005 - Cleaning Distributed Store - 2.5 m2</b>							
No Asbestos							
<b>B00L - R0006 - Toilets - Girls - 5.06 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00L - R0007 - Movement - 11.81 m2</b>							
No Asbestos							
<b>B00L - R0008 - Movement - 19.46 m2</b>							
No Asbestos							
<b>B00L - R0009 - Distribution Board - .13 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Electrical - Backing Board	Resinous Board	2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00L - R0010 - Library Office/Workroom - 6.17 m2</b>							
No Asbestos							
<b>B00L - R0011 - Library Office/Workroom - 19.05 m2</b>							
No Asbestos							
<b>B00L - R0012 - Communications Room - 10.52 m2</b>							
No Asbestos							
<b>B00L - R0013 - Movement - 22.74 m2</b>							
No Asbestos							
<b>B00M - General Learning/Communal Facilities - 1943 - Brick/Block</b>							
<b>Exterior</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	8	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00M - R0001 - Movement - 23.21 m2</b>							
No Asbestos							
<b>B00M - R0002 - Craft Store - 12.69 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	
<b>B00M - R0003 - Sports Store - 14.6 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00M - R0004 - No Access - 19 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00M - R0005 - Home Base - 50.89 m2</b>							
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	7m2	East and West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00N - General Learning - 1969 - Brick/Veneer</b>							
<b>Exterior</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	15	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00N - R0001 - Practical Activities - 1hb - 18.9 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00N - R0002 - Home Base - 50.97 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	7m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00N - R0003 - Movement - 32.01 m2</b>							
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00N - R0004 - Home Base - 50.67 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	7m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00N - R0005 - Practical Activities - 1hb - 18.97 m2</b>							
No Asbestos							
<b>B00O - General Learning - 1969 - Brick/Veneer</b>							
<b>Exterior</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	25	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>Interior</b>							
<b>B00O - R0001 - Movement - 32.73 m2</b>							

No Asbestos							
<b>B000 - R0002 - Practical Activities - 1hb - 18.97 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B000 - R0003 - Home Base - 50.74 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	7m2	East and West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B000 - R0004 - Home Base - 51.03 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	7m2	East and West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B000 - R0005 - Practical Activities - 1hb - 19.02 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00P - General Learning - 1969 - Brick/Veneer</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Linings Internal - Infill	Flat AC Sheeting	12	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>Interior</b>							
<b>B00P - R0001 - Movement - 32.96 m2</b>							
No Asbestos							
<b>B00P - R0002 - Practical Activities - 1hb - 18.85 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00P - R0003 - Home Base - 50.73 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	7m2	East and West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00P - R0004 - Home Base - 51.11 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	7m2	East and West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
				Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00P - R0005 - Practical Activities - 1hb - 18.78 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

**B00Q - Pre-School Facilities - 2004 - Brick/Veneer**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00Q - R0001 - Movement - 2.23 m2**

No Asbestos

**B00Q - R0002 - Entry Vestibule - 13.9 m2**

No Asbestos

**B00Q - R0003 - Security Store - 8.6 m2**

No Asbestos

**B00Q - R0004 - General Storeroom - Pre - 12.39 m2**

No Asbestos

**B00Q - R0005 - Home Base - Pre - 69.01 m2**

Floor Coverings Res/Textile	No Asbestos Found
-----------------------------	-------------------

**B00Q - R0006 - Practical Activities - Pre - 46.33 m2**

No Asbestos

**B00Q - R0007 - Toilets - Boys/Girls - Pre - 12.81 m2**

No Asbestos

**B00Q - R0008 - Laundry - Pre - 4.54 m2**

No Asbestos

**B00Q - R0009 - Access Shower/Toilet - Type 2 - 5.56 m2**

No Asbestos

**B00Q - R0010 - Cleaning Distributed Store - 3.54 m2**

No Asbestos

**B00Q - R0011 - Kitchen - Pre - 12.91 m2**

No Asbestos

**B00Q - R0012 - Clerical Office - Pre - 12.44 m2**

Floor Coverings Res/Textile	No Asbestos Found
-----------------------------	-------------------

**B00Q - R0013 - Clerical Office - Pre - 8.66 m2**

Floor Coverings Res/Textile	No Asbestos Found
-----------------------------	-------------------

**B00Q - R0014 - General Storeroom - Pre - 20.56 m2**

No Asbestos

**B00Q - R0015 - Movement - 69.4 m2**

No Asbestos

**B00R - General Learning/Pupil Facilities - 2010 - Brick/Veneer**

**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found
Underfloor Voids - Slab on Ground	

**Interior**

**B00R - R0001 - Covered Outdoor Learning Area - 155.89 m2**

No Asbestos

**B00R - R0002 - Communal Space - 142.87 m2**

No Asbestos

**B00R - R0003 - Movement - 5.45 m2**

No Asbestos

<b>B00R - R0004 - Raised Platform - 62.92 m2</b>		
No Asbestos		
<b>B00R - R0005 - Hall Chair Store - 9.17 m2</b>		
No Asbestos		
<b>B00R - R0006 - Communal/Performance Store - 9.18 m2</b>		
No Asbestos		
<b>B00R - R0007 - P.E. Store - 13.08 m2</b>		
No Asbestos		
<b>B00R - R0008 - Movement - 2.37 m2</b>		
No Asbestos		
<b>B00R - R0009 - Toilets - Girls - 7.3 m2</b>		
No Asbestos		
<b>B00R - R0010 - Sound Cupboard - 2.05 m2</b>		
No Asbestos		
<b>B00R - R0011 - Movement - 3.41 m2</b>		
No Asbestos		
<b>B00R - R0012 - Toilets - Boys - 5.75 m2</b>		
No Asbestos		
<b>B00R - R0013 - Cleaning Supplies - 3.53 m2</b>		
No Asbestos		
<b>B00R - R0014 - Plant - 1.7 m2</b>		
No Asbestos		
<b>B00R - R0015 - Distribution Board - 3.33 m2</b>		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00R - R0016 - Toilet - P - 6.93 m2</b>		
No Asbestos		
<b>B00R - R0017 - Movement - 11.28 m2</b>		
No Asbestos		
<b>B00R - R0018 - Movement - 13.15 m2</b>		
No Asbestos		
<b>B00S - Storage - 1998 - Metal Shed</b>		
<b>Exterior</b>		
Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00S - R0001 - General Storeroom - 17.11 m2</b>		
No Asbestos		
<b>B00T - Storage - 2019 - Steel</b>		
<b>Exterior</b>		
Require Inspection		
<b>Interior</b>		
<b>B00T - R0001 - Sports Store - 19.13 m2</b>		
Require Inspection		
<b>B00T - R0002 - General Assistant/Bulk Store - 19.9 m2</b>		
Require Inspection		



## Demountables

OS 534 10712 - Library/Group Study/Office/A V Store - Placement Date : 17-MAR-2003

### Exterior

Eaves Linings	Flat AC Sheeting	23.04m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

### Interior

#### R1- Clerical Office

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

#### R2- Staff Room

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Assumed Asbestos
----------------------------	------------------	------	------------------

#### R3- Security Store

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos
----------------------------	------------------	-----	------------------

#### R4- Principal

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Assumed Asbestos
----------------------------	------------------	------	------------------

#### R5- Staff Toilet

Toilet Partitions	Compressed AC Sheet	4m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Assumed Asbestos

#### R6- Staff Toilet

Toilet Partitions	Compressed AC Sheet	4m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Assumed Asbestos

#### R7- Reading Area

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Assumed Asbestos
----------------------------	------------------	------	------------------

#### R8- Entry

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Assumed Asbestos
----------------------------	------------------	------	------------------