


# Asbestos Register

(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Illawarra Sports High School (8205)</b>
<b>Region:</b>	<b>Southern NSW AMU</b>
<b>State Electorate:</b>	<b>Wollongong</b>
<b>Local Government Area:</b>	<b>Wollongong</b>

<b>Last Reviewed By:</b>	<b>Greencap 26-AUG-2014</b>
<b>Last Revised By:</b>	

<b>Historical Fibro In Grounds Investigations/Events</b>	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

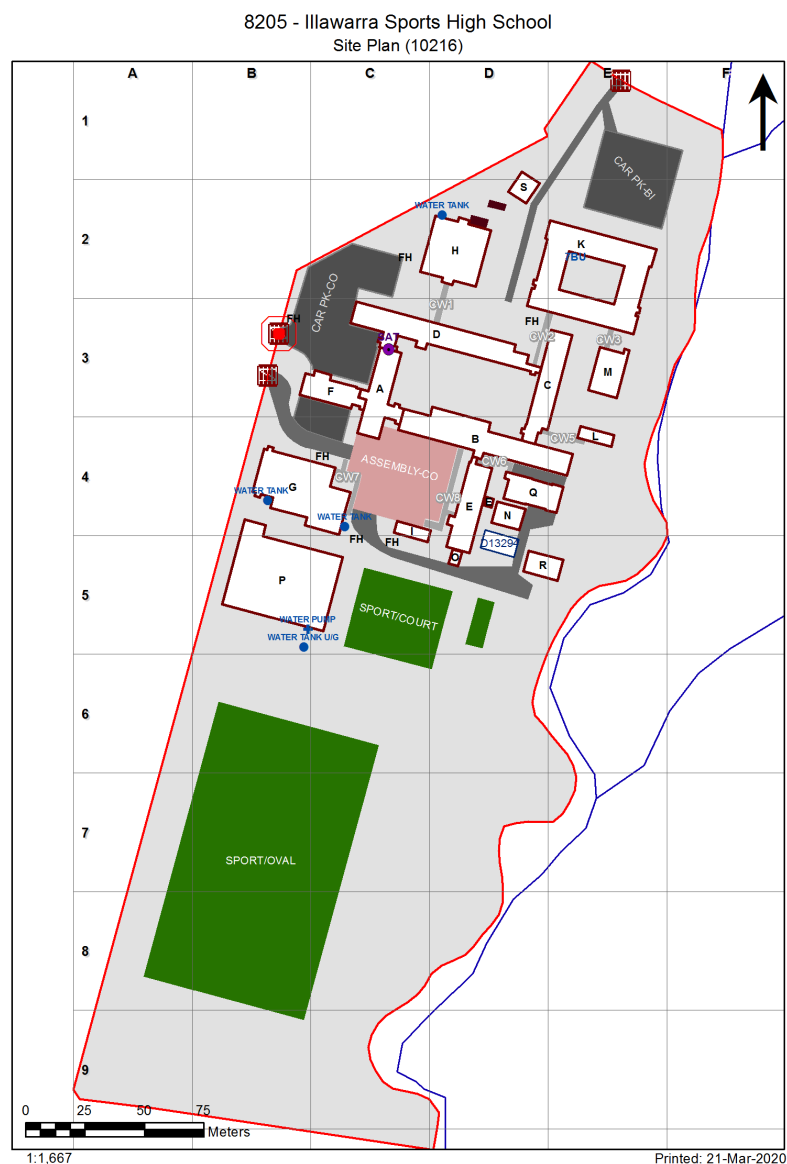

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

### Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

### Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

### Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

#### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - General Learning - 1958 - Concrete Framed</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Verge Lining	Flat AC Sheeting	15m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids	Flat AC Sheeting	500	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	Flat AC Sheeting	500	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00A - R0002 - Distribution Board Cupboard - 3.42 m2</b>						<b>Note: No inspection of live electrical installation</b>	
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00A - R0004 - General Learning Space - 60.5 m2</b>							
No Asbestos							
<b>B00A - R0006 - Movement - 31.31 m2</b>							
No Asbestos							
<b>B00A - R0007 - General Learning Space - 84.04 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	84.03m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0008 - General Storeroom - 7.6 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0009 - General Storeroom - 4.13 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00A - R0011 - Stairs - .58 m2</b>							
No Asbestos							
<b>B00A - R0012 - Clerical Office - 41.74 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	41.73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0013 - Duplicating Workroom - 35.71 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	35.71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0014 - Movement - 23.52 m2</b>							
No Asbestos							
<b>B00A - R0015 - General Storeroom - 9.77 m2</b>							
No Asbestos							
<b>B00A - R0016 - External Movement - 2.55 m2</b>							
No Asbestos							
<b>B00A - R0017 - External Movement - 2.52 m2</b>							
No Asbestos							
<b>B00A - R0018 - Lift - 2.2 m2</b>							
Require Inspection							
<b>B00A - R0019 - Movement - 52.06 m2</b>							

Require Inspection							
<b>B00A - R1001 - General Learning Space - 59.98 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	59.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1002 - General Learning Space - 60.35 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1003 - Staff Kitchen - 2.94 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1004 - General Storeroom - 3.51 m2</b>							
No Asbestos							
<b>B00A - R1006 - Cleaning Store - Distributed - 3.46 m2</b>							
No Asbestos							
<b>B00A - R1007 - Leading Teacher - 13.79 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13.78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1008 - General Storeroom - 5.31 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1009 - General Storeroom - 7.93 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1010 - Performing Arts Store - 7.79 m2</b>							
No Asbestos							
<b>B00A - R1011 - Performance Workspace - 84.58 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	84.58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1012 - Performing Arts Store - 4.21 m2</b>							
No Asbestos							
<b>B00A - R1013 - Movement - 15.18 m2</b>							
No Asbestos							
<b>B00A - R1014 - Stairs - 13.02 m2</b>							
No Asbestos							
<b>B00A - R1015 - Movement - 63.96 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1016 - Movement - 2.52 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - Technological &amp; Applied Studies/Pupil Facilities - 1958 - Concrete Framed</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids	Flat AC Sheeting	1000	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

Underfloor Voids	Flat AC Sheeting	1000	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00B - R0004 - Food Technology L.S. - 63.17 m2</b>							
No Asbestos							
<b>B00B - R0009 - Staff Study - 17.66 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	17.66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0010 - Laundry - 17.74 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0011 - Cleaning Store - Distributed - 4.48 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0012 - Staff Study - 24.86 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	24.85m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0013 - Movement - 10.19 m2</b>							
No Asbestos							
<b>B00B - R0014 - Movement - 188.95 m2</b>							
Wall Linings Internal	Flat AC Sheeting	20m2	Northwest	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	5m2	Southeast	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0017 - Office/Store - 2.62 m2</b>							
No Asbestos							
<b>B00B - R0018 - Staff Kitchen - 15.14 m2</b>							
No Asbestos							
<b>B00B - R0019 - Office/Store - 3.32 m2</b>							
No Asbestos							
<b>B00B - R0020 - Movement - 20.33 m2</b>							
No Asbestos							
<b>B00B - R0021 - General Storeroom - 14.41 m2</b>							
No Asbestos							
<b>B00B - R0022 - General Storeroom - 14.33 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0023 - Cleaning Supplies Store - 6.57 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0024 - General Assistants - 17.04 m2</b>							
No Asbestos							
<b>B00B - R0025 - Main Switchroom - 9.88 m2</b>							
Electrical - Mounting Board	Resinous Board						
<b>B00B - R0026 - Student Canteen - 36.01 m2</b>							
No Asbestos							
<b>B00B - R0027 - External Movement - 96.78 m2</b>							

No Asbestos							
<b>B00B - R0028 - Food Technology L.S. - 67.4 m2</b>							
No Asbestos							
<b>B00B - R0029 - Food/Research Space - 24.75 m2</b>							
No Asbestos							
<b>B00B - R0030 - Staff Study - 42.48 m2</b>							
No Asbestos							
<b>B00B - R0031 - Movement - 45.9 m2</b>							
No Asbestos							
<b>B00B - R1001 - Movement - 124.14 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	125m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1002 - Design L.S. - 65.06 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1003 - Materials Store - 5.89 m2</b>							
No Asbestos							
<b>B00B - R1004 - Resource/Project Store - 11.9 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	11.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1005 - Materials Store - 5.89 m2</b>							
No Asbestos							
<b>B00B - R1006 - Design L.S. - 63.06 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1007 - Design L.S. - 50.19 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1008 - General Storeroom - 5.97 m2</b>							
No Asbestos							
<b>B00B - R1009 - General Storeroom - 5.85 m2</b>							
No Asbestos							
<b>B00B - R1010 - Design L.S. - 50.55 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1011 - General Learning Space - 50.4 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	50.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1012 - Staff Study - 17.56 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	17.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1014 - General Storeroom - 21.17 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	21.17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1015 - General Learning Space - 51.05 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	51.04m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1016 - General Learning Space - 50.91 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles	50.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1017 - Staff Study - 37.55 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	37.54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1018 - Staff Kitchen - 4.59 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1019 - Staff - Toilet - 7.49 m2</b>							
No Asbestos							
<b>B00B - R1020 - Staff Study - 6.27 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6.27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1021 - Movement - 4.19 m2</b>							
No Asbestos							
<b>B00C - Computer Learning/General Learning - 1958 - Concrete Framed</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00C - R0002 - Preparation - 18.49 m2</b>							
No Asbestos							
<b>B00C - R0003 - Distribution Board Cupboard - 3.13 m2</b>							
No Asbestos							
<b>B00C - R0004 - Staff Study - 17.97 m2</b>							
No Asbestos							
<b>B00C - R0005 - Tiered Learning Area - 41.76 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0006 - Preparation - 23.27 m2</b>							
No Asbestos							
<b>B00C - R0007 - Apparatus Store - 13.89 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0010 - Stairs - .57 m2</b>							
No Asbestos							
<b>B00C - R0011 - Movement - 79.02 m2</b>							
No Asbestos							
<b>B00C - R0012 - Cleaning Distributed Store - 10.45 m2</b>							
No Asbestos							
<b>B00C - R0013 - External Movement - 2.45 m2</b>							
No Asbestos							
<b>B00C - R0014 - External Movement - 2.55 m2</b>							
No Asbestos							
<b>B00C - R0015 - Laboratory L.S. - 88.04 m2</b>							
No Asbestos							
<b>B00C - R0016 - Laboratory L.S. - 80.72 m2</b>							

No Asbestos							
<b>B00C - R1001 - Computer Learning Space - 64.95 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1002 - General Learning Space - 60.73 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	60.72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1003 - General Learning Space - 60.59 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	60.59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1004 - Computer Learning Space - 63.44 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1005 - Computer Resource - 2.92 m2</b>							
No Asbestos							
<b>B00C - R1006 - Staff Study - 21.28 m2</b>							
No Asbestos							
<b>B00C - R1007 - Staff Kitchen - 4.78 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1008 - Staff - Toilet - 7.3 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting						
<b>B00C - R1010 - Stairs - 13.16 m2</b>							
No Asbestos							
<b>B00C - R1011 - Movement - 67 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1012 - Movement - 16.54 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - General Learning/Staff Facilities - 1958 - Concrete Framed</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00D - R0004 - Preparation - 28.06 m2</b>							
Plant / Equipment - Oven	Millboard						
<b>B00D - R0006 - Security Store - 12.35 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	12.3m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0007 - General Learning Space - 78.63 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	78.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0008 - Movement - 116.84 m2</b>							



Electrical - Backing Board	Resinous Board	1	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Flat AC Sheeting						
<b>B00D - R0009 - Interview/Office - Type 1 - 11.65 m2</b>							
No Asbestos							
<b>B00D - R0010 - Interview/Office - Type 1 - 11.65 m2</b>							
No Asbestos							
<b>B00D - R0011 - Staff Study - 36.05 m2</b>							
No Asbestos							
<b>B00D - R0012 - Clinic - Boys - 13.95 m2</b>							
No Asbestos							
<b>B00D - R0013 - Toilets-Disabled - 3.34 m2</b>							
No Asbestos							
<b>B00D - R0014 - Toilets-Disabled - 3.42 m2</b>							
No Asbestos							
<b>B00D - R0015 - Clinic - Girls - 13.87 m2</b>							
No Asbestos							
<b>B00D - R0016 - Commonroom - 118.54 m2</b>							
No Asbestos							
<b>B00D - R0017 - General Storeroom - 10.05 m2</b>							
No Asbestos							
<b>B00D - R0019 - Movement - .59 m2</b>							
No Asbestos							
<b>B00D - R0020 - Movement - .58 m2</b>							
No Asbestos							
<b>B00D - R0021 - General Storeroom - 11.03 m2</b>							
No Asbestos							
<b>B00D - R0022 - Movement - 21.08 m2</b>							
No Asbestos							
<b>B00D - R0023 - External Movement - 2.45 m2</b>							
No Asbestos							
<b>B00D - R0024 - External Movement - 11.61 m2</b>							
No Asbestos							
<b>B00D - R0025 - External Movement - 2.4 m2</b>							
No Asbestos							
<b>B00D - R0026 - External Movement - 2.36 m2</b>							
No Asbestos							
<b>B00D - R0027 - Laboratory L.S. - 84.86 m2</b>							
No Asbestos							
<b>B00D - R0028 - Toilet - Lobby - 3.7 m2</b>							
Require Inspection							
<b>B00D - R0029 - Access Staff Shower/Toilet - 15.41 m2</b>							
Require Inspection							
<b>B00D - R0030 - Staff - Toilet - 2.21 m2</b>							
Require Inspection							
<b>B00D - R0031 - Staff - Toilet - 2.21 m2</b>							
Require Inspection							
<b>B00D - R0032 - Movement - 82.92 m2</b>							
Require Inspection							
<b>B00D - R1001 - Movement - 169.3 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles	170m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R1002 - Interview/Office - Type 1 - 21.09 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1003 - General Storeroom - 3.43 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1004 - General Learning Space - 48.83 m2</b>							
No Asbestos							
<b>B00D - R1005 - General Learning Space - 48.91 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	48.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1006 - General Learning Space - 48.97 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	48.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1007 - General Learning Space - 49.17 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	49.17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1008 - General Learning Space - 49.11 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	49.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1009 - General Learning Space - 48.96 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	48.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1010 - Staff - Toilet - 15.96 m2</b>							
No Asbestos							
<b>B00D - R1011 - Music Store - 4.98 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1012 - General Storeroom - 3.53 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1013 - Study Space - 17.54 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	17.54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1014 - General Learning Space - 49.04 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	49.04m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1015 - Music Learning Space - 64.79 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	64.78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1016 - Movement - 14.59 m2</b>							
No Asbestos							

<b>B00D - R1017 - Movement - 13.91 m2</b>							
No Asbestos							
<b>B00D - R1018 - Movement - 13.69 m2</b>							
No Asbestos							
<b>B00E - Technological &amp; Applied Studies - 1958 - Concrete Framed</b>							
<b>Exterior</b>							
Ceiling Voids	Bituminous Membrane						
Eaves Linings	Flat AC Sheeting	45m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids	Flat AC Sheeting	300	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>Interior</b>							
<b>B00E - R0001 - Movement - 15.71 m2</b>							
No Asbestos							
<b>B00E - R0002 - Staff - Toilet - 3.88 m2</b>							
No Asbestos							
<b>B00E - R0003 - Security Store - 17.86 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00E - R0005 - Materials Technology L.S. - 77.71 m2</b>							
No Asbestos							
<b>B00E - R0006 - Materials Technology L.S. - 78.1 m2</b>							
No Asbestos							
<b>B00E - R0008 - Movement - 6.29 m2</b>							
No Asbestos							
<b>B00E - R0009 - Materials Technology L.S. - 69.8 m2</b>							
No Asbestos							
<b>B00E - R0010 - Welding Store - 9.95 m2</b>							
No Asbestos							
<b>B00E - R0011 - Welding Area - 12.61 m2</b>							
No Asbestos							
<b>B00E - R0012 - Materials Store - 11.04 m2</b>							
No Asbestos							
<b>B00E - R0013 - Resource/Project Store - 4.71 m2</b>							
No Asbestos							
<b>B00E - R0014 - Resource/Project Store - 4.86 m2</b>							
No Asbestos							
<b>B00E - R0015 - Materials Store - 10.91 m2</b>							
No Asbestos							
<b>B00E - R0016 - Dust Extraction Space - 8.66 m2</b>							
No Asbestos							
<b>B00E - R0017 - External Movement - 8.81 m2</b>							
No Asbestos							
<b>B00F - Administration - 1958 - Concrete Framed</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	50m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							

<b>B00F - R0001 - Administration - Clerical - 12.28 m2</b>							
No Asbestos							
<b>B00F - R0002 - Movement - 21.15 m2</b>							
No Asbestos							
<b>B00F - R0003 - Staff - Toilet - 5.77 m2</b>							
No Asbestos							
<b>B00F - R0005 - General Storeroom - 3.1 m2</b>							
No Asbestos							
<b>B00F - R0006 - Staff - Toilet - 9.68 m2</b>							
No Asbestos							
<b>B00F - R0009 - Principal Office - 18.65 m2</b>							
No Asbestos							
<b>B00F - R0010 - Staff - Toilet - 1.28 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	1.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Compressed AC Sheet						
<b>B00F - R0011 - Administration - Clerical - 12.22 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00F - R0012 - Public Entry - 26.99 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Wall Linings Internal	Flat AC Sheeting						
<b>B00F - R0013 - Cleaning Store - Distributed - 1.55 m2</b>							
No Asbestos							
<b>B00F - R0014 - General Storeroom - 6.07 m2</b>							
No Asbestos							
<b>B00F - R0015 - Security Store - 9.66 m2</b>							
No Asbestos							
<b>B00F - R0016 - Deputy Principal Office - 15.43 m2</b>							
No Asbestos							
<b>B00F - R0018 - Study Space - 8.36 m2</b>							
No Asbestos							
<b>B00F - R0019 - Leading Teacher - 9.48 m2</b>							
No Asbestos							
<b>B00F - R0020 - Clerical Office - 23.62 m2</b>							
No Asbestos							
<b>B00F - R0021 - Movement - 12.64 m2</b>							
No Asbestos							
<b>B00F - R0022 - External Movement - 2.19 m2</b>							
No Asbestos							
<b>B00F - R0023 - Movement - 24.61 m2</b>							
Require Inspection							
<b>B00G - Multi Purpose Facilities - 1965 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting						
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids	Flat AC Sheeting	400	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	Flat AC Sheeting						

<b>Interior</b>		
<b>B00G- M0001 - Gymnasium - 15.29 m2</b>		
No Asbestos		
<b>B00G- M0002 - Performing Arts Store - 15.04 m2</b>		
No Asbestos		
<b>B00G- R0001 - Pupil Entry - 11.98 m2</b>		
No Asbestos		
<b>B00G- R0002 - Gymnasium - 420.64 m2</b>		
No Asbestos		
<b>B00G- R0003 - Stage - 85.28 m2</b>		
No Asbestos		
<b>B00G- R0013 - Movement - 9.21 m2</b>		
Ceiling Structures/Linings	Flat AC Sheeting	
<b>B00G- R0014 - External Movement - 3.22 m2</b>		
No Asbestos		
<b>B00G- R0015 - External Movement - 3.19 m2</b>		
No Asbestos		
<b>B00G- R0016 - Uniform Shop - 20.8 m2</b>		
No Asbestos		
<b>B00G- R0017 - Chair Store - 38.18 m2</b>		
No Asbestos		
<b>B00G- R0018 - Cleaning Supplies Store - 8.32 m2</b>		
No Asbestos		
<b>B00G- R0019 - Change - 27.11 m2</b>		
No Asbestos		
<b>B00G- R0020 - Shower - 17.31 m2</b>		
No Asbestos		
<b>B00G- R0021 - Movement - 5.21 m2</b>		
No Asbestos		
<b>B00G- R0022 - Access Student Shower/Toilet/Change - 8.03 m2</b>		
No Asbestos		
<b>B00G- R0023 - Movement - 5.14 m2</b>		
No Asbestos		
<b>B00G- R0024 - Change - 17.02 m2</b>		
No Asbestos		
<b>B00G- R0025 - Change - 27.48 m2</b>		
No Asbestos		
<b>B00G- R0026 - Movement - 48.45 m2</b>		
No Asbestos		
<b>B00G- R0027 - Office/Store - 15.06 m2</b>		
No Asbestos		
<b>B00G- R0028 - Seminar - 32.79 m2</b>		
No Asbestos		
<b>B00G- R0029 - Distribution Board Cupboard - 1.94 m2</b>		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00G- R0030 - Movement - 2.78 m2</b>		
No Asbestos		
<b>B00G- R9001 - Chair Store - 26.28 m2</b>		
No Asbestos		
<b>B00G- R9002 - Chair Store - 26.28 m2</b>		

No Asbestos		
<b>B00G - R9003 - General Storeroom - 26.28 m2</b>		
No Asbestos		
<b>B00H - Library - 1993 - Brick/Block</b>		
<b>Exterior</b>		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00H - R0001 - Main Area - 400.85 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00H - R0002 - Seminar - 14.6 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00H - R0003 - Seminar - 14.7 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00H - R0004 - Seminar - 14.55 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00H - R0005 - Entry - 17.95 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00H - R0006 - Distribution Board Cupboard - .75 m2</b>		
		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00H - R0007 - Cleaning Store - Distributed - 2.38 m2</b>		
No Asbestos		
<b>B00H - R0008 - Staff - Toilet - 4.95 m2</b>		
No Asbestos		
<b>B00H - R0009 - Maintenance Bulk Store - .6 m2</b>		
No Asbestos		
<b>B00H - R0010 - Audio Visual Workroom - 26.61 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00H - R0011 - Workroom - 37.64 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00H - R0012 - Librarian - 11.31 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00H - R0013 - External Movement - 13.35 m2</b>		
No Asbestos		
<b>B00H - R0014 - External Movement - 10.96 m2</b>		
No Asbestos		
<b>B00I - Pupil Facilities - 1958 - Concrete</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	Non Accessible Area	
Ceiling Voids	Non Accessible Area	
Eaves Linings	Flat AC Sheeting	
<b>Interior</b>		
<b>B00I - R0001 - Toilets-Boys - 53.6 m2</b>		

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet						
<b>B00I - R0002 - General Assistants - 15.14 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet						
<b>B00K - Science/Art - 1965 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	Non Accessible Area						
<b>Interior</b>							
<b>B00K - R0001 - General Learning Space - 59.68 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00K - R0002 - Cleaning Store - Distributed - 5.19 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00K - R0003 - Distribution Board Cupboard - .56 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00K - R0004 - Staff - Toilet - 4.98 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00K - R0005 - Staff Study - 25.71 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00K - R0006 - Apparatus Store - 18.75 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00K - R0007 - General Storeroom - 6.14 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00K - R0008 - General Learning Space - 52.2 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00K - R0010 - Art Learning Space - 59.41 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00K - R0015 - Art Learning Space - 52.42 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00K - R0016 - Art Learning Space - 59.45 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00K - R0018 - Resources Store - 10.06 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						

<b>B00K - R0019 - Distribution Board Cupboard - .88 m2</b>		<b>Note: No inspection of live electrical installation</b>					
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00K - R0020 - General Learning Space - 58.24 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00K - R0022 - Preparation - 9.79 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00K - R0023 - Preparation - 28.41 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00K - R0028 - Chemical Store - 25.63 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00K - R0030 - Movement - 5.25 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00K - R0033 - Darkroom Space - 25.63 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00K - R0034 - Resources Store - 8.31 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00K - R0035 - Resources Store - 12.79 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00K - R0036 - Stairs - .62 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00K - R0037 - Stairs - .65 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00K - R0038 - Stairs - .66 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00K - R0039 - Movement - 320.74 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - ( X25 )						
<b>B00K - R0040 - General Storeroom - 19.67 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00K - R0041 - General Storeroom - 1.33 m2</b>							
No Asbestos							
<b>B00K - R0042 - Laboratory L.S. - 87.38 m2</b>							
No Asbestos							
<b>B00K - R0043 - Laboratory L.S. - 82.07 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00K - R0044 - Preparation - Science - 36.84 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						



<b>B00K - R0045 - Laboratory L.S. - 86.34 m2</b>		
No Asbestos		
<b>B00K - R1001 - General Learning Space - 59.54 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00K - R1002 - Cleaning Store - Distributed - 5.21 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00K - R1003 - Distribution Board Cupboard - .56 m2</b>		
<b>Note: No inspection of live electrical installation</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00K - R1004 - Staff - Toilet - 5.07 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00K - R1005 - Staff Study - 25.63 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00K - R1008 - General Learning Space - 52.21 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00K - R1009 - General Learning Space - 52.43 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00K - R1010 - General Learning Space - 45.33 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00K - R1011 - Study Space - 12.75 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00K - R1012 - Interview/Office - Type 1 - 12.78 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00K - R1013 - General Learning Space - 51.92 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00K - R1014 - General Storeroom - 6 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00K - R1015 - General Storeroom - 6.05 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00K - R1016 - General Learning Space - 52.13 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00K - R1017 - Distribution Board Cupboard - .88 m2</b>		
<b>Note: No inspection of live electrical installation</b>		
No Asbestos		
<b>B00K - R1018 - General Learning Space - 58.29 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00K - R1019 - Deputy Principal Office - 18.38 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00K - R1020 - General Storeroom - 6.66 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00K - R1021 - General Learning Space - 51.98 m2</b>		

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00K - R1023 - Staff - Toilet - 6.11 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00K - R1024 - General Storeroom - 6.14 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00K - R1025 - General Learning Space - 54.31 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00K - R1026 - General Learning Space - 51.91 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00K - R1027 - General Learning Space - 51.91 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00K - R1028 - General Storeroom - 6.09 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00K - R1029 - General Storeroom - 6.09 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00K - R1030 - General Learning Space - 52.35 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00K - R1031 - General Storeroom - 12.33 m2</b>		
No Asbestos		
<b>B00K - R1033 - Stairs - 6.93 m2</b>		
No Asbestos		
<b>B00K - R1034 - Stairs - 7 m2</b>		
No Asbestos		
<b>B00K - R1035 - Stairs - 16.07 m2</b>		
No Asbestos		
<b>B00K - R1036 - Movement - 301.29 m2</b>		
No Asbestos		
<b>B00K - R1037 - Staff Study - 25.63 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00K - R1038 - General Storeroom - 1.33 m2</b>		
No Asbestos		
<b>B00K - R1039 - General Storeroom - 1.34 m2</b>		
No Asbestos		
<b>B00K - R1040 - Staff Study - 34.36 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00L - Pupil Facilities - 1958 - Concrete</b>		
<b>Exterior</b>		
Eaves Linings	Flat AC Sheeting	
Ceiling Voids	Non Accessible Area	
Underfloor Voids - Slab on Ground	Non Accessible Area	
<b>Interior</b>		
<b>B00L - R0001 - Toilets-Girls - 64.56 m2</b>		

Ceiling Structures/Linings	Flat AC Sheeting	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00L - R0002 - Cleaning Store - Distributed - 4.38 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00M - Pupil Facilities/Art - 1965 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00M - R0001 - Toilets-Boys - 24.89 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet						
Furniture / Fixtures - Cistern	Fibre Cement Moulded	4	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00M - R0002 - Art Learning Space - 56.08 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00M - R0003 - Toilets-Girls - 24.43 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet						
Furniture / Fixtures - Cistern	Fibre Cement Moulded	4	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00M - R0004 - No Access - 5.34 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00M - R0005 - Movement - 45.99 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00M - R0006 - External Movement - 49.53 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00M - R0007 - Isolation Space - 2.97 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00N - Technological &amp; Applied Studies - 2005 - Steel</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00N - R0002 - Materials Store - 91.78 m2</b>							

No Asbestos		
<b>B00N - R0003 - Resource/Project Store - 17.21 m2</b>		
No Asbestos		
<b>B00O - Other - 2005 - Metal Shed</b>		
<b>Exterior</b>		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00O - R0001 - Machine Storage - 24.96 m2</b>		
No Asbestos		
<b>B00P - Physical Education/Pupil Facilities - 2005 - Brick/Block</b>		
<b>Exterior</b>		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00P - M0001 - Gymnasium - 172.73 m2</b>		
No Asbestos		
<b>B00P - M0002 - Plant - 2.7 m2</b>		
No Asbestos		
<b>B00P - M0003 - Stairs - 3.76 m2</b>		
No Asbestos		
<b>B00P - M0004 - Stairs - 3.84 m2</b>		
No Asbestos		
<b>B00P - R0001 - Gymnasium - 1208.27 m2</b>		
No Asbestos		
<b>B00P - R0002 - Stairs - 1.3 m2</b>		
No Asbestos		
<b>B00P - R0003 - General Storeroom - 3.84 m2</b>		
No Asbestos		
<b>B00P - R0004 - Staff Study - 27.54 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00P - R0005 - P.E. Store - 15.86 m2</b>		
No Asbestos		
<b>B00P - R0006 - Shower/Change - 31.33 m2</b>		
No Asbestos		
<b>B00P - R0007 - Movement - 5.17 m2</b>		
No Asbestos		
<b>B00P - R0008 - Toilets - Girls - 17.08 m2</b>		
No Asbestos		
<b>B00P - R0009 - Movement - 3.65 m2</b>		
No Asbestos		
<b>B00P - R0010 - Stairs - 4.59 m2</b>		
No Asbestos		
<b>B00P - R0011 - Cleaning Distributed Store - 1.93 m2</b>		
No Asbestos		
<b>B00P - R0012 - Toilets - Boys - 17.06 m2</b>		
No Asbestos		
<b>B00P - R0013 - Movement - 5.24 m2</b>		
No Asbestos		
<b>B00P - R0014 - Shower/Change - 31.4 m2</b>		

No Asbestos	
<b>B00P - R0015 - Movement - 4.47 m2</b>	
No Asbestos	
<b>B00P - R0016 - Distribution Board Cupboard - .8 m2</b>	<b>Note: No inspection of live electrical installation</b>
No Asbestos	
<b>B00P - R0017 - Disabled Shower/Toilet - 5.64 m2</b>	
No Asbestos	
<b>B00P - R0018 - Staff Kitchen - 15.57 m2</b>	
No Asbestos	
<b>B00P - R0019 - Movement - 16.38 m2</b>	
No Asbestos	
<b>B00P - R0020 - External Movement - 8.71 m2</b>	
No Asbestos	
<b>B00Q - Technological &amp; Applied Studies - 2012 - Steel</b>	
<b>Exterior</b>	
No Asbestos	
<b>Interior</b>	
<b>B00Q - R0001 - External Movement - 5.42 m2</b>	
No Asbestos	
<b>B00Q - R0002 - Metal Technology Bay - 84.29 m2</b>	
No Asbestos	
<b>B00Q - R0003 - Welding Area - 4.31 m2</b>	
No Asbestos	
<b>B00Q - R0004 - Welding Area - 4.37 m2</b>	
No Asbestos	
<b>B00Q - R0005 - Welding Area - 4.22 m2</b>	
No Asbestos	
<b>B00Q - R0006 - Metal Technology Bay - 109.8 m2</b>	
No Asbestos	
<b>B00Q - R0007 - Store - 11.42 m2</b>	
No Asbestos	
<b>B00Q - R0008 - Store - 22.42 m2</b>	
No Asbestos	
<b>B00R - Technological &amp; Applied Studies - 2010 - Steel</b>	
<b>Exterior</b>	
Ceiling Voids - Raked Ceiling	Non Accessible Area
<b>Interior</b>	
<b>B00R - R0001 - Workshop Area - 135.62 m2</b>	
No Asbestos	
<b>B00S - Storage - 2019 - Metal Shed</b>	
<b>Exterior</b>	
Require Inspection	
<b>Interior</b>	
<b>B00S - R0001 - Bulk Store - 87.83 m2</b>	
Require Inspection	

## Demountables

OS 770 13294 - Technics - Metalwork/Heat Area/Store - Placement Date : 30-JUN-1995

### Exterior

Eaves Linings	Flat AC Sheeting	17.28m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

### Interior

#### R1- Entry

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Assumed Asbestos

#### R2- Materials Technology L.S.

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	91m2	Assumed Asbestos