


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Jasper Road Public School (4382)
Region:	Western Sydney AMU
State Electorate:	Baulkham Hills
Local Government Area:	The Hills

Last Reviewed By:	Greencap 22-JUN-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

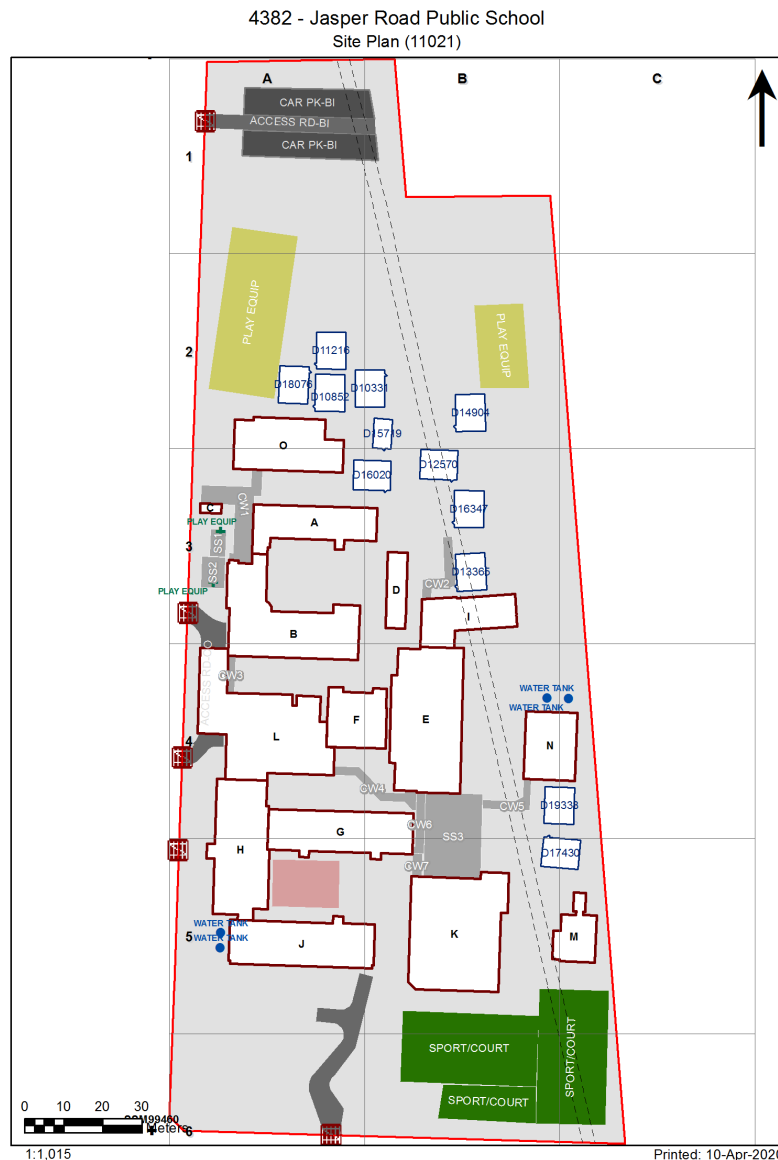

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - General Learning - 1966 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)
Window	Mastic						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Non Accessible Area						
Interior							
B00A - R0001 - Home Base - 56.57 m2							
No Asbestos							
B00A - R0002 - Home Base Store - 3.13 m2							
No Asbestos							
B00A - R0003 - Personal Effects Storage - 6.34 m2							
No Asbestos							
B00A - R0004 - Movement - 7.72 m2							
No Asbestos							
B00A - R0005 - Movement - 4.63 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0006 - Personal Effects Storage - 6.37 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Manhole cover	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
B00A - R0007 - Home Base Store - 3.15 m2							
No Asbestos							
B00A - R0008 - Home Base - 56.4 m2							
No Asbestos							
B00A - R0009 - Home Base - 84.86 m2							
No Asbestos							
B00A - R0010 - Toilets - Boys/Girls - 4.31 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00A - R0011 - Home Base Store - 3.19 m2							
No Asbestos							
B00A - R0012 - Personal Effects Storage - 6.33 m2							
Electrical - Mounting Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0013 - Movement - 3.75 m2							
No Asbestos							
B00A - R0014 - Movement - 10.09 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	2	Northern side of eastern section adjacent ceiling.	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)
B00A - R9001 - Sports Store - 26.26 m2							
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R9002 - General Storeroom - 26.05 m2							

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - Support Unit - 1975 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	80m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	40m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids	AC Fragments/Debris - Flat AC Sheet	200	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Window	Mastic						
Interior							
B00B - R0001 - Movement - 32.22 m2							
Eaves Linings	Flat AC Sheeting	6	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00B - R0002 - Movement - 4.31 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	1m2	North upper portion & west above door	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00B - R0003 - Therapy - 71.31 m2							
No Asbestos							
B00B - R0004 - Practical Activities - P - 1hb - 7.88 m2							
No Asbestos							
B00B - R0005 - Home Base Store - P - 5.75 m2							
No Asbestos							
B00B - R0006 - Home Base - P - 56.62 m2							
No Asbestos							
B00B - R0007 - Toilet - P - 24.14 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0008 - Laundry - P - 6.69 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0009 - Toilet - P - 24.01 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0010 - Community Clinic - 20.97 m2							
No Asbestos							
B00B - R0011 - Wheelchair Store - 10.84 m2							
Electrical - Mounting Board	Resinous Membrane	1	North-west	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00B - R0012 - Speech Therapy - 9.53 m2							
No Asbestos							
B00B - R0013 - Movement - 18.96 m2							
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0014 - Personal Effects - P - 1.95 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0015 - Main Switch Board - 1.28 m2							

Ceiling Structures/Linings	Flat AC Sheeting	1.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Electrical - Mounting Board	Resinous Membrane	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00B - R0016 - Movement - 82.42 m2							
Wall Linings Internal	Flat AC Sheeting	6m2	West upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Western end southern side.	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00B - R0017 - Movement - 3.16 m2							
No Asbestos							
B00B - R0018 - Practical Activities - P - 1hb - 12.43 m2							
No Asbestos							
B00B - R0019 - Home Base - P - 56.84 m2							
No Asbestos							
B00B - R0020 - Home Base Store - P - 6.15 m2							
No Asbestos							
B00B - R0021 - Movement - 1.43 m2							
No Asbestos							
B00B - R0022 - Movement - 26.01 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0023 - Distribution Board - .6 m2						Note: No inspection of live electrical installation	
Wall Linings Internal	Flat AC Sheeting	5m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Mounting Board	Resinous Membrane	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	0.6m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos), Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R0024 - Distribution Board - .6 m2						Note: No inspection of live electrical installation	
Wall Linings Internal	Flat AC Sheeting	2m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	0.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R9001 - Wheelchair Store - 29.73 m2							
No Asbestos							
B00B - R9002 - General Storeroom - 26.44 m2							
Floor Coverings Res/Textile	Vinyl Tiles	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R9003 - Craft Store - 26.16 m2							
Floor Coverings Res/Textile	Vinyl Tiles	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						

B00C - Administration - 1967 - Metal Shed**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	

Interior**B00C - R0001 - General Storeroom - 11.67 m2**

No Asbestos

B00D - Pupil Facilities - 1967 - Brick/Block**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						

Interior**B00D - R0001 - Toilets - Boys - 29.35 m2**

Partition Walls (Cubides)	Compressed AC Sheet	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
---------------------------	---------------------	------	--------------------	--------------------	---------	--------------------	-----------------------------

B00D - R0002 - Cleaning Distributed Store - 1.68 m2

No Asbestos

B00D - R0003 - Drinking Facilities - 13.46 m2

No Asbestos

B00D - R0004 - Toilets - Girls - 36.33 m2

Partition Walls (Cubides)	Compressed AC Sheet	25m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
---------------------------	---------------------	------	--------------------	--------------------	---------	--------------------	-----------------------------

B00D - R0005 - Cleaning Distributed Store - 1.49 m2

No Asbestos

B00E - General Learning/Pupil Facilities - 1966 - Brick/Block**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)
Gable Verge Lining	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						

Interior**B00E - R0001 - Home Base - 85.65 m2**

Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	85.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						

B00E - R0002 - Practical Activities - 1hb - 14.61 m2

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
----------------------------	---	--

Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00E - R0003 - Toilets - Boys/Girls - 3.24 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0004 - Practical Activities - 1hb - 14.8 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00E - R0005 - Toilets - Boys/Girls - 3.24 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0006 - Home Base - 85.92 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	85.89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
B00E - R0007 - Home Base - 52.02 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51.99m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0008 - Practical Activities - 1hb - 21.68 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00E - R0009 - General Storeroom - 6.97 m2							
No Asbestos							
B00E - R0010 - General Storeroom - 6.91 m2							
No Asbestos							
B00E - R0011 - Cleaning Distributed Store - .65 m2							
No Asbestos							
B00E - R0012 - Toilets - Boys - 11.07 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0013 - Security Store - 10.88 m2							
No Asbestos							
B00E - R0014 - Movement - 74.71 m2							
Wall Linings Internal - Infill	Compressed AC Sheet	1m2	NW at former entry to ER0017	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0015 - Security Store - 10.88 m2							
Wall Linings Internal - Infill	Compressed AC Sheet	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00E - R0016 - Distribution Board - .61 m2						Note: No inspection of live electrical installation	
Electrical - Mounting Board	Resinous Membrane	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00E - R0017 - Disabled Toilet - 11.76 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0018 - Stairs - 4.98 m2							
No Asbestos							
B00E - R0019 - Stairs - 4.98 m2							
No Asbestos							
B00E - R0020 - Covered Outdoor Learning Area - 157.63 m2							
No Asbestos							
B00E - R1001 - Home Base - 59.55 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
B00E - R1002 - Practical Activities - 1hb - 13.33 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
B00E - R1003 - Practical Activities - 1hb - 13.33 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
B00E - R1004 - Home Base - 60.36 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
B00E - R1005 - Home Base - 60.11 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
B00E - R1006 - Practical Activities - 1hb - 13.41 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
B00E - R1007 - Practical Activities - 1hb - 13.43 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
B00E - R1008 - Home Base - 60.19 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive							
B00E - R1009 - Cleaning Distributed Store - .63 m2								
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R1010 - Disabled Toilet - 11.98 m2								
No Asbestos								
B00E - R1011 - Movement - 82.38 m2								
Ceiling Structures/Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R1012 - Distribution Board - .63 m2						Note: No inspection of live electrical installation		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Electrical - Mounting Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00E - R1013 - Toilets - Girls - 12.58 m2								
No Asbestos								
B00E - R1014 - Movement - 6.88 m2								
No Asbestos								
B00E - R1015 - Stairs - 4.98 m2								
No Asbestos								
B00E - R1016 - Stairs - 15.28 m2								
No Asbestos								
B00F - General Learning - 1967 - Brick/Veneer								
Exterior								
Eaves Linings	Flat AC Sheeting	25m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Voids	Non Accessible Area							
Underfloor Voids	No Asbestos Found							
Interior								
B00F - R0001 - Movement - 16.17 m2								
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Wall Linings Internal - Infill	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Wall Linings Internal - Infill	Mastic							
B00F - R0002 - Practical Activities - 1hb - 26.1 m2								
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
B00F - R0003 - Home Base - 56.6 m2								
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
B00F - R0004 - Movement - 27.44 m2								
Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00F - R0006 - Home Base - 56.2 m2								
Floor Coverings Res/Textile	Vinyl Sheet							

Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
B00F - R0007 - Movement - 17.58 m2							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Mastic						
B00F - R9001 - Uniform Shop - 28.61 m2							
Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - General Learning/Support Unit - 1966 - Brick/Block							
Exterior							
Wall Linings Internal - Infill	Compressed AC Sheet	14	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Mastic						
Eaves Linings	Flat AC Sheeting	50m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Gable Verge Lining	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00G - R0001 - Home Base - 47.84 m2							
No Asbestos							
B00G - R0002 - Practical Activities - 1hb - 12.21 m2							
No Asbestos							
B00G - R0003 - Home Base Store - 5.56 m2							
No Asbestos							
B00G - R0004 - Home Base Store - 5.53 m2							
No Asbestos							
B00G - R0005 - Practical Activities - 1hb - 13.01 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00G - R0006 - Home Base - 56.61 m2							
No Asbestos							
B00G - R0007 - Home Base - P - 44.33 m2							
No Asbestos							
B00G - R0008 - Practical Activities - P - 1hb - 12.48 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00G - R0009 - Home Base Store - P - 5.64 m2							
No Asbestos							
B00G - R0010 - Toilet - P - 13.01 m2							
Wall Linings Internal	Flat AC Sheeting						
B00G - R0011 - Home Base Store - 5.62 m2							

Electrical - Mounting Board	Resinous Membrane	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00G- R0012 - Practical Activities - 1hb - 11.76 m2							
No Asbestos							
B00G- R0013 - Home Base - 44.95 m2							
Furniture / Fixtures - Safe / Vault	Insulation Material	1	Southwest corner	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00G- R0014 - Movement - 74.78 m2							
Ceiling Structures/Linings	Flat AC Sheeting	75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Compressed AC Sheet	18m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Mastic						
B00G- R9001 - Cleaning Supplies - 11.6 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11.59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G- R9002 - Toilets - Boys - 36.46 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G- R9003 - Movement - 23.85 m2							
No Asbestos							
B00G- R9004 - Toilets - Girls - 36.72 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G- R9005 - Sports Store - 11.39 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - Administration/Staff Facilities - 1966 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	60m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Gable Verge Lining	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Wall Linings Internal - Infill	Compressed AC Sheet	6	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Mastic						
External Roof Structure - Infill	Flat AC Sheeting	10	North above HR0032	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00H- R0001 - Community Clinic - 5.29 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00H- R0002 - Community Clinic - 15.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						

Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
B00H - R0003 - Staff Toilet - 1.96 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00H - R0004 - Security Store - 19 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
B00H - R0005 - General Storeroom - 4.79 m2								
No Asbestos								
B00H - R0006 - General Storeroom - 2.76 m2								
Floor Coverings Res/Textile	Vinyl Tiles	2.76m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00H - R0007 - Sick Bay - 7.65 m2								
No Asbestos								
B00H - R0008 - Staff Toilet - 3.78 m2								
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00H - R0009 - Cleaning Distributed Store - 3.59 m2								
Floor Coverings Res/Textile	Vinyl Tiles	3.59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive							
B00H - R0010 - Staff Toilet - 3.67 m2								
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00H - R0011 - Deputy Principal - 13.21 m2								
No Asbestos								
B00H - R0012 - Movement - 4.07 m2								
No Asbestos								
B00H - R0013 - Interview - 13.01 m2								
No Asbestos								
B00H - R0014 - General Storeroom - 6.99 m2								
No Asbestos								
B00H - R0015 - Staff Room Annexe - 9.59 m2								
No Asbestos								
B00H - R0016 - Principal - 21.18 m2								
No Asbestos								
B00H - R0017 - Distribution Board - .62 m2						Note: No inspection of live electrical installation		
Wall Linings Internal	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Electrical - Mounting Board	Resinous Membrane	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00H - R0018 - Staff Room Annexe - 13.69 m2								
No Asbestos								

B00H - R0019 - Plant - .8 m2							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00H - R0020 - Entry Vestibule - 11.52 m2							
No Asbestos							
B00H - R0021 - Movement - 9.26 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)
Wall Linings Internal - Infill	Compressed AC Sheet	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Mastic						
B00H - R0022 - Clerical Office - 14.97 m2							
No Asbestos							
B00H - R0023 - Duplicating Workroom - 35.55 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
B00H - R0024 - Staff Room Annexe - 15.59 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00H - R0025 - Movement - .74 m2							
No Asbestos							
B00H - R0026 - Movement - 3.74 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00H - R0027 - Movement - 7.25 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00H - R0028 - Movement - 23.73 m2							
No Asbestos							
B00H - R0029 - Movement - 44.61 m2							
Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Compressed AC Sheet	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Mastic						
B00H - R0031 - Stairs - 4.34 m2							
No Asbestos							
B00H - R0032 - Movement - 102.84 m2							
Ceiling Structures/Linings	Flat AC Sheeting	103m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	6m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R1001 - Staff Room - 68.31 m2							
No Asbestos							
B00H - R1002 - Staff Kitchen - 10.76 m2							
Floor Coverings Res/Textile	Vinyl Sheet						

Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
B00H - R1003 - Staff Toilet - 3.93 m2								
No Asbestos								
B00H - R1004 - Staff Toilet - 5.47 m2								
No Asbestos								
B00H - R1005 - Movement - 3.34 m2								
No Asbestos								
B00H - R1006 - Movement - 4.11 m2								
No Asbestos								
B00H - R1007 - Stairs - 4.34 m2								
No Asbestos								
B00I - General Learning - 1967 - Timber								
Exterior								
Wall Cladding	Flat AC Sheeting							
Ceiling Voids	No Asbestos Found							
Underfloor Voids	AC Fragments/Debris - Flat AC Sheet	0.01	East	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Assumed Asbestos	
Electrical - Backing Board	Resinous Board	1	North	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Assumed Asbestos	
Electrical - Backing Board	Resinous Membrane	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
Interior								
B00I - R0001 - Movement - 23.6 m2								
Wall Linings Internal	Flat AC Sheeting							
Floor Coverings Res/Textile	Compressed AC Sheet							
B00I - R0004 - Covered Outdoor Learning Area - 112.81 m2								
Wall Linings Internal	Flat AC Sheeting							
B00I - R0005 - Home Base - 94.5 m2								
Require Inspection								
B00J - General Learning/Building Services - 1966 - Brick/Block								
Exterior								
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)	
Underfloor Voids	No Asbestos Found							
Ceiling Voids	No Asbestos Found							
Interior								
B00J - R0001 - Home Base - 56.97 m2								
No Asbestos								
B00J - R0002 - Home Base Store - 5.94 m2								
No Asbestos								
B00J - R0003 - Personal Effects Storage - 15.22 m2								
No Asbestos								
B00J - R0004 - Home Base Store - 5.94 m2								
No Asbestos								
B00J - R0005 - Home Base - 56.82 m2								
No Asbestos								
B00J - R0006 - Home Base - 56.98 m2								
No Asbestos								

B00J - R0007 - Home Base Store - 5.94 m2							
No Asbestos							
B00J - R0008 - Personal Effects Storage - 15.31 m2							
Electrical - Mounting Board	Resinous Membrane	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00J - R0009 - Home Base Store - 5.94 m2							
No Asbestos							
B00J - R0010 - Home Base - 57.23 m2							
No Asbestos							
B00J - R0011 - Movement - 71.19 m2							
Ceiling Structures/Linings	Flat AC Sheeting	72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting						
B00J - R0012 - Covered Outdoor Learning Area - 28 m2							
Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting						
B00J - R9001 - General Storeroom - 37.22 m2							
Ceiling Structures/Linings	Flat AC Sheeting	37.21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	37.21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	37.21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - R9002 - General Assistant/Bulk Store - 37.85 m2							
Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	37.83m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
B00J - R9003 - General Assistant/Bulk Store - 7.69 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive	7.69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7.69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - Communal Facilities/Pupil Facilities - 1980 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00K - R0001 - P.E Store - 19.77 m2							
No Asbestos							
B00K - R0002 - Hall Chair Store - 10.96 m2							
No Asbestos							
B00K - R0004 - Garden Store - 17.35 m2							
No Asbestos							

B00K - R0005 - Communal Space - 201.35 m2							
No Asbestos							
B00K - R0006 - Raised Platform - 46.32 m2							
No Asbestos							
B00K - R0007 - Toilets - Girls - 11.74 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00K - R0008 - Cleaning Distributed Store - 3.46 m2							
No Asbestos							
B00K - R0009 - Toilets - Boys - 13.89 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00K - R0010 - Distribution Board - 1.1 m2							
							Note: No inspection of live electrical installation
Electrical - Mounting Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	0.5	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00K - R0011 - Movement - 33.24 m2							
No Asbestos							
B00K - R0012 - Canteen - 43.29 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
B00K - R0013 - Canteen Office/Store - 5.74 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
B00K - R0014 - Staff Toilet - 3.3 m2							
No Asbestos							
B00K - R0015 - Canteen Office/Store - 2.57 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
B00K - R0018 - Movement - 26.27 m2							
Eaves Linings	Flat AC Sheeting	12	South & west	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)
B00K - R0019 - Movement - 178.1 m2							
Ceiling Structures/Linings	Flat AC Sheeting	150m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - Library - 1967 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00L - R0003 - Seminar/Study - 15.59 m2							
No Asbestos							

B00L - R0004 - Seminar/Study - 15.47 m2							
No Asbestos							
B00L - R0005 - Toilets - Boys - 3.66 m2							
No Asbestos							
B00L - R0006 - General Storeroom - 1.61 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
B00L - R0007 - Movement - 9.82 m2							
No Asbestos							
B00L - R0008 - Distribution Board - .77 m2						Note: No inspection of live electrical installation	
Electrical - Mounting Board	Resinous Membrane	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00L - R0009 - Toilets - Girls - 3.56 m2							
No Asbestos							
B00L - R0010 - Cleaning Distributed Store - 1.61 m2							
No Asbestos							
B00L - R0011 - Communications Room - 13.54 m2							
No Asbestos							
B00L - R0012 - Library Office/Workroom - 8.34 m2							
No Asbestos							
B00L - R0013 - Library Office/Workroom - 19.93 m2							
No Asbestos							
B00L - R0016 - Movement - 93.8 m2							
Ceiling Structures/Linings	Flat AC Sheeting	94m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R0017 - Covered Vehicle Area/Porte Cochere - 173.69 m2							
Ceiling Structures/Linings	Flat AC Sheeting	173.61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)
B00L - R0018 - Reading Area - 259.85 m2							
No Asbestos							
B00L - R0019 - Special Programs Room - 37.11 m2							
No Asbestos							
B00M - Other-Community Use - 1967 - Steel							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00M - R0005 - Staff Kitchen - 5.16 m2							
No Asbestos							
B00M - R0006 - Disabled Toilet - 4.52 m2							
No Asbestos							
B00M - R0007 - Other-After School Care - 95.6 m2							
No Asbestos							
B00M - R0008 - Home Base Store - 14.81 m2							
No Asbestos							
B00M - R0009 - Movement - 12.12 m2							
No Asbestos							
B00N - General Learning - 2006 - Fibre Cement Clad							
Exterior							

Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00N - R0001 - Movement - 38.49 m2		
No Asbestos		
B00N - R0002 - Practical Activities - 1hb - 19.4 m2		
No Asbestos		
B00N - R0003 - Home Base Store - 6.02 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0004 - Home Base - 59.22 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0005 - Withdrawal Space - 2hb - 11.36 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0006 - Home Base - 59.21 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0007 - Home Base Store - 6.02 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00N - R0008 - Practical Activities - 1hb - 19.42 m2		
No Asbestos		
B00O - General Learning - 2010 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Interior		
B00O - R0001 - Movement - 3.55 m2		
No Asbestos		
B00O - R0002 - Special Programs Room - 26.08 m2		
No Asbestos		
B00O - R0003 - Practical Activities - S - 1hb - 5.16 m2		
No Asbestos		
B00O - R0004 - General Storeroom - 6.75 m2		
No Asbestos		
B00O - R0005 - Home Base - 60.13 m2		
No Asbestos		
B00O - R0006 - Home Base Store - 6.18 m2		
No Asbestos		
B00O - R0007 - Practical Activities - 1hb - 18.78 m2		
No Asbestos		
B00O - R0008 - Withdrawal Space - 2hb - 11.58 m2		
No Asbestos		
B00O - R0009 - Home Base - 59.9 m2		
No Asbestos		
B00O - R0010 - Home Base Store - 6.18 m2		
No Asbestos		
B00O - R0011 - Practical Activities - 1hb - 18.06 m2		
No Asbestos		
B00O - R0012 - General Storeroom - 16.77 m2		

No Asbestos	
B000 - R0013 - External Movement - 68.4 m2	
No Asbestos	
B000 - R0014 - Main Switch Board - .6 m2	
No Asbestos	
B000 - R0015 - External Movement - 6.43 m2	
No Asbestos	
B000 - R1001 - Home Base - 60.06 m2	
No Asbestos	
B000 - R1002 - Home Base Store - 6.18 m2	
No Asbestos	
B000 - R1003 - Practical Activities - 1hb - 18.71 m2	
No Asbestos	
B000 - R1004 - Withdrawal - M - 11.58 m2	
No Asbestos	
B000 - R1005 - Home Base - 59.87 m2	
No Asbestos	
B000 - R1006 - Home Base Store - 6.18 m2	
No Asbestos	
B000 - R1007 - Practical Activities - 1hb - 18.07 m2	
No Asbestos	
B000 - R1008 - External Movement - 53.12 m2	
No Asbestos	
B000 - R1009 - Main Switch Board - .65 m2	
No Asbestos	
B000 - R1010 - External Movement - 27.74 m2	
No Asbestos	

Demountables

OS 602 10331 - Learning Unit - Standard With P.A.A. - Placement Date : 09-SEP-2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 10852 - Learning Unit - Standard With P.A.A. - Placement Date : 30-OCT-2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 11216 - Learning Unit - Standard With P.A.A. - Placement Date : 30-OCT-2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 12570 - Learning Unit - Standard With P.A.A. - Placement Date : 30-OCT-2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 13365 - Learning Unit - Standard With P.A.A. - Placement Date : 15-AUG-2007

No Asbestos Found

OS 603 14904 - Learning Unit - Standard With P.A.A. A/C - Placement Date : 15-JAN-2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 750 15719 - Learning Unit - ESL - Placement Date : 30-OCT-2015

No Asbestos Found

OS 602 16020 - Learning Unit - Standard With P.A.A. - Placement Date : 24-OCT-2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 16347 - Learning Unit - Standard With P.A.A. - Placement Date : 29-MAR-2008

Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- Learning space/withdrawal/entry

Ceiling Structures/Linings	Flat AC Sheeting	70m2	Assumed Asbestos
----------------------------	------------------	------	------------------

R2- Home Base Store

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Assumed Asbestos

OS 602 17430 - Learning Unit - Standard With P.A.A. - Placement Date : 17-FEB-2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 18076 - Learning Unit - Standard With P.A.A. - Placement Date : 30-OCT-2017

No Asbestos Found

OS 606 19338 - Learning Unit - Standard With P.A.A A/C - Placement Date : 19-JUN-2018

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found