


# Asbestos Register

(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>John Warby Public School (4479)</b>
<b>Region:</b>	<b>South Western Sydney AMU</b>
<b>State Electorate:</b>	<b>Campbelltown</b>
<b>Local Government Area:</b>	<b>Campbelltown</b>

Last Reviewed By:	WSP 13-OCT-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	<b>Yes</b>
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

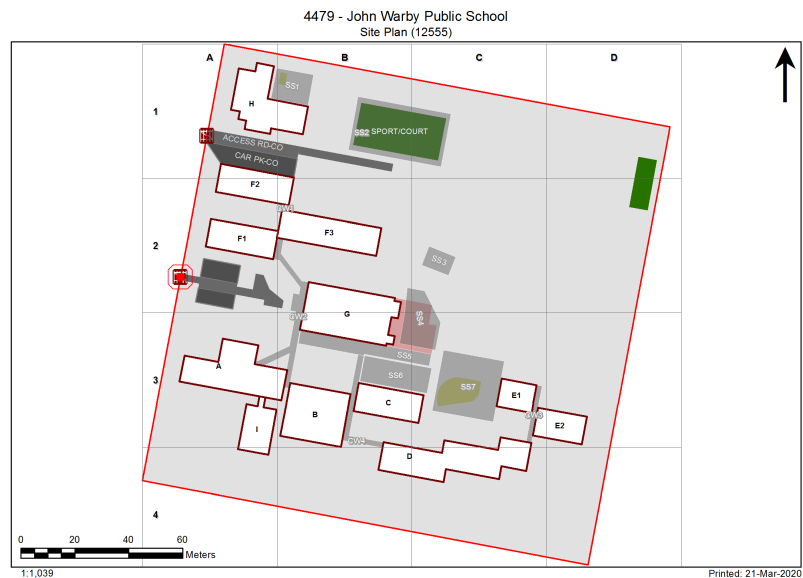

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - Administration - 1975 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00A - R0002 - Sick Bay - 10.71 m2</b>							
No Asbestos							
<b>B00A - R0003 - Staff Toilet - 9.18 m2</b>							
Partition Walls (Cubides)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0004 - Cleaning Distributed Store - 2.47 m2</b>							
No Asbestos							
<b>B00A - R0005 - Staff Toilet - 9.14 m2</b>							
Partition Walls (Cubides)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0006 - Uniform Shop - 3.75 m2</b>							
No Asbestos							
<b>B00A - R0007 - Principal - 18.61 m2</b>							
No Asbestos							
<b>B00A - R0008 - Clerical Office - 12.32 m2</b>							
No Asbestos							
<b>B00A - R0009 - Entry Vestibule - 16.27 m2</b>							
No Asbestos							
<b>B00A - R0010 - Duplicating Workroom - 12.71 m2</b>							
No Asbestos							
<b>B00A - R0011 - Interview - 12.68 m2</b>							
No Asbestos							
<b>B00A - R0012 - Community Clinic - 17.21 m2</b>							
No Asbestos							
<b>B00A - R0013 - Staff Room Annexe - 14.33 m2</b>							
No Asbestos							
<b>B00A - R0014 - Staff Room Annexe - 13.14 m2</b>							
No Asbestos							
<b>B00A - R0015 - Security Store - 11.99 m2</b>							
No Asbestos							
<b>B00A - R0016 - Movement - 16.59 m2</b>							
No Asbestos							
<b>B00A - R0017 - Movement - 1.35 m2</b>							
No Asbestos							
<b>B00A - R0018 - Movement - 18.83 m2</b>							
No Asbestos							
<b>B00A - R0019 - Movement - 39.69 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00A - R0020 - Main Switch Board - 11.52 m2</b>							
Electrical - Mounting Board	Resinous Board	2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0021 - Dental Clinic - 13.91 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0022 - Dental Clinic - 6.13 m2</b>							
No Asbestos							
<b>B00A - R0023 - Dental Clinic - 10.07 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0024 - Dental Clinic - 9.85 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0025 - Dental Clinic - 9.63 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0026 - Dental Clinic - 9.63 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0027 - Dental Clinic - 4.79 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0028 - Dental Clinic - 9.99 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0029 - Dental Clinic - 2.44 m2</b>							
No Asbestos							
<b>B00A - R0030 - Dental Clinic - 2.1 m2</b>							
No Asbestos							
<b>B00A - R0031 - Movement - 53.98 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00A - R0032 - Interview - 12.69 m2</b>							
No Asbestos							
<b>B00A - R0033 - Staff Kitchen - 22.24 m2</b>							
No Asbestos							
<b>B00A - R0034 - Movement - 10.86 m2</b>							
No Asbestos							
<b>B00A - R0035 - Principal - 21.13 m2</b>							
No Asbestos							
<b>B00B - Library - 1975 - Brick/Block</b>							
<b>Exterior</b>							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00B - R0001 - Entry Vestibule - 13.74 m2</b>							
No Asbestos							
<b>B00B - R0002 - Toilets - Boys - 3.4 m2</b>							
No Asbestos							
<b>B00B - R0003 - Cleaning Distributed Store - 1.73 m2</b>							
No Asbestos							
<b>B00B - R0004 - Distribution Board - 1.73 m2</b>							
<b>Note: No inspection of live electrical installation</b>							

No Asbestos							
<b>B00B - R0005 - Toilets - Girls - 3.41 m2</b>							
No Asbestos							
<b>B00B - R0006 - Library Office/Workroom - 10.4 m2</b>							
No Asbestos							
<b>B00B - R0007 - Library Office/Workroom - 25.56 m2</b>							
No Asbestos							
<b>B00B - R0008 - Security Store - 20.37 m2</b>							
No Asbestos							
<b>B00B - R0009 - K.L.A. Store - 16.06 m2</b>							
No Asbestos							
<b>B00B - R0010 - K.L.A. Store - 16.06 m2</b>							
No Asbestos							
<b>B00B - R0011 - Reading Area - 255.74 m2</b>							
No Asbestos							
<b>B00B - R0012 - Movement - 40.67 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - General Learning - 1975 - Brick/Block</b>							
<b>Exterior</b>							
Gable Verge Lining	Flat AC Sheeting	25m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00C - R0001 - Toilets - Boys/Girls - 3.13 m2</b>							
No Asbestos							
<b>B00C - R0002 - Practical Activities - 1hb - 9.91 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0003 - Home Base - 78.63 m2</b>							
No Asbestos							
<b>B00C - R0004 - Home Base - 78.63 m2</b>							
No Asbestos							
<b>B00C - R0005 - Practical Activities - 1hb - 9.91 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0006 - Toilets - Boys/Girls - 3.13 m2</b>							
No Asbestos							
<b>B00C - R0007 - Movement - 43.34 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - General Learning - 1975 - Brick/Block</b>							
<b>Exterior</b>							
Gable Verge Lining	Flat AC Sheeting	46m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						

<b>Interior</b>							
<b>B00D - R0001 - Staff Room Annexe - 8.31 m2</b>							
No Asbestos							
<b>B00D - R0002 - Practical Activities - 1hb - 17.94 m2</b>							
No Asbestos							
<b>B00D - R0003 - Home Base - 50.15 m2</b>							
No Asbestos							
<b>B00D - R0004 - Home Base - 78.77 m2</b>							
No Asbestos							
<b>B00D - R0005 - Practical Activities - 1hb - 9.97 m2</b>							
No Asbestos							
<b>B00D - R0006 - Toilets - Boys/Girls - 3.16 m2</b>							
No Asbestos							
<b>B00D - R0007 - Cleaning Distributed Store - 3.07 m2</b>							
No Asbestos							
<b>B00D - R0008 - Toilets - Girls - 30.71 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0009 - General Storeroom - 11.52 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0010 - Garden Store - 14.22 m2</b>							
No Asbestos							
<b>B00D - R0011 - Drinking Facilities - 7.52 m2</b>							
No Asbestos							
<b>B00D - R0012 - Toilets - Boys - 26.82 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0013 - Home Base - 50.7 m2</b>							
No Asbestos							
<b>B00D - R0014 - Practical Activities - 1hb - 17.94 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0015 - Home Base - 46.02 m2</b>							
No Asbestos							
<b>B00D - R0016 - Practical Activities - 1hb - 17.94 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0020 - External Movement - 119.36 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00G - Communal Facilities - 1975 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	Flat AC Sheeting						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00G - R0001 - Distribution Board - .68 m2</b>						<b>Note: No inspection of live electrical installation</b>	
Electrical - Mounting Board	Resinous Board	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

<b>B00G- R0002 - Garden Store - 17.07 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00G- R0003 - Movement - 11.63 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R0004 - Movement - 3.2 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R0005 - Canteen Office/Store - 7.14 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R0006 - Staff Toilet - 1.86 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R0007 - Movement - 3.09 m2</b>							
No Asbestos							
<b>B00G- R0008 - Security Store - 4.66 m2</b>							
No Asbestos							
<b>B00G- R0009 - Canteen - 45.74 m2</b>							
No Asbestos							
<b>B00G- R0010 - Movement - 60.01 m2</b>							
No Asbestos							
<b>B00G- R0011 - Toilets - Girls - 13.48 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R0012 - General Storeroom - 12.96 m2</b>							
No Asbestos							
<b>B00G- R0013 - Cleaning Distributed Store - 1.07 m2</b>							
No Asbestos							
<b>B00G- R0014 - Toilets - Boys - 13.48 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R0015 - Raised Platform - 33.41 m2</b>							
No Asbestos							
<b>B00G- R0016 - Hall Chair Store - 5.85 m2</b>							
No Asbestos							
<b>B00G- R0017 - Hall Chair Store - 5.85 m2</b>							
No Asbestos							
<b>B00G- R0018 - Communal Space - 265.22 m2</b>							
No Asbestos							
<b>B00G- R0019 - Movement - 1.45 m2</b>							
No Asbestos							
<b>B00G- R0020 - Drinking Facilities - 7.17 m2</b>							
No Asbestos							
<b>B00G- R0021 - Movement - 2.23 m2</b>							
No Asbestos							
<b>B00G- R0022 - Drinking Facilities - 14.22 m2</b>							
No Asbestos							

<b>B00G - R0023 - Movement - 1.46 m2</b>							
No Asbestos							
<b>B00G - R0024 - Cleaning Supplies - 9.44 m2</b>							
No Asbestos							
<b>B00H - Pre-School Facilities - 1975 - Brick/Block</b>							
<b>Exterior</b>							
Gable Verge Lining	Flat AC Sheeting	50m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	12m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00H - R0001 - Kitchen - Pre - 8.66 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0002 - Staff Toilet - Pre - 4.1 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0003 - Distribution Board - .34 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Electrical - Mounting Board	Resinous Board						
<b>B00H - R0004 - General Storeroom - 7.33 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0005 - Withdrawal - Pre - 29.55 m2</b>							
No Asbestos							
<b>B00H - R0006 - Home Base - Pre - 46.92 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0007 - Personal Effects - Pre - 5.18 m2</b>							
No Asbestos							
<b>B00H - R0008 - Toilets - Boys/Girls - Pre - 5.18 m2</b>							
No Asbestos							
<b>B00H - R0009 - General Storeroom - 10.43 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0010 - Practical Activities - Pre - 21.75 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0011 - Staff Room - Pre - 23.91 m2</b>							
No Asbestos							
<b>B00H - R0012 - Personal Effects - Pre - 35.33 m2</b>							
No Asbestos							
<b>B00H - R0013 - Staff Room Annexe - 13.67 m2</b>							



Ceiling Structures/Linings	Flat AC Sheeting	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0014 - General Storeroom - 5.6 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0015 - Withdrawal - Pre - 29.43 m2</b>							
No Asbestos							
<b>B00H - R0016 - Home Base - Pre - 45.95 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0017 - Personal Effects - Pre - 5.65 m2</b>							
No Asbestos							
<b>B00H - R0018 - Toilets - Boys/Girls - Pre - 5.04 m2</b>							
No Asbestos							
<b>B00H - R0019 - Movement - 60.14 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0020 - Movement - 8.12 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0021 - Movement - 11.35 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00I - General Learning/Staff Facilities - 2010 - Brick/Veneer</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00I - R0001 - Movement - 11.26 m2</b>							
No Asbestos							
<b>B00I - R0002 - Movement - 28.43 m2</b>							
No Asbestos							
<b>B00I - R0003 - Staff Room Annexe - 19.32 m2</b>							
No Asbestos							
<b>B00I - R0004 - Staff Room - 39.53 m2</b>							
No Asbestos							
<b>B00I - R0005 - Staff Kitchen - 8.18 m2</b>							
No Asbestos							
<b>B00I - R0006 - Staff Toilet - 5.31 m2</b>							
No Asbestos							
<b>B00I - R0007 - Staff Toilet - 5.35 m2</b>							
No Asbestos							
<b>B00I - R0008 - Special Programs Store - 6.97 m2</b>							
No Asbestos							
<b>B00I - R0009 - Special Programs Store - 6.97 m2</b>							
No Asbestos							
<b>B00I - R0010 - Special Programs Room - 31.84 m2</b>							

No Asbestos							
<b>B001 - R0011 - External Movement - 9.31 m2</b>							
No Asbestos							
<b>B001 - R0012 - External Movement - 10.71 m2</b>							
No Asbestos							
<b>B0E1 - General Learning - 1975 - Brick/Block</b>							
<b>Exterior</b>							
Gable Verge Lining	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B0E1 - R0001 - General Assistant/Bulk Store - 14.62 m2</b>							
No Asbestos							
<b>B0E1 - R0002 - Music Store - 13.03 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0E1 - R0003 - Home Base - 50.47 m2</b>							
No Asbestos							
<b>B0E1 - R0004 - Practical Activities - 1hb - 17.94 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0E1 - R0005 - Movement - 24.23 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B0E2 - General Learning - 1975 - Brick/Block</b>							
<b>Exterior</b>							
Gable Verge Lining	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B0E2 - R0001 - Practical Activities - 1hb - 17.95 m2</b>							
No Asbestos							
<b>B0E2 - R0002 - Home Base - 50.7 m2</b>							
No Asbestos							
<b>B0E2 - R0003 - Home Base - 50.7 m2</b>							
No Asbestos							
<b>B0E2 - R0004 - Practical Activities - 1hb - 17.94 m2</b>							
No Asbestos							
<b>B0E2 - R0005 - Movement - 34.01 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B0F1 - General Learning - 1975 - Brick/Block</b>							
<b>Exterior</b>							
Gable Verge Lining	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							

<b>B0F1 - R0001 - Practical Activities - 1hb - 17.94 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - ( X3 )						
<b>B0F1 - R0002 - Home Base - 50.94 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - ( X5 )						
<b>B0F1 - R0003 - Home Base - 50.55 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - ( X5 )						
<b>B0F1 - R0004 - Practical Activities - 1hb - 17.94 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F1 - R0005 - Distribution Board - .47 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Electrical - Mounting Board	Resinous Board	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F1 - R0006 - General Storeroom - 12.35 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F1 - R0007 - Movement - 17.55 m2</b>							
No Asbestos							
<b>B0F1 - R0008 - Movement - 46.51 m2</b>							
No Asbestos							
<b>B0F1 - R1001 - Practical Activities - 1hb - 17.94 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F1 - R1002 - Home Base - 50.7 m2</b>							
No Asbestos							
<b>B0F1 - R1003 - Home Base - 50.7 m2</b>							
No Asbestos							
<b>B0F1 - R1004 - Practical Activities - 1hb - 17.94 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F1 - R1005 - Distribution Board - .48 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Electrical - Mounting Board	Resinous Board	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F1 - R1006 - K.L.A. Store - 12.35 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F1 - R1007 - Movement - 17.55 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F1 - R1008 - Movement - 44.99 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F2 - General Learning - 1975 - Brick/Block</b>							

Exterior							
Gable Verge Lining	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B0F2 - R0001 - Practical Activities - 1hb - 17.95 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0F2 - R0002 - Home Base - 50.71 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
B0F2 - R0003 - Home Base - 51.26 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
B0F2 - R0004 - Practical Activities - 1hb - 17.94 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0F2 - R0005 - Distribution Board - .43 m2 <span style="float: right;">Note: No inspection of live electrical installation</span>							
Electrical - Mounting Board	Resinous Board	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0F2 - R0006 - K.L.A. Store - 12.49 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0F2 - R0007 - Movement - 18.21 m2							
No Asbestos							
B0F2 - R0008 - Movement - 67.76 m2							
No Asbestos							
B0F2 - R1001 - Music Store - 12.52 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0F2 - R1002 - Distribution Board - .43 m2 <span style="float: right;">Note: No inspection of live electrical installation</span>							
Electrical - Mounting Board	Resinous Board	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0F2 - R1003 - Practical Activities - 1hb - 17.94 m2							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0F2 - R1004 - Home Base - 51.25 m2							
No Asbestos							
B0F2 - R1005 - Home Base - 50.7 m2							
No Asbestos							
B0F2 - R1006 - Practical Activities - 1hb - 17.94 m2							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0F2 - R1007 - Movement - 18.23 m2							

Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F2 - R1008 - Movement - 64.92 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F3 - General Learning - 1975 - Brick/Block</b>							
<b>Exterior</b>							
Gable Verge Lining	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B0F3 - R0001 - Security Store - 11.27 m2</b>							
No Asbestos							
<b>B0F3 - R0002 - Distribution Board - .42 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Electrical - Mounting Board	Resinous Board	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F3 - R0003 - Practical Activities - 1hb - 17.93 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F3 - R0004 - Home Base - 50.7 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B0F3 - R0005 - Home Base - 50.54 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B0F3 - R0006 - Practical Activities - 1hb - 17.93 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F3 - R0007 - Drinking Facilities - 15.29 m2</b>							
No Asbestos							
<b>B0F3 - R0008 - Toilets - Boys - 23.37 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F3 - R0009 - Movement - 18.02 m2</b>							
No Asbestos							
<b>B0F3 - R0010 - Movement - 95.2 m2</b>							
No Asbestos							
<b>B0F3 - R0011 - Movement - 9.89 m2</b>							
No Asbestos							
<b>B0F3 - R0012 - Cleaning Distributed Store - 4.16 m2</b>							
No Asbestos							
<b>B0F3 - R0013 - Movement - 3.24 m2</b>							
No Asbestos							
<b>B0F3 - R1001 - Practical Activities - 1hb - 17.94 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F3 - R1002 - Home Base - 50.7 m2</b>							
No Asbestos							
<b>B0F3 - R1003 - Home Base - 50.54 m2</b>							
No Asbestos							
<b>B0F3 - R1004 - Practical Activities - 1hb - 17.94 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F3 - R1005 - Distribution Board - .42 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Electrical - Mounting Board	Resinous Board	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F3 - R1006 - Staff Room Annexe - 11.27 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F3 - R1007 - Drinking Facilities - 13.18 m2</b>							
No Asbestos							
<b>B0F3 - R1008 - Toilets - Girls - 23.37 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0F3 - R1009 - Movement - 94.71 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B0F3 - R1010 - Movement - 7.57 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B0F3 - R1011 - Movement - 17.91 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

## Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020