


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Junee High School (8179)
Region:	Southern NSW AMU
State Electorate:	Cootamundra
Local Government Area:	Junee

Last Reviewed By:	WSP 15-SEP-2017
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

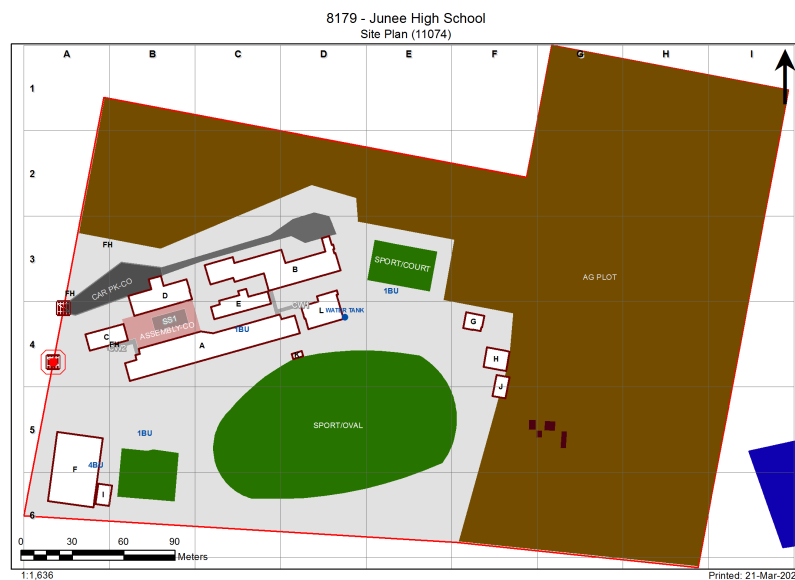

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - General Learning/Admin - 1958 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	150m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
Interior							
B00A - R0001 - General Learning Space - 54.22 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0002 - General Learning Space - 53.7 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0003 - Distribution Board Cupboard - .81 m2							
Note: No inspection of live electrical installation							
Wall Linings Internal	Flat AC Sheeting	6m2	All surfaces	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0004 - General Storeroom - .79 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0005 - General Storeroom - 7.18 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0006 - Staff Study - 22.95 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0007 - Cleaning Store - Distributed - 3.22 m2							
No Asbestos							
B00A - R0008 - Movement - 52.55 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0009 - External Movement - 108.45 m2							
No Asbestos							
B00A - R0010 - General Storeroom - 9.36 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0011 - Commonroom - 75.83 m2							
No Asbestos							
B00A - R0012 - Disabled Shower/Toilet - 7.74 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0013 - Cleaning Supplies Store - 9.47 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0014 - Chair Store - 15.24 m2							
No Asbestos							
B00A - R0015 - Interview/Office - Type 1 - 18.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0016 - General Learning Space - 53.5 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0017 - General Learning Space - 53.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						

B00A - R0018 - Staff Study - 24.02 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0019 - General Storeroom - 16.23 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0020 - General Storeroom - 9.93 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0021 - General Learning Space - 53.36 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0022 - Security Store - 8.33 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0023 - Deputy Principal Office - 23.47 m2							
No Asbestos							
B00A - R0024 - Clinic - 11.15 m2							
No Asbestos							
B00A - R0025 - Library Office/Workroom - 12.68 m2							
No Asbestos							
B00A - R0026 - Distribution Board Cupboard - 3.39 m2							
Note: No inspection of live electrical installation							
Door - Lining	Flat AC Sheeting	4	All surfaces	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical - Mounting Board	Resinous Board	1	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0027 - Administration - Clerical - 25.89 m2							
No Asbestos							
B00A - R0028 - Duplicating Workroom - 17.96 m2							
No Asbestos							
B00A - R0029 - Principal Office - 24.45 m2							
No Asbestos							
B00A - R0030 - Seminar - 20.85 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0031 - General Storeroom - 5.49 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0032 - External Movement - 2.61 m2							
No Asbestos							
B00A - R0034 - Security Store - 6.49 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0035 - Staff - Toilet - 7.67 m2							
No Asbestos							
B00A - R0036 - Movement - 9.88 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0037 - Movement - 11.88 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0038 - Staff - Toilet - 7.64 m2							
No Asbestos							
B00A - R0039 - Study Space - 13.95 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						

B00A - R0040 - External Movement - 4.82 m2							
No Asbestos							
B00A - R0042 - Public Entry - 29.07 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0043 - Stairs - 4.67 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0044 - Stairs - 5.32 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0045 - Stairs - 3.65 m2							
No Asbestos							
B00A - R0046 - Movement - 136.05 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00A - R0047 - External Movement - 299.53 m2							
No Asbestos							
B00A - R0048 - Lift - 1.15 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R1001 - Laboratory L.S. - 92.58 m2							
No Asbestos							
B00A - R1002 - Preparation - 26.38 m2							
No Asbestos							
B00A - R1003 - Apparatus Store - 14.88 m2							
No Asbestos							
B00A - R1004 - Chemical Store - 8.77 m2							
No Asbestos							
B00A - R1005 - Distribution Board Cupboard - .77 m2							
Note: No inspection of live electrical installation							
Wall Linings Internal	Flat AC Sheeting	6m2	All surfaces	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical - Mounting Board	Resinous Board	1	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1006 - Staff Study - 23.84 m2							
No Asbestos							
B00A - R1007 - General Learning Space - 59.1 m2							
No Asbestos							
B00A - R1010 - Laboratory L.S. - 95.19 m2							
No Asbestos							
B00A - R1011 - Laboratory L.S. - 87.46 m2							
No Asbestos							
B00A - R1012 - Staff Study - 27.55 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1013 - General Learning Space - 51.18 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1014 - General Learning Space - 55.26 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1015 - Audio Visual Workroom - 33.37 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1016 - Main Area - 163.63 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00A - R1017 - Computer Resource - 14.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1018 - Computer Resource - 14.61 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1019 - Senior Study - 13.11 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1020 - Distribution Board Cupboard - .37 m2							
Note: No inspection of live electrical installation							
Door - Lining	Flat AC Sheeting	2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1021 - Movement - 101.03 m2							
Floor Coverings Res/Textile	Vinyl Tiles	102m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Adjacent to room 1026 and 1027 stair landings	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1022 - Cleaning Store - Distributed - 4.24 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R1023 - Staff - Toilet - 8.43 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1024 - Movement - 99.48 m2							
Floor Coverings Res/Textile	Vinyl Tiles	100m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1025 - Study Space - 41.27 m2							
No Asbestos							
B00A - R1026 - Stairs - 15.75 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1027 - Stairs - 7.63 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R1028 - Stairs - 12.41 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B00B - Technological & Applied Studies - 1990 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00B - R0001 - Materials Store - 41.01 m2							
No Asbestos							
B00B - R0002 - Dust Extraction Space - 7.05 m2							
No Asbestos							

B00B - R0003 - Wood Technology Bay - 26.46 m2		
No Asbestos		
B00B - R0004 - Materials Technology L.S. - 91.21 m2		
No Asbestos		
B00B - R0005 - General Storeroom - 3.3 m2		
No Asbestos		
B00B - R0006 - Materials Store - 32.97 m2		
No Asbestos		
B00B - R0007 - Welding Area - 13.94 m2		
No Asbestos		
B00B - R0008 - Materials Technology L.S. - 91.01 m2		
No Asbestos		
B00B - R0009 - Metal Technology Bay - 26.54 m2		
No Asbestos		
B00B - R0010 - Distribution Board Cupboard - 2.62 m2		Note: No inspection of live electrical installation
No Asbestos		
B00B - R0011 - Darkroom Space - 34.22 m2		
No Asbestos		
B00B - R0012 - Staff Study - 28.64 m2		
No Asbestos		
B00B - R0013 - Staff Study - 40.28 m2		
No Asbestos		
B00B - R0014 - External Movement - 209.26 m2		
No Asbestos		
B00B - R0015 - Practice/Seminar - 14.11 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00B - R0016 - Music Store - 13.23 m2		
No Asbestos		
B00B - R0017 - Music Learning Space - 78.05 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00B - R0018 - Workshop - 37.05 m2		
No Asbestos		
B00B - R0019 - Art Learning Space - 62.6 m2		
No Asbestos		
B00B - R0020 - Distribution Board Cupboard - 1.11 m2		Note: No inspection of live electrical installation
No Asbestos		
B00B - R0021 - Senior Study - 18.32 m2		
No Asbestos		
B00B - R0022 - Bulk Store - 15.19 m2		
No Asbestos		
B00B - R0023 - General Learning Space - 48.22 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00B - R0024 - Computer Room - 56.92 m2		
No Asbestos		
B00B - R0025 - Cleaning Store - Distributed - 5.03 m2		
No Asbestos		
B00B - R0026 - Staff - Toilet - 6.27 m2		
No Asbestos		
B00B - R0027 - L.P.G Store - 1.25 m2		
No Asbestos		

B00C - General Learning/Computer Learning - 1959 - Brick/Block

Exterior

Eaves Linings	Flat AC Sheeting	50m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Flat AC Sheeting		Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Underfloor Voids	AC Fragments/Debris		Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)

Interior

B00C - R0001 - Computer Learning Space - 60.6 m2

No Asbestos

B00C - R0002 - Computer Store - 9.98 m2

No Asbestos

B00C - R0003 - Distribution Board Cupboard - .26 m2

Note: No inspection of live electrical installation

Door - Lining	Flat AC Sheeting	2	All surfaces	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
---------------	------------------	---	--------------	----------------------------	---------	--------------------	---

B00C - R0004 - External Movement - 7.65 m2

No Asbestos

B00C - R0005 - Pupil Entry - 5.04 m2

No Asbestos

B00C - R0006 - General Learning Space - 51.08 m2

No Asbestos

B00C - R0007 - Study Space - 20.42 m2

No Asbestos

B00C - R0008 - Store - 19.07 m2

No Asbestos

B00C - R0009 - Entry - 7.37 m2

No Asbestos

B00C - R0010 - Computer Resource - 15.83 m2

No Asbestos

B00D - Pupil Facilities - 1959 - Brick/Block

Exterior

Eaves Linings	Flat AC Sheeting	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						

Interior

B00D - R0001 - Toilets-Girls - 28.49 m2

Ceiling Structures/Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------	---

B00D - R0002 - Cleaning Store - Distributed - 1.5 m2

No Asbestos

B00D - R0006 - Entry - 1.08 m2

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
----------------------------	------------------	-----	--------------	--------------------	---------	--------------------	---

B00D - R0007 - Distribution Board Cupboard - .26 m2

Note: No inspection of live electrical installation

Door - Lining	Flat AC Sheeting	2	All surfaces	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
---------------	------------------	---	--------------	----------------------------	---------	--------------------	---

B00D - R0009 - Student Canteen - 32.67 m2

Ceiling Structures/Linings	Flat AC Sheeting	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------	---

B00D - R0010 - Uniform Shop - 13.61 m2

Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00D - R0011 - Uniform Shop - 5.03 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00D - R0012 - Toilets-Boys - 28.54 m2							
Ceiling Structures/Linings	Flat AC Sheeting	29m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00D - R0013 - Cleaning Store - Distributed - 1.48 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00D - R0014 - Utility Space - 18.76 m2							
Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00D - R0015 - External Movement - 187.1 m2							
No Asbestos							
B00D - R0016 - Office/Store - 4.38 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4.38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00D - R0017 - Store - Coolroom - 3.68 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3.68m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00D - R0018 - Movement - 3.22 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3.22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00D - R0019 - Staff - Toilet - 1.53 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1.53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00D - R0020 - Student Canteen - 72.66 m2							
Ceiling Structures/Linings	Flat AC Sheeting	72.66m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00D - R0021 - Store - 31.24 m2							
Ceiling Structures/Linings	Flat AC Sheeting	31.24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00E - Technological & Applied Studies - 1959 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	AC Fragments/Debris - Vinyl Floor Tile						
Interior							
B00E - R0007 - Materials Technology L.S. - 63.79 m2							
Ceiling Structures/Linings	Non Accessible Area		m2				
Floor Coverings Res/Textile	Vinyl Tiles						
B00E - R0008 - Movement - 29.65 m2							
Ceiling Structures/Linings	Non Accessible Area		m2				
B00E - R0009 - Staff Kitchen - 10.49 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0010 - Laundry - 4.48 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00E - R0011 - Distribution Board Cupboard - .56 m2							
Note: No inspection of live electrical installation							

Door - Lining	Flat AC Sheeting	2	All surfaces	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0013 - Staff Kitchen - 19.9 m2							
No Asbestos							
B00E - R0016 - Food Technology L.S. - 105.9 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B00E - R0017 - Food/Research Space - 15.53 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0018 - Preparation - Materials - 8.81 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00F - Multi Purpose Facilities - 1988 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00F - R0001 - Chair Store - 48.99 m2							
No Asbestos							
B00F - R0002 - Toilets-Disabled - 4.5 m2							
No Asbestos							
B00F - R0003 - Distribution Board Cupboard - 3.08 m2						Note: No inspection of live electrical installation	
No Asbestos							
B00F - R0004 - Pupil Entry - 2.79 m2							
No Asbestos							
B00F - R0005 - Toilets-Boys - 17.74 m2							
No Asbestos							
B00F - R0006 - Shower/Change - 30.04 m2							
No Asbestos							
B00F - R0007 - Store - 34.85 m2							
No Asbestos							
B00F - R0008 - Store - 19.21 m2							
No Asbestos							
B00F - R0009 - Shower/Change - 29.92 m2							
No Asbestos							
B00F - R0010 - Toilets-Girls - 17.69 m2							
No Asbestos							
B00F - R0011 - Pupil Entry - 2.62 m2							
No Asbestos							
B00F - R0012 - Cleaning Store - Distributed - 3.2 m2							
No Asbestos							
B00F - R0013 - Staff Kitchen - 14.38 m2							
No Asbestos							
B00F - R0014 - Staff Shower - 5.65 m2							
No Asbestos							
B00F - R0015 - Staff Study - 11.79 m2							
No Asbestos							
B00F - R0016 - Sport Equipment Store - 20.45 m2							
No Asbestos							
B00F - R0017 - Multi-Purpose Space - 460.85 m2							
No Asbestos							
B00F - R0018 - External Movement - 6.06 m2							

No Asbestos							
B00F - R0019 - Stage - 63.04 m2							
No Asbestos							
B00F - R0020 - External Movement - 244.71 m2							
No Asbestos							
B00F - R0021 - Stairs - 3.82 m2							
No Asbestos							
B00F - R0022 - Stairs - 3.72 m2							
No Asbestos							
B00G - Agricultural Science - 1900 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Flat AC Sheeting						
Underfloor Voids	AC Fragments/Debris						
Interior							
B00G - R0001 - Agriculture Covered Area - 58.77 m2							
No Asbestos							
B00G - R0002 - External Movement - 10.62 m2							
Wall Linings Internal	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Compressed AC Sheet						
B00G - R0003 - Class Tools Storage - 11.1 m2							
No Asbestos							
B00H - Shed - 1959 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00H - R0001 - External Movement - 30.26 m2							
No Asbestos							
B00H - R0002 - Shower/Change - 8.33 m2							
No Asbestos							
B00H - R0003 - Class Tools Storage - 12.59 m2							
No Asbestos							
B00H - R0004 - Class Tools Storage - 20.97 m2							
No Asbestos							
B00H - R0005 - Machine Storage - 64.72 m2							
No Asbestos							
B00H - R0006 - Shower/Change - 8.34 m2							
No Asbestos							
B00I - Building Services - 2005 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00I - R0001 - Bulk Store - 92.7 m2							
No Asbestos							

B00J - Mechanical Services - 2005 - Metal Shed**Exterior**

Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	

Interior**B00J - R0001 - Machine Storage - 88 m2**

No Asbestos

B00K - Physical Education - 2005 - Metal Shed**Exterior**

Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	Non Accessible Area	

Interior**B00K - R0001 - Sport Equipment Store - 17.92 m2**

No Asbestos

B00L - Science Learning - 2010 - Brick/Veneer**Exterior**

Ceiling Voids	Non Accessible Area	
Underfloor Voids - Slab on Ground	Non Accessible Area	

Interior**B00L - R0001 - General Learning Space - Type 10 - 59.85 m2**

No Asbestos

B00L - R0002 - Science Laboratory - 60.08 m2

No Asbestos

B00L - R0003 - Preparation - Science - 30.23 m2

No Asbestos

B00L - R0004 - Staff Study - 21.07 m2

No Asbestos

B00L - R0005 - P.E Store - 21.15 m2

No Asbestos

B00L - R0006 - Chemical Store - 12.02 m2

No Asbestos

B00L - R0007 - Movement - 6.4 m2

No Asbestos

B00L - R0008 - Apparatus Storage - 13.63 m2

No Asbestos

B00L - R0009 - Main Switch Board Cupboard - .54 m2

No Asbestos

B00L - R0010 - External Movement - 90.42 m2

No Asbestos

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020