


# Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	J J Cahill Memorial High School (8263)
Region:	Sydney AMU
State Electorate:	Heffron
Local Government Area:	Bayside

Last Reviewed By:	WSP 28-JUL-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	<b>Yes</b>
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

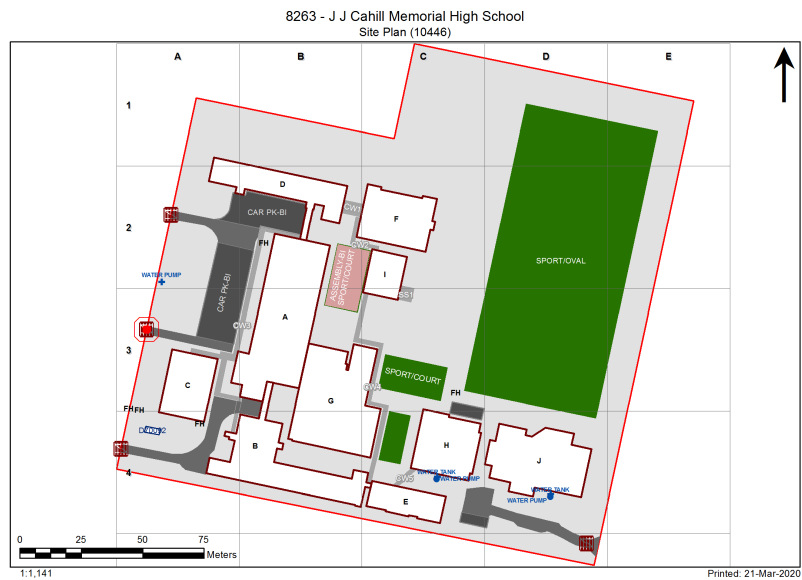

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - General Learning/Art - 1961 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)
Ceiling Voids	Insulation Material						
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00A - R0001 - Gymnasium - 64.66 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R0004 - Art Learning Space - 64.98 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R0005 - Resources Store - 25 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0006 - Art Learning Space - 65.24 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R0007 - Resources Store - 25.94 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0008 - Resources Store - 5.78 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0013 - Cleaning Store - Distributed - 1.62 m2</b>							
No Asbestos							
<b>B00A - R0034 - Staff Study - 31.76 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00A - R0035 - Distribution Board Cupboard - .67 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
No Asbestos							
<b>B00A - R0036 - Computer Learning Space - 64.43 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R0037 - Computer Learning Space - 64.3 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R0047 - External Movement - 5.04 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)
<b>B00A - R0049 - Cleaning Store - Distributed - 1.59 m2</b>							
No Asbestos							
<b>B00A - R0050 - Cleaning Store - Distributed - 1.65 m2</b>							
No Asbestos							
<b>B00A - R0051 - Toilets-Unisex - 3.66 m2</b>							
No Asbestos							
<b>B00A - R0052 - Deputy Principal Office - 13.42 m2</b>							
No Asbestos							
<b>B00A - R0053 - Deputy Principal Office - 13.39 m2</b>							

No Asbestos							
<b>B00A - R0054 - Communication Space - 6.35 m2</b>							
No Asbestos							
<b>B00A - R0055 - Clinic - 13.28 m2</b>							
No Asbestos							
<b>B00A - R0056 - Interview/Office - Type 1 - 12.31 m2</b>							
Non Accessible							
<b>B00A - R0057 - Disabled Toilet - 4.34 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00A - R0058 - Interview/Office - Type 1 - 12.94 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00A - R0059 - Movement - 361.31 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( > 250 m2) - ( X25 )						
<b>B00A - R0060 - Lift - 1.22 m2</b>							
No Asbestos							
<b>B00A - R0061 - Administration - Clerical - 59.59 m2</b>							
No Asbestos							
<b>B00A - R0062 - Duplicating Workroom - 13.21 m2</b>							
No Asbestos							
<b>B00A - R0063 - Security Store - 19.1 m2</b>							
No Asbestos							
<b>B00A - R0064 - Administration - Clerical - 11.16 m2</b>							
No Asbestos							
<b>B00A - R0065 - Staff Kitchen - 10.08 m2</b>							
No Asbestos							
<b>B00A - R0066 - Staff - Toilet - 4.79 m2</b>							
No Asbestos							
<b>B00A - R0067 - Movement - 5.28 m2</b>							
No Asbestos							
<b>B00A - R0068 - Staff - Toilet - 5.92 m2</b>							
No Asbestos							
<b>B00A - R0069 - Cleaning Supplies Store - 5.82 m2</b>							
No Asbestos							
<b>B00A - R0070 - Principal Office - 19.57 m2</b>							
No Asbestos							
<b>B00A - R0071 - Interview/Office - Type 1 - 13.76 m2</b>							
No Asbestos							
<b>B00A - R0072 - Movement - 11.79 m2</b>							
No Asbestos							
<b>B00A - R0073 - Computer Learning Space - 129.77 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 120 - 250 m2) - ( X15 )						
<b>B00A - R0074 - Computer Store - 11.38 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0075 - Computer Store - 19.26 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0076 - Distribution Board Cupboard - .85 m2</b>							
							<b>Note: No inspection of live electrical installation</b>
No Asbestos							

<b>B00A - R0077 - Sport Equipment Store - 9.43 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00A - R0078 - Movement - 3.78 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00A - R0079 - Darkroom Space - 20.47 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00A - R0080 - Stairs - 3.76 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00A - R0081 - Stairs - 3.76 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00A - R0082 - Art Learning Space - 65.23 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00A - R0083 - General Learning Space - 48.18 m2</b>		
No Asbestos		
<b>B00A - R0084 - Stairs - 3.76 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00A - R0085 - External Movement - 2.1 m2</b>		
No Asbestos		
<b>B00A - R0086 - External Movement - 60.06 m2</b>		
No Asbestos		
<b>B00A - R1001 - Senior Seminar - 32.06 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00A - R1002 - Interview/Office - Type 1 - 16.62 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00A - R1003 - General Storeroom - 9.56 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00A - R1004 - General Learning Space - 31.48 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00A - R1005 - General Learning Space - 64.97 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00A - R1006 - Computer Learning Space - 31.58 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00A - R1007 - General Learning Space - 65.15 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00A - R1008 - General Learning Space - 65.06 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00A - R1009 - General Learning Space - 52.36 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00A - R1010 - Cleaning Store - Distributed - 3.39 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	

<b>B00A - R1011 - General Storeroom - 6.18 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00A - R1012 - General Learning Space - 51.78 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00A - R1013 - Stage - 25.39 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00A - R1014 - General Storeroom - 3.25 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00A - R1015 - General Storeroom - 6.16 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00A - R1016 - General Storeroom - 6.12 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00A - R1017 - General Learning Space - 65.31 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00A - R1019 - Staff Study - 51.93 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00A - R1020 - General Storeroom - 3.7 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00A - R1021 - General Storeroom - 5.62 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00A - R1022 - Distribution Board Cupboard - .35 m2</b>		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00A - R1023 - General Storeroom - 3.97 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00A - R1024 - General Learning Space - 52.15 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00A - R1025 - General Learning Space - 52.28 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00A - R1026 - General Storeroom - 4.02 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00A - R1027 - General Storeroom - 6.28 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00A - R1028 - Secure Storeroom - 6.32 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00A - R1029 - Interview/Office - Type 1 - 12.61 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00A - R1030 - Interview/Office - Type 1 - 12.61 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00A - R1031 - General Learning Space - 65.1 m2</b>		

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R1032 - Commonroom - 98.53 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00A - R1033 - Staff Kitchen - 7.55 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R1034 - Staff - Toilet - 9.21 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R1035 - Staff - Toilet - 9.98 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R1036 - Movement - 230.06 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 120 - 250 m2) - ( X15 )						
<b>B00A - R1037 - Plant - 2.79 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R1038 - Lift - 1.22 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R1039 - Stairs - 11.66 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R1040 - Stairs - 11.49 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R1041 - Stairs - 11.05 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R1042 - Movement - 8.79 m2</b>							
No Asbestos							
<b>B00B - General Learning/Science - 1986 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	10m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00B - R0001 - General Learning Space - 52.58 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0002 - Cleaning Store - Distributed - 3.64 m2</b>							
No Asbestos							
<b>B00B - R0003 - General Learning Space - 56.21 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	57m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0004 - General Storeroom - 6.55 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0005 - General Storeroom - 4.76 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0006 - General Learning Space - 52.5 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0007 - Staff - Toilet - 3.8 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00B - R0008 - Distribution Board Cupboard - .89 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
No Asbestos							
<b>B00B - R0009 - Cleaning Store - Distributed - 1.49 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0010 - General Storeroom - 10.91 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0011 - General Learning Space - 52.65 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0012 - Movement - 129.06 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 120 - 250 m2) - ( X15 )						
<b>B00B - R0013 - External Movement - 73.52 m2</b>							
No Asbestos							
<b>B00B - R0014 - Apparatus Store - 24.71 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R0015 - Laboratory L.S. - 93.05 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00B - R0016 - Apparatus Store - 9.81 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0017 - Preparation - 30.14 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	31m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0018 - Laboratory L.S. - 92.87 m2</b>							



Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00B - R0019 - Toilets-Girls - 24.75 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R0020 - Distribution Board Cupboard - .85 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
No Asbestos							
<b>B00B - R0021 - Cleaning Store - Distributed - 6.6 m2</b>							
No Asbestos							
<b>B00B - R0022 - External Movement - 4.28 m2</b>							
No Asbestos							
<b>B00B - R0023 - External Stairs - 11.98 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0024 - Stairs - 9.74 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00B - R0025 - External Movement - 5.37 m2</b>							
No Asbestos							
<b>B00B - R0026 - External Movement - 10.9 m2</b>							
No Asbestos							
<b>B00B - R0028 - External Movement - 33.15 m2</b>							
No Asbestos							
<b>B00B - R0029 - External Movement - 4.22 m2</b>							
No Asbestos							
<b>B00B - R0030 - Large Equipment Store - 50.95 m2</b>							
Require Inspection							
<b>B00B - R1001 - General Learning Space - 52.72 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1002 - Staff Study - 26.03 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1003 - Staff Study - 15.9 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1004 - Staff Study - 15.94 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1005 - Staff Study - 26.5 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1006 - Staff - Toilet - 3.81 m2</b>							

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Incinerator	Compressed AC Sheet	<1	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00B - R1007 - Distribution Board Cupboard - .87 m2</b>							<b>Note: No inspection of live electrical installation</b>
No Asbestos							
<b>B00B - R1008 - Cleaning Store - Distributed - 1.55 m2</b>							
No Asbestos							
<b>B00B - R1009 - Secure Storeroom - 10.91 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1010 - General Learning Space - 52.64 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1012 - Movement - 73.72 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	74m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1013 - General Learning Space - 51.48 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	52m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1014 - General Learning Space - 66.01 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	66m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1015 - General Storeroom - 20.84 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1016 - Secure Storeroom - 17.73 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1017 - General Learning Space - 52.57 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1018 - General Learning Space - 52.13 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1019 - General Storeroom - 11.66 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1020 - Distribution Board Cupboard - .85 m2</b>							<b>Note: No inspection of live electrical installation</b>
No Asbestos							

<b>B00B - R1021 - Movement - 11.6 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R1022 - Stairs - 19.33 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R1023 - Stairs - 19.74 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1026 - Movement - 117.16 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00B - R1027 - Sport Equipment Store - 38.97 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	39m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1028 - Movement - 32.15 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet						
<b>B00B - R1029 - External Movement - 3.99 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00B - R2001 - Computer Learning Space - 56.6 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	57m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R2002 - General Learning Space - 56.6 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	57m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R2003 - General Storeroom - 6.61 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R2004 - General Storeroom - 6.61 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R2005 - General Learning Space - 52.42 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00B - R2006 - Staff - Toilet - 3.81 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00B - R2007 - Distribution Board Cupboard - .89 m2</b>							
No Asbestos	<b>Note: No inspection of live electrical installation</b>						
<b>B00B - R2008 - Cleaning Store - Distributed - 1.49 m2</b>							
No Asbestos							
<b>B00B - R2009 - General Storeroom - 10.91 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R2010 - Computer Learning Space - 52.64 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00B - R2011 - Computer Resource - 6.63 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R2012 - Computer Resource - 6.66 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R2013 - Movement - 90.97 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00B - R2014 - Stairs - 19.33 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00C - Technological &amp; Applied Studies - 1961 - Brick/Block</b>							
<b>Exterior</b>							
Wall Cladding	Flat AC Sheeting	50m2	North, east and west facing below windows	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00C - R0001 - Staff Study - 15.96 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00C - R0002 - Design L.S. - 72.4 m2</b>							
Wall Linings Internal	Flat AC Sheeting	10m2	West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00C - R0003 - Resource/Project Store - 10.63 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00C - R0004 - Distribution Board Cupboard - .49 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
No Asbestos							
<b>B00C - R0005 - Resource/Project Store - 10.68 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00C - R0006 - Materials Technology L.S. - 93.71 m2</b>							
Wall Linings Internal	Flat AC Sheeting	15m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00C - R0007 - Materials Technology L.S. - 76.57 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						

<b>B00C - R0008 - Resource/Project Store - 15.26 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00C - R0009 - Resource/Project Store - 8.78 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00C - R0010 - Materials Technology L.S. - 87.38 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00C - R0011 - Staff - Toilet - 4.6 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00C - R0012 - Cleaning Store - Distributed - 2.9 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00C - R0013 - Dust Extraction Space - 5.49 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00C - R0014 - Movement - 39.02 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00C - R0015 - External Movement - 3.21 m2</b>							
No Asbestos							
<b>B00D - General Learning/Technological &amp; Applied Studies - 1972 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
New XYZ	AC Fragments/Debris	1	Throughout northern flower beds within building fill	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Insulation Material						
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00D - R0001 - Food Technology L.S. - 82.86 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00D - R0002 - Movement - 17.18 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00D - R0003 - Cleaning Store - Distributed - 3.53 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00D - R0004 - Toilets-Girls - 16.98 m2</b>							
No Asbestos							
<b>B00D - R0005 - Movement - 111.17 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00D - R0006 - Cleaning Store - Distributed - 2.49 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00D - R0007 - General Storeroom - 4.33 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00D - R0008 - Staff Study - 18.05 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00D - R0009 - Design L.S. - 64.27 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00D - R0010 - Resource/Project Store - 6.13 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00D - R0011 - Laundry - 5.94 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00D - R0012 - Design L.S. - 64.54 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00D - R0013 - Resource/Project Store - 18.18 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00D - R0014 - Distribution Board Cupboard - 4.08 m2</b>		
		<b>Note: No inspection of live electrical installation</b>
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00D - R0015 - Food Technology L.S. - 79.14 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )	
<b>B00D - R0016 - Food/Research Space - 18.57 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00D - R0017 - Resource/Project Store - 12.42 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00D - R0018 - Stairs - 7.16 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00D - R0019 - Stairs - 4.02 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00D - R0020 - External Movement - 7.9 m2</b>		
No Asbestos		
<b>B00D - R0021 - External Movement - 8.21 m2</b>		
No Asbestos		
<b>B00D - R0022 - External Movement - 33.91 m2</b>		
No Asbestos		
<b>B00D - R1001 - Food Technology L.S. - 52 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00D - R1002 - Movement - 12.95 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00D - R1003 - Toilets-Girls - 16.95 m2</b>		
No Asbestos		
<b>B00D - R1004 - Movement - 109.8 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )	
<b>B00D - R1005 - General Learning Space - 52.29 m2</b>		

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00D - R1006 - General Storeroom - 16.51 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00D - R1007 - Staff Study - 34.62 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00D - R1008 - General Storeroom - 2.27 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00D - R1009 - Careers Advisers Office - 20.87 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00D - R1010 - Distribution Board Cupboard - .64 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
No Asbestos							
<b>B00D - R1011 - General Learning Space - 52.51 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00D - R1012 - General Learning Space - 52.07 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00D - R1013 - General Learning Space - 52.43 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00D - R1014 - General Learning Space - 52.5 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00D - R1015 - Stairs - 12.43 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00D - R1016 - Stairs - 7.98 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00D - R1017 - Movement - 34.38 m2</b>							
No Asbestos							
<b>B00E - Science/Pupil Facilities - 1986 - Brick/Block</b>							
<b>Exterior</b>							
Plant / Equipment - Flue	Fibre Cement Pipe	1	North facing on roof top	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00E - R0001 - External Movement - 57.79 m2</b>							
No Asbestos							
<b>B00E - R0002 - Laboratory L.S. - 80.49 m2</b>							
No Asbestos							
<b>B00E - R0003 - Distribution Board Cupboard - .67 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
No Asbestos							
<b>B00E - R0004 - Preparation - 27.36 m2</b>							
No Asbestos							
<b>B00E - R0005 - Lift - .53 m2</b>							
No Asbestos							
<b>B00E - R0006 - Plant - .75 m2</b>							
No Asbestos							

<b>B00E - R0007 - Laboratory L.S. - 80.76 m2</b>		
No Asbestos		
<b>B00E - R0008 - Cleaning Store - Distributed - 1.56 m2</b>		
No Asbestos		
<b>B00E - R0009 - Apparatus Store - 41.34 m2</b>		
No Asbestos		
<b>B00E - R0010 - Chemical Store - 9.91 m2</b>		
No Asbestos		
<b>B00E - R1001 - External Movement - 56.57 m2</b>		
Ceiling Structures/Linings	Flat AC Sheeting	
<b>B00E - R1002 - Laboratory L.S. - 80.75 m2</b>		
No Asbestos		
<b>B00E - R1003 - Preparation - 27.95 m2</b>		
No Asbestos		
<b>B00E - R1004 - Lift - .53 m2</b>		
No Asbestos		
<b>B00E - R1005 - Distribution Board Cupboard - .67 m2</b>		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00E - R1006 - Laboratory L.S. - 80.58 m2</b>		
No Asbestos		
<b>B00E - R1007 - Cleaning Store - Distributed - 1.51 m2</b>		
No Asbestos		
<b>B00E - R1008 - Staff Study - 38.03 m2</b>		
No Asbestos		
<b>B00E - R1009 - Toilets-Girls - 17.19 m2</b>		
No Asbestos		
<b>B00F - Library - 1986 - Brick/Block</b>		
<b>Exterior</b>		
Ceiling Voids	Non Accessible Area	
Underfloor Voids	Non Accessible Area	
Eaves Linings	Compressed AC Sheet	
<b>Interior</b>		
<b>B00F - R0001 - Main Area - 438.88 m2</b>		
No Asbestos		
<b>B00F - R0002 - Seminar - 12.48 m2</b>		
No Asbestos		
<b>B00F - R0003 - Seminar - 13.29 m2</b>		
No Asbestos		
<b>B00F - R0004 - Seminar - 13.12 m2</b>		
No Asbestos		
<b>B00F - R0005 - Librarian - 12.25 m2</b>		
No Asbestos		
<b>B00F - R0006 - Workroom - 46.17 m2</b>		
No Asbestos		
<b>B00F - R0007 - Distribution Board Cupboard - .94 m2</b>		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00F - R0008 - Audio Visual Workroom - 30.29 m2</b>		
No Asbestos		
<b>B00F - R0009 - Seminar - 15.63 m2</b>		
Wall Linings Internal	Flat AC Sheeting	



<b>B00F - R0010 - External Movement - 4.54 m2</b>							
No Asbestos							
<b>B00G - Multi Purpose Facilities/Pupil Facilities - 1961 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	200m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00G - M0001 - General Storeroom - 11.46 m2</b>							
No Asbestos							
<b>B00G - M0002 - General Storeroom - 10.25 m2</b>							
No Asbestos							
<b>B00G - R0001 - Shower/Change - 48.65 m2</b>							
No Asbestos							
<b>B00G - R0002 - Staff Shower - 6.36 m2</b>							
No Asbestos							
<b>B00G - R0003 - Staff Study - 20.37 m2</b>							
No Asbestos							
<b>B00G - R0004 - Toilets-Girls - 7.68 m2</b>							
No Asbestos							
<b>B00G - R0005 - Movement - 2.22 m2</b>							
No Asbestos							
<b>B00G - R0007 - Movement - 5.69 m2</b>							
No Asbestos							
<b>B00G - R0008 - General Storeroom - 9.07 m2</b>							
Plant / Equipment - Flue	Fibre Cement Pipe	2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00G - R0009 - Staff Kitchen - 10.24 m2</b>							
No Asbestos							
<b>B00G - R0010 - Multi-Purpose Space - 387.13 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - ( X25 )						
<b>B00G - R0013 - Chair Store - 10.31 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
<b>B00G - R0014 - Plant - 18.68 m2</b>							
No Asbestos							
<b>B00G - R0015 - Distribution Board Cupboard - .66 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
No Asbestos							
<b>B00G - R0016 - Movement - 10.9 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0017 - External Movement - 5.89 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
<b>B00G - R0018 - Movement - 18.09 m2</b>							
No Asbestos							
<b>B00G - R0019 - Stage - 71.99 m2</b>							
No Asbestos							
<b>B00G - R0020 - Movement - 17.94 m2</b>							

No Asbestos							
<b>B00G- R0021 - Movement - 19.08 m2</b>							
No Asbestos							
<b>B00G- R0022 - General Storeroom - 5.88 m2</b>							
No Asbestos							
<b>B00G- R0023 - Toilets-Boys - 6.51 m2</b>							
No Asbestos							
<b>B00G- R0024 - Sport Equipment Store - 8.87 m2</b>							
No Asbestos							
<b>B00G- R0025 - Sport Equipment Store - 28.08 m2</b>							
Plant / Equipment - Flue	Fibre Cement Pipe	1	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00G- R0028 - Music Learning Space - 60.51 m2</b>							
No Asbestos							
<b>B00G- R0029 - Music Learning Space - 110.98 m2</b>							
No Asbestos							
<b>B00G- R0030 - Music Learning Space - 60.81 m2</b>							
No Asbestos							
<b>B00G- R0031 - Music Store - 18.95 m2</b>							
No Asbestos							
<b>B00G- R0032 - Practice/Seminar - 18.69 m2</b>							
No Asbestos							
<b>B00G- R0033 - Practice/Seminar - 19.43 m2</b>							
No Asbestos							
<b>B00G- R0034 - Other-Vacant - 2.6 m2</b>							
No Asbestos							
<b>B00G- R0035 - Shower/Change - 30.29 m2</b>							
No Asbestos							
<b>B00G- R0036 - Distribution Board Cupboard - .72 m2</b>							
							<b>Note: No inspection of live electrical installation</b>
No Asbestos							
<b>B00G- R0037 - Movement - 2.74 m2</b>							
No Asbestos							
<b>B00G- R0038 - External Movement - 8.7 m2</b>							
No Asbestos							
<b>B00G- R0039 - Covered Area - 126.38 m2</b>							
No Asbestos							
<b>B00H - Support Unit - 1961 - Brick/Block</b>							
<b>Exterior</b>							
No Asbestos							
<b>Interior</b>							
<b>B00H- R0001 - Toilets - Boys - 86.78 m2</b>							
No Asbestos							
<b>B00H- R0002 - General Learning Space - S/P - 58.16 m2</b>							
No Asbestos							
<b>B00H- R0003 - General Learning Space - S/P - 60.28 m2</b>							
No Asbestos							
<b>B00H- R0004 - Staff Study - 40.07 m2</b>							
No Asbestos							
<b>B00H- R0005 - Home Base Store - S - 20.66 m2</b>							
No Asbestos							
<b>B00H- R0006 - Home Base Store - S - 6.46 m2</b>							

No Asbestos		
<b>B00H - R0007 - Seminar - Type 3 - 13.13 m2</b>		
No Asbestos		
<b>B00H - R0008 - Practical Activity Area - 58.24 m2</b>		
No Asbestos		
<b>B00H - R0009 - Toilets-Disabled - 10.26 m2</b>		
No Asbestos		
<b>B00H - R0010 - Student Laundry - Type 3 - 8.94 m2</b>		
No Asbestos		
<b>B00H - R0011 - Toilets-Disabled - 10.59 m2</b>		
No Asbestos		
<b>B00H - R0012 - Staff - Toilet - 3.83 m2</b>		
No Asbestos		
<b>B00H - R0013 - Cleaning Store - Distributed - 1.32 m2</b>		
No Asbestos		
<b>B00H - R0014 - Distribution Board Cupboard - .3 m2</b>		
		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00H - R0015 - General Learning Space - S/P - 73.66 m2</b>		
No Asbestos		
<b>B00H - R0017 - External Movement - 15.3 m2</b>		
No Asbestos		
<b>B00H - R0018 - External Movement - 85.53 m2</b>		
No Asbestos		
<b>B00I - Pupil Facilities - 2003 - Brick/Veneer</b>		
<b>Exterior</b>		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00I - R0001 - Student Canteen - 54.56 m2</b>		
No Asbestos		
<b>B00I - R0002 - Office/Store - 13.29 m2</b>		
No Asbestos		
<b>B00I - R0003 - Student Canteen - 3.26 m2</b>		
No Asbestos		
<b>B00I - R0004 - Covered Area - 176.08 m2</b>		
No Asbestos		
<b>B00J - Physical Education/Pupil Facilities - 2009 - Brick/Veneer</b>		
<b>Exterior</b>		
No Asbestos		
<b>Interior</b>		
<b>B00J - R0001 - Gymnasium - 633.7 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B00J - R0002 - Distribution Board Cupboard - .55 m2</b>		
		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00J - R0003 - Chair Store - 33 m2</b>		
No Asbestos		
<b>B00J - R0004 - Large Equipment Store - 24.78 m2</b>		
No Asbestos		
<b>B00J - R0005 - Toilet - Lobby - 3.07 m2</b>		
No Asbestos		

<b>B00J - R0006 - Access Student Shower/Toilet/Change - 35.4 m2</b>	
No Asbestos	
<b>B00J - R0007 - Access Student Shower/Toilet/Change - 35.25 m2</b>	
No Asbestos	
<b>B00J - R0008 - Toilet - Lobby - 3.11 m2</b>	
No Asbestos	
<b>B00J - R0009 - Cleaning Store - Distributed - 3.51 m2</b>	
No Asbestos	
<b>B00J - R0010 - Plant - .73 m2</b>	
No Asbestos	
<b>B00J - R0011 - Access Staff Shower/Toilet - 9.09 m2</b>	
No Asbestos	
<b>B00J - R0012 - First Aid - 13.22 m2</b>	
No Asbestos	
<b>B00J - R0013 - External Movement - 24.84 m2</b>	
No Asbestos	
<b>B00J - R0014 - Plant - .75 m2</b>	
No Asbestos	
<b>B00J - R0015 - Covered Area - 52.37 m2</b>	
No Asbestos	
<b>B00J - R0016 - Stairs - 5.93 m2</b>	
No Asbestos	
<b>B00J - R0017 - Movement - 5.46 m2</b>	
No Asbestos	
<b>B00J - R1001 - Stairs - 8.3 m2</b>	
No Asbestos	
<b>B00J - R1002 - Multi-Purpose Space - 53.77 m2</b>	
No Asbestos	

**Demountables**

**OS 971 70092 - Shed - Container (Garden/Sports/Bulk) - Placement Date : 31-JUL-2003**

No Asbestos Found