


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Kanwal Public School (2259)
Region:	Hunter/Central Coast AMU
State Electorate:	Wyong
Local Government Area:	Central Coast

Last Reviewed By:	Greencap 20-MAR-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

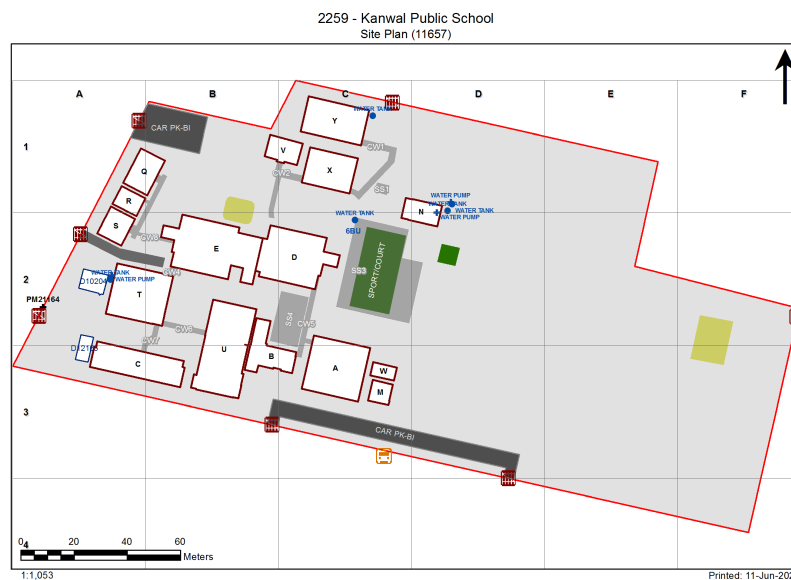

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration - 1965 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00A - R0001 - Staff Toilet - 3.48 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0002 - Staff Toilet - 3.62 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0003 - Entry Vestibule - 12.75 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0004 - Clerical Office - 22.92 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0005 - Plant - .61 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0006 - Sick Bay - 9.71 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Wall Linings Internal	Flat AC Sheeting						
Wall Linings Internal - Infill	Compressed AC Sheet						
B00A - R0007 - Staff Shower/Change - 2.56 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0008 - Staff Toilet - 4.04 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Wall Linings Internal	Flat AC Sheeting						
B00A - R0009 - Interview - 12.84 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0010 - Principal - 21.75 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Wall Linings Internal	Flat AC Sheeting						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00A - R0011 - Staff Room - 72.25 m2							
Wall Linings Internal	Flat AC Sheeting						

Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00A - R0012 - Staff Room Annexe - 26.6 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00A - R0013 - Interview - 11.57 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00A - R0014 - Deputy Principal - 12.39 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00A - R0015 - Duplicating Workroom - 32 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0016 - Distribution Board - .87 m2 Note: No inspection of live electrical installation							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0017 - Cleaning Distributed Store - .56 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0018 - Security Store - 22.54 m2							
No Asbestos							
B00A - R0019 - Movement - 34.86 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0020 - External Movement - 95.83 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - Pupil Facilities - 1969 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	10m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00B - R0001 - Uniform Shop - 8.78 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0002 - General Assistant/Bulk Store - 14.77 m2							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00B - R0003 - Canteen - 50.9 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0005 - Staff Toilet - 1.96 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0006 - Handwashing Facilities - 2.7 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0007 - Movement - 3.02 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0008 - Canteen Office/Store - 1.61 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0009 - External Movement - 53.86 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0010 - Toilets - Boys - 9.25 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0011 - Toilets - Girls - 29.75 m2							
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - General Learning - 1973 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00C - R0001 - Home Base Store - 6.45 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0002 - Home Base - 67.43 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0003 - Home Base - 53.9 m2							
No Asbestos							
B00C - R0004 - Practical Activities - 1hb - 8.29 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
B00C - R0005 - Practical Activities - 1hb - 14.71 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
B00C - R0006 - Home Base - 53.91 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

B00C - R0007 - Home Base - 54.21 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0008 - Practical Activities - 1hb - 6.43 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0009 - External Movement - 60.73 m2							
Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - General Learning - 1965 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00D - R0001 - Home Base - 63.91 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0002 - Practical Activities - 1hb - 9.52 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0003 - Practical Activities - 1hb - 9.51 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0004 - Home Base - 63.91 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0005 - Cleaning Supplies - 5.67 m2							
No Asbestos							
B00D - R0006 - Home Base - 63.91 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0007 - Practical Activities - 1hb - 9.51 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0008 - Distribution Board - .37 m2							
Note: No inspection of live electrical installation							
Electrical - Backing Board	Resinous Board	2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R0009 - Practical Activities - 1hb - 9.51 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00D - R0010 - Home Base - 63.91 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R0011 - External Movement - 115.82 m2								
No Asbestos								
B00D - R0012 - External Stairs - 15.82 m2								
No Asbestos								
B00D - R1001 - Home Base - 50.86 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R1002 - Practical Activities - 1hb - 22.12 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R1003 - Practical Activities - 1hb - 22.13 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R1004 - Home Base - 50.86 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R1005 - Movement - 16.96 m2								
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R1006 - Home Base - 50.86 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R1007 - Practical Activities - 1hb - 22.13 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R1008 - Practical Activities - 1hb - 22.13 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R1009 - Home Base - 50.86 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R1010 - Movement - 33.94 m2								
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R1011 - Stairs - 21.89 m2								
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	

B00E - General Learning/Pupil Facilities - 1965 - Brick/Block

Exterior

Gable Verge Lining	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						

Interior

B00E - R0001 - Toilets - Boys - 26.84 m2

No Asbestos

B00E - R0002 - Cleaning Distributed Store - 1.22 m2

No Asbestos

B00E - R0003 - Toilets - Girls - 21.57 m2

No Asbestos

B00E - R0004 - Cleaning Distributed Store - 5.57 m2

No Asbestos

B00E - R0005 - Home Base - 77.14 m2

Ceiling Structures/Linings Vermiculite - Composite Sample - (70 - 120 m2) - (X8)

B00E - R0006 - Practical Activities - 1hb - 18.66 m2

Ceiling Structures/Linings Vermiculite - Composite Sample - (10 - 40 m2) - (X3)

Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------------	-------------	------	------------	--------------------	---------	--------------------	-----------------------------

B00E - R0007 - Home Base Store - 3.03 m2

No Asbestos

B00E - R0008 - Home Base - 77.15 m2

Ceiling Structures/Linings Vermiculite - Composite Sample - (40 - 70 m2) - (X5)

B00E - R0009 - Practical Activities - 1hb - 18.67 m2

Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------------	-------------	------	------------	--------------------	---------	--------------------	-----------------------------

Ceiling Structures/Linings Vermiculite - Composite Sample - (10 - 40 m2) - (X3)

B00E - R0010 - Home Base Store - 3.02 m2

No Asbestos

B00E - R0011 - Distribution Board - 1.13 m2

Note: No inspection of live electrical installation

Ceiling Structures/Linings Vermiculite - Composite Sample - (< 10 m2) - (X2)

B00E - R0012 - General Assistant/Bulk Store - 14.91 m2

Ceiling Structures/Linings Vermiculite - Composite Sample - (10 - 40 m2) - (X3)

B00E - R0013 - General Storeroom - 8.7 m2

Ceiling Structures/Linings Vermiculite - Composite Sample - (< 10 m2) - (X2)

B00E - R0014 - General Storeroom - 12.85 m2

Ceiling Structures/Linings Vermiculite - Composite Sample - (10 - 40 m2) - (X3)

B00E - R0015 - Sports Store - 16.66 m2

Ceiling Structures/Linings Vermiculite - Composite Sample - (10 - 40 m2) - (X3)

B00E - R0016 - Garden Store - 12.03 m2

Ceiling Structures/Linings Vermiculite - Composite Sample - (10 - 40 m2) - (X3)

B00E - R0017 - External Movement - 202.03 m2							
No Asbestos							
B00E - R0018 - P.E Store - 5 m2							
No Asbestos							
B00E - R0019 - Kiln Room - 8.62 m2							
No Asbestos							
B00E - R0020 - External Stairs - 16.61 m2							
No Asbestos							
B00E - R0021 - External Stairs - 5.78 m2							
No Asbestos							
B00E - R1001 - Home Base - 53.03 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1002 - Practical Activities - 1hb - 20.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R1003 - Practical Activities - 1hb - 20.99 m2							
Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R1004 - Home Base - 52.56 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1005 - Movement - 17.04 m2							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1006 - Home Base - 53.02 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1007 - Practical Activities - 1hb - 20.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R1008 - Practical Activities - 1hb - 20.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1009 - Home Base - 53.02 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1010 - Toilets - Girls - 13.03 m2							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1011 - Cleaning Distributed Store - 4.51 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1012 - Interview - 14.59 m2							
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R1013 - Toilets - Boys - 17.23 m2								
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R1014 - Movement - 67.82 m2								
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R1015 - Stairs - 22.51 m2								
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R1016 - Stairs - 22.35 m2								
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00M - Other-Community Use - 1965 - Timber								
Exterior								
Underfloor Voids	No Asbestos Found							
Ceiling Voids	No Asbestos Found							
Interior								
B00M - R0001 - Plant - 39.04 m2								
Wall Linings Internal	Flat AC Sheeting	2m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00M - R0002 - External Movement - 15.5 m2								
Ceiling Structures/Linings	Flat AC Sheeting							
B00M - R0003 - Toilets - Boys/Girls - 3.05 m2								
Floor Coverings Res/Textile	Vinyl Sheet							
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00N - Communal Facilities - 1965 - Fibre Cement Clad								
Exterior								
Wall Cladding	Flat AC Sheeting							
Gable Ends	Flat AC Sheeting							
Underfloor Voids - Slab on Ground	No Asbestos Found							
Ceiling Voids	No Asbestos Found							
Interior								
B00N - R0001 - Communal Space - 86.24 m2								
Wall Linings Internal	Flat AC Sheeting							
Ceiling Structures/Linings	Flat AC Sheeting							
B00N - R0002 - External Movement - 20.29 m2								
Ceiling Structures/Linings	Flat AC Sheeting							
B00Q - General Learning - 1965 - Timber								
Exterior								
Eaves Linings	Flat AC Sheeting							
Ceiling Voids	No Asbestos Found							
Underfloor Voids	No Asbestos Found							
Interior								
B00Q - R0001 - Home Base Store - 7.08 m2								
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	

B00Q - R0002 - Home Base - 52.37 m2							
No Asbestos							
B00Q - R0003 - Home Base - 52.37 m2							
Wall Linings Internal - Infill	Compressed AC Sheet	2m2	North west	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00Q - R0005 - Practical Activities - 1hb - 10.14 m2							
No Asbestos							
B00Q - R0006 - Practical Activities - 1hb - 13.27 m2							
No Asbestos							
B00Q - R0007 - Home Base Store - 3.74 m2							
No Asbestos							
B00R - General Learning - 1965 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00R - R0001 - Home Base - 52.23 m2							
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00R - R0003 - Home Base Store - 3.59 m2							
No Asbestos							
B00R - R0004 - Practical Activities - 1hb - 13.5 m2							
No Asbestos							
B00S - General Learning - 1965 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting	6m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	AC Fragments/Debris	2	Variable positions	Minimal Damage (2)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Interior							
B00S - R0001 - Home Base - 53.62 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00S - R0006 - General Storeroom - 4.34 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00S - R0007 - External Movement - 3.58 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00S - R0008 - Practical Activities - 1hb - 12.25 m2							
No Asbestos							
B00S - R0009 - Home Base Store - 3.82 m2							
No Asbestos							
B00S - R0010 - Special Programs Room - Type 1 - 26.74 m2							
No Asbestos							
B00T - Library - 1993 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						

Interior		
B00T - R0001 - Reading Area - 219.77 m2		
No Asbestos		
B00T - R0002 - Communications Room - 13.29 m2		
No Asbestos		
B00T - R0003 - Library Office/Workroom - 25.86 m2		
No Asbestos		
B00T - R0004 - Movement - 14.48 m2		
No Asbestos		
B00T - R0005 - External Movement - 12.61 m2		
No Asbestos		
B00T - R0006 - Special Programs Room - 41.43 m2		
No Asbestos		
B00T - R0007 - Distribution Board - .92 m2		
No Asbestos		Note: No inspection of live electrical installation
B00T - R0008 - Security Store - 1.99 m2		
No Asbestos		
B00T - R0009 - Plant - 4.93 m2		
No Asbestos		
B00T - R0010 - External Movement - 43.57 m2		
No Asbestos		
B00T - R0011 - Disabled Toilet - 6.16 m2		
No Asbestos		
B00T - R0012 - Cleaning Distributed Store - 3.25 m2		
No Asbestos		
B00U - Communal Facilities - 1993 - Brick/Veneer		
Exterior		
Ceiling Voids - Raked Ceiling	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Interior		
B00U - R0001 - External Movement - 231.72 m2		
No Asbestos		
B00U - R0002 - Communal Space - 203.96 m2		
No Asbestos		
B00U - R0003 - Plant - .56 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00U - R0004 - Cleaning Distributed Store - 19.61 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00U - R0005 - Raised Platform - 46.35 m2		
No Asbestos		
B00U - R0006 - P.E Store - 17.73 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00U - R0007 - Distribution Board - 1.04 m2		
No Asbestos		Note: No inspection of live electrical installation
B00U - R0008 - External Movement - 21.42 m2		
No Asbestos		
B00U - R0009 - External Movement - 17.37 m2		
No Asbestos		

B00V - General Learning - 2006 - Concrete

Exterior

Underfloor Voids	No Asbestos Found
------------------	-------------------

Ceiling Voids	No Asbestos Found
---------------	-------------------

Interior

B00V - R0001 - Seminar/Study - 7.08 m2

No Asbestos

B00V - R0002 - Seminar/Study - 7.14 m2

No Asbestos

B00V - R0003 - Movement - 6.01 m2

No Asbestos

B00V - R0004 - Staff Toilet - 1.27 m2

No Asbestos

B00V - R0005 - Special Programs Room - 78.07 m2

No Asbestos

B00V - R0006 - External Movement - 1.89 m2

No Asbestos

B00W - Building Services - 2007 - Metal Shed

Exterior

Ceiling Voids	No Asbestos Found
---------------	-------------------

Underfloor Voids - Slab on Ground	No Asbestos Found
-----------------------------------	-------------------

Interior

B00W - R0001 - General Assistant/Bulk Store - 45.18 m2

No Asbestos

B00X - General Learning - 2010 - Brick/Veneer

Exterior

Ceiling Voids	No Asbestos Found
---------------	-------------------

Underfloor Voids	No Asbestos Found
------------------	-------------------

Interior

B00X - R0001 - Practical Activities - 1hb - 14.48 m2

No Asbestos

B00X - R0002 - Personal Effects Storage - 4.49 m2

No Asbestos

B00X - R0003 - Home Base Store - 6.12 m2

No Asbestos

B00X - R0004 - Home Base - 60.32 m2

No Asbestos

B00X - R0005 - Withdrawal Space - 2hb - 11.57 m2

No Asbestos

B00X - R0006 - Practical Activities - 1hb - 14.52 m2

No Asbestos

B00X - R0007 - Personal Effects Storage - 4.49 m2

No Asbestos

B00X - R0008 - Home Base Store - 6.12 m2

No Asbestos

B00X - R0009 - Home Base - 60.32 m2

No Asbestos

B00X - R0010 - External Movement - 45.87 m2

No Asbestos

B00Y - General Learning - 2010 - Brick/Veneer

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found	
-----------------------------------	-------------------	--

Ceiling Voids	No Asbestos Found	
---------------	-------------------	--

Interior

B00Y - R0001 - Practical Activities - 1hb - 14.08 m2

No Asbestos	
-------------	--

B00Y - R0002 - Personal Effects Storage - 4.3 m2

No Asbestos	
-------------	--

B00Y - R0003 - Home Base Store - 6.29 m2

No Asbestos	
-------------	--

B00Y - R0004 - Home Base - 59.78 m2

No Asbestos	
-------------	--

B00Y - R0005 - Withdrawal Space - 2hb - 11.68 m2

No Asbestos	
-------------	--

B00Y - R0006 - Practical Activities - 1hb - 13.8 m2

No Asbestos	
-------------	--

B00Y - R0007 - Personal Effects Storage - 4.71 m2

No Asbestos	
-------------	--

B00Y - R0008 - Home Base Store - 6.37 m2

No Asbestos	
-------------	--

B00Y - R0009 - Home Base - 60.02 m2

No Asbestos	
-------------	--

B00Y - R0010 - External Movement - 54.36 m2

No Asbestos	
-------------	--

B00Y - R0011 - Movement - 5.46 m2

No Asbestos	
-------------	--

B00Y - R0012 - Special Programs Store - 9.72 m2

No Asbestos	
-------------	--

B00Y - R0013 - Practical Activities - 6.48 m2

No Asbestos	
-------------	--

B00Y - R0014 - Special Programs Room - 27.68 m2

No Asbestos	
-------------	--

Demountables

OS 602 10204 - Learning Unit - Standard With P.A.A. - Placement Date : 13-MAY-2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

NS 020 12165 - Staff Study/Store - Placement Date : 10-AUG-1999

No Asbestos Found