

# Asbestos Register


(Hazardous Materials and Risk Assessment)

School:	Kenthurst Public School (2284)
Region:	Northern Sydney AMU
State Electorate:	Castle Hill
Local Government Area:	The Hills

Last Reviewed By:	WSP 15-SEP-2016
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	<b>Yes</b>
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

2284 - Kenthurst Public School  
Site Plan (12575)

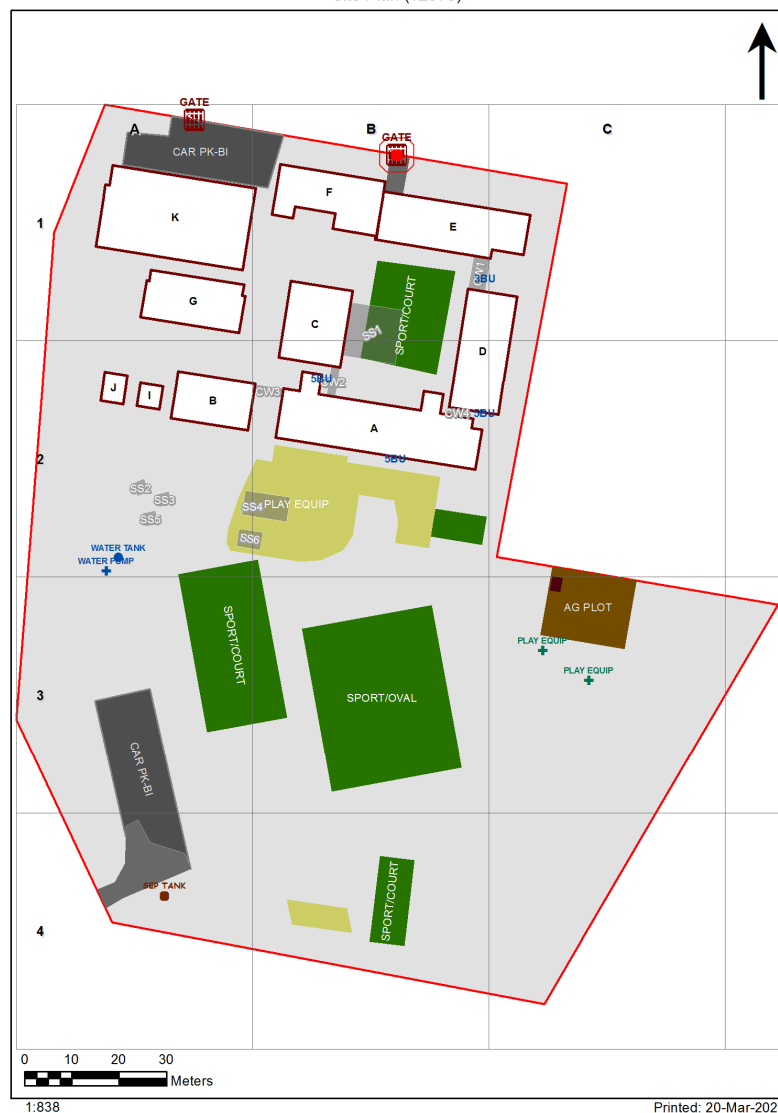

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - General Learning - 1970 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Cladding	Flat AC Sheeting	32m2	Below windows, infill panels, south	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00A - R0001 - Practical Activities - 1hb - 18.4 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0002 - Home Base - 52 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R0003 - Home Base - 59.2 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R0004 - Practical Activities - 1hb - 12.8 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0005 - Practical Activities - 1hb - 12.8 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0006 - Home Base - 58.4 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R0007 - Cleaning Supplies - 7.91 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0008 - Security Store - 15.37 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0009 - Deputy Principal - 13.01 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0010 - General Storeroom - 7.64 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0011 - Staff Toilet - 3.84 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0012 - Movement - 3.76 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00A - R0013 - Staff Toilet - 3.48 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0014 - Toilets - Girls - 28.79 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	14m2	All surfaces	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0015 - Toilets - Boys - 29.62 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	All surfaces	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0017 - Personal Effects Storage - 77.74 m2</b>							
No Asbestos							
<b>B00A - R0018 - Sports Store - 3.84 m2</b>							
No Asbestos							
<b>B00A - R0019 - Cleaning Distributed Store - 3.84 m2</b>							
No Asbestos							
<b>B00A - R1001 - Practical Activities - 1hb - 18.3 m2</b>							
Floor Coverings Res/Textile	Vnyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1002 - Home Base - 52.05 m2</b>							
No Asbestos							
<b>B00A - R1003 - Home Base - 52.21 m2</b>							
No Asbestos							
<b>B00A - R1004 - Practical Activities - 1hb - 18.38 m2</b>							
Floor Coverings Res/Textile	Vnyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1006 - Practical Activities - 1hb - 12.74 m2</b>							
Floor Coverings Res/Textile	Vnyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1007 - Home Base - 57.3 m2</b>							
No Asbestos							
<b>B00A - R1008 - General Storeroom - 46.16 m2</b>							
Floor Coverings Res/Textile	Vnyl Tiles	m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1009 - Home Base - 58.4 m2</b>							
No Asbestos							
<b>B00A - R1010 - Practical Activities - 1hb - 12.8 m2</b>							
Floor Coverings Res/Textile	Vnyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1011 - Personal Effects Storage - 73.32 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	74m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	12m2	Below windows, infill panels	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)
<b>B00B - Library - 1898 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>Interior</b>							
<b>B00B - R0001 - Reading Area - 97.4 m2</b>							
No Asbestos							

<b>B00B - R0002 - Reading Area - 21.39 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0003 - Library Office/Workroom - 9.26 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0004 - Library Office/Workroom - 10.4 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0005 - Personal Effects Storage - 10.43 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	2m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - Communal Facilities - 1970 - Brick/Veneer</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00C - R0001 - Communal Space - 103.56 m2</b>							
No Asbestos							
<b>B00C - R0002 - Movement - 93.03 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	94m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - Pupil Facilities/General Learning - 1970 - Brick/Veneer</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	20m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Cladding	Flat AC Sheeting	16m2	Below windows, infill panels	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00D - R0001 - Toilets - Boys - 23.58 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	All surfaces	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0002 - Toilets - Girls - 22.41 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	All surfaces	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0003 - Cleaning Distributed Store - 1.05 m2</b>							
No Asbestos							
<b>B00D - R0004 - Personal Effects Storage - 7.56 m2</b>							
No Asbestos							
<b>B00D - R0005 - Home Base Store - 6.3 m2</b>							
No Asbestos							
<b>B00D - R0006 - Home Base - 56.59 m2</b>							
No Asbestos							
<b>B00D - R0007 - Home Base - 56.51 m2</b>							
No Asbestos							

<b>B00D - R0008 - Home Base Store - 6.11 m2</b>							
No Asbestos							
<b>B00D - R0009 - Personal Effects Storage - 45.64 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	46m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0010 - Personal Effects Storage - 7.26 m2</b>							
No Asbestos							
<b>B00E - Administration/General Learning - 1970 - Brick/Block</b>							
<b>Exterior</b>							
Wall Cladding	Flat AC Sheeting	12m2	Below windows, infill panels	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting		Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	20m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>Interior</b>							
<b>B00E - R0001 - Staff Room - 57.28 m2</b>							
No Asbestos							
<b>B00E - R0002 - General Storeroom - 5.91 m2</b>							
No Asbestos							
<b>B00E - R0003 - Distribution Board - 1.54 m2</b>							
							<b>Note: No inspection of live electrical installation</b>
No Asbestos							
<b>B00E - R0004 - Staff Kitchen - 3.33 m2</b>							
No Asbestos							
<b>B00E - R0005 - Movement - 2.29 m2</b>							
No Asbestos							
<b>B00E - R0006 - Deputy Principal - 12.04 m2</b>							
No Asbestos							
<b>B00E - R0007 - Principal - 15.5 m2</b>							
No Asbestos							
<b>B00E - R0008 - Entry Vestibule - 17.72 m2</b>							
No Asbestos							
<b>B00E - R0009 - Staff Toilet - 4.08 m2</b>							
Wall Linings Internal	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00E - R0010 - Movement - 5.09 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0011 - Movement - 5.72 m2</b>							
No Asbestos							
<b>B00E - R0012 - Clerical Office - 15.01 m2</b>							
No Asbestos							
<b>B00E - R0013 - Clerical Office - 15.01 m2</b>							
No Asbestos							
<b>B00E - R0014 - Sick Bay - 7.69 m2</b>							
No Asbestos							
<b>B00E - R0015 - Staff Toilet - 4.01 m2</b>							
Wall Linings Internal	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00E - R0016 - General Storeroom - 7.01 m2</b>							

No Asbestos							
<b>B00E - R0017 - Cleaning Distributed Store - 4.97 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0018 - Canteen Office/Store - 2.97 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0019 - Canteen Office/Store - 2.43 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0020 - Canteen - 16.3 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0021 - Movement - 27.81 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0022 - Movement - 44.48 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	45m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R9001 - General Assistant/Bulk Store - 13.19 m2</b>							
No Asbestos							
<b>B00E - R9002 - Garden Store - 13.55 m2</b>							
No Asbestos							
<b>B00E - R9003 - General Storeroom - 42.57 m2</b>							
External Roof Structure - Packing	Flat AC Sheeting	10	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00F - General Learning - 1970 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00F - R0001 - Toilets - Boys/Girls - 3.26 m2</b>							
No Asbestos							
<b>B00F - R0002 - Personal Effects Storage - 2.13 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0003 - Practical Activities - 1hb - 21.26 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0004 - Home Base - 71.44 m2</b>							
Wall Linings Internal	Flat AC Sheeting	1m2	Behind sink, southwest	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
<b>B00F - R0005 - Home Base - 85.18 m2</b>							
No Asbestos							
<b>B00F - R0006 - Personal Effects Storage - 10.5 m2</b>							
No Asbestos							

<b>B00F - R0007 - Movement - 3.24 m2</b>							
No Asbestos							
<b>B00F - R0008 - Movement - 4.07 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00F - R0009 - Toilets - Boys/Girls - 3.74 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00G - Special Purpose - 1970 - Brick/Veneer</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>Interior</b>							
<b>B00G - R0001 - Home Base - 53.73 m2</b>							
No Asbestos							
<b>B00G - R0002 - Interview - 13.29 m2</b>							
No Asbestos							
<b>B00G - R0003 - Movement - 3.4 m2</b>							
No Asbestos							
<b>B00G - R0004 - Teachers Aide Special Ed - 9.1 m2</b>							
No Asbestos							
<b>B00G - R0005 - General Storeroom - 3.93 m2</b>							
Non Accessible							
<b>B00G - R0006 - General Storeroom - 8.4 m2</b>							
No Asbestos							
<b>B00G - R0007 - Home Base - 53.51 m2</b>							
No Asbestos							
<b>B00G - R0008 - Main Switch Board - 1.09 m2</b>							
Electrical - Mounting Board	Resinous Board	5	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Linings Internal	Flat AC Sheeting	4m2	North facing, South facing	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0009 - Movement - 16.16 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00G - R0010 - Personal Effects Storage - 24.05 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00I - Communal Facilities - 1970 - Fibre Cement Clad</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Wall Cladding	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	4m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>Interior</b>							
<b>B00I - R0001 - Entry Vestibule - 6.9 m2</b>							



Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00I - R0002 - Community Clinic - 11.13 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00I - R0003 - Staff Toilet - 4.09 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00J - Pupil Facilities - 1987 - Metal Shed</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00J - R0001 - P.E Store - 27.21 m2</b>							
No Asbestos							
<b>B00K - Multi Purpose Facilities - 2010 - Brick/Veneer</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00K - R0001 - Covered Outdoor Learning Area - 215.85 m2</b>							
No Asbestos							
<b>B00K - R0002 - Communal Space - 138.02 m2</b>							
No Asbestos							
<b>B00K - R0003 - Movement - 6.08 m2</b>							
No Asbestos							
<b>B00K - R0004 - Raised Platform - 63.96 m2</b>							
No Asbestos							
<b>B00K - R0005 - Movement - 11.54 m2</b>							
No Asbestos							
<b>B00K - R0006 - Movement - 14.08 m2</b>							
No Asbestos							
<b>B00K - R0007 - Chair Storeroom - 9.28 m2</b>							
No Asbestos							
<b>B00K - R0008 - Communal/Performance Store - 9.07 m2</b>							
No Asbestos							
<b>B00K - R0009 - P.E Store - 12.99 m2</b>							
No Asbestos							
<b>B00K - R0010 - Toilet - Lobby - 2.34 m2</b>							
No Asbestos							
<b>B00K - R0011 - Toilets - Girls - 7.34 m2</b>							
No Asbestos							

<b>B00K - R0012 - Sound Cupboard - 2.02 m2</b>	
No Asbestos	
<b>B00K - R0013 - Toilet - Lobby - 3.39 m2</b>	
No Asbestos	
<b>B00K - R0014 - Toilets - Boys - 5.71 m2</b>	
No Asbestos	
<b>B00K - R0015 - Cleaning Distributed Store - 3.49 m2</b>	
No Asbestos	
<b>B00K - R0016 - Plant - 1.53 m2</b>	
No Asbestos	
<b>B00K - R0017 - Main Switch Board - 3.26 m2</b>	
No Asbestos	
<b>B00K - R0018 - Access Shower/Toilet - 6.87 m2</b>	
No Asbestos	
<b>B00K - R9001 - General Storeroom - 14.65 m2</b>	
No Asbestos	

## Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020