


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Kingsgrove Public School (2307)
Region:	Sydney AMU
State Electorate:	Kogarah
Local Government Area:	Georges River

Last Reviewed By:	WSP 01-NOV-2016
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

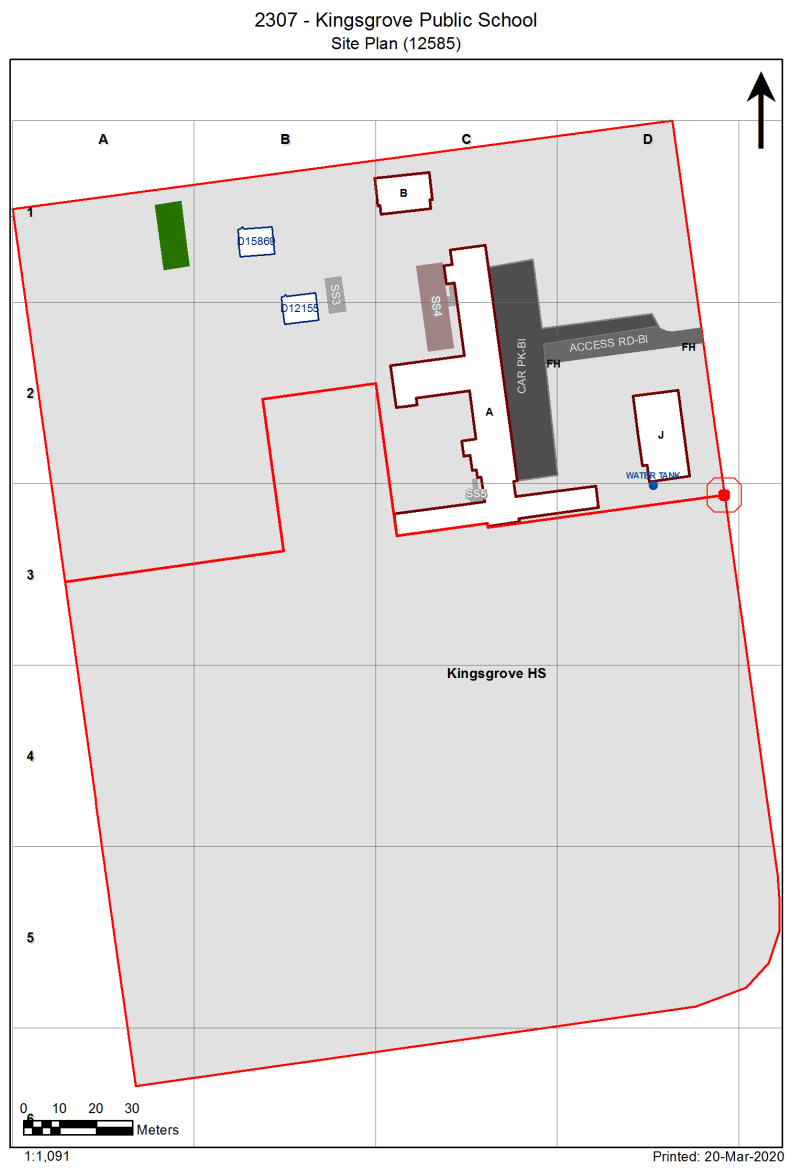

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - General Learning/Administration - 1954 - Brick/Block							
Exterior							
Underfloor Voids	Flat AC Sheeting	1	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Underfloor Voids	AC Fragments/Debris	1	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Non Accessible Area						
Interior							
B00A - R0001 - Movement - 163.21 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Above sink	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0002 - Movement - 1.69 m2							
No Asbestos							
B00A - R0003 - Duplicating Workroom - 7.08 m2							
No Asbestos							
B00A - R0004 - General Storeroom - 4.12 m2							
No Asbestos							
B00A - R0005 - Movement - 1.72 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00A - R0006 - Home Base - 47.46 m2							
No Asbestos							
B00A - R0007 - Home Base - 47.67 m2							
No Asbestos							
B00A - R0008 - Home Base - 47.48 m2							
No Asbestos							
B00A - R0009 - Sick Bay - 6.73 m2							
No Asbestos							
B00A - R0010 - Principal - 15.83 m2							
No Asbestos							
B00A - R0011 - Movement - 2.08 m2							
No Asbestos							
B00A - R0012 - Entry Vestibule - 10.43 m2							
No Asbestos							
B00A - R0013 - Clerical Office - 22.97 m2							
No Asbestos							
B00A - R0014 - Home Base - 47.73 m2							
No Asbestos							
B00A - R0015 - Home Base - 47.34 m2							
No Asbestos							
B00A - R0016 - Home Base - 47.54 m2							
No Asbestos							
B00A - R0017 - Movement - 1.69 m2							
No Asbestos							
B00A - R0018 - Movement - 8.62 m2							
No Asbestos							

B00A - R0019 - Distribution Board - 49 m2							Note: No inspection of live electrical installation
Electrical - Mounting Board	Resinous Board	2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Door - Lining	Flat AC Sheeting	2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0020 - Toilets - Girls - 47.2 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Insufficient Sample
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0021 - Cleaning Distributed Store - 3.02 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R0022 - General Storeroom - 5.27 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0023 - Cleaning Supplies - 4.7 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R0024 - Staff Room - 56.9 m2							
Floor Coverings Res/Textile	Vinyl Tiles	15m2	West facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0025 - Main Switch Board - 1.3 m2							
Floor Coverings Res/Textile	Vinyl Tiles	2m2	West facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0026 - Staff Toilet - 4.72 m2							
No Asbestos							
B00A - R0027 - Canteen - 28.03 m2							
No Asbestos							
B00A - R0030 - General Storeroom - 8.95 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0031 - Practical Activity Area - 48.75 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0032 - Toilets - Boys - 65.51 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	14m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Insufficient Sample
Ceiling Structures/Linings	Flat AC Sheeting	66m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0033 - Sports Store - 11.67 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0034 - Movement - 1.86 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00A - R0035 - General Storeroom - 7.93 m2							
No Asbestos							
B00A - R0036 - Staff Toilet - 4.81 m2							
No Asbestos							
B00A - R0037 - Movement - 2.82 m2							

Ceiling Structures/Linings	Flat AC Sheeting							
B00A - R0038 - General Storeroom - 5.41 m2								
Ceiling Structures/Linings	Flat AC Sheeting							
B00A - R0039 - Raised Platform - 41.52 m2								
No Asbestos								
B00A - R0040 - Communal Space - 121.12 m2								
No Asbestos								
B00A - R0041 - Duplicating Workroom - 4.3 m2								
No Asbestos								
B00A - R0042 - Stairs - 7.08 m2								
No Asbestos								
B00A - R0043 - Stairs - 11.32 m2								
No Asbestos								
B00A - R0044 - Disabled Shower/Toilet - 13.38 m2								
No Asbestos								
B00A - R0045 - Movement - 53.55 m2								
No Asbestos								
B00A - R1001 - Movement - 176.75 m2								
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Above sink	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1002 - Duplicating Workroom - 17.86 m2								
No Asbestos								
B00A - R1003 - General Storeroom - 7.87 m2								
Ceiling Structures/Linings	Flat AC Sheeting							
B00A - R1004 - Home Base - 47.54 m2								
No Asbestos								
B00A - R1005 - Home Base - 47.55 m2								
No Asbestos								
B00A - R1006 - Home Base - 47.47 m2								
No Asbestos								
B00A - R1007 - Sports Store - 6.7 m2								
Ceiling Structures/Linings - Access Hatch	Flat AC Sheeting							
B00A - R1008 - Interview - 16.82 m2								
No Asbestos								
B00A - R1009 - Staff Room Annexe - 5.07 m2								
No Asbestos								
B00A - R1010 - Staff Room Annexe - 17.46 m2								
No Asbestos								
B00A - R1011 - General Storeroom - 5.86 m2								
Ceiling Structures/Linings - Access Hatch	Flat AC Sheeting							
B00A - R1012 - Home Base - 47.75 m2								
No Asbestos								
B00A - R1013 - Home Base - 47.81 m2								
No Asbestos								
B00A - R1014 - Home Base - 47.49 m2								
No Asbestos								
B00A - R1015 - Special Programs Room - 86.63 m2								

No Asbestos							
B00A - R1016 - General Storeroom - 7.89 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R1017 - Staff Toilet - 6.58 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R1018 - Staff Toilet - 5.85 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R1019 - Stairs - 5.43 m2							
No Asbestos							
B00A - R1020 - Stairs - 5.76 m2							
No Asbestos							
B00A - R9001 - General Storeroom - 5.59 m2							
No Asbestos							
B00A - R9002 - General Assistant/Bulk Store - 9.09 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R9003 - General Assistant/Bulk Store - 74.12 m2							
Material - Packing	Flat AC Sheeting						
B00A - R9004 - General Storeroom - 10.13 m2							
No Asbestos							
B00B - General Learning - 1954 - Timber							
Exterior							
Underfloor Voids	Flat AC Sheeting	1	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	AC Fragments/Debris	1	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Interior							
B00B - R0001 - Home Base - 53.36 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	Northwest	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00B - R0002 - Movement - 25.88 m2							
Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	2m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0003 - General Storeroom - 5.36 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0004 - Home Base - 53.36 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	Northwest	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00C - General Learning - 1954 - Brick/Block							
Exterior							

Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00C - R0001 - P.E. Store - 20.33 m2							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0002 - Toilets - Girls - 40.35 m2							
Ceiling Structures/Linings	Flat AC Sheeting	41m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0003 - Home Base - 45.06 m2							
No Asbestos							
B00C - R0004 - Home Base - 45.72 m2							
No Asbestos							
B00C - R0005 - Home Base - 45.6 m2							
No Asbestos							
B00C - R0006 - Home Base - 47.46 m2							
No Asbestos							
B00C - R0007 - Home Base - 47.46 m2							
No Asbestos							
B00C - R0008 - General Storeroom - 20.65 m2							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0009 - Staff Toilet - 2.81 m2							
No Asbestos							
B00C - R0010 - Cleaning Distributed Store - 3.08 m2							
No Asbestos							
B00C - R0011 - Toilets - Boys - 51.27 m2							
Ceiling Structures/Linings	Flat AC Sheeting	52m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0012 - Movement - 6.21 m2							
No Asbestos							
B00C - R0013 - Movement - 92.6 m2							
No Asbestos							
B00C - R0014 - General Storeroom - 8.49 m2							
No Asbestos							
B00C - R0015 - Staff Room Annexe - 13.97 m2							
No Asbestos							
B00C - R0016 - General Storeroom - 8.74 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00C - R0017 - Disabled Toilet - 14.08 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00C - R0018 - Movement - 1.39 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0019 - Movement - 61.75 m2							
No Asbestos							
B00D - General Learning - 1954 - Brick/Block							
Exterior							
Underfloor Voids	Flat AC Sheeting	1	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Interior							

B00D - R0001 - Outdoor Learning Area - 39.66 m2							
No Asbestos							
B00D - R0002 - Home Base - 46.7 m2							
No Asbestos							
B00D - R0003 - Toilets - Boys/Girls - 4.58 m2							
No Asbestos							
B00D - R0004 - Home Base - 65.25 m2							
No Asbestos							
B00D - R0005 - Practical Activities - 1hb - 1.31 m2							
No Asbestos							
B00D - R0006 - Home Base - 46.71 m2							
No Asbestos							
B00D - R0007 - Home Base - 46.97 m2							
No Asbestos							
B00D - R0008 - Home Base - 46.9 m2							
No Asbestos							
B00D - R0009 - Movement - 2.05 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0010 - Interview - 11.6 m2							
No Asbestos							
B00D - R0011 - Staff Toilet - 3.15 m2							
No Asbestos							
B00D - R0012 - Cleaning Distributed Store - 1.59 m2							
No Asbestos							
B00D - R0013 - Staff Toilet - 3.05 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R0014 - Home Base Store - 13.72 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R0015 - Security Store - 8.88 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R0016 - Movement - 83.44 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R0017 - Movement - 1.52 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0018 - Craft Store - 4.65 m2							
No Asbestos							
B00D - R0019 - Movement - 2.8 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R9001 - General Assistant/Bulk Store - 18.83 m2							
No Asbestos							
B00D - R9002 - General Storeroom - 56.84 m2							
No Asbestos							
B00E - General Learning - 1954 - Timber							
Exterior							
Wall Cladding	Flat AC Sheeting						
Underfloor Voids	Flat AC Sheeting						

Ceiling Voids	No Asbestos Found	
Interior		
B00E - R0001 - Movement - 24.91 m2		
No Asbestos		
B00E - R0002 - Home Base - 47.48 m2		
No Asbestos		
B00E - R0003 - Communal Space - 46.54 m2		
No Asbestos		
B00F - Pupil Facilities - 1940 - Timber		
Exterior		
Ceiling Voids	Non Accessible Area	
Underfloor Voids	No Asbestos Found	
Interior		
B00F - R0001 - Movement - 12.26 m2		
No Asbestos		
B00F - R0002 - Canteen - 46.66 m2		
No Asbestos		
B00H - General Learning - 2004 - Fibre Cement Clad		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00H - R0001 - Movement - 38.45 m2		
No Asbestos		
B00H - R0002 - Practical Activities - 1hb - 19.4 m2		
No Asbestos		
B00H - R0003 - Home Base Store - 6.02 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00H - R0004 - Home Base - 59.21 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00H - R0005 - Withdrawal Space - 2hb - 11.36 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00H - R0006 - Home Base - 59.19 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00H - R0007 - Home Base Store - 6.02 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00H - R0008 - Practical Activities - 1hb - 19.4 m2		
No Asbestos		
B00I - Administration/Library - 2010 - Brick/Veneer		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00I - R0001 - Entry Vestibule - 14.67 m2		
No Asbestos		
B00I - R0002 - Clerical Office - 22.46 m2		

No Asbestos		
B00I - R0003 - Sick Bay - 9.37 m2		
No Asbestos		
B00I - R0004 - Staff Room - 38.79 m2		
No Asbestos		
B00I - R0005 - Staff Room Annexe - 19.53 m2		
No Asbestos		
B00I - R0007 - Communications Room - 8.79 m2		
No Asbestos		
B00I - R0008 - K.L.A. Store - 9.55 m2		
No Asbestos		
B00I - R0009 - Reading Area - 90.75 m2		
No Asbestos		
B00I - R0010 - Library Office/Workroom - 19.28 m2		
No Asbestos		
B00I - R0011 - Security Store - 14.36 m2		
No Asbestos		
B00I - R0012 - Cleaning Distributed Store - 2.77 m2		
No Asbestos		
B00I - R0013 - Main Switch Board - 2.81 m2		
No Asbestos		
B00I - R0014 - Staff Toilet - 4.85 m2		
No Asbestos		
B00I - R0015 - Staff Toilet - 4.85 m2		
No Asbestos		
B00I - R0016 - Staff Toilet - 4.85 m2		
No Asbestos		
B00I - R0017 - Access Shower/Toilet - 5.06 m2		
No Asbestos		
B00I - R0018 - Principal - 19.08 m2		
No Asbestos		
B00I - R0019 - Movement - 35.81 m2		
No Asbestos		
B00I - R0020 - External Movement - 49.83 m2		
No Asbestos		
B00J - Library - 2010 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00J - R0001 - External Movement - 48.29 m2		
No Asbestos		
B00J - R0002 - Toilet - Lobby - 2.38 m2		
No Asbestos		
B00J - R0003 - Toilets-Unisex - 4.62 m2		
No Asbestos		
B00J - R0004 - Cleaning Distributed Store - 3.62 m2		
No Asbestos		
B00J - R0005 - Reading Area - 169.45 m2		
No Asbestos		
B00J - R0006 - K.L.A. Store - 14.35 m2		

No Asbestos	
B00J - R0007 - Communications Room - 7.92 m2	
No Asbestos	
B00J - R0008 - Library Office/Workroom - 22.36 m2	
No Asbestos	
B00J - R0009 - Distribution Board - .6 m2	Note: No inspection of live electrical installation
No Asbestos	

Demountables

OS 601 12155 - Learning Unit - Standard/Withdrawal - Placement Date : 09-JAN-2005

Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- Entry

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

R2- General Learning Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

R3- Store

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

OS 602 15869 - Learning Unit - Standard With P.A.A. - Placement Date : 30-SEP-2009

Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- Learning space/withdrawal/entry

Ceiling Structures/Linings	Flat AC Sheeting	70m2	Assumed Asbestos
----------------------------	------------------	------	------------------

R2- Home Base Store

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Assumed Asbestos

OS 522 18180 - Staff Study - Placement Date : 05-AUG-2008

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found