


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Kingswood Public School (2312)
Region:	Western Sydney AMU
State Electorate:	Penrith
Local Government Area:	Penrith

Last Reviewed By:	WSP 17-JUN-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

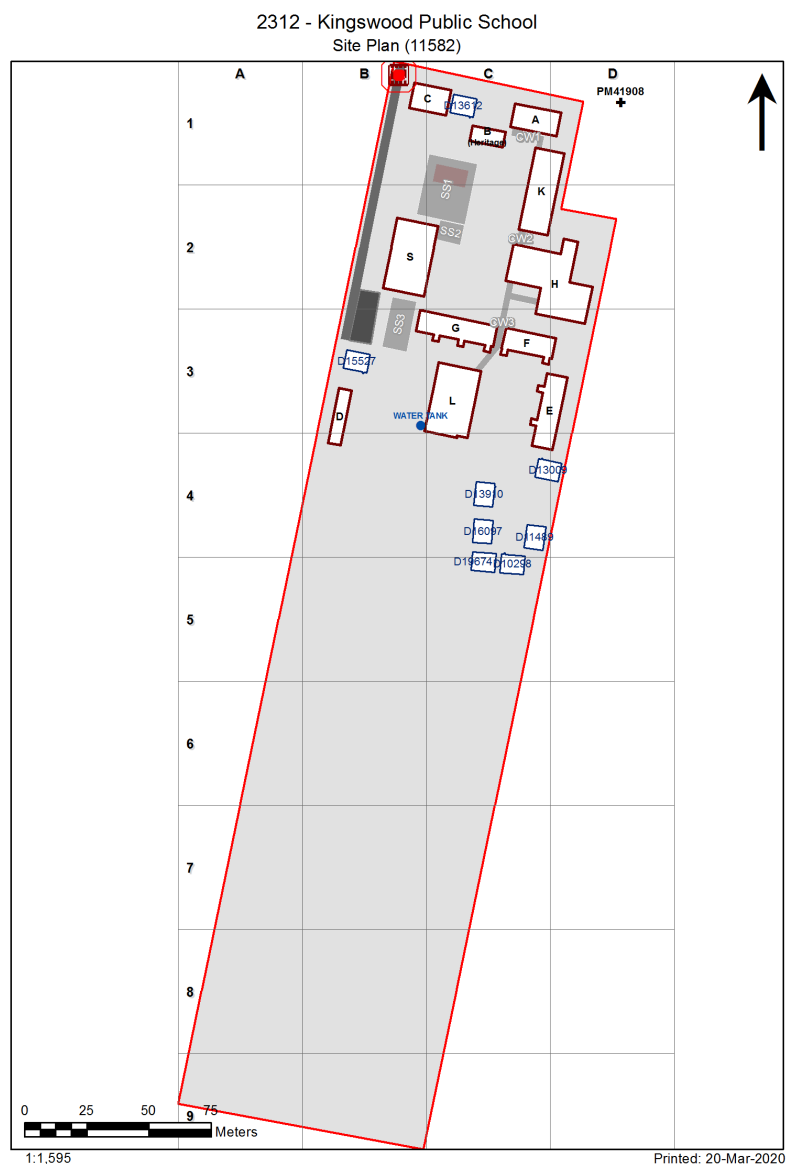

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - General Learning/Administration - 1959 - Brick/Block							
Exterior							
Gable Verge Lining	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	No Asbestos Found						
Ceiling Voids	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B00A - R0002 - Movement - 9.35 m2							
No Asbestos							
B00A - R0003 - Toilets - Boys/Girls - 1.47 m2							
No Asbestos							
B00A - R0004 - Home Base Store - 11.41 m2							
No Asbestos							
B00A - R0005 - Home Base - 91.27 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	Panels behind heaters	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0006 - Movement - 13.49 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0007 - General Storeroom - 2.56 m2							
No Asbestos							
B00A - R0008 - General Storeroom - 1.01 m2							
No Asbestos							
B00A - R0009 - Community Clinic - 15.93 m2							
No Asbestos							
B00A - R0010 - General Storeroom - 12.67 m2							
No Asbestos							
B00B - General Learning - 1892 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	No Asbestos Found						
Ceiling Voids	Non Accessible Area						
Interior							
B00B - R0001 - Practical Activities - 1hb - 29.45 m2							
No Asbestos							
B00B - R0002 - Special Programs Room - 44.28 m2							
No Asbestos							
B00C - General Learning - 1954 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						

Eaves Linings	Flat AC Sheeting	6m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B00C - R0001 - Home Base - 52.63 m2							
No Asbestos							
B00C - R0002 - Movement - 35.21 m2							
No Asbestos							
B00C - R0003 - Home Base - 52.48 m2							
No Asbestos							
B00D - Pupil Facilities/Administration - 1963 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Interior							
B00D - R0001 - Toilets - Boys - 47.22 m2							
No Asbestos							
B00D - R0002 - General Storeroom - 8.27 m2							
No Asbestos							
B00D - R0003 - Toilets - Girls - 43.04 m2							
No Asbestos							
B00E - General Learning - 1967 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Gable Verge Lining	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	Flat AC Sheeting	2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	Non Accessible Area						
Interior							
B00E - R0001 - Home Base - 85.12 m2							
No Asbestos							
B00E - R0002 - External Movement - 4.54 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0003 - Home Base - 57.1 m2							
No Asbestos							
B00E - R0004 - Home Base Store - 4.11 m2							
No Asbestos							
B00E - R0005 - Movement - 19.1 m2							
No Asbestos							
B00E - R0006 - External Movement - 4.61 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0007 - Home Base Store - 4.11 m2							
No Asbestos							
B00E - R0008 - Home Base - 57.65 m2							
No Asbestos							

B00E - R9001 - Sports Store - 22.77 m2							
No Asbestos							
B00F - General Learning - 1967 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00F - R0001 - Interview - 9.04 m2							
No Asbestos							
B00F - R0002 - Personal Effects Storage - 7.33 m2							
No Asbestos							
B00F - R0003 - Movement - 6.41 m2							
No Asbestos							
B00F - R0004 - External Movement - 4.64 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0005 - Home Base Store - 4.55 m2							
No Asbestos							
B00F - R0006 - Home Base - 56.46 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	Panels behind heaters	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0007 - Home Base - 56.54 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	Panels behind heaters	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0008 - Home Base Store - 7.12 m2							
No Asbestos							
B00F - R0009 - Personal Effects Storage - 3.61 m2							
No Asbestos							
B00F - R0010 - Movement - 3.13 m2							
No Asbestos							
B00F - R0011 - External Movement - 3.52 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	4m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - General Learning - 1967 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Gable Verge Lining	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00G - R0001 - Interview - 18.27 m2							
No Asbestos							
B00G - R0002 - Movement - 9.85 m2							

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0003 - External Movement - 4.52 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0004 - Home Base - 57.05 m2							
No Asbestos							
B00G - R0005 - Home Base Store - 4.34 m2							
No Asbestos							
B00G - R0006 - Movement - 18.53 m2							
No Asbestos							
B00G - R0007 - External Movement - 4.56 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0008 - Home Base Store - 4.4 m2							
No Asbestos							
B00G - R0009 - Home Base - 56.81 m2							
No Asbestos							
B00G - R0010 - External Movement - 4.49 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0011 - Movement - 4.21 m2							
No Asbestos							
B00G - R0012 - Personal Effects Storage - 4.5 m2							
No Asbestos							
B00G - R0013 - Home Base Store - 4.41 m2							
No Asbestos							
B00G - R0014 - Home Base - 57.44 m2							
No Asbestos							
B00H - Administration/Library - 1974 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00H - R0001 - Reading Area - 200.68 m2							
No Asbestos							
B00H - R0002 - Library Office/Workroom - 8.66 m2							
No Asbestos							
B00H - R0003 - Seminar/Study - 8.66 m2							
No Asbestos							
B00H - R0004 - Toilets - Girls - 4.85 m2							
No Asbestos							
B00H - R0005 - Toilets - Boys - 5.13 m2							
No Asbestos							
B00H - R0006 - Movement - 8.97 m2							
No Asbestos							
B00H - R0008 - Library Office/Workroom - 17.64 m2							
No Asbestos							
B00H - R0009 - Library Office/Workroom - 7.62 m2							
No Asbestos							

B00H - R0010 - Communications Room - 11.56 m2							
No Asbestos							
B00H - R0011 - Movement - 80.61 m2							
No Asbestos							
B00H - R0012 - Staff Room - 56.91 m2							
Floor Coverings Res/Textile	Vinyl Tiles	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0013 - Distribution Board - .73 m2 Note: No inspection of live electrical installation							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0014 - General Storeroom - 7.6 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0015 - General Storeroom - 6.18 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0016 - Interview - 13.45 m2							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0017 - Principal - 16.89 m2							
Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0018 - Deputy Principal - 11.8 m2							
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0019 - Movement - 10.19 m2							
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0020 - External Movement - 32.14 m2							
Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0021 - Movement - 32.4 m2							
Floor Coverings Res/Textile	Vinyl Tiles	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0022 - Clerical Office - 12.99 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0023 - Duplicating Workroom - 12.6 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0024 - Sick Bay - 8.06 m2							
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0025 - Interview - 12.81 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0026 - Community Clinic - 14.84 m2							
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0027 - Staff Toilet - 3.66 m2							
No Asbestos							
B00H - R0028 - Staff Toilet - 4.02 m2							
No Asbestos							
B00K - General Learning/Pupil Facilities - 1974 - Brick/Block							
Exterior							

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	10m2	North & South	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00K - R0001 - Toilets - Boys/Girls - 2.92 m2							
No Asbestos							
B00K - R0002 - Practical Activities - 1hb - 15.62 m2							
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0003 - Home Base - 87.62 m2							
No Asbestos							
B00K - R0004 - Home Base - 89.49 m2							
No Asbestos							
B00K - R0005 - Practical Activities - 1hb - 16.78 m2							
Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0006 - Toilets - Boys/Girls - 2.91 m2							
No Asbestos							
B00K - R0007 - Main Switch Board - 4.92 m2							
No Asbestos							
B00K - R0008 - Toilets - Girls - 30.79 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
B00K - R0009 - Cleaning Distributed Store - 4.05 m2							
Ceiling Structures/Linings - Access Hatch	Flat AC Sheeting	1m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0010 - Toilets - Boys - 30.79 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
B00K - R0011 - External Movement - 68.78 m2							
Ceiling Structures/Linings	Flat AC Sheeting	69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - Pupil Facilities/Communal Facilities - 2010 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00L - R0001 - Communal Space - 147.06 m2							
No Asbestos							
B00L - R0002 - Raised Platform - 59.62 m2							
No Asbestos							
B00L - R0003 - Movement - 6.7 m2							
No Asbestos							
B00L - R0004 - Movement - 11.57 m2							
No Asbestos							
B00L - R0005 - Movement - 11.83 m2							
No Asbestos							
B00L - R0006 - Hall Chair Store - 9.5 m2							

No Asbestos							
B00L - R0007 - Communal/Performance Store - 9.5 m2							
No Asbestos							
B00L - R0008 - P.E Store - 13.02 m2							
No Asbestos							
B00L - R0009 - Toilet - Lobby - 2.37 m2							
No Asbestos							
B00L - R0010 - Toilets - Girls - 7.31 m2							
No Asbestos							
B00L - R0011 - Sound Cupboard - 2.06 m2							
No Asbestos							
B00L - R0012 - Toilet - Lobby - 3.11 m2							
No Asbestos							
B00L - R0013 - Toilets - Boys - 5.76 m2							
No Asbestos							
B00L - R0014 - Cleaning Distributed Store - 5.19 m2							
No Asbestos							
B00L - R0015 - Disabled Shower/Toilet - 6.87 m2							
No Asbestos							
B00L - R0016 - Main Switch Board - 3.23 m2							
No Asbestos							
B00L - R0017 - Covered Outdoor Learning Area - 150.51 m2							
No Asbestos							
B00S - Communal Facilities/Pupil Facilities - 1974 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00S - R0001 - External Movement - 176.5 m2							
No Asbestos							
B00S - R0002 - Communal Space - 129.69 m2							
No Asbestos							
B00S - R0003 - Raised Platform - 21.76 m2							
No Asbestos							
B00S - R0004 - Toilets - Girls - 9.81 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00S - R0005 - Movement - 30.4 m2							
No Asbestos							
B00S - R0006 - General Storeroom - 8.08 m2							
No Asbestos							
B00S - R0007 - Garden Store - 13.43 m2							
No Asbestos							
B00S - R0008 - Toilets - Boys - 9.81 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00S - R0010 - Canteen - 12.67 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00S - R0012 - Canteen - 25.96 m2							
No Asbestos							

B00S - R0013 - Canteen Office/Store - 2.11 m2	
No Asbestos	
B00S - R0014 - Staff Toilet - 6.48 m2	
No Asbestos	

Demountables

OS 602 10298 - Learning Unit - Standard With P.A.A. - Placement Date : 07-NOV-2018

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 606 11489 - Learning Unit - Standard With P.A.A A/C - Placement Date : 21-SEP-2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 13009 - Learning Unit - Standard With P.A.A. - Placement Date : 24-FEB-2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 13612 - Learning Unit - Standard With P.A.A. - Placement Date : 21-MAR-2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 13910 - Learning Unit - Standard With P.A.A. - Placement Date : 18-JAN-2020

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 15527 - Learning Unit - Standard With P.A.A. - Placement Date : 04-MAR-2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 606 16097 - Learning Unit - Standard With P.A.A A/C - Placement Date : 14-JUN-2019

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 606 19674 - Learning Unit - Standard With P.A.A A/C - Placement Date : 07-MAR-2019

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found