


# Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Kootingal Public School (2327)
Region:	North Western NSW AMU
State Electorate:	Tamworth
Local Government Area:	Tamworth

Last Reviewed By:	WSP 08-AUG-2016
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

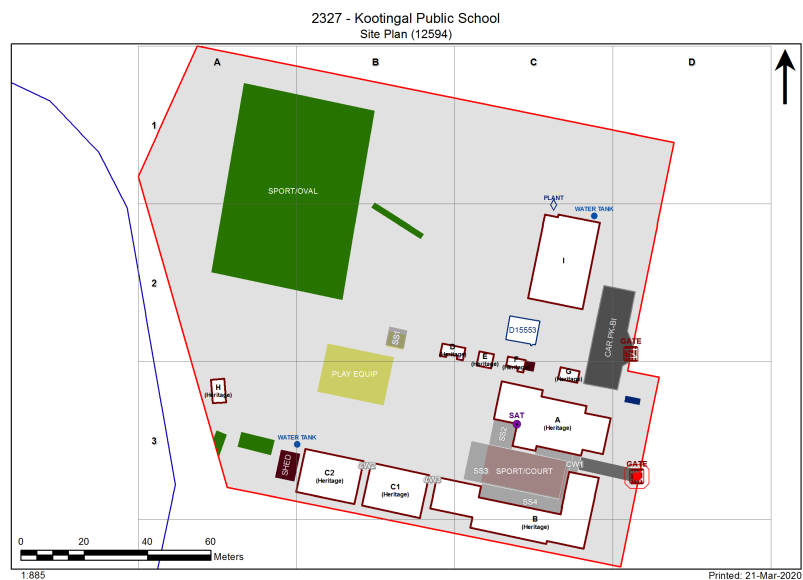

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

### Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

### Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

### Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

#### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - Administration/Library - 1982 - Brick/Veneer</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	12m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00A - R0001 - Entry Vestibule - 12.89 m2</b>							
No Asbestos							
<b>B00A - R0002 - Principal - 17.11 m2</b>							
No Asbestos							
<b>B00A - R0003 - Sick Bay - 8.52 m2</b>							
No Asbestos							
<b>B00A - R0004 - Staff Toilet - 4.72 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0005 - Cleaning Distributed Store - .88 m2</b>							
No Asbestos							
<b>B00A - R0006 - Staff Toilet - 4.72 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0007 - Interview - 12.82 m2</b>							
No Asbestos							
<b>B00A - R0008 - Deputy Principal - 12.89 m2</b>							
No Asbestos							
<b>B00A - R0009 - Movement - 9.72 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0010 - Movement - 8.01 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0011 - Distribution Board - 1.6 m2</b>						<b>Note: No inspection of live electrical installation</b>	
No Asbestos							
<b>B00A - R0015 - Communications Room - 8.59 m2</b>							
No Asbestos							
<b>B00A - R0016 - Library Office/Workroom - 17.36 m2</b>							
No Asbestos							
<b>B00A - R0017 - Seminar/Study - 8.73 m2</b>							
No Asbestos							
<b>B00A - R0018 - Reading Area - 89.46 m2</b>							
No Asbestos							
<b>B00A - R0020 - Staff Room - 35.88 m2</b>							
No Asbestos							
<b>B00A - R0021 - Uniform Shop - 17.11 m2</b>							
No Asbestos							
<b>B00A - R0022 - Disabled Toilet - 2.99 m2</b>							

No Asbestos							
<b>B00A - R0023 - Uniform Shop - 5.36 m2</b>							
No Asbestos							
<b>B00A - R0024 - Duplicating Workroom - 19.75 m2</b>							
No Asbestos							
<b>B00A - R0025 - Clerical Office - 13.67 m2</b>							
No Asbestos							
<b>B00A - R0026 - Movement - 30.6 m2</b>							
No Asbestos							
<b>B00A - R0027 - Movement - 52.79 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0028 - Movement - 8.34 m2</b>							
No Asbestos							
<b>B00A - R0029 - Reading Area - 44.31 m2</b>							
No Asbestos							
<b>B00A - R0030 - Special Programs Room - 6.94 m2</b>							
No Asbestos							
<b>B00A - R0031 - General Storeroom - 1.99 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00A - R0032 - Movement - 12.75 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00A - R0033 - K.L.A. Store - 2.88 m2</b>							
No Asbestos							
<b>B00B - General Learning/Pupil Facilities - 1913 - Timber</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	70m2	East & South elevations adj BR0023, North elevation adj BR0027	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00B - R0001 - Home Base Store - 4.32 m2</b>							
No Asbestos							
<b>B00B - R0002 - Home Base - 55.72 m2</b>							
No Asbestos							
<b>B00B - R0003 - Withdrawal Space - 1hb - 9.04 m2</b>							
No Asbestos							
<b>B00B - R0004 - Practical Activities - 1hb - 15.38 m2</b>							
No Asbestos							
<b>B00B - R0005 - Home Base - 60.47 m2</b>							
No Asbestos							
<b>B00B - R0006 - Withdrawal Space - 1hb - 15.81 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0007 - Home Base Store - 6.8 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0008 - Craft Store - 2.68 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0009 - Home Base Store - 5.24 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0010 - Practical Activities - 1hb - 16.21 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0011 - Withdrawal Space - 1hb - 5.55 m2</b>							
No Asbestos							
<b>B00B - R0012 - Home Base - 53.37 m2</b>							
No Asbestos							
<b>B00B - R0013 - Home Base - 53.29 m2</b>							
No Asbestos							
<b>B00B - R0014 - Practical Activities - 1hb - 19.18 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0015 - Withdrawal Space - 1hb - 5.61 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0016 - Home Base Store - 5.53 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0017 - General Storeroom - 3.12 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0018 - Craft Store - 8.83 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0019 - Cleaning Distributed Store - 1.66 m2</b>							
No Asbestos							
<b>B00B - R0020 - Cleaning Supplies - 9.62 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0021 - Toilets - Boys - 9.39 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0022 - Toilets - Girls - 9.35 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0023 - Home Base - 52.41 m2</b>							
Wall Linings Internal	Flat AC Sheeting	70m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0024 - Home Base Store - 4.76 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0025 - General Storeroom - 5.82 m2</b>							
Wall Linings Internal	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0026 - Movement - 39.41 m2</b>							
No Asbestos							
<b>B00B - R0027 - Movement - 98.12 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	60m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00D - Pupil Facilities - 1948 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00D - R0001 - Toilets - Boys - 23.18 m2</b>							
Wall Linings Internal	Flat AC Sheeting	40m2	Middle portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - Pupil Facilities - 1948 - Timber</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00E - R0001 - Drinking Facilities - 9.41 m2</b>							
No Asbestos							
<b>B00E - R0002 - Drinking Facilities - 9.41 m2</b>							
No Asbestos							
<b>B00F - Pupil Facilities - 1948 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00F - R0001 - Toilets - Girls - 16.72 m2</b>							
Wall Linings Internal	Flat AC Sheeting	40m2	Middle portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - Communal Facilities - 1948 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						

<b>Interior</b>							
<b>B00G - R0001 - Sports Store - 15.67 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet	16m2	All surfaces	Friable Asbestos (5)	Medium (2)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0002 - Movement - 4.32 m2</b>							
No Asbestos							
<b>B00H - Other - 2007 - Metal Shed</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00H - R0001 - Sports Store - 30.34 m2</b>							
No Asbestos							
<b>B00I - Communal Facilities - 2011 - Brick/Veneer</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00I - R0001 - Communal Space - 144.95 m2</b>							
No Asbestos							
<b>B00I - R0002 - Raised Platform - 57.82 m2</b>							
No Asbestos							
<b>B00I - R0003 - Hall Chair Store - 9.63 m2</b>							
No Asbestos							
<b>B00I - R0004 - Communal/Performance Store - 9.49 m2</b>							
No Asbestos							
<b>B00I - R0005 - P.E Store - 13.09 m2</b>							
No Asbestos							
<b>B00I - R0006 - Toilet - Lobby - 2.04 m2</b>							
No Asbestos							
<b>B00I - R0007 - Toilets - Girls - 7.47 m2</b>							
No Asbestos							
<b>B00I - R0008 - Sound Cupboard - 2.03 m2</b>							
No Asbestos							
<b>B00I - R0009 - Toilet - Lobby - 3.16 m2</b>							
No Asbestos							
<b>B00I - R0010 - Toilets - Boys - 5.78 m2</b>							
No Asbestos							
<b>B00I - R0011 - Cleaning Distributed Store - 3.68 m2</b>							
No Asbestos							
<b>B00I - R0012 - General Storeroom - 1.56 m2</b>							
No Asbestos							
<b>B00I - R0013 - Main Switch Board - 3.54 m2</b>							
No Asbestos							
<b>B00I - R0014 - Access Shower/Toilet/Change - 6.65 m2</b>							
No Asbestos							
<b>B00I - R0015 - Covered Outdoor Learning Area - 151.73 m2</b>							
No Asbestos							

<b>B001 - R0016 - Movement - 7.3 m2</b>		
No Asbestos		
<b>B001 - R0017 - Ramp - 10.64 m2</b>		
No Asbestos		
<b>B001 - R0018 - Movement - 12.69 m2</b>		
No Asbestos		
<b>B0C1 - General Learning - 1993 - Timber</b>		
<b>Exterior</b>		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
<b>Interior</b>		
<b>B0C1 - R0001 - Movement - 34.94 m2</b>		
No Asbestos		
<b>B0C1 - R0002 - Practical Activities - 1hb - 17.27 m2</b>		
No Asbestos		
<b>B0C1 - R0003 - Home Base - 59.54 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0C1 - R0004 - Home Base Store - 5.8 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0C1 - R0005 - Movement - 13.92 m2</b>		
No Asbestos		
<b>B0C1 - R0006 - Withdrawal Space - 1hb - 11.86 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0C1 - R0007 - Movement - 13.92 m2</b>		
No Asbestos		
<b>B0C1 - R0008 - Home Base Store - 5.8 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0C1 - R0009 - Home Base - 59.47 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0C1 - R0010 - Practical Activities - 1hb - 17.19 m2</b>		
No Asbestos		
<b>B0C2 - General Learning - 1993 - Timber</b>		
<b>Exterior</b>		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
<b>Interior</b>		
<b>B0C2 - R0001 - Movement - 34.94 m2</b>		
No Asbestos		
<b>B0C2 - R0002 - Practical Activities - 1hb - 17.27 m2</b>		
No Asbestos		
<b>B0C2 - R0003 - Home Base - 59.54 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0C2 - R0004 - Home Base Store - 5.8 m2</b>		



Floor Coverings Res/Textile	No Asbestos Found	
<b>B0C2 - R0005 - Movement - 13.92 m2</b>		
No Asbestos		
<b>B0C2 - R0006 - Withdrawal Space - 1hb - 11.86 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0C2 - R0007 - Movement - 13.92 m2</b>		
No Asbestos		
<b>B0C2 - R0008 - Home Base Store - 5.8 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0C2 - R0009 - Home Base - 59.47 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B0C2 - R0010 - Practical Activities - 1hb - 17.19 m2</b>		
No Asbestos		

## Demountables

OS 804 15553 - FSU - Placement Date : 30-JUN-1995

### Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

### Interior

#### R1- Canteen

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Assumed Asbestos

#### R2- Covered Area

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Assumed Asbestos