

Asbestos Register


(Hazardous Materials and Risk Assessment)

School:	Kororo Public School (2330)
Region:	North Coast AMU
State Electorate:	Coffs Harbour
Local Government Area:	Coffs Harbour

Last Reviewed By:	WSP 28-FEB-2017
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

2330 - Kororo Public School
Site Plan (12595)

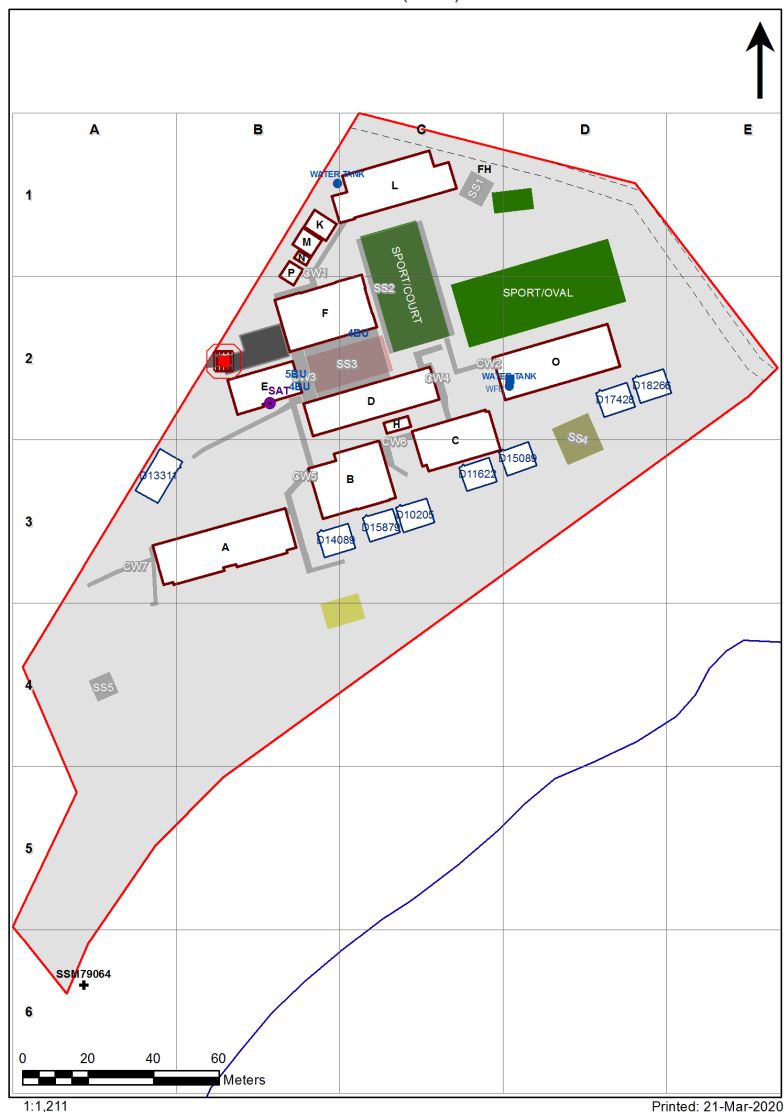

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - General Learning - 1991 - Brick/Veneer							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00A - R0001 - General Storeroom - 11.92 m2							
No Asbestos							
B00A - R0002 - Home Base Store - 6.31 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00A - R0003 - Withdrawal Space - 1hb - 6.05 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00A - R0008 - Home Base Store - 5.99 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00A - R0009 - Withdrawal Space - 1hb - 12.83 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00A - R0010 - Home Base Store - 5.99 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00A - R0014 - Withdrawal Space - 1hb - 6.03 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00A - R0015 - Home Base Store - 6.28 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00A - R0017 - Garden Store - 11.92 m2							
No Asbestos							
B00A - R0018 - Distribution Board - .42 m2							
No Asbestos							Note: No inspection of live electrical installation
B00A - R0019 - Kiln Room - 4.85 m2							
No Asbestos							
B00A - R0020 - Cleaning Distributed Store - 4.91 m2							
No Asbestos							
B00A - R0021 - External Movement - 99.05 m2							
No Asbestos							
B00A - R0022 - Home Base - 61.34 m2							
No Asbestos							
B00A - R0023 - Practical Activities - 18.24 m2							
No Asbestos							
B00A - R0024 - Home Base - 61.32 m2							
No Asbestos							
B00A - R0025 - Practical Activities - 18.24 m2							
No Asbestos							
B00A - R0026 - Home Base - 61.05 m2							
No Asbestos							
B00A - R0027 - Practical Activities - 19.14 m2							
No Asbestos							
B00A - R0028 - Home Base - 61.33 m2							

No Asbestos		
B00A - R0029 - Practical Activities - 18.41 m2		
No Asbestos		
B00B - Library - 1982 - Brick/Veneer		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00B - R0004 - Communications Room - 42.84 m2		
No Asbestos		
B00B - R0005 - K.L.A. Store - 4.87 m2		
No Asbestos		
B00B - R0006 - Cleaning Distributed Store - 1.98 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
Wall Linings Internal	Flat AC Sheeting	
B00B - R0007 - Distribution Board - .51 m2		Note: No inspection of live electrical installation
No Asbestos		
B00B - R0008 - External Movement - 102.41 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
Wall Linings Internal	Flat AC Sheeting	
B00B - R0011 - K.L.A. Store - 15.7 m2		
No Asbestos		
B00B - R0012 - Library Office/Workroom - 15.92 m2		
No Asbestos		
B00B - R0013 - Reading Area - 155.47 m2		
No Asbestos		
B00B - R0014 - Reading Area - 38.01 m2		
No Asbestos		
B00C - General Learning - 1914 - Brick/Block		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00C - R0001 - Distribution Board - .75 m2		Note: No inspection of live electrical installation
No Asbestos		
B00C - R0002 - Home Base Store - 5.01 m2		
No Asbestos		
B00C - R0003 - Home Base Store - 5.88 m2		
No Asbestos		
B00C - R0004 - Withdrawal Space - 1hb - 6.05 m2		
No Asbestos		
B00C - R0009 - Withdrawal Space - 1hb - 6.05 m2		
No Asbestos		
B00C - R0010 - Home Base Store - 5.88 m2		
No Asbestos		
B00C - R0011 - Toilets - Girls - 15.25 m2		
Wall Linings Internal	Flat AC Sheeting	
B00C - R0013 - Toilets - Boys - 11.87 m2		

No Asbestos							
B00C - R0014 - External Movement - 82.92 m2							
No Asbestos							
B00C - R0015 - Home Base - 51.75 m2							
No Asbestos							
B00C - R0016 - Practical Activities - 19.92 m2							
No Asbestos							
B00C - R0017 - Home Base - 51.32 m2							
No Asbestos							
B00C - R0018 - Practical Activities - 25.78 m2							
No Asbestos							
B00D - General Learning - 1985 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	50m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Compressed AC Sheet	15	South, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00D - R0001 - Cleaning Distributed Store - 7.15 m2							
No Asbestos							
B00D - R0002 - General Storeroom - 6.22 m2							
No Asbestos							
B00D - R0003 - Practical Activities - 1hb - 22.09 m2							
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0004 - Special Programs Room - 49.39 m2							
No Asbestos							
B00D - R0005 - Movement - 3.58 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0006 - Personal Effects Storage - 5.52 m2							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0007 - Home Base Store - 4.75 m2							
No Asbestos							
B00D - R0008 - Home Base - 57.12 m2							
No Asbestos							
B00D - R0009 - Home Base - 57.28 m2							
No Asbestos							
B00D - R0010 - Home Base Store - 4.7 m2							
No Asbestos							
B00D - R0011 - Personal Effects Storage - 5.52 m2							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0012 - Movement - 3.61 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0013 - Toilets - Boys - 29.01 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0015 - Toilets - Girls - 26.24 m2							

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East	Good Condition (1)	Low (1)	Low Priority(2-3)	Chrysotile (white asbestos)
B00D - R0017 - Main Switch Board - 4.41 m2							
No Asbestos							
B00D - R0018 - General Storeroom - 5.6 m2							
No Asbestos							
B00D - R0019 - External Movement - 73.47 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal - Infill	Compressed AC Sheet	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority(2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0020 - Toilet - Lobby - 1.64 m2							
No Asbestos							
B00D - R0021 - Staff Toilet - 1.87 m2							
No Asbestos							
B00D - R0022 - Toilet - Lobby - 1.71 m2							
No Asbestos							
B00D - R0023 - Staff Toilet - 2.04 m2							
No Asbestos							
B00E - Administration/Staff Facilities - 1915 - Timber							
Exterior							
Underfloor Voids	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Interior							
B00E - R0003 - General Storeroom - 13.42 m2							
No Asbestos							
B00E - R0004 - Clerical Office - 14.12 m2							
No Asbestos							
B00E - R0005 - Duplicating Workroom - 22.03 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00E - R0006 - Sick Bay - 7.3 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00E - R0007 - Principal - 10.34 m2							
No Asbestos							
B00E - R0008 - Entry Vestibule - 6.59 m2							
No Asbestos							
B00E - R0009 - Movement - 7.46 m2							
No Asbestos							
B00E - R0010 - Interview - 9.45 m2							
No Asbestos							
B00E - R0011 - Withdrawal Space - 1hb - 13.47 m2							
No Asbestos							
B00E - R0012 - External Movement - 46.01 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00E - R0013 - Staff Study - 24.5 m2							
No Asbestos							
B00E - R0014 - Deputy Principal - 9.75 m2							
No Asbestos							
B00E - R0015 - Deputy Principal - 9.06 m2							
No Asbestos							

B00E - R0016 - Movement - 2.92 m2		
No Asbestos		
B00F - Communal Facilities/Pupil Facilities - 1969 - Brick/Veneer		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00F - R0001 - Distribution Board - 1.51 m2		Note: No inspection of live electrical installation
No Asbestos		
B00F - R0002 - Shower/Change - 2.68 m2		
Wall Linings Internal	Flat AC Sheeting	
B00F - R0003 - Movement - 6.43 m2		
Wall Linings Internal	Flat AC Sheeting	
B00F - R0004 - Raised Platform - 54.58 m2		
No Asbestos		
B00F - R0005 - Movement - 6.5 m2		
Wall Linings Internal	Flat AC Sheeting	
B00F - R0006 - Cleaning Distributed Store - .99 m2		
Wall Linings Internal	Flat AC Sheeting	
B00F - R0007 - Plant - .9 m2		
Wall Linings Internal	Flat AC Sheeting	
B00F - R0008 - Shower/Change - 2.18 m2		
Wall Linings Internal	Flat AC Sheeting	
B00F - R0009 - Toilets - Girls - 10.91 m2		
Wall Linings Internal	Flat AC Sheeting	
Partition Walls (Cubicles)	Compressed AC Sheet	
B00F - R0010 - Hall Chair Store - 2.68 m2		
No Asbestos		
B00F - R0011 - Communal Space - 134.56 m2		
No Asbestos		
B00F - R0012 - Canteen Office/Store - 4.93 m2		
No Asbestos		
B00F - R0013 - Canteen Office/Store - 3.95 m2		
No Asbestos		
B00F - R0014 - General Storeroom - 10.95 m2		
No Asbestos		
B00F - R0015 - P.E. Store - 13.3 m2		
No Asbestos		
B00F - R0016 - Disabled Toilet - 3.31 m2		
Wall Linings Internal	Flat AC Sheeting	
B00F - R0017 - Hall Chair Store - 2.61 m2		
No Asbestos		
B00F - R0018 - Toilets - Boys - 10.91 m2		
Partition Walls (Cubicles)	Compressed AC Sheet	
Wall Linings Internal	Flat AC Sheeting	
B00F - R0019 - Movement - 16.66 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
Wall Linings Internal	Flat AC Sheeting	
B00F - R0020 - External Movement - 78.65 m2		

Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
B00F - R0021 - External Movement - 23.37 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
B00F - R0022 - Canteen - 27.94 m2							
No Asbestos							
B00H - Building Services - 1985 - Timber Shed							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	8m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Interior							
B00H - R0001 - Garden Store - 22.93 m2							
No Asbestos							
B00K - Communal Facilities - 2007 - Steel							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00K - R0001 - Sports Store - 22.69 m2							
No Asbestos							
B00K - R0002 - Sports Store - 23 m2							
No Asbestos							
B00L - General Learning - 2011 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00L - R0001 - External Movement - 86.67 m2							
No Asbestos							
B00L - R0002 - General Storeroom - 11.45 m2							
No Asbestos							
B00L - R0003 - External Stairs - 12.83 m2							
No Asbestos							
B00L - R0004 - Home Base - 59.25 m2							
No Asbestos							
B00L - R0005 - Practical Activities - 1hb - 19.08 m2							
No Asbestos							
B00L - R0006 - Withdrawal Space - 1hb - 8.78 m2							
No Asbestos							
B00L - R0007 - Home Base Store - 5.82 m2							
No Asbestos							
B00L - R0008 - Home Base Store - 6.22 m2							
No Asbestos							
B00L - R0009 - Home Base - 60.15 m2							

No Asbestos		
B00L - R0010 - Practical Activities - 1hb - 18.44 m2		
No Asbestos		
B00L - R0011 - Withdrawal Space - 2hb - 11.47 m2		
No Asbestos		
B00L - R0012 - Home Base - 60.09 m2		
No Asbestos		
B00L - R0013 - Practical Activities - 1hb - 18.85 m2		
No Asbestos		
B00L - R0014 - Home Base Store - 6.18 m2		
No Asbestos		
B00L - R0015 - External Stairs - 12.66 m2		
No Asbestos		
B00L - R0016 - General Storeroom - 11.55 m2		
No Asbestos		
B00L - R0017 - Distribution Board - .58 m2		
		Note: No inspection of live electrical installation
No Asbestos		
B00L - R1001 - External Movement - 91.15 m2		
No Asbestos		
B00L - R1002 - External Stairs - 29.2 m2		
No Asbestos		
B00L - R1003 - Practical Activities - 1hb - 18.93 m2		
No Asbestos		
B00L - R1004 - Home Base - 59.11 m2		
No Asbestos		
B00L - R1005 - Home Base Store - 5.79 m2		
No Asbestos		
B00L - R1006 - Withdrawal Space - 1hb - 8.93 m2		
No Asbestos		
B00L - R1007 - Distribution Board - .58 m2		
		Note: No inspection of live electrical installation
No Asbestos		
B00L - R1008 - Practical Activities - 1hb - 18.24 m2		
No Asbestos		
B00L - R1009 - Home Base Store - 6.18 m2		
No Asbestos		
B00L - R1010 - Home Base - 59.91 m2		
No Asbestos		
B00L - R1011 - Withdrawal Space - 2hb - 11.46 m2		
No Asbestos		
B00L - R1012 - Home Base - 60.1 m2		
No Asbestos		
B00L - R1013 - Practical Activities - 1hb - 19.08 m2		
No Asbestos		
B00L - R1014 - Home Base Store - 6.19 m2		
No Asbestos		
B00L - R1015 - External Stairs - 29.27 m2		
No Asbestos		
B00M - Building Services - 2011 - Brick/Veneer		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	

Ceiling Voids	No Asbestos Found	
Interior		
B00M - R0001 - General Storeroom - 40.12 m2		
No Asbestos		
B00N - Building Services - 2011 - Brick/Veneer		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00N - R0001 - General Storeroom - 10.09 m2		
No Asbestos		
B00O - General Learning - 2011 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00O - R0001 - Practical Activities - 1hb - 19.71 m2		
No Asbestos		
B00O - R0002 - Home Base Store - 6.23 m2		
No Asbestos		
B00O - R0003 - Home Base - 60.45 m2		
No Asbestos		
B00O - R0004 - Withdrawal Space - 2hb - 11.67 m2		
No Asbestos		
B00O - R0005 - Practical Activities - 1hb - 19.23 m2		
No Asbestos		
B00O - R0006 - Home Base - 60.37 m2		
No Asbestos		
B00O - R0007 - Home Base Store - 6.23 m2		
No Asbestos		
B00O - R0008 - Practical Activities - 1hb - 19.1 m2		
No Asbestos		
B00O - R0009 - Home Base Store - 6.23 m2		
No Asbestos		
B00O - R0010 - Home Base - 60.36 m2		
No Asbestos		
B00O - R0011 - Practical Activities - 1hb - 19.73 m2		
No Asbestos		
B00O - R0012 - Home Base Store - 6.23 m2		
No Asbestos		
B00O - R0013 - Home Base - 60.43 m2		
No Asbestos		
B00O - R0014 - Distribution Board - .92 m2		
No Asbestos		Note: No inspection of live electrical installation
B00O - R0015 - Withdrawal Space - 2hb - 11.67 m2		
No Asbestos		
B00O - R0016 - External Movement - 88.36 m2		

No Asbestos		
B00O - R9001 - Movement - 206.98 m2		
No Asbestos		
B00P - Building Services - 2013 - Metal Shed		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00P - R0001 - Garden Store - 26.41 m2		
No Asbestos		

Demountables

OS 602 10205 - Learning Unit - Standard With P.A.A. - Placement Date : 14-JUL-2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 11622 - Learning Unit - Standard With P.A.A. - Placement Date : 13-APR-2010

Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- Learning space/withdrawal/entry

Ceiling Structures/Linings	Flat AC Sheeting	70m2	Assumed Asbestos
----------------------------	------------------	------	------------------

R2- Home Base Store

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Assumed Asbestos

OS 510 13311 - Staff Common Room - Placement Date : 17-DEC-2016

No Asbestos Found

OS 602 14089 - Learning Unit - Standard With P.A.A. - Placement Date : 24-OCT-2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 603 15089 - Learning Unit - Standard With P.A.A. A/C - Placement Date : 16-MAR-2007

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 603 15879 - Learning Unit - Standard With P.A.A. A/C - Placement Date : 24-FEB-2003

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 17428 - Learning Unit - Standard With P.A.A. - Placement Date : 17-NOV-2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 18266 - Learning Unit - Standard With P.A.A. - Placement Date : 22-FEB-2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found