

Asbestos Register


(Hazardous Materials and Risk Assessment)

School:	Kahibah Public School (3874)
Region:	Hunter/Central Coast AMU
State Electorate:	Charlestown
Local Government Area:	Lake Macquarie

Last Reviewed By:	Greencap 24-JUN-2015
Last Revised By:	AECOM 25-JUN-2020

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

3874 - Kahibah Public School
Site Plan (11654)

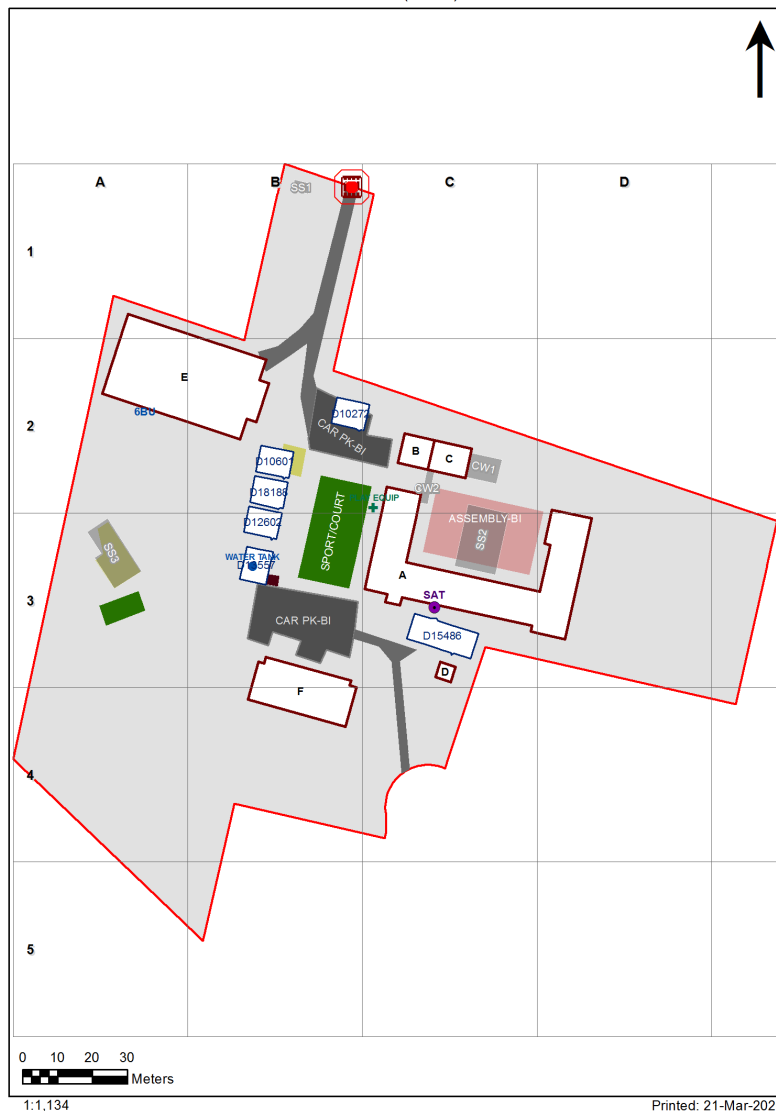

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - General Learning/Administration - 1956 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	AC Fragments/Debris	5	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	Millboard						
Interior							
B00A - R0001 - Home Base Store - 7.73 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0002 - Practical Activities - 1hb - 13.91 m2							
No Asbestos							
B00A - R0003 - Home Base - 53.73 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0004 - Toilets - Girls - 6.87 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet						
B00A - R0005 - Toilets - Boys - 5.93 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet						
B00A - R0006 - Movement - 53.9 m2							
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	28m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0007 - Home Base - 53.58 m2							
Wall Linings Internal	Flat AC Sheeting	10m2	South, Upper portion, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0008 - Home Base - 53.36 m2							
Wall Linings Internal	Flat AC Sheeting	25m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0009 - Home Base - 66.83 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0010 - Practical Activities - 1hb - 12.72 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0011 - Home Base Store - 4.84 m2							

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R0012 - Movement - 83.91 m2							
Ceiling Structures/Linings	Flat AC Sheeting	84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0013 - General Storeroom - 5.32 m2							
Wall Linings Internal	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
B00A - R0014 - Staff Room Annexe - 9.59 m2							
Wall Linings Internal	Flat AC Sheeting	20m2	North, East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0015 - Home Base Store - 6.22 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0016 - Home Base - 53.36 m2							
No Asbestos							
B00A - R0017 - Home Base - 53.36 m2							
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	60m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0018 - Home Base Store - 6.44 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0019 - Library Office/Workroom - 15.33 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0020 - Home Base - 88.96 m2							
Wall Linings Internal	Flat AC Sheeting	60m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0021 - K.L.A. Store - 12.46 m2							
No Asbestos							

B00A - R0022 - Cleaning Distributed Store - 4.78 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
Wall Linings Internal	Flat AC Sheeting	20m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0023 - General Storeroom - 9.39 m2							
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
B00A - R0024 - Clerical Office - 11.72 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	12	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Linings Internal	Flat AC Sheeting	20m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0025 - Entry Vestibule - 15.51 m2							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	1.00	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R0026 - Movement - 11.61 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0027 - Movement - 18.49 m2							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0028 - General Storeroom - 31.49 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00A - R0029 - Movement - 1.37 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0030 - Staff Toilet - 4.12 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0031 - Staff Toilet - 5.66 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0032 - General Storeroom - 6.93 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00A - R0033 - Deputy Principal - 18.54 m2							

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00A - R0034 - Staff Toilet - 3.29 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0035 - General Storeroom - 2.2 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0036 - Movement - 29.95 m2							
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0037 - Home Base - 53.29 m2							
No Asbestos							
B00A - R0038 - Home Base Store - 4.44 m2							
No Asbestos							
B00A - R0039 - General Storeroom - 9.32 m2							
No Asbestos							
B00A - R0040 - Movement - 8.14 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
B00A - R0041 - Home Base Store - 4.46 m2							
No Asbestos							
B00A - R0042 - Home Base - 53.29 m2							
No Asbestos							
B00A - R0043 - Movement - 6.64 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0044 - Distribution Board - .64 m2						Note: No inspection of live electrical installation	
No Asbestos							
B00A - R9001 - Special Programs Room - 103.36 m2							
Ceiling Structures/Linings	Flat AC Sheeting	104m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R9002 - Craft Store - 7.98 m2							
No Asbestos							
B00A - R9003 - Kiln Room - 20.84 m2							
No Asbestos							
B00A - R9005 - General Storeroom - 15.99 m2							
No Asbestos							
B00A - R9006 - Sports Store - 24.27 m2							
No Asbestos							
B00A - R9008 - Movement - 15.91 m2							
No Asbestos							
B00B - Pupil Facilities - 1978 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	15.00m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00B - R0001 - Movement - 34.62 m2							
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0002 - Canteen Office/Store - 3.6 m2							

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0003 - Canteen - 16.26 m2							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0004 - Canteen Office/Store - 1.99 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - Pupil Facilities - 1960 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	15m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00C - R0001 - Movement - 27.98 m2							
Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0002 - Toilets - Boys - 21.78 m2							
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubides)	Compressed AC Sheet	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0003 - Toilets - Girls - 21.78 m2							
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubides)	Compressed AC Sheet	20.00m2	East, West	Minimal Damage (2)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)
B00D - Administration - 1954 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting						
Wall Cladding	Flat AC Sheeting						
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00D - R0001 - General Storeroom - 9.97 m2							
No Asbestos							
B00D - R0002 - General Storeroom - 9.48 m2							
No Asbestos							
B00E - Communal Facilities - 2003 - Concrete							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00E - R0001 - Movement - 32.2 m2							
No Asbestos							
B00E - R0002 - Laundry - Type 2 - 2.12 m2							
No Asbestos							
B00E - R0003 - Canteen - 38.24 m2							
No Asbestos							

B00E - R0004 - Disabled Toilet - 3.19 m2		
No Asbestos		
B00E - R0005 - Movement - 3.37 m2		
No Asbestos		
B00E - R0006 - Toilets - Girls - 18.67 m2		
No Asbestos		
B00E - R0007 - Toilets - Boys - 13.7 m2		
No Asbestos		
B00E - R0008 - Movement - 71.41 m2		
No Asbestos		
B00E - R0009 - Communal Space - 656.59 m2		
No Asbestos		
B00E - R0010 - Raised Platform - 161.64 m2		
No Asbestos		
B00F - Library - 2010 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	Non Accessible Area	
Interior		
B00F - R0001 - External Movement - 71.69 m2		
No Asbestos		
B00F - R0002 - Movement - 2.41 m2		
No Asbestos		
B00F - R0003 - Staff Toilet - 4.72 m2		
No Asbestos		
B00F - R0004 - Cleaning Distributed Store - 3.63 m2		
No Asbestos		
B00F - R0005 - Main Switch Board - .56 m2		
No Asbestos		
B00F - R0006 - Reading Area - 167.77 m2		
No Asbestos		
B00F - R0007 - K.L.A. Store - 14.64 m2		
No Asbestos		
B00F - R0008 - Communications Room - 7.99 m2		
No Asbestos		
B00F - R0009 - Library Office/Workroom - 24.06 m2		
No Asbestos		
B00F - R0010 - Special Programs Room - 38.08 m2		
No Asbestos		
B00F - R0011 - Special Programs Store - 9.41 m2		
No Asbestos		
B00F - R9001 - Garden Store - 12.77 m2		
No Asbestos		

Demountables

OS 601 10272 - Learning Unit - Standard/Withdrawal - Placement Date : 16-FEB-2000

Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- Entry

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

R2- General Learning Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

R3- Store

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

OS 602 10601 - Learning Unit - Standard With P.A.A. - Placement Date : 19-JAN-2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 603 12602 - Learning Unit - Standard With P.A.A. A/C - Placement Date : 08-NOV-2007

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 13557 - Learning Unit - Standard With P.A.A. - Placement Date : 17-NOV-2017

No Asbestos Found

OS 502 15486 - Admin Staff/Principal/Clerk/Dup/Clinic - Placement Date : 20-APR-2006

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 603 18188 - Learning Unit - Standard With P.A.A. A/C - Placement Date : 07-DEC-2005

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found