


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Katoomba North Public School (3987)
Region:	Western Sydney AMU
State Electorate:	Blue Mountains
Local Government Area:	Blue Mountains

Last Reviewed By:	WSP 14-MAY-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

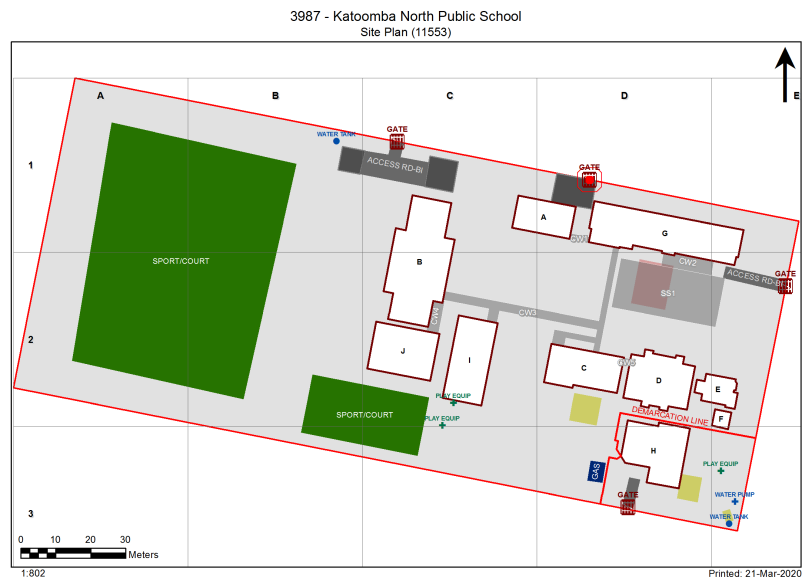

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration/Staff Facilities - 1980 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00A - R0001 - General Storeroom - 11.52 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0002 - Main Switch Board - .75 m2							
No Asbestos							
B00A - R0003 - Principal - 12.93 m2							
No Asbestos							
B00A - R0004 - Movement - 2.95 m2							
No Asbestos							
B00A - R0005 - Sick Bay - 7.83 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0006 - Staff Toilet - 2.52 m2							
No Asbestos							
B00A - R0007 - Staff Toilet - 2.86 m2							
No Asbestos							
B00A - R0008 - Cleaning Distributed Store - 2.23 m2							
No Asbestos							
B00A - R0009 - Clerical Office/Workroom - 13.68 m2							
No Asbestos							
B00A - R0010 - Movement - 6.03 m2							
No Asbestos							
B00A - R0011 - Duplicating Workroom - 21.65 m2							
No Asbestos							
B00A - R0012 - Clerical Office - 9.19 m2							
No Asbestos							
B00A - R0013 - Entry Vestibule - 13.12 m2							
No Asbestos							
B00A - R0014 - Movement - 2.89 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0015 - Movement - 24.14 m2							
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - Communal Facilities - 1993 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00B - R0001 - Cleaning Supplies - 9.39 m2							
No Asbestos							
B00B - R0002 - General Storeroom - 6.79 m2							
No Asbestos							
B00B - R0003 - Disabled Toilet - 5.39 m2							
No Asbestos							
B00B - R0004 - Toilets - Girls - 7.41 m2							

No Asbestos							
B00B - R0005 - Plant - .78 m2							
No Asbestos							
B00B - R0006 - P.E Store - 12.81 m2							
No Asbestos							
B00B - R0007 - Hall Chair Store - 10.72 m2							
No Asbestos							
B00B - R0008 - Toilets - Boys - 7.07 m2							
No Asbestos							
B00B - R0009 - Movement - 1 m2							
No Asbestos							
B00B - R0010 - Shower/Change - 3.22 m2							
No Asbestos							
B00B - R0011 - Distribution Board - .41 m2							
							Note: No inspection of live electrical installation
No Asbestos							
B00B - R0012 - Communal Space - 147.51 m2							
No Asbestos							
B00B - R0013 - Raised Platform - 40.16 m2							
No Asbestos							
B00B - R0014 - Movement - 51.42 m2							
No Asbestos							
B00B - R0015 - Movement - 38.81 m2							
No Asbestos							
B00B - R0016 - Canteen - 28.93 m2							
No Asbestos							
B00B - R0017 - Canteen Office/Store - 10.16 m2							
No Asbestos							
B00B - R0018 - Cleaning Distributed Store - 2.73 m2							
No Asbestos							
B00B - R0019 - Movement - 51.42 m2							
No Asbestos							
B00B - R0020 - Sports Store - 5.81 m2							
No Asbestos							
B00B - R0021 - General Assistant/Bulk Store - 16.83 m2							
No Asbestos							
B00B - R0022 - Garden Store - 12.23 m2							
No Asbestos							
B00C - General Learning/Pupil Facilities - 1968 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	15m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Gable Verge Lining	Flat AC Sheeting	5m2	East & West	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found						
Interior							
B00C - R0001 - Movement - 23.34 m2							
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0002 - Home Base - 85.99 m2							
No Asbestos							
B00C - R0003 - Withdrawal Space - 1hb - 6.51 m2							

No Asbestos							
B00C - R0004 - Home Base Store - 3.06 m2							
Ceiling Structures/Linings - Access Hatch	Flat AC Sheeting	1m2	Middle portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0005 - Toilets - Boys/Girls - 3.35 m2							
No Asbestos							
B00C - R0006 - Toilets - Boys - 31.79 m2							
Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0007 - Cleaning Distributed Store - 2.16 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0008 - Toilets - Girls - 26.09 m2							
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0009 - Movement - 22.57 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - General Learning - 1980 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00D - R0001 - Movement - 11.34 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0002 - Home Base - 61.82 m2							
No Asbestos							
B00D - R0003 - Movement - 7.84 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0004 - Home Base Store - 5.18 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R0005 - Withdrawal Space - 1hb - 11.19 m2							
No Asbestos							
B00D - R0006 - Home Base Store - 5.18 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R0007 - Movement - 7.71 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0008 - Home Base - 61.89 m2							
No Asbestos							
B00D - R0009 - Movement - 11.51 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0010 - Cleaning Supplies - 3.11 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R0011 - Practical Activities - 1hb - 44.82 m2							
No Asbestos							
B00D - R0012 - General Storeroom - 3.07 m2							

Floor Coverings Res/Textile	Vinyl Tiles							
B00E - Music - 1956 - Timber								
Exterior								
Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Gable Ends	Flat AC Sheeting	8m2	North (Variable)	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids	No Asbestos Found							
Ceiling Voids	Fibre Cement Pipe	1	Adjacent Manhole hatch from R0002	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)	
Interior								
B00E - R0001 - Practical Activities - 1hb - 41.89 m2								
No Asbestos								
B00E - R0002 - Music Store - 17.72 m2								
No Asbestos								
B00E - R0003 - General Storeroom - 8.49 m2								
No Asbestos								
B00E - R0004 - Craft Store - 7.7 m2								
No Asbestos								
B00F - Administration - 1956 - Timber								
Exterior								
Wall Cladding	Flat AC Sheeting	40m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found							
Underfloor Voids	No Asbestos Found							
Floor Coverings Res/Textile	Compressed AC Sheet							
Interior								
B00F - R0001 - Community Clinic - 10.37 m2								
Wall Linings Internal	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles							
B00F - R0002 - Community Clinic - 6.71 m2								
Wall Linings Internal	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00F - R0003 - Community Clinic - 3.85 m2								
Floor Coverings Res/Textile	Vinyl Tiles							
Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00G - General Learning/Staff Facilities - 1956 - Brick/Veneer								
Exterior								

Eaves Linings	Flat AC Sheeting	50m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00G- R0001 - Cleaning Supplies - 5.53 m2							
No Asbestos							
B00G- R0002 - General Storeroom - 16.46 m2							
No Asbestos							
B00G- R0003 - Home Base - 53.72 m2							
No Asbestos							
B00G- R0004 - Home Base - 53.8 m2							
No Asbestos							
B00G- R0005 - Movement - 40.35 m2							
Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G- R0006 - Movement - 8.93 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G- R0007 - General Storeroom - 9.27 m2							
No Asbestos							
B00G- R0008 - Home Base Store - 12.62 m2							
No Asbestos							
B00G- R0011 - Movement - 37.82 m2							
Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G- R0012 - Cleaning Distributed Store - 5.76 m2							
No Asbestos							
B00G- R0013 - Staff Room - 31.48 m2							
No Asbestos							
B00G- R0014 - Staff Toilet - 4.32 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G- R0015 - Staff Toilet - 3.78 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G- R0016 - Movement - 1.7 m2							
No Asbestos							
B00G- R0017 - Movement - 13.42 m2							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G- R0018 - Special Programs Room - 49.98 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	50m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G- R0019 - Special Programs Room - 49.88 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	50m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G- R0020 - Special Programs Store - 6.26 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - Other-Non-Govt Pre-School - 1953 - Steel							

Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00H - R0001 - Other-Non Government Pre-Sch - 53.67 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00H - R0003 - Other-Non Government Pre-Sch - 8.64 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00H - R0004 - Other-Non Government Pre-Sch - 6.96 m2		
No Asbestos		
B00H - R0005 - Kitchen - Pre - 15.65 m2		
No Asbestos		
B00H - R0006 - General Storeroom - Pre - 17.26 m2		
No Asbestos		
B00H - R0007 - Covered Outdoor Learning Area - Pre - 52.62 m2		
No Asbestos		
B00H - R0008 - Practical Activities - Pre - 22.56 m2		
No Asbestos		
B00H - R0009 - Practical Activities - Pre - 39.63 m2		
No Asbestos		
B00H - R0010 - Toilets - Boys/Girls - Pre - 10.57 m2		
No Asbestos		
B00H - R0011 - General Storeroom - Pre - 21.54 m2		
No Asbestos		
B00H - R0012 - External Movement - 8.74 m2		
No Asbestos		
B00I - Library - 2002 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00I - R0001 - Reading Area - 168.57 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00I - R0002 - Library Office/Workroom - 23.01 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00I - R0003 - Communications Room - 8.06 m2		
No Asbestos		
B00I - R0004 - K.L.A. Store - 14.73 m2		
No Asbestos		
B00I - R0005 - Distribution Board - .78 m2		
No Asbestos		Note: No inspection of live electrical installation
B00I - R0006 - Cleaning Distributed Store - 3.52 m2		
No Asbestos		
B00I - R0007 - Staff Toilet - 4.68 m2		
No Asbestos		
B00I - R0008 - Movement - 2.4 m2		
No Asbestos		
B00I - R0009 - Movement - 21.91 m2		

No Asbestos							
B00J - General Learning - 2010 - Brick/Veneer							
Exterior							
Ceiling Voids							
Underfloor Voids	No Asbestos Found						
Interior							
B00J - R0001 - External Movement - 49.83 m2							
No Asbestos							
B00J - R0002 - Practical Activities - 1hb - 18.63 m2							
No Asbestos							
B00J - R0003 - Home Base Store - 6.16 m2							
No Asbestos							
B00J - R0004 - Home Base - 60.51 m2							
No Asbestos							
B00J - R0005 - Withdrawal Space - 2hb - 11.23 m2							
No Asbestos							
B00J - R0006 - Home Base - 60.53 m2							
No Asbestos							
B00J - R0007 - Home Base Store - 6.16 m2							
No Asbestos							
B00J - R0008 - Practical Activities - 1hb - 18.61 m2							
No Asbestos							

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020