


# Asbestos Register

(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Kempsey South Public School (4196)</b>
<b>Region:</b>	<b>North Coast AMU</b>
<b>State Electorate:</b>	<b>Oxley</b>
<b>Local Government Area:</b>	<b>Kempsey</b>

<b>Last Reviewed By:</b>	<b>AECOM 29-OCT-2014</b>
<b>Last Revised By:</b>	

<b>Historical Fibro In Grounds Investigations/Events</b>	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

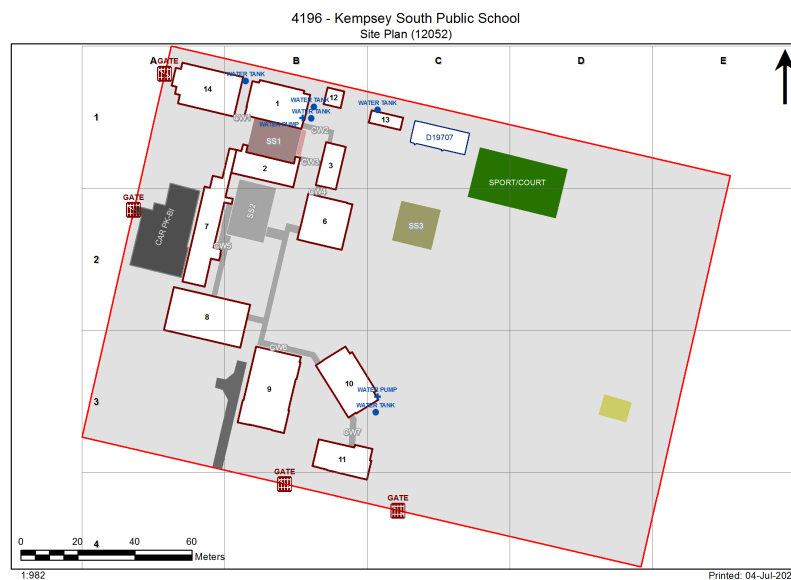

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B001 - General Learning - 1960 - Brick/Veneer</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting						
Underfloor Voids - Slab on Ground							
Ceiling Voids	No Asbestos Found						
Wall Linings Internal	Flat AC Sheeting						
<b>Interior</b>							
<b>B001 - R0001 - General Storeroom - 6.6 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B001 - R0002 - Home Base Store - 6.59 m2</b>							
No Asbestos							
<b>B001 - R0003 - Staff Room Annexe - 6.6 m2</b>							
No Asbestos							
<b>B001 - R0004 - Home Base - 65.64 m2</b>							
No Asbestos							
<b>B001 - R0005 - Home Base - 65.64 m2</b>							
No Asbestos							
<b>B001 - R0006 - Staff Room Annexe - 6.6 m2</b>							
No Asbestos							
<b>B001 - R0007 - Home Base Store - 6.59 m2</b>							
No Asbestos							
<b>B001 - R0008 - Kiln Room - 6.09 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B001 - R0009 - Practical Activities - 1hb - 17.77 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B001 - R0010 - Practical Activities - 1hb - 17.77 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B001 - R0011 - Distribution Board - .36 m2</b>							
Wall Linings Internal	Flat AC Sheeting						<b>Note: No inspection of live electrical installation</b>
<b>B001 - R0012 - External Movement - 47.64 m2</b>							
No Asbestos							
<b>B002 - General Learning - 1961 - Timber</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	AC Fragments/Debris		Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B002 - R0001 - Interview - 12.44 m2</b>							
No Asbestos							
<b>B002 - R0002 - Movement - 13.9 m2</b>							
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B002 - R0003 - General Storeroom - 9.61 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B002 - R0004 - Home Base - 58.37 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles							
Wall Linings Internal	Flat AC Sheeting							
<b>B002 - R0005 - Home Base Store - 5.37 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles							
<b>B002 - R0006 - Home Base - 58.22 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles							
Wall Linings Internal	Flat AC Sheeting							
<b>B002 - R0007 - Movement - 3.85 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles							
<b>B002 - R0008 - Personal Effects Storage - 3.84 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles							
<b>B002 - R0009 - Home Base Store - 6.31 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting							
Floor Coverings Res/Textile	Vinyl Tiles							
<b>B002 - R0010 - External Movement - 4.19 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B002 - R0011 - External Movement - 4.24 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B003 - Pupil Facilities - 1960 - Brick/Block</b>								
<b>Exterior</b>								
Ceiling Voids	No Asbestos Found							
Underfloor Voids - Slab on Ground	No Asbestos Found							
<b>Interior</b>								
<b>B003 - R0001 - External Movement - 46.67 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting							
<b>B003 - R0002 - Toilets - Boys - 23.52 m2</b>								
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B003 - R0003 - Staff Toilet - 1.53 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B003 - R0004 - Cleaning Supplies - 3.08 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B003 - R0005 - Toilets - Girls - 16.43 m2</b>								
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B003 - R0006 - Staff Toilet - 1.92 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B006 - General Learning - 1960 - Brick/Veneer</b>								

Exterior							
Gable Ends	Flat AC Sheeting	20m2	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Interior							
B006 - R0001 - Home Base Store - 3.97 m2							
No Asbestos							
B006 - R0002 - Home Base Store - 1.9 m2							
No Asbestos							
B006 - R0003 - Practical Activities - 1hb - 38.08 m2							
No Asbestos							
B006 - R0004 - Home Base Store - 1.9 m2							
No Asbestos							
B006 - R0005 - Home Base Store - 3.97 m2							
No Asbestos							
B006 - R0006 - Home Base - 58.99 m2							
No Asbestos							
B006 - R0007 - Withdrawal Space - 1hb - 6.61 m2							
No Asbestos							
B006 - R0008 - Home Base - 58.99 m2							
No Asbestos							
B006 - R0009 - External Movement - 44.15 m2							
Wall Cladding	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
B006 - R0010 - External Movement - 28.72 m2							
Wall Cladding	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
B007 - General Learning - 1960 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	AC Fragments/Debris		Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Interior							
B007 - R0001 - Home Base - 77.71 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B007 - R0003 - Toilets - Boys/Girls - 3.64 m2							
Wall Linings Internal	Flat AC Sheeting	12m2	Lower portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B007 - R0004 - Personal Effects Storage - 3.41 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B007 - R0005 - Movement - 4.14 m2							
No Asbestos							
B007 - R0006 - Home Base Store - 6.13 m2							
Floor Coverings Res/Textile	Flat AC Sheeting						
B007 - R0007 - Home Base - 56.54 m2							

Floor Coverings Res/Textile	Vinyl Tiles						
Wall Linings Internal	Flat AC Sheeting	1m2	South, behind heater	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B007 - R0008 - Home Base - 56.46 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
Wall Linings Internal	Flat AC Sheeting						
<b>B007 - R0009 - Home Base Store - 6.13 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive - Paper Backing						
<b>B007 - R0010 - Personal Effects Storage - 3.41 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B007 - R0011 - Movement - 21.38 m2</b>							
No Asbestos							
<b>B007 - R0012 - Staff Room Annexe - 16.34 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B007 - R0013 - Cleaning Supplies - 6.15 m2</b>							
No Asbestos							
<b>B007 - R0014 - Staff Toilet - 3.78 m2</b>							
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B007 - R0015 - Staff Toilet - 3.51 m2</b>							
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B007 - R0016 - Movement - 19.53 m2</b>							
No Asbestos							
<b>B007 - R0017 - Sick Bay - 4.73 m2</b>							
No Asbestos							
<b>B007 - R0018 - External Movement - 4.91 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B007 - R0019 - Home Base Store - 6.63 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B007 - R0020 - Home Base Store - 8.86 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B007 - R0021 - External Movement - 4.97 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B008 - Library - 1980 - Brick/Veneer</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B008 - R0001 - External Movement - 141.75 m2</b>							
No Asbestos							

<b>B008 - R0002 - Toilets - Girls - 6.6 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B008 - R0003 - Toilets - Boys - 6.6 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B008 - R0004 - Communications Room - 44.26 m2</b>							
No Asbestos							
<b>B008 - R0005 - Distribution Board - 1.77 m2</b> <span style="float: right;"><b>Note: No inspection of live electrical installation</b></span>							
No Asbestos							
<b>B008 - R0006 - General Storeroom - 5.12 m2</b>							
No Asbestos							
<b>B008 - R0007 - Distribution Board - 2.11 m2</b> <span style="float: right;"><b>Note: No inspection of live electrical installation</b></span>							
Electrical - Backing Board	Resinous Board	2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Linings Internal	Flat AC Sheeting	3m2	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting						
<b>B008 - R0008 - Library Office/Workroom - 24.92 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B008 - R0009 - General Storeroom - 13.08 m2</b>							
No Asbestos							
<b>B008 - R0010 - Reading Area - 156.34 m2</b>							
No Asbestos							
<b>B009 - Communal Facilities - 1988 - Brick/Veneer</b>							
<b>Exterior</b>							
Gable Ends	Flat AC Sheeting	20m2	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	Non Accessible Area						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B009 - R0001 - External Movement - 77.26 m2</b>							
Wall Cladding	Flat AC Sheeting						
<b>B009 - R0002 - Canteen - 27.68 m2</b>							
No Asbestos							
<b>B009 - R0003 - General Storeroom - 5.05 m2</b>							
No Asbestos							
<b>B009 - R0004 - General Storeroom - 3.89 m2</b>							
No Asbestos							
<b>B009 - R0005 - Communal Space - 135.84 m2</b>							
No Asbestos							
<b>B009 - R0006 - Sports Store - 13.32 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting						
<b>B009 - R0007 - P.E. Store - 10.71 m2</b>							
No Asbestos							
<b>B009 - R0008 - Raised Platform - 54.73 m2</b>							
No Asbestos							
<b>B009 - R0009 - Hall Chair Store - 2.73 m2</b>							
No Asbestos							

<b>B009 - R0010 - Hall Chair Store - 2.72 m2</b>							
No Asbestos							
<b>B009 - R0011 - Toilets - Boys - 10.91 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B009 - R0012 - Shower/Change - 2.68 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B009 - R0013 - Movement - 6.57 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B009 - R0014 - Distribution Board - 1.53 m2</b>						<b>Note: No inspection of live electrical installation</b>	
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B009 - R0015 - External Movement - 16.33 m2</b>							
Wall Cladding	Flat AC Sheeting						
<b>B009 - R0016 - Movement - 6.39 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting						
<b>B009 - R0017 - Cleaning Supplies - 1.08 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B009 - R0018 - General Storeroom - .96 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B009 - R0019 - Shower/Change - 2.22 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B009 - R0020 - Toilets - Girls - 10.86 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B009 - R0021 - Disabled Toilet - 3.35 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting						
<b>B009 - R0022 - External Movement - 22.46 m2</b>							
Wall Cladding	Flat AC Sheeting						
<b>B010 - General Learning - 1982 - Brick/Veneer</b>							



Exterior							
Eaves Linings	Flat AC Sheeting						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	AC Fragments/Debris						
Interior							
B010 - R0001 - Toilets - Girls - 12.03 m2							
Wall Linings Internal	Flat AC Sheeting						
B010 - R0002 - Distribution Board - .32 m2							
Wall Linings Internal	Flat AC Sheeting						Note: No inspection of live electrical installation
B010 - R0003 - General Storeroom - 5.79 m2							
No Asbestos							
B010 - R0004 - Withdrawal Space - 1hb - 5.91 m2							
No Asbestos							
B010 - R0005 - Home Base - 62.71 m2							
No Asbestos							
B010 - R0006 - Practical Activities - 1hb - 18.13 m2							
Wall Linings Internal	Flat AC Sheeting						
B010 - R0007 - Practical Activities - 1hb - 18.13 m2							
Wall Linings Internal	Flat AC Sheeting						
B010 - R0008 - Home Base - 62.7 m2							
No Asbestos							
B010 - R0009 - Withdrawal Space - 1hb - 6.11 m2							
No Asbestos							
B010 - R0010 - General Storeroom - 6 m2							
No Asbestos							
B010 - R0011 - Toilets - Boys - 12.03 m2							
Wall Linings Internal	Flat AC Sheeting						
B010 - R0012 - External Movement - 51.49 m2							
No Asbestos							
B011 - General Learning - 1960 - Timber							
Exterior							
Wall Cladding	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	Flat AC Sheeting		Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	AC Fragments/Debris		Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Interior							
B011 - R0004 - Other-Community Use - 13.94 m2							
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B011 - R0005 - Other-Community Use - 2.31 m2							
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B011 - R0006 - Other-Community Use - 3.24 m2							
Wall Linings Internal	Flat AC Sheeting	16m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B011 - R0007 - Other-Community Use - 23.78 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B011 - R0008 - Home Base - 71.62 m2</b>							
Requires Inspection							
<b>B011 - R0009 - External Movement - 73.4 m2</b>							
Requires Inspection							
<b>B012 - Communal Facilities - 2001 - Metal Shed</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B012 - R0001 - Sports Store - 33.93 m2</b>							
No Asbestos							
<b>B013 - Storage - 2010 - Brick/Block</b>							
<b>Exterior</b>							
No Asbestos							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B013 - R0001 - Sports Store - 12.73 m2</b>							
No Asbestos							
<b>B013 - R0002 - General Assistant/Bulk Store - 15.86 m2</b>							
No Asbestos							
<b>B013 - R0003 - Garden Store - 12.73 m2</b>							
No Asbestos							
<b>B014 - Administration - 2010 - Brick/Veneer</b>							
<b>Exterior</b>							
No Asbestos							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B014 - R0001 - Entry Vestibule - 15.2 m2</b>							
No Asbestos							
<b>B014 - R0002 - Movement - 42.16 m2</b>							
No Asbestos							
<b>B014 - R0003 - Interview/Office - Type 3 - 13.29 m2</b>							
No Asbestos							
<b>B014 - R0004 - Principal - 13.21 m2</b>							
No Asbestos							
<b>B014 - R0005 - Staff Toilet - 4.86 m2</b>							
No Asbestos							
<b>B014 - R0006 - Staff Toilet - 4.86 m2</b>							
No Asbestos							
<b>B014 - R0007 - Staff Toilet - 4.86 m2</b>							
No Asbestos							
<b>B014 - R0008 - Cleaning Distributed Store - 2.71 m2</b>							
No Asbestos							

No Asbestos	
<b>B014 - R0009 - Security Store - 14.16 m2</b>	
No Asbestos	
<b>B014 - R0010 - Staff Room Annexe - 16.37 m2</b>	
No Asbestos	
<b>B014 - R0011 - Staff Room - 22.41 m2</b>	
No Asbestos	
<b>B014 - R0012 - Access Shower/Toilet - 4.95 m2</b>	
No Asbestos	
<b>B014 - R0013 - Sick Bay - 9.03 m2</b>	
No Asbestos	
<b>B014 - R0014 - Clerical Office - 22.68 m2</b>	
No Asbestos	
<b>B014 - R0015 - Main Switch Board - 2.68 m2</b>	
No Asbestos	
<b>B014 - R0016 - External Movement - 85.16 m2</b>	
No Asbestos	
<b>B014 - R0017 - External Movement - 5.59 m2</b>	
No Asbestos	
<b>B014 - R0018 - Staff Kitchen - 8.48 m2</b>	
No Asbestos	

**Demountables**

**OS 612 19707 - Learning Unit - Double With Resource - Placement Date : 23-OCT-2019**

**Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.**

No Asbestos Found