

# Asbestos Register


(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Kingswood Park Public School (4346)</b>
<b>Region:</b>	<b>Western Sydney AMU</b>
<b>State Electorate:</b>	<b>Penrith</b>
<b>Local Government Area:</b>	<b>Penrith</b>

<b>Last Reviewed By:</b>	Greencap 10-JUN-2015
<b>Last Revised By:</b>	

<b>Historical Fibro In Grounds Investigations/Events</b>	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

4346 - Kingswood Park Public School  
Site Plan (11101)

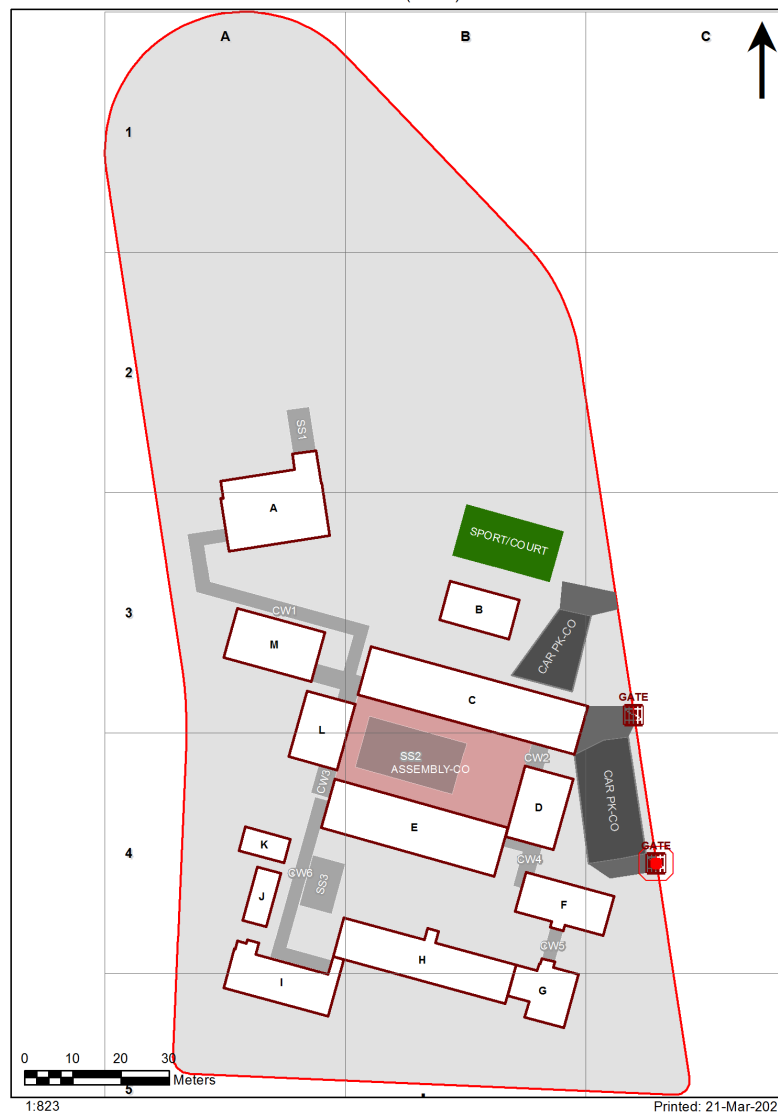

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

### Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

### Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

### Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

#### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - Pre-School Facilities - 2004 - Brick/Veneer</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00A - R0001 - Movement - 2.23 m2</b>							
No Asbestos							
<b>B00A - R0002 - Entry Vestibule - 13.89 m2</b>							
No Asbestos							
<b>B00A - R0003 - Security Store - 8.59 m2</b>							
No Asbestos							
<b>B00A - R0004 - General Storeroom - Pre - 12.38 m2</b>							
No Asbestos							
<b>B00A - R0005 - Home Base - Pre - 68.95 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R0006 - Practical Activities - Pre - 46.29 m2</b>							
No Asbestos							
<b>B00A - R0007 - Toilets - Boys/Girls - Pre - 12.8 m2</b>							
No Asbestos							
<b>B00A - R0008 - Laundry - Pre - 4.54 m2</b>							
No Asbestos							
<b>B00A - R0009 - Access Shower/Toilet - Type 2 - 5.55 m2</b>							
No Asbestos							
<b>B00A - R0010 - Cleaning Distributed Store - 3.54 m2</b>							
No Asbestos							
<b>B00A - R0011 - Kitchen - Pre - 12.9 m2</b>							
No Asbestos							
<b>B00A - R0012 - Clerical Office - Pre - 12.43 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R0013 - Clerical Office - Pre - 8.65 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00A - R0014 - General Storeroom - Pre - 20.55 m2</b>							
No Asbestos							
<b>B00A - R0015 - Movement - 69.34 m2</b>							
No Asbestos							
<b>B00B - Other-Community Use - 1960 - Timber</b>							
<b>Exterior</b>							
Wall Cladding	Flat AC Sheeting						
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00B - R0001 - Movement - 25.14 m2</b>							
No Asbestos							
<b>B00B - R0002 - Other-Community Use - 47.25 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00B - R0003 - Other-Community Use - 46.99 m2</b>							

No Asbestos							
<b>B00C - General Learning/Pupil Facilities - 1969 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	60m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	16	Panels under windows	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00C - R0001 - Canteen - 18.46 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00C - R0002 - Canteen - 5.15 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00C - R0003 - Canteen - 5.91 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00C - R0004 - Movement - 42.23 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0005 - Movement - 78.75 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	16m2	Under windows	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0006 - Home Base - 57.35 m2</b>							
No Asbestos							
<b>B00C - R0007 - Home Base Store - 6.17 m2</b>							
No Asbestos							
<b>B00C - R0008 - Personal Effects Storage - 14.73 m2</b>							
Electrical - Backing Board	Resinous Board	2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00C - R0009 - Home Base Store - 6.17 m2</b>							
No Asbestos							
<b>B00C - R0010 - Home Base - 56.88 m2</b>							
No Asbestos							

<b>B00C - R0011 - Home Base - 56.74 m2</b>							
No Asbestos							
<b>B00C - R0012 - Home Base Store - 6.17 m2</b>							
No Asbestos							
<b>B00C - R0013 - Personal Effects Storage - 14.81 m2</b>							
No Asbestos							
<b>B00C - R0014 - Home Base Store - 6.17 m2</b>							
No Asbestos							
<b>B00C - R0015 - Home Base - 57.05 m2</b>							
No Asbestos							
<b>B00D - Staff Facilities - 1969 - Brick/Veneer</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	25m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	8	Panels under windows	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids		1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00D - R0001 - Staff Room - 85.79 m2</b>							
No Asbestos							
<b>B00D - R0002 - Interview - 10.9 m2</b>							
No Asbestos							
<b>B00D - R0003 - Staff Kitchen - 17.3 m2</b>							
No Asbestos							
<b>B00D - R0004 - Movement - 27.61 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - General Learning - 1969 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	50m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	20	Panels under windows	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	Requires Inspection						
Ceiling Voids	Requires Inspection						
<b>Interior</b>							
<b>B00E - R0001 - Movement - 63.31 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	14m2	Under windows	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

<b>B00E - R0002 - Home Base - 57.5 m2</b>							
No Asbestos							
<b>B00E - R0003 - Home Base Store - 5.71 m2</b>							
No Asbestos							
<b>B00E - R0004 - Movement - 16.01 m2</b>							
Electrical - Backing Board	Resinous Board	2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00E - R0005 - Home Base Store - 5.64 m2</b>							
No Asbestos							
<b>B00E - R0006 - Home Base - 56.8 m2</b>							
No Asbestos							
<b>B00E - R0007 - Home Base - 56.88 m2</b>							
No Asbestos							
<b>B00E - R0008 - Home Base Store - 5.67 m2</b>							
No Asbestos							
<b>B00E - R0009 - Movement - 15.98 m2</b>							
No Asbestos							
<b>B00E - R0010 - Home Base Store - 5.67 m2</b>							
No Asbestos							
<b>B00E - R0011 - Home Base - 57.67 m2</b>							
No Asbestos							
<b>B00F - Administration - 1967 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00F - R0001 - Staff Toilet - 3.65 m2</b>							
Wall Linings Internal	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0002 - Movement - 39.54 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00F - R0003 - Clerical Office - 24.13 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0004 - Clerical Office - 15.21 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0005 - Principal - 18.05 m2</b>							

No Asbestos							
<b>B00F - R0006 - General Storeroom - 1.9 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00F - R0007 - Staff Room Annexe - 15.92 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0008 - General Storeroom - 2.94 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00F - R0009 - Duplicating Workroom - 8.76 m2</b>							
No Asbestos							
<b>B00F - R0010 - Sick Bay - 3.43 m2</b>							
No Asbestos							
<b>B00F - R0011 - Staff Toilet - 3.57 m2</b>							
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0012 - Movement - 3.17 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - Administration - 1967 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	40m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Gable Ends	Fibre Cement Moulded	14m2	North & South	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>Interior</b>							
<b>B00G - R0001 - Deputy Principal - 17.62 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00G - R0002 - Interview - 18.1 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0003 - Community Clinic - 12.96 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	15m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0004 - Community Clinic - 9.41 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	15m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0005 - Staff Toilet - 3.28 m2</b>							
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
<b>B00G - R0006 - Movement - 21.21 m2</b>							
No Asbestos							
<b>B00G - R0007 - Cleaning Distributed Store - 2.92 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00G - R0008 - Uniform Shop - 12.09 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00G - R0009 - Main Switch Board - 5.05 m2</b>							
No Asbestos							
<b>B00G - R0011 - Movement - 2.46 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0012 - Movement - 3.17 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - General Learning - 1967 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting						
Gable Verge Lining	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00H - R0001 - Movement - 3.13 m2</b>							
No Asbestos							
<b>B00H - R0002 - Personal Effects Storage - 5.95 m2</b>							
No Asbestos							
<b>B00H - R0003 - Home Base Store - 4.17 m2</b>							
No Asbestos							
<b>B00H - R0004 - Home Base - 57.11 m2</b>							



No Asbestos							
<b>B00H - R0005 - Home Base - 57.11 m2</b>							
No Asbestos							
<b>B00H - R0006 - Home Base Store - 3.71 m2</b>							
No Asbestos							
<b>B00H - R0007 - Personal Effects Storage - 6.35 m2</b>							
No Asbestos							
<b>B00H - R0008 - Movement - 6.43 m2</b>							
No Asbestos							
<b>B00H - R0009 - Movement - 4.52 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00H - R0010 - Personal Effects Storage - 6.44 m2</b>							
No Asbestos							
<b>B00H - R0011 - Home Base Store - 3.72 m2</b>							
No Asbestos							
<b>B00H - R0012 - Home Base - 57.23 m2</b>							
No Asbestos							
<b>B00H - R0013 - Home Base - 56.36 m2</b>							
No Asbestos							
<b>B00H - R0014 - Movement - 3.21 m2</b>							
No Asbestos							
<b>B00H - R0015 - Personal Effects Storage - 6.61 m2</b>							
No Asbestos							
<b>B00H - R0016 - Home Base Store - 3.85 m2</b>							
No Asbestos							
<b>B00I - General Learning - 1967 - Brick/Block</b>							
<b>Exterior</b>							
Gable Verge Lining	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	No Asbestos Found						
Ceiling Voids	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	50m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>Interior</b>							
<b>B00I - R0001 - Movement - 7.91 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00I - R0002 - Movement - 3.22 m2</b>							
No Asbestos							
<b>B00I - R0003 - Personal Effects Storage - 6.55 m2</b>							
No Asbestos							
<b>B00I - R0004 - Home Base Store - 3.89 m2</b>							
No Asbestos							
<b>B00I - R0007 - Home Base Store - 3.83 m2</b>							
No Asbestos							
<b>B00I - R0008 - Personal Effects Storage - 6.55 m2</b>							
No Asbestos							
<b>B00I - R0009 - Movement - 3.13 m2</b>							
No Asbestos							
<b>B00I - R0010 - Movement - 2.89 m2</b>							

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00I - R0011 - Toilets - Boys/Girls - 4.14 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00I - R0012 - Reading Area - 131.4 m2</b>							
No Asbestos							
<b>B00I - R0013 - Library Office/Workroom - 10.99 m2</b>							
No Asbestos							
<b>B00J - Pupil Facilities - 1967 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	12m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
<b>Interior</b>							
<b>B00J - R0001 - Cleaning Supplies - 5.99 m2</b>							
No Asbestos							
<b>B00J - R0002 - Sports Store - 5.93 m2</b>							
No Asbestos							
<b>B00J - R0003 - Toilets - Girls - 37.06 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	25m2	East, West, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00K - Pupil Facilities - 1967 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	12m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
<b>Interior</b>							
<b>B00K - R0001 - Toilets - Boys - 41.41 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	North, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
<b>B00L - Pupil Facilities - 1967 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	30m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	25m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00L - R0001 - Movement - 25.76 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00L - R0002 - Toilets - Girls - 38.71 m2</b>							

Partition Walls (Cubicles)	Compressed AC Sheet						
<b>B00L - R0003 - Security Store - 14.12 m2</b>							
No Asbestos							
<b>B00L - R0004 - Cleaning Distributed Store - 14 m2</b>							
No Asbestos							
<b>B00L - R0005 - Toilets - Boys - 38.37 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet						
<b>B00M - Pupil Facilities/Multi Purpose Facilities - 1969 - Brick/Veneer</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	30m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	8	Panels under windows	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00M - R0002 - Movement - 34.18 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	6m2	Under windows	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00M - R0004 - Communal Space - 119.61 m2</b>							
No Asbestos							
<b>B00M - R0005 - Raised Platform - 30.1 m2</b>							
No Asbestos							
<b>B00M - R9001 - General Storeroom - 51.85 m2</b>							
No Asbestos							
<b>B00M - R9002 - Sports Store - 7.28 m2</b>							
No Asbestos							
<b>B00M - R9003 - General Storeroom - 6.86 m2</b>							
No Asbestos							
<b>B00M - R9004 - General Assistant/Bulk Store - 6.6 m2</b>							
No Asbestos							

## Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020