


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Killarney Heights Public School (4386)
Region:	Northern Sydney AMU
State Electorate:	Wakehurst
Local Government Area:	Northern Beaches

Last Reviewed By:	Greencap 13-AUG-2014
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

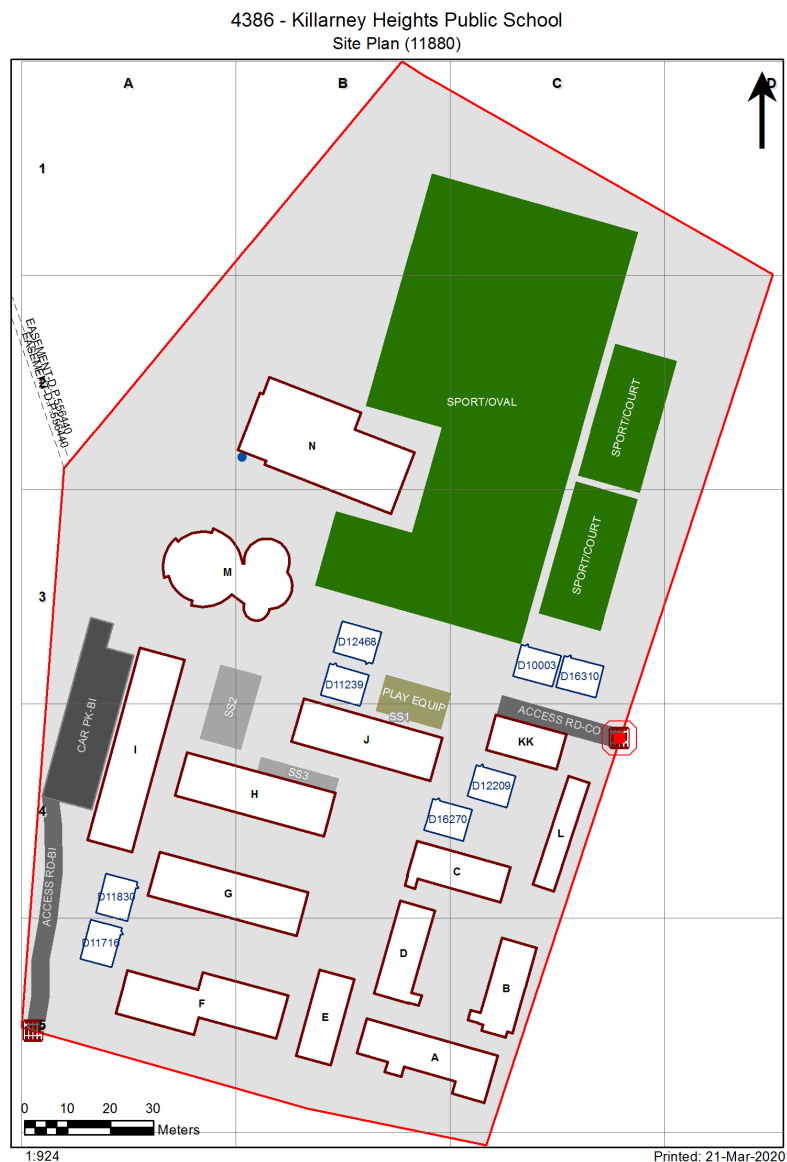

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration - 1967 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	25m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting	1	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Interior							
B00A - R0002 - General Storeroom - 3.94 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0003 - Staff Kitchen - 12.18 m2							
No Asbestos							
B00A - R0004 - Movement - 3.56 m2							
No Asbestos							
B00A - R0005 - External Movement - 1.44 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0006 - General Storeroom - 3.94 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0008 - Staff Toilet - 3.31 m2							
Wall Linings Internal	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0009 - External Movement - 10.68 m2							
Wall Linings Internal	Flat AC Sheeting	9m2	Variable positions	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0010 - Entry Vestibule - 16.7 m2							
No Asbestos							
B00A - R0012 - External Movement - 1.16 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0013 - Main Switch Board - 3.68 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0014 - General Storeroom - 7.11 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0015 - Principal - 17.48 m2							
No Asbestos							
B00A - R0016 - Deputy Principal - 17.88 m2							
No Asbestos							
B00A - R0017 - Plant - .58 m2							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0018 - General Storeroom - 2.75 m2							
Floor Coverings Res/Textile	Vinyl Tiles	2.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0019 - Movement - 5.76 m2							
No Asbestos							

B00A - R0020 - Clerical Office - 21.06 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0021 - Clerical Office/Workroom - 12.19 m2							
No Asbestos							
B00A - R0022 - Sick Bay - 5.62 m2							
No Asbestos							
B00A - R0023 - Clerical/Printing - 34.74 m2							
No Asbestos							
B00A - R0024 - Staff Room - 79.21 m2							
No Asbestos							
B00B - General Learning - 1967 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	12	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Fibrous Membrane						
Interior							
B00B - R0001 - External Movement - 4.86 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0002 - External Movement - 1.18 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0003 - Practical Activities - 1hb - 8.13 m2							
Electrical - Mounting Board	Flat AC Sheeting	1	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00B - R0004 - General Storeroom - 4.02 m2							
No Asbestos							
B00B - R0005 - Home Base - 56.68 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00B - R0006 - Home Base - 56.68 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00B - R0007 - General Storeroom - 4.02 m2							
No Asbestos							
B00B - R0008 - Practical Activities - 1hb - 11.56 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	Behind sink splashback tiles	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0009 - Movement - 4.3 m2							
No Asbestos							
B00B - R0010 - External Movement - 1.45 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R9001 - General Storeroom - 4.57 m2							
No Asbestos							
B00B - R9002 - Uniform Shop - 52.43 m2							
Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R9003 - Movement - 7.21 m2							

Wall Linings Internal	Flat AC Sheeting	12m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - General Learning - 1967 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Interior							
B00C - R0001 - External Movement - 4.88 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0002 - External Movement - 1.24 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0003 - Practical Activities - 1hb - 6.02 m2							
Electrical - Mounting Board	Flat AC Sheeting	1	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00C - R0004 - Home Base Store - 2.63 m2							
No Asbestos							
B00C - R0005 - Toilets - Boys/Girls - 3.38 m2							
Wall Linings Internal	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0006 - Practical Activities - 1hb - 28.84 m2							
No Asbestos							
B00C - R0007 - Home Base - 56.88 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00C - R0008 - Home Base - 57.04 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00C - R0009 - General Storeroom - 3.99 m2							
No Asbestos							
B00C - R0010 - Personal Effects Storage - 8.13 m2							
No Asbestos							
B00C - R0011 - External Movement - 1.26 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - General Learning - 1967 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Flat AC Sheeting	1	North	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Underfloor Voids	AC Fragments/Debris - Flat AC Sheet	1	North West	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Interior							
B00D - R0001 - External Movement - 1.16 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0002 - Personal Effects Storage - 5.66 m2							
No Asbestos							
B00D - R0003 - General Storeroom - 2.95 m2							
No Asbestos							
B00D - R0004 - Toilets - Boys/Girls - 3.45 m2							
Wall Linings Internal	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0005 - Practical Activities - 1hb - 27.58 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R0006 - Home Base - 57.92 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R0007 - Home Base - 56.89 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R0008 - Home Base Store - 4.38 m2							
No Asbestos							
B00D - R0009 - Personal Effects Storage - 5.43 m2							
Electrical - Mounting Board	Flat AC Sheeting	1	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R0010 - Movement - 2.28 m2							
No Asbestos							
B00D - R0011 - External Movement - 1.26 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0012 - External Movement - 4.79 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R9001 - General Assistant/Bulk Store - 44.88 m2							
No Asbestos							
B00E - Administration - 1967 - Brick/Block							
Exterior							
Gable Verge Lining	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	12	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	Fibrous Membrane						
Ceiling Voids	Non Accessible Area						
Interior							
B00E - R0001 - Practical Activities - 1hb - 15.21 m2							
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Thermacon Heater	Insulation Material	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00E - R0002 - Staff Room Annexe - 17.81 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Thermacon Heater	Insulation Material	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00E - R0003 - Staff Toilet - 2.24 m2							

Wall Linings Internal	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0004 - General Storeroom - .94 m2							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0005 - General Storeroom - 9.38 m2							
No Asbestos							
B00E - R0006 - Staff Toilet - 5.77 m2							
Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0007 - Staff Toilet - 5.77 m2							
Wall Linings Internal	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0008 - General Storeroom - 6.69 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0009 - Craft Store - 14.69 m2							
Floor Coverings Res/Textile	Vinyl Tiles	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0012 - Distribution Board - 1.23 m2							
						Note: No inspection of live electrical installation	
Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Mounting Board	Resinous Board	1	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00E - R0013 - General Storeroom - 14.09 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Thermacon Heater	Insulation Material	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00E - R0015 - Home Base - 42.9 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	2	East facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00E - R0016 - Practical Activities - 1hb - 3.6 m2							
No Asbestos							
B00E - R0017 - Movement - 11.65 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - General Learning - 1967 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	60m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	70m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	16	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Interior							
B00F - R0001 - Home Base - 57.19 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00F - R0002 - Home Base Store - 5.78 m2							
No Asbestos							
B00F - R0003 - Craft Store - 5.69 m2							

No Asbestos							
B00F - R0004 - Personal Effects Storage - 9.9 m2							
No Asbestos							
B00F - R0005 - Movement - 5.8 m2							
No Asbestos							
B00F - R0006 - Home Base - 57.27 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00F - R0007 - External Movement - 33.5 m2							
Ceiling Structures/Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	8m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0008 - Home Base - 57.19 m2							
No Asbestos							
B00F - R0009 - Home Base Store - 5.57 m2							
No Asbestos							
B00F - R0010 - Personal Effects Storage - 10.4 m2							
Electrical - Mounting Board	Flat AC Sheeting	1	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Linings Internal	Flat AC Sheeting	1m2	Behind sink splashback tiles	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0011 - Movement - 5.41 m2							
No Asbestos							
B00F - R0012 - Home Base Store - 5.64 m2							
No Asbestos							
B00F - R0013 - Home Base - 57.35 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00F - R0014 - External Movement - 41.51 m2							
Ceiling Structures/Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	16m2	Variable positions	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)
B00G - Library - 1967 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	12	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting	1	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Interior							
B00G - R0001 - Toilets - Girls - 60.12 m2							
Ceiling Structures/Linings	Flat AC Sheeting	61m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0002 - K.L.A. Store - 8.21 m2							
No Asbestos							
B00G - R0003 - K.L.A. Store - 5.85 m2							
Electrical - Mounting Board	Flat AC Sheeting	1	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos

B00G - R0004 - Reading Area - 149.46 m2							
No Asbestos							
B00G - R0005 - K.L.A. Store - 19.5 m2							
No Asbestos							
B00G - R0006 - Library Office/Workroom - 31.2 m2							
No Asbestos							
B00G - R0007 - External Movement - 64.03 m2							
Ceiling Structures/Linings	Flat AC Sheeting	64m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	12m2	Variable positions	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)
B00H - General Learning - 1967 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	45m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting	1	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Interior							
B00H - R0001 - Toilets - Boys - 60.2 m2							
Ceiling Structures/Linings	Flat AC Sheeting	61m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0002 - Home Base Store - 5.72 m2							
No Asbestos							
B00H - R0003 - Personal Effects Storage - 7.99 m2							
Electrical - Backing Board	Flat AC Sheeting	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00H - R0004 - Home Base - 56.88 m2							
Plant / Equipment - Thermocon Heater	Insulation Material	2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00H - R0005 - Home Base - 56.95 m2							
Plant / Equipment - Thermocon Heater	Insulation Material	2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00H - R0006 - Personal Effects Storage - 10.05 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	Behind sink splashback tiles	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0007 - Movement - 5.63 m2							
No Asbestos							
B00H - R0008 - Home Base Store - 5.67 m2							
No Asbestos							
B00H - R0009 - Home Base - 57.35 m2							
Plant / Equipment - Thermocon Heater	Insulation Material	2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00H - R0010 - Home Base Store - 5.7 m2							
No Asbestos							
B00H - R0011 - External Movement - 63.58 m2							
Ceiling Structures/Linings	Flat AC Sheeting	64m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	12m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - General Learning - 1967 - Brick/Block							

Exterior							
Eaves Linings	Flat AC Sheeting	60m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found						
Wall Cladding	Flat AC Sheeting	8m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Interior							
B001 - R0001 - Home Base - 56.88 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0002 - Home Base Store - 5.47 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0003 - Other-Commercial - .95 m2							
Electrical - Mounting Board	Flat AC Sheeting	1	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Electrical - Conduit	Fibre Cement Pipe	1	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Front area of cupboard floor	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0004 - Other-Commercial - 14.17 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0005 - Home Base Store - 6.59 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0006 - Home Base - 56.72 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B001 - R0010 - External Movement - 85.05 m2							
Wall Linings Internal	Flat AC Sheeting	4m2	West facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0012 - Communal/Performance Store - 16.03 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B001 - R0013 - Communal Space - 161.56 m2							
Wall Linings Internal	Flat AC Sheeting	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0014 - Garden Store - 36.06 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Plant / Equipment - Incinerator	Insulation Material	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Linings Internal	Flat AC Sheeting						

B00I - R1001 - Home Base - 57.17 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R1002 - Home Base Store - 5.47 m2							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R1003 - Distribution Board - .94 m2							
Note: No inspection of live electrical installation							
Electrical - Mounting Board	Flat AC Sheeting	1	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R1004 - Personal Effects Storage - 14.24 m2							
Floor Coverings Res/Textile	Vinyl Tiles	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R1005 - Home Base Store - 6.59 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R1006 - Home Base - 56.88 m2							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	West facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R1007 - Home Base - 56.72 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R1008 - Home Base Store - 6.67 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R1009 - Personal Effects Storage - 13.95 m2							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R1010 - Home Base Store - 6.71 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R1011 - Home Base - 56.72 m2							
No Asbestos							
B00I - R1012 - Home Base - 56.72 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R1013 - Home Base Store - 6.71 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R1014 - Home Base Store - 6.78 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R1015 - Movement - 83.25 m2							
Ceiling Structures/Linings	Flat AC Sheeting	84m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - General Learning - 1967 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						

Underfloor Voids	Flat AC Sheeting	1	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Interior							
B00J - R0001 - Home Base - 57.43 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00J - R0002 - Home Base Store - 6.02 m2							
No Asbestos							
B00J - R0003 - Personal Effects Storage - 15.09 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	Behind sink splashback tiles	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Mounting Board	Flat AC Sheeting	1	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00J - R0004 - Home Base Store - 6.09 m2							
No Asbestos							
B00J - R0006 - Withdrawal Space - 1hb - 21.76 m2							
No Asbestos							
B00J - R0007 - Movement - 5.79 m2							
No Asbestos							
B00J - R0008 - External Movement - 60.08 m2							
Ceiling Structures/Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - R0009 - Home Base - 86.78 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00J - R0010 - Home Base - 57.2 m2							
Plant / Equipment - Thermacon Heater	Insulation Material	2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00L - Pupil Facilities - 1967 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	Non Accessible Area						
Ceiling Voids - Flat Roof	Non Accessible Area						
Interior							
B00L - R0001 - General Storeroom - 8.29 m2							
No Asbestos							
B00L - R0002 - Toilets - Boys - 33.16 m2							
No Asbestos							
B00L - R0003 - General Storeroom - 17.03 m2							
No Asbestos							
B00L - R0004 - Cleaning Distributed Store - 5.39 m2							
No Asbestos							
B00L - R0005 - General Storeroom - 5.35 m2							
No Asbestos							
B00L - R0006 - General Storeroom - 17.12 m2							
No Asbestos							
B00L - R0007 - Toilets - Girls - 28.99 m2							
No Asbestos							
B00M - Other-After School Care - 1967 - Brick/Veneer							
Exterior							

Wall Cladding	Flat AC Sheeting						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids - Flat Roof	Non Accessible Area						
Interior							
B00M - R0001 - Out Of School Hours Care Centre - 6.32 m2							
No Asbestos							
B00M - R0002 - Out Of School Hours Care Centre - 6.34 m2							
No Asbestos							
B00M - R0003 - Out Of School Hours Care Centre - 24.13 m2							
No Asbestos							
B00M - R0004 - No Access - .9 m2							
Electrical - Backing Board	Flat AC Sheeting	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00M - R0005 - Out Of School Hours Care Centre - 2.01 m2							
No Asbestos							
B00M - R0006 - Out Of School Hours Care Centre - 19.81 m2							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00M - R0007 - Out Of School Hours Care Centre - 22.24 m2							
Floor Coverings Res/Textile	Vinyl Tiles	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00M - R0008 - Out Of School Hours Care Centre - 12.36 m2							
No Asbestos							
B00M - R0009 - Out Of School Hours Care Centre - 18.15 m2							
No Asbestos							
B00M - R0010 - Out Of School Hours Care Centre - 17.97 m2							
No Asbestos							
B00M - R0011 - Out Of School Hours Care Centre - 259.62 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - (X25)						
B00N - Other/Pupil Facilities - 2010 - Brick/Veneer							
Exterior							
Underfloor Voids	Non Accessible Area						
Ceiling Voids	Non Accessible Area						
Interior							
B00N - R0001 - Covered Outdoor Learning Area - 226.43 m2							
No Asbestos							
B00N - R0002 - External Movement - 33.99 m2							
No Asbestos							
B00N - R0003 - External Movement - 15.97 m2							
No Asbestos							
B00N - R0004 - Communal Space - 205.45 m2							
No Asbestos							
B00N - R0005 - Raised Platform - 57.42 m2							
No Asbestos							
B00N - R0006 - Main Switch Board - 3.32 m2							
No Asbestos							
B00N - R0007 - Toilet - P - 7.01 m2							
No Asbestos							
B00N - R0008 - Cleaning Supplies - 5.23 m2							
No Asbestos							

B00N - R0009 - Toilet - Lobby - 3.53 m2	
No Asbestos	
B00N - R0010 - Toilets - Boys - 5.63 m2	
No Asbestos	
B00N - R0011 - Sound Cupboard - 2.06 m2	
No Asbestos	
B00N - R0012 - Toilet - Lobby - 2.51 m2	
No Asbestos	
B00N - R0013 - Toilets - Girls - 7.38 m2	
No Asbestos	
B00N - R0014 - Sports Store - 16.4 m2	
No Asbestos	
B00N - R0015 - Communal/Performance Store - 10.97 m2	
No Asbestos	
B00N - R0016 - Hall Chair Store - 11.14 m2	
No Asbestos	
B00N - R0017 - Movement - 17.23 m2	
No Asbestos	
B00N - R0018 - Ramp - 10.99 m2	
No Asbestos	
B0KK - Canteen - 2006 - Brick/Veneer	
Exterior	
Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found
Interior	
B0KK - R0001 - Canteen Covered Area - 70.56 m2	
No Asbestos	
B0KK - R0002 - Staff Toilet - 5.17 m2	
No Asbestos	
B0KK - R0003 - Canteen Office/Store - 10.62 m2	
No Asbestos	
B0KK - R0004 - Canteen - 41.04 m2	
No Asbestos	

Demountables

OS 602 10003 - Learning Unit - Standard With P.A.A. - Placement Date : 15-JAN-2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 11239 - Learning Unit - Standard With P.A.A. - Placement Date : 10-DEC-2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 11716 - Learning Unit - Standard With P.A.A. - Placement Date : 12-MAR-2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 11830 - Learning Unit - Standard With P.A.A. - Placement Date : 21-NOV-2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 12209 - Learning Unit - Standard/Withdrawal - Placement Date : 24-JAN-2008

Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- Entry

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

R2- General Learning Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

R3- Store

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

OS 602 12468 - Learning Unit - Standard With P.A.A. - Placement Date : 04-DEC-2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 16270 - Learning Unit - Standard With P.A.A. - Placement Date : 01-NOV-2013

Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- Learning space/withdrawal/entry

Ceiling Structures/Linings	Flat AC Sheeting	70m2	Assumed Asbestos
----------------------------	------------------	------	------------------

R2- Home Base Store

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Assumed Asbestos

OS 602 16310 - Learning Unit - Standard With P.A.A. - Placement Date : 15-JAN-2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found