


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Koonawarra Public School (4409)
Region:	Southern NSW AMU
State Electorate:	Shellharbour
Local Government Area:	Wollongong

Last Reviewed By:	AECOM 18-JUN-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

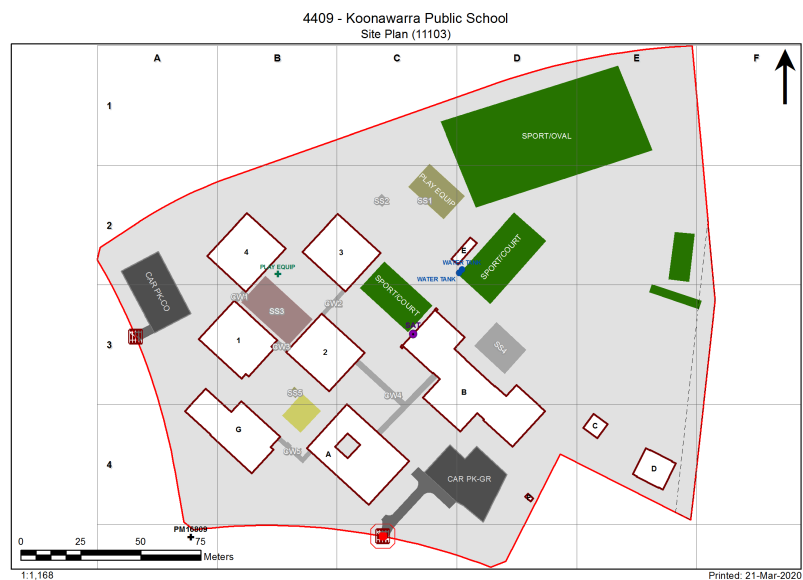

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B001 - General Learning/Pre-School Facilities - 1970 - Brick/Block							
Exterior							
Ceiling Voids	Non Accessible Area						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B001 - R0001 - Personal Effects Storage - 7.56 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0002 - Home Base - 57.75 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B001 - R0003 - Home Base Store - 7.39 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0004 - Personal Effects Storage - 7.6 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0005 - Home Base - 57.52 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B001 - R0006 - Home Base Store - 7.35 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0009 - External Movement - 83.98 m2							
No Asbestos							
B001 - R0010 - Staff Room - Pre - 12.4 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B001 - R0011 - General Storeroom - Pre - 14.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B001 - R0012 - Covered Outdoor Learning Area - Pre - 56.06 m2							
No Asbestos							
B001 - R0013 - Home Base - Pre - 116.37 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B001 - R0014 - General Storeroom - Pre - 7.24 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0015 - Personal Effects - Pre - 7.6 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B001 - R0016 - External Movement - 10.38 m2							
No Asbestos							
B001 - R0017 - External Movement - 3.57 m2							
No Asbestos							
B001 - R0018 - Toilets - Boys/Girls - Pre - 12.92 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0019 - Laundry - Pre - 3.25 m2							
No Asbestos							
B001 - R0020 - Staff Toilet - Pre - 1.07 m2							
No Asbestos							
B001 - R0021 - Staff Room - Pre - 18.4 m2							
No Asbestos							
B001 - R0022 - General Storeroom - Pre - 10.88 m2							
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0023 - Distribution Board - .61 m2 Note: No inspection of live electrical installation							
No Asbestos							
B002 - General Learning/Other-Community Use - 1970 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	Non Accessible Area						
Interior							
B002 - R0001 - General Storeroom - 7.37 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B002 - R0002 - Special Programs Room - 57.1 m2							
Floor Coverings Res/Textile	Vinyl Tiles	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B002 - R0003 - Other-Community Use - 7.6 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B002 - R0004 - Practical Activities - 1hb - 56.8 m2							
Floor Coverings Res/Textile	Vinyl Tiles	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B002 - R0005 - General Storeroom - 7.59 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						

B002 - R0006 - Home Base Store - 7.43 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B002 - R0007 - Toilets - Girls - 37.15 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	24m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0008 - Staff Toilet - 1.19 m2							
No Asbestos							
B002 - R0009 - General Storeroom - 7.56 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B002 - R0010 - Home Base - 56.88 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B002 - R0011 - Home Base Store - 7.41 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B002 - R0012 - Kiln Room - 7.53 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B002 - R0013 - Canteen - 56.87 m2							
Floor Coverings Res/Textile	Vinyl Tiles	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B002 - R0014 - Home Base Store - 7.37 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B002 - R0015 - Staff Shower/Change - 8.85 m2							
No Asbestos							
B002 - R0016 - Movement - 6.3 m2							
No Asbestos							
B002 - R0017 - Cleaning Distributed Store - 5.94 m2							
No Asbestos							
B002 - R0018 - Distribution Board - .58 m2							
No Asbestos							
B002 - R0019 - External Movement - 122.7 m2							
No Asbestos							
B003 - General Learning - 1970 - Brick/Block							
Exterior							
Ceiling Voids	Non Accessible Area						

Underfloor Voids - Slab on Ground	No Asbestos Found							
Interior								
B003 - R0001 - Home Base Store - 7.38 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B003 - R0002 - Home Base - 57.02 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B003 - R0003 - General Storeroom - 7.56 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B003 - R0004 - Movement - 3.71 m2								
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B003 - R0005 - General Storeroom - 7.37 m2								
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B003 - R0006 - Distribution Board - .72 m2 Note: No inspection of live electrical installation								
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B003 - R0007 - General Storeroom - 11.66 m2								
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B003 - R0008 - Personal Effects Storage - 7.56 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B003 - R0009 - Home Base - 51.94 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B003 - R0010 - Home Base Store - 7.38 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B003 - R0011 - Withdrawal Space - 1hb - 5.08 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B003 - R0012 - Personal Effects Storage - 7.55 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	

B003 - R0013 - Home Base - 57.02 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B003 - R0014 - Home Base Store - 7.34 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0015 - Toilets - Boys - 34.9 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0016 - Staff Toilet - 1.19 m2							
No Asbestos							
B003 - R0017 - Personal Effects Storage - 6.51 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0018 - Practical Activities - 1hb - 1.03 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0019 - Home Base - 51.66 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B003 - R0020 - Home Base Store - 7.34 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0021 - Withdrawal Space - 1hb - 5.29 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B003 - R0022 - External Movement - 122.73 m2							
No Asbestos							
B004 - General Learning - 1970 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	Non Accessible Area						
Interior							
B004 - R0001 - Personal Effects Storage - 6.32 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B004 - R0002 - Home Base - 77.25 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B004 - R0003 - Home Base Store - 5.84 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B004 - R0004 - Toilets - Boys/Girls - 3.2 m2								
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B004 - R0005 - Withdrawal Space - 1hb - 8.94 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B004 - R0006 - Home Base - 76.48 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B004 - R0007 - Personal Effects Storage - 6.3 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B004 - R0008 - Home Base Store - 5.83 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B004 - R0009 - Toilets - Boys/Girls - 3.2 m2								
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B004 - R0010 - Withdrawal Space - 1hb - 9.64 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B004 - R0011 - Home Base - 82.19 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B004 - R0012 - Toilets - Boys/Girls - 3.18 m2								
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B004 - R0013 - Home Base Store - 6.13 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B004 - R0014 - Personal Effects Storage - 6.44 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B004 - R0015 - Toilets - Boys - 18.69 m2								
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B004 - R0016 - Toilets - Girls - 21.1 m2								
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	

B004 - R0017 - Cleaning Distributed Store - 2.51 m2							
No Asbestos							
B004 - R0018 - Distribution Board - .56 m2							Note: No inspection of live electrical installation
No Asbestos							
B004 - R0019 - External Movement - 130.72 m2							
No Asbestos							
B004 - R0020 - Cleaning Distributed Store - 8.06 m2							
No Asbestos							
B00A - Administration/Library - 1970 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00A - R0001 - Library Office/Workroom - 15.85 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0002 - Movement - 5.53 m2							
No Asbestos							
B00A - R0003 - Clerical Office/Workroom - 110.14 m2							
No Asbestos							
B00A - R0006 - General Assistant/Bulk Store - 12.45 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0007 - Sick Bay - 22.4 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0008 - Uniform Shop - 3.92 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0009 - Movement - 4.72 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0012 - Deputy Principal - 13.05 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0015 - Staff Toilet - 4 m2							
No Asbestos							
B00A - R0016 - Staff Room Annexe - 7.68 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00A - R0017 - Movement - 20.77 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0018 - Interview - 15.85 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0019 - General Storeroom - 6.04 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0020 - General Storeroom - 9.36 m2							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0021 - General Storeroom - 5.68 m2							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0022 - K.L.A. Store - 49.59 m2							
No Asbestos							
B00A - R0023 - Movement - 4.23 m2							
No Asbestos							
B00A - R0024 - Staff Toilet - 6.51 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0025 - Staff Toilet - 6.7 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0026 - Cleaning Distributed Store - 1.37 m2							
No Asbestos							
B00A - R0027 - Staff Room - 63.61 m2							
No Asbestos							
B00A - R0028 - External Movement - 17.57 m2							
No Asbestos							
B00A - R0029 - Main Switch Board - 10.58 m2							
No Asbestos							
B00A - R0030 - External Movement - 30.32 m2							
No Asbestos							
B00A - R0031 - Movement - 2.16 m2							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0032 - Canteen Office/Store - 2.1 m2							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0033 - Deputy Principal - 26.69 m2							
No Asbestos							
B00A - R0034 - Canteen Office/Store - 4.51 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0035 - Cleaning Distributed Store - 5.59 m2							
No Asbestos							
B00A - R0036 - External Movement - 141.03 m2							

No Asbestos							
B00A - R0037 - Entry Vestibule - 23.2 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0038 - Clerical Office - 33.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0039 - Principal - 19.38 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0040 - Toilet - Lobby - 1.22 m2							
No Asbestos							
B00A - R0041 - Staff Toilet - 1.42 m2							
No Asbestos							
B00A - R0042 - Toilet - Lobby - 1.23 m2							
No Asbestos							
B00A - R0043 - Staff Toilet - 1.38 m2							
No Asbestos							
B00B - General Learning/Library - 1970 - Brick/Block							
Exterior							
Wall Linings Internal - Infill	Flat AC Sheeting	80	North, South, East, West, Upper portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	Non Accessible Area						
Interior							
B00B - R0001 - Home Base - 61.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0002 - Home Base - 62.15 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0003 - Home Base - 62.15 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0004 - Home Base - 62.15 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0005 - Cleaning Distributed Store - .45 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0006 - Distribution Board - .77 m2							
				Note: No inspection of live electrical installation			
Wall Linings Internal	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0007 - Seminar/Study - 18.02 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0008 - Movement - 33.67 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0009 - Movement - 44.23 m2								
No Asbestos								
B00B - R0010 - Hall Chair Store - 11.22 m2								
No Asbestos								
B00B - R0011 - Cleaning Supplies - 10.63 m2								
No Asbestos								
B00B - R0012 - Raised Platform - 38.81 m2								
No Asbestos								
B00B - R0013 - Movement - 9.37 m2								
No Asbestos								
B00B - R0014 - Communal Space - 132.36 m2								
No Asbestos								
B00B - R0015 - Movement - 55.53 m2								
No Asbestos								
B00B - R0016 - Sports Store - 10.49 m2								
No Asbestos								
B00B - R0023 - External Movement - 3.87 m2								
No Asbestos								
B00B - R0024 - Toilets - Boys - 100.92 m2								
Partition Walls (Cubides)	Compressed AC Sheet							
B00B - R0025 - Cleaning Distributed Store - 1.84 m2								
No Asbestos								
B00B - R0026 - Staff Toilet - 2.8 m2								
No Asbestos								
B00B - R0027 - Garden Store - 9.81 m2								
No Asbestos								
B00B - R0028 - Cleaning Supplies - 17.9 m2								
No Asbestos								
B00B - R0029 - Toilets - Girls - 75.52 m2								
Partition Walls (Cubides)	Compressed AC Sheet							
B00B - R0030 - Staff Toilet - 1.96 m2								
No Asbestos								
B00B - R0031 - External Movement - 10.93 m2								
No Asbestos								
B00B - R0032 - Distribution Board - .69 m2								
Note: No inspection of live electrical installation								
Electrical - Mounting Board	Resinous Board	0.5	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00B - R0033 - Stairs - 7.97 m2								
No Asbestos								
B00B - R0034 - Stairs - 7.8 m2								
No Asbestos								
B00B - R0035 - Staff Kitchen - 5.43 m2								
No Asbestos								
B00B - R0036 - Distribution Board Cupboard - .74 m2								
Note: No inspection of live electrical installation								
Wall Linings Internal	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	

B00B - R0037 - Cleaning Supplies - .4 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0038 - Library Office/Workroom - 18.51 m2							
No Asbestos							
B00B - R0039 - K.L.A. Store - 18.92 m2							
No Asbestos							
B00B - R0040 - Reading Area - 246.51 m2							
No Asbestos							
B00B - R0041 - Communications Room - 10.73 m2							
No Asbestos							
B00B - R1001 - Home Base - 61.92 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1002 - Cleaning Distributed Store - .43 m2							
No Asbestos							
B00B - R1003 - Staff Room Annexe - 18.44 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1004 - Home Base - 62 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1005 - Home Base - 62 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1007 - Home Base - 62 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1010 - Home Base - 62.38 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1011 - Home Base - 62.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1012 - Home Base - 62.07 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1013 - Home Base - 61.98 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1016 - Home Base - 61.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1017 - Home Base - 61.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1018 - General Storeroom - 18.91 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1019 - Cleaning Distributed Store - .43 m2							
No Asbestos							

B00B - R1020 - Home Base - 62.07 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00B - R1021 - Home Base - 62.07 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00B - R1023 - Stairs - 10.92 m2		
No Asbestos		
B00B - R1024 - Stairs - 11 m2		
No Asbestos		
B00B - R1025 - Movement - 211.43 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)	
B00C - Shed - 1970 - Metal Shed		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00C - R0001 - General Storeroom - 51.84 m2		
No Asbestos		
B00D - Other-Community Use - 1975 - Brick/Veneer		
Exterior		
Ceiling Voids	Non Accessible Area	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Interior		
B00D - M0009 - Withdrawal - Pre - 15.03 m2		
No Asbestos		
B00D - M0010 - General Storeroom - Pre - 35.86 m2		
No Asbestos		
B00D - M0011 - Stairs - 2.36 m2		
No Asbestos		
B00D - R0001 - External Movement - 22.03 m2		
No Asbestos		
B00D - R0002 - Staff Room - 24.73 m2		
No Asbestos		
B00D - R0003 - Distribution Board - .1 m2		
No Asbestos		Note: No inspection of live electrical installation
B00D - R0004 - Staff Toilet - 1.87 m2		
No Asbestos		
B00D - R0005 - Home Base - Pre - 61.82 m2		
No Asbestos		
B00D - R0006 - General Storeroom - Pre - 11.54 m2		
No Asbestos		
B00D - R0007 - Toilets - Boys/Girls - Pre - 11.83 m2		
No Asbestos		
B00D - R0008 - External Movement - 22.03 m2		
No Asbestos		
B00D - R0009 - Stairs - 1.38 m2		
No Asbestos		
B00E - Shed/Administration - 1970 - Steel		

Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Interior		
B00E - R0001 - General Storeroom - 30.72 m2		
No Asbestos		
B00E - R0002 - External Movement - 9.52 m2		
No Asbestos		
B00F - Electrical Services - 1970 - Brick/Block		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Interior		
B00F - R0001 - Plant - 4.22 m2		
No Asbestos		
B00G - Pupil Facilities/Multi Purpose Facilities - 2010 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Interior		
B00G - R0001 - Communal Space - 198.13 m2		
No Asbestos		
B00G - R0002 - Raised Platform - 58.25 m2		
No Asbestos		
B00G - R0003 - Chair Storeroom - 12.71 m2		
No Asbestos		
B00G - R0004 - Communal/Performance Store - 10.37 m2		
No Asbestos		
B00G - R0005 - P.E Store - 16.4 m2		
No Asbestos		
B00G - R0006 - Toilet - Lobby - 2.68 m2		
No Asbestos		
B00G - R0007 - Toilets - Girls - 6.89 m2		
No Asbestos		
B00G - R0008 - Sound Cupboard - 1.85 m2		
No Asbestos		
B00G - R0009 - Toilet - Lobby - 3.4 m2		
No Asbestos		
B00G - R0010 - Toilets - Boys - 5.88 m2		
No Asbestos		
B00G - R0011 - Cleaning Distributed Store - 3.46 m2		
No Asbestos		
B00G - R0012 - Plant - 1.59 m2		
No Asbestos		
B00G - R0013 - Main Switch Board - 3.41 m2		
No Asbestos		
B00G - R0014 - Access Shower/Toilet/Change - 7.05 m2		
No Asbestos		
B00G - R0015 - Covered Outdoor Learning Area - 184.81 m2		

No Asbestos	
B00G- R0016 - Movement - 7.18 m2	
No Asbestos	
B00G- R0017 - Movement - 18.44 m2	
No Asbestos	
B00G- R0018 - Ramp - 11.72 m2	
No Asbestos	
B00G- R0019 - External Movement - 44.61 m2	
No Asbestos	

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020