


# Asbestos Register

(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>King Park Public School (4467)</b>
<b>Region:</b>	<b>South Western Sydney AMU</b>
<b>State Electorate:</b>	<b>Fairfield</b>
<b>Local Government Area:</b>	<b>Fairfield</b>

<b>Last Reviewed By:</b>	<b>Greencap 30-NOV-2017</b>
<b>Last Revised By:</b>	

<b>Historical Fibro In Grounds Investigations/Events</b>	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

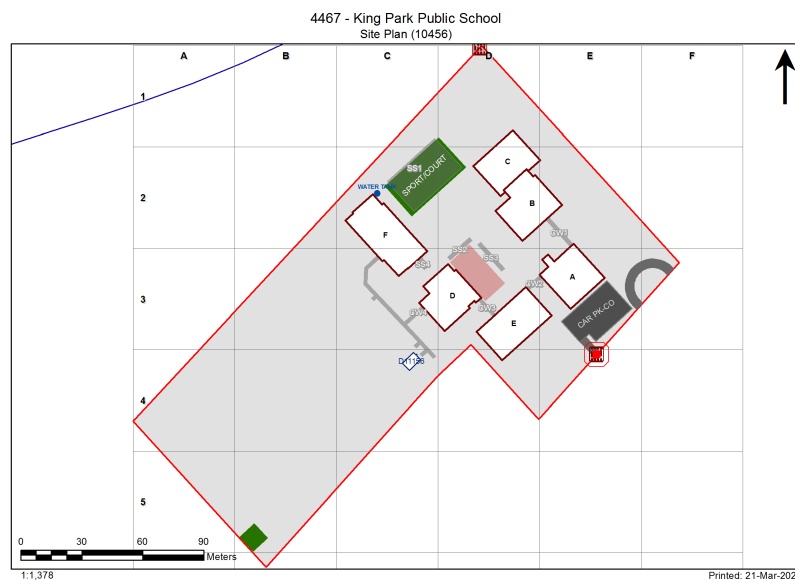

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

### Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

### Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

### Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

#### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - Library/Administration - 1972 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00A - R0001 - Deputy Principal - 12.24 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12.24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R0002 - Staff Toilet - 4.11 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R0003 - Security Store - 9.26 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R0004 - Security Store - 9.36 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R0005 - Security Store - 13.57 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0006 - Distribution Board - .72 m2</b> <span style="float: right;"><b>Note: No inspection of live electrical installation</b></span>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	0.72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R0007 - Duplicating Workroom - 12.11 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
Furniture / Fixtures - Safe / Vault	Encapsulated Asbestos material within unit	2	Southwest wall	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Furniture / Fixtures - Safe / Vault	Encapsulated Asbestos material within unit	3.75	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00A - R0008 - Clerical Office - 12.6 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R0009 - Clerical Office/Workroom - 12.64 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12.64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)

<b>B00A - R0010 - Sick Bay - 12.24 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12.24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R0011 - Community Clinic - 12.55 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12.55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R0012 - Movement - 6.22 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R0013 - Staff Toilet - 3.06 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R0014 - Staff Toilet - 3.1 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R0015 - Entry Vestibule - 23.25 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	23.25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R0016 - Staff Shower/Change - 5.35 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0017 - Cleaning Distributed Store - 1.81 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	1.81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R0018 - Staff Toilet - 1.48 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0019 - Movement - 3.2 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0020 - Staff Toilet - 3.78 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0021 - General Storeroom - 2.65 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	2.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R0022 - Principal - 16.2 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)

<b>B00A - R0023 - Staff Room Annexe - 16.2 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R0024 - Interview - 9.79 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9.79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R0025 - Movement - 22.01 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	22.01m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R0026 - Staff Kitchen - 4.72 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0027 - Movement - 5.11 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0028 - Movement - 1.34 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0029 - Staff Toilet - 4.02 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0030 - Staff Toilet - 3.2 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0031 - Movement - 3.09 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0032 - Staff Room - 58.67 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58.67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R0033 - Movement - 141.29 m2</b>							
No Asbestos							
<b>B00A - R1001 - Toilets - Boys - 3.16 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R1002 - Movement - 1.48 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R1003 - Distribution Board - .86 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						<b>Note: No inspection of live electrical installation</b>
<b>B00A - R1004 - Cleaning Distributed Store - 1.51 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						

Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R1005 - Movement - 1.26 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00A - R1006 - Toilets - Girls - 3.37 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Northwest	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R1007 - K.L.A. Store - 26.07 m2</b>							
No Asbestos							
<b>B00A - R1008 - Reading Area - 186.36 m2</b>							
No Asbestos							
<b>B00A - R1009 - Reading Area - 52.57 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00A - R1010 - Library Office/Workroom - 6.1 m2</b>							
No Asbestos							
<b>B00A - R1011 - Library Office/Workroom - 19.49 m2</b>							
No Asbestos							
<b>B00A - R1012 - Entry Vestibule - 25.78 m2</b>							
No Asbestos							
<b>B00A - R1013 - Movement - 18.49 m2</b>							
No Asbestos							
<b>B00B - General Learning - 1972 - Brick/Block</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00B - R0001 - Home Base - 91.46 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	87m2	Northwest	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00B - R0002 - Toilets - Boys/Girls - 3.55 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00B - R0003 - Personal Effects Storage - 5.29 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00B - R0004 - Practical Activities - 1hb - 1.54 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00B - R0005 - Home Base Store - 4.69 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)

<b>B00B - R0006 - Home Base Store - 4.67 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00B - R0007 - Practical Activities - 1hb - 1.54 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00B - R0008 - Personal Effects Storage - 5.26 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00B - R0009 - Toilets - Boys/Girls - 3.53 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00B - R0010 - Home Base - 91.67 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	88m2	Northwest	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00B - R0011 - Garden Store - 2.58 m2</b>							
Door - Lining	Flat AC Sheeting	4	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0012 - Movement - 236.16 m2</b>							
No Asbestos							
<b>B00B - R0013 - Movement - 79.13 m2</b>							
No Asbestos							
<b>B00B - R1001 - Movement - 41.02 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00B - R1002 - Movement - 55.18 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00B - R1003 - Practical Activities - 1hb - .86 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00B - R1004 - Personal Effects Storage - 5.73 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
<b>B00B - R1005 - Home Base Store - 7.05 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
<b>B00B - R1006 - Home Base - 63.96 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	63.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
<b>B00B - R1007 - Home Base - 63.96 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Northwest	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
<b>B00B - R1008 - Home Base Store - 7.05 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
<b>B00B - R1009 - Personal Effects Storage - 5.73 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
<b>B00B - R1010 - Practical Activities - 1hb - .86 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
<b>B00B - R1011 - Practical Activities - 1hb - .86 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
<b>B00B - R1012 - Personal Effects Storage - 5.76 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
<b>B00B - R1013 - Home Base Store - 7.09 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
<b>B00B - R1014 - Home Base - 63.96 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	63.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
<b>B00B - R1015 - Home Base - 63.96 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							



<b>B00B - R1016 - Home Base Store - 7.09 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
<b>B00B - R1017 - Personal Effects Storage - 5.78 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
<b>B00B - R1018 - Practical Activities - 1hb - .86 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
<b>B00B - R1019 - Movement - 4.17 m2</b>							
No Asbestos							
<b>B00C - General Learning - 1972 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	Non Accessible Area						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00C - R0001 - Toilets - Boys/Girls - 3.48 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00C - R0002 - Home Base Store - 4.23 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00C - R0003 - Personal Effects Storage - 10.58 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00C - R0004 - Practical Activities - 1hb - 4.86 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	4.86m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00C - R0005 - Distribution Board - .83 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Door - Lining	Flat AC Sheeting	5	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0006 - Sports Store - 22.87 m2</b>							
No Asbestos							
<b>B00C - R0007 - Cleaning Supplies - 24.97 m2</b>							
No Asbestos							
<b>B00C - R0008 - Personal Effects Storage - 9.54 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00C - R0009 - Practical Activities - 1hb - 1.97 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00C - R0010 - Toilets - Boys/Girls - 3.44 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00C - R0011 - Home Base Store - 6.23 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00C - R0012 - Home Base - 92.23 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	80m2	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00C - R0013 - Home Base - 95.58 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	85.58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00C - R0014 - Toilets - Girls - 43.44 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00C - R0015 - Toilets - Boys - 43.5 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	16m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00C - R0016 - Movement - 79 m2</b>							
No Asbestos							
<b>B00C - R1001 - Practical Activities - 1hb - .87 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
<b>B00C - R1002 - Personal Effects Storage - 5.74 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
<b>B00C - R1003 - Home Base Store - 6.85 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
<b>B00C - R1004 - Home Base - 63.56 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	63.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
<b>B00C - R1005 - Cleaning Distributed Store - .3 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
<b>B00C - R1006 - Personal Effects Storage - 6.88 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
<b>B00C - R1007 - Home Base Store - 7.1 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
<b>B00C - R1008 - Home Base - 63.57 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	63.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
<b>B00C - R1009 - Cleaning Distributed Store - .31 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
Wall Linings Internal	Flat AC Sheeting	3m2	Northeast	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
Door - Lining	Flat AC Sheeting	6	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
<b>B00C - R1010 - Distribution Board - .53 m2</b> <span style="float: right;"><b>Note: No inspection of live electrical installation</b></span>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Wall Linings Internal	Flat AC Sheeting	3m2	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
Door - Lining	Flat AC Sheeting	6	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
<b>B00C - R1011 - General Storeroom - 19.75 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
<b>B00C - R1012 - Personal Effects Storage - 6.8 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
<b>B00C - R1013 - Home Base Store - 7 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							

Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
<b>B00C - R1014 - Home Base - 63.97 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	63.97m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
<b>B00C - R1015 - Practical Activities - 1hb - .86 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
<b>B00C - R1016 - Personal Effects Storage - 5.73 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
<b>B00C - R1017 - Home Base Store - 7.14 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
<b>B00C - R1018 - Home Base - 63.9 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	63.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
<b>B00C - R1019 - Movement - 34.08 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00D - General Learning - 1972 - Brick/Block</b>								
<b>Exterior</b>								
Underfloor Voids - Slab on Ground	No Asbestos Found							
Ceiling Voids	No Asbestos Found							
<b>Interior</b>								
<b>B00D - R0001 - Security Store - 6.79 m2</b>								
Furniture / Fixtures - Safe / Vault	Encapsulated Asbestos material within unit	3.75	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>B00D - R0002 - Home Base - 66.06 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66.06m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
<b>B00D - R0003 - Home Base - 66.25 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66.25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00D - R0004 - Personal Effects Storage - 32.74 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00D - R0005 - Cleaning Distributed Store - .38 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
Door - Lining	Flat AC Sheeting	2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0006 - Distribution Board - .75 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Wall Linings Internal	Flat AC Sheeting	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00D - R0007 - General Storeroom - 18.09 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18.09m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00D - R0008 - Home Base - 65.78 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	65.78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00D - R0009 - Home Base - 65.95 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	65.95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00D - R0010 - Movement - 141.58 m2</b>							
No Asbestos							
<b>B00D - R1001 - Home Base - 66.25 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66.25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00D - R1002 - Home Base - 66.08 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66.08m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00D - R1003 - Movement - 42.74 m2</b>							
No Asbestos							
<b>B00D - R1004 - Personal Effects Storage - 49.74 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00D - R1005 - Home Base - 65.76 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	65.76m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00D - R1006 - Home Base - 65.86 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	65.86m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
<b>B00E - Communal Facilities - 1972 - Brick/Block</b>								
<b>Exterior</b>								
Underfloor Voids - Slab on Ground	No Asbestos Found							
Ceiling Voids	Non Accessible Area							
<b>Interior</b>								
<b>B00E - R0001 - General Assistant/Bulk Store - 15.14 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
<b>B00E - R0002 - Main Switch Board - 12.42 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
Wall Linings Internal	Flat AC Sheeting							
<b>B00E - R0003 - Canteen - 34.18 m2</b>								
No Asbestos								
<b>B00E - R0004 - Staff Toilet - 1.92 m2</b>								
No Asbestos								
<b>B00E - R0005 - Canteen Office/Store - 2.52 m2</b>								
No Asbestos								
<b>B00E - R0006 - Canteen Office/Store - 2.66 m2</b>								
No Asbestos								
<b>B00E - R0007 - General Storeroom - 2.46 m2</b>								
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
<b>B00E - R0008 - Communal Space - 176.57 m2</b>								
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
<b>B00E - R0009 - P.E. Store - 9.59 m2</b>								
No Asbestos								
<b>B00E - R0010 - General Assistant/Bulk Store - 21.54 m2</b>								
No Asbestos								
<b>B00E - R0011 - Toilets - Boys - 64.66 m2</b>								
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
<b>B00E - R0012 - Out Of School Hours Care Centre - 2.42 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
<b>B00E - R0013 - Out Of School Hours Care Centre - 2.55 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet							

Floor Coverings Res/Textile	Vinyl Sheet - Adhesive							
<b>B00E - R0014 - Toilets - Girls - 64.61 m2</b>								
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)	
<b>B00E - R0015 - Movement - 20.16 m2</b>								
No Asbestos								
<b>B00E - R0016 - Movement - 137.34 m2</b>								
No Asbestos								
<b>B00F - Communal Facilities - 2010 - Brick/Veneer</b>								
<b>Exterior</b>								
Underfloor Voids	No Asbestos Found							
Ceiling Voids	No Asbestos Found							
<b>Interior</b>								
<b>B00F - R0001 - Communal Space - 201.78 m2</b>								
No Asbestos								
<b>B00F - R0002 - Raised Platform - 58.42 m2</b>								
No Asbestos								
<b>B00F - R0003 - Hall Chair Store - 12.64 m2</b>								
No Asbestos								
<b>B00F - R0004 - Communal/Performance Store - 10.26 m2</b>								
No Asbestos								
<b>B00F - R0005 - P.E Store - 16.35 m2</b>								
No Asbestos								
<b>B00F - R0006 - Toilet - Lobby - 2.47 m2</b>								
No Asbestos								
<b>B00F - R0007 - Toilets - Girls - 7.26 m2</b>								
No Asbestos								
<b>B00F - R0008 - Sound Cupboard - 2.15 m2</b>								
No Asbestos								
<b>B00F - R0009 - Toilet - Lobby - 3.43 m2</b>								
No Asbestos								
<b>B00F - R0010 - Toilets - Boys - 5.79 m2</b>								
No Asbestos								
<b>B00F - R0011 - Cleaning Distributed Store - 3.54 m2</b>								
No Asbestos								
<b>B00F - R0012 - Plant - 1.63 m2</b>								
No Asbestos								
<b>B00F - R0013 - Main Switch Board - 3.24 m2</b>								
No Asbestos								
<b>B00F - R0014 - Access Shower/Toilet - 7.03 m2</b>								
No Asbestos								
<b>B00F - R0015 - External Movement - 57.02 m2</b>								
No Asbestos								
<b>B00F - R0016 - Movement - 17.7 m2</b>								
No Asbestos								
<b>B00F - R0017 - Movement - 12.89 m2</b>								
No Asbestos								
<b>B00F - R0018 - Movement - 4.76 m2</b>								
No Asbestos								

<b>B00F - R0019 - External Movement - 16.91 m2</b>	
No Asbestos	
<b>B00F - R0020 - Covered Outdoor Learning Area - 198.36 m2</b>	
No Asbestos	
<b>B00F - R0021 - Canteen - 41.81 m2</b>	
No Asbestos	
<b>B00F - R0022 - Canteen Office/Store - 10.19 m2</b>	
No Asbestos	



## Demountables

OS 750 11156 - Learning Unit - ESL - Placement Date : 10-JAN-2007

### Exterior

Eaves Linings	Flat AC Sheeting	5.76m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

### Interior

#### R1- Es1

End Wall Panel	Flat AC Sheeting	50m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Assumed Asbestos