


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Kariong Public School (4580)
Region:	Hunter/Central Coast AMU
State Electorate:	Gosford
Local Government Area:	Central Coast

Last Reviewed By:	WSP 29-JUN-2017
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

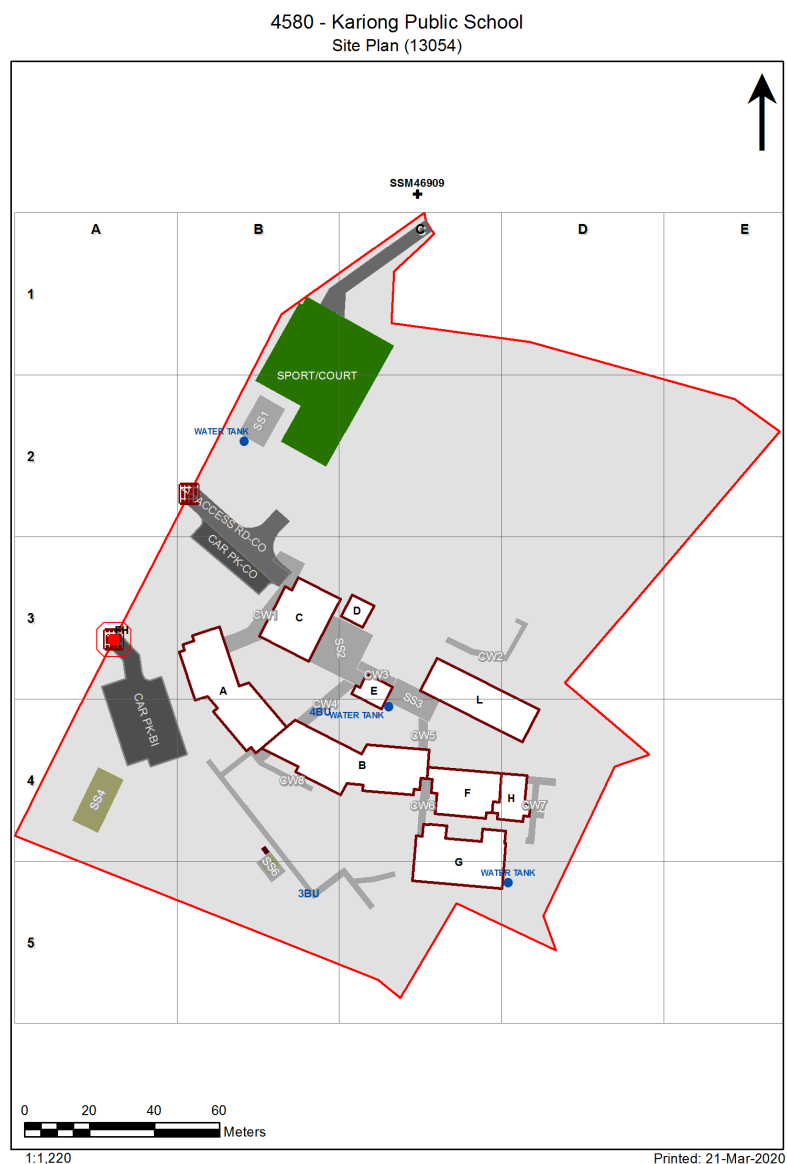

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration - 1988 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	16m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids		1	South	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Underfloor Voids	Packing	1	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00A - R0005 - Principal - 19.21 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00A - R0006 - Security Store - 21.76 m2							
No Asbestos							
B00A - R0007 - Staff Toilet - 5.5 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting						
B00A - R0008 - Staff Toilet - 5.5 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R0009 - Staff Toilet - 5.5 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R0011 - Seminar/Study - 19.8 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00A - R0013 - Interview - 14.48 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00A - R0014 - Distribution Board - .68 m2							
						Note: No inspection of live electrical installation	
No Asbestos							
B00A - R0015 - Cleaning Distributed Store - 4.72 m2							
No Asbestos							
B00A - R0016 - Deputy Principal - 12.19 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00A - R0017 - Staff Room Annexe - 12.19 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00A - R0018 - Sick Bay - 12.19 m2							
No Asbestos							
B00A - R0019 - Staff Toilet - 8.28 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R0021 - KIn Room - 5.68 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
Floor Coverings Res/Textile	Compressed AC Sheet						
B00A - R0023 - Movement - 108.36 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0024 - Entry Vestibule - 11.61 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00A - R0025 - Clerical Office - 38.54 m2							
Floor Coverings Res/Textile	No Asbestos Found						

B00A - R0026 - Duplicating Workroom - 21.22 m2								
No Asbestos								
B00A - R0027 - Movement - 54.18 m2								
Floor Coverings Res/Textile		No Asbestos Found						
B00A - R0028 - Staff Room - 80.54 m2								
Floor Coverings Res/Textile		No Asbestos Found						
B00A - R0029 - Stairs - 16.42 m2								
Wall Linings Internal		Flat AC Sheeting						
B00A - R1001 - Home Base Store - 5.78 m2								
Floor Coverings Res/Textile		No Asbestos Found						
B00A - R1002 - Home Base - 58.33 m2								
Floor Coverings Res/Textile		No Asbestos Found						
B00A - R1003 - Practical Activities - 1hb - 20 m2								
No Asbestos								
B00A - R1004 - Communications Room - 13.23 m2								
Floor Coverings Res/Textile		No Asbestos Found						
B00A - R1005 - Practical Activities - 1hb - 20.05 m2								
No Asbestos								
B00A - R1006 - Home Base - 58.41 m2								
Floor Coverings Res/Textile		No Asbestos Found						
B00A - R1007 - Home Base Store - 7.08 m2								
Floor Coverings Res/Textile		No Asbestos Found						
B00A - R1008 - Cleaning Distributed Store - 3.05 m2								
No Asbestos								
B00A - R1009 - Distribution Board - 1.36 m2							Note: No inspection of live electrical installation	
No Asbestos								
B00A - R1013 - Movement - 104.03 m2								
Wall Linings Internal		Flat AC Sheeting						
B00A - R1014 - Home Base Store - 9 m2								
No Asbestos								
B00A - R1015 - Practical Activities - 1hb - 19.94 m2								
No Asbestos								
B00A - R1016 - Home Base - 58.79 m2								
Floor Coverings Res/Textile		No Asbestos Found						
B00A - R1017 - Home Base - 58.94 m2								
Floor Coverings Res/Textile		No Asbestos Found						
B00A - R1018 - Withdrawal Space - 1hb - 14.75 m2								
Floor Coverings Res/Textile		No Asbestos Found						
B00A - R1019 - Practical Activities - 1hb - 19.9 m2								
No Asbestos								
B00A - R1020 - Interview - 8.12 m2								
Floor Coverings Res/Textile		No Asbestos Found						
B00A - R1021 - Home Base Store - 6.93 m2								
No Asbestos								
B00A - R1022 - Stairs - 13.56 m2								
Wall Linings Internal		Flat AC Sheeting						
B00B - General Learning - 1988 - Brick/Veneer								
Exterior								
Eaves Linings		Flat AC Sheeting	12m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Cladding		Flat AC Sheeting						
Ceiling Voids		No Asbestos Found						

Underfloor Voids	No Asbestos Found	
Interior		
B00B - R0001 - Special Programs Room - 31.54 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00B - R0002 - Communications Room - 3.75 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00B - R0003 - Toilets - Boys/Girls - 6.2 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
Wall Linings Internal	Flat AC Sheeting	
B00B - R0004 - Toilets - Boys/Girls - 6.71 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
Wall Linings Internal	Flat AC Sheeting	
B00B - R0005 - Home Base Store - 5.8 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00B - R0006 - Home Base - 58.79 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00B - R0007 - Practical Activities - 1hb - 20 m2		
No Asbestos		
B00B - R0008 - Withdrawal Space - 1hb - 13.24 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00B - R0009 - Practical Activities - 1hb - 20 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00B - R0010 - Home Base - 58.79 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00B - R0011 - Home Base Store - 6.75 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00B - R0012 - Main Switch Board - 3.97 m2		
Floor Coverings Res/Textile	Compressed AC Sheet	
B00B - R0013 - Cleaning Distributed Store - 2.88 m2		
No Asbestos		
B00B - R0014 - Home Base Store - 6.79 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00B - R0015 - Home Base - 58.56 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00B - R0016 - Practical Activities - 1hb - 19.35 m2		
No Asbestos		
B00B - R0017 - Withdrawal Space - 1hb - 13.2 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00B - R0018 - Practical Activities - 1hb - 19.42 m2		
No Asbestos		
B00B - R0019 - Home Base - 58.8 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00B - R0020 - Home Base Store - 5.77 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00B - R0021 - Movement - 146.61 m2		
Wall Linings Internal	Flat AC Sheeting	
B00B - R1001 - Toilets - Girls - 6.22 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
Wall Linings Internal	Flat AC Sheeting	
B00B - R1002 - Toilets - Boys - 6.62 m2		
Ceiling Structures/Linings	Flat AC Sheeting	

Wall Linings Internal	Flat AC Sheeting						
B00B - R1003 - Home Base Store - 7.53 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00B - R1004 - Home Base - 58.56 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00B - R1005 - Practical Activities - 1hb - 20.05 m2							
No Asbestos							
B00B - R1006 - Withdrawal Space - 1hb - 13.19 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00B - R1007 - Home Base - 58.56 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00B - R1008 - Practical Activities - 1hb - 20.04 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00B - R1009 - Home Base Store - 6.74 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00B - R1010 - Plant - 4.96 m2							
Non Accessible							
Non Accessible							
B00B - R1011 - General Storeroom - 6.11 m2							
No Asbestos							
B00B - R1012 - Distribution Board - .97 m2							
						Note: No inspection of live electrical installation	
No Asbestos							
B00B - R1013 - Home Base Store - 6.69 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00B - R1014 - Home Base - 58.72 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00B - R1015 - Practical Activities - 1hb - 19.35 m2							
No Asbestos							
B00B - R1016 - Communications Room - 13.12 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00B - R1017 - Practical Activities - 1hb - 19.35 m2							
No Asbestos							
B00B - R1018 - Home Base - 58.72 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00B - R1019 - Home Base Store - 5.78 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00B - R1020 - Movement - 142.94 m2							
Wall Linings Internal	Flat AC Sheeting						
B00C - Communal Facilities - 1988 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00C - R0001 - Movement - 3.83 m2							
No Asbestos							
B00C - R0002 - Hall Chair Store - 6.28 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
B00C - R0003 - P.E Store - 12.48 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						

B00C - R0004 - Distribution Board - 1.07 m2		Note: No inspection of live electrical installation
No Asbestos		
B00C - R0006 - Plant - 1.07 m2		
No Asbestos		
B00C - R0007 - General Storeroom - 5.34 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00C - R0008 - Garden Store - 5.64 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00C - R0009 - General Assistant/Bulk Store - 15.87 m2		
No Asbestos		
B00C - R0010 - Movement - 2.47 m2		
No Asbestos		
B00C - R0011 - Movement - 2.47 m2		
No Asbestos		
B00C - R0012 - Communal Space - 156.7 m2		
No Asbestos		
B00C - R0013 - Raised Platform - 52.63 m2		
No Asbestos		
B00C - R0014 - Movement - 3.83 m2		
No Asbestos		
B00C - R0015 - General Storeroom - 6.29 m2		
Wall Linings Internal	Flat AC Sheeting	
Ceiling Structures/Linings	Flat AC Sheeting	
B00C - R0016 - Movement - 11.53 m2		
No Asbestos		
B00C - R0017 - Movement - 42.27 m2		
No Asbestos		
B00D - Pupil Facilities - 1988 - Brick/Block		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00D - R0001 - Uniform Shop - 11.52 m2		
Wall Linings Internal	Flat AC Sheeting	
B00D - R0002 - Canteen Office/Store - 8.35 m2		
Wall Linings Internal	Flat AC Sheeting	
B00D - R0003 - Canteen - 27.72 m2		
Wall Linings Internal	Flat AC Sheeting	
B00E - Pupil Facilities - 1988 - Brick/Block		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00E - R0001 - Toilets - Boys - 20.86 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00E - R0002 - Disabled Shower/Toilet - 4.41 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00E - R0003 - Shower/Change - 2.26 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00E - R0004 - Toilets - Girls - 32.67 m2		

Ceiling Structures/Linings	Flat AC Sheeting						
B00F - General Learning - 1988 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	8m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00F - R0001 - Distribution Board - .76 m2				Note: No inspection of live electrical installation			
No Asbestos							
B00F - R0002 - Practical Activities - 1hb - 19.97 m2							
No Asbestos							
B00F - R0003 - Home Base - 58.4 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00F - R0004 - Home Base Store - 5.71 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00F - R0005 - Communications Room - 13.19 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00F - R0006 - Practical Activities - 1hb - 19.97 m2							
No Asbestos							
B00F - R0007 - Home Base - 58.4 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00F - R0008 - Home Base Store - 5.78 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00F - R0009 - General Storeroom - 5.63 m2							
Wall Linings Internal	Flat AC Sheeting						
B00F - R0010 - Movement - 62.54 m2							
Wall Linings Internal	Flat AC Sheeting						
B00F - R0011 - Stairs - 11.18 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
B00F - R1001 - Distribution Board - .76 m2				Note: No inspection of live electrical installation			
No Asbestos							
B00F - R1002 - Home Base Store - 5.71 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00F - R1003 - Practical Activities - 1hb - 19.97 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00F - R1004 - Home Base - 58.4 m2							
No Asbestos							
B00F - R1005 - Withdrawal Space - 2hb - 13.2 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00F - R1006 - Practical Activities - 1hb - 19.97 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00F - R1007 - Home Base - 58.41 m2							
No Asbestos							
B00F - R1008 - Home Base Store - 5.78 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00F - R1009 - Movement - 58.46 m2							
Wall Linings Internal	Flat AC Sheeting						
B00F - R1010 - Stairs - 14.36 m2							
Wall Linings Internal	Flat AC Sheeting						
B00G - General Learning - 2010 - Brick/Veneer							

Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00G-R0001 - Practical Activities - 1hb - 14.98 m2		
No Asbestos		
B00G-R0002 - Personal Effects Storage - 4.77 m2		
No Asbestos		
B00G-R0003 - Home Base Store - 6.18 m2		
No Asbestos		
B00G-R0004 - Home Base - 60.65 m2		
No Asbestos		
B00G-R0005 - Withdrawal Space - 2hb - 11.65 m2		
No Asbestos		
B00G-R0006 - Home Base - 60.41 m2		
No Asbestos		
B00G-R0007 - Home Base Store - 6.17 m2		
No Asbestos		
B00G-R0008 - Personal Effects Storage - 3.95 m2		
No Asbestos		
B00G-R0009 - Practical Activities - 1hb - 14.95 m2		
No Asbestos		
B00G-R0010 - Withdrawal Space - 1hb - 9.19 m2		
No Asbestos		
B00G-R0011 - Home Base Store - 5.95 m2		
No Asbestos		
B00G-R0012 - Home Base - 58.74 m2		
No Asbestos		
B00G-R0013 - Personal Effects Storage - 5.12 m2		
No Asbestos		
B00G-R0014 - Practical Activities - 1hb - 15.48 m2		
No Asbestos		
B00G-R0015 - Distribution Board - .68 m2		
No Asbestos		Note: No inspection of live electrical installation
B00G-R0016 - General Storeroom - 9.91 m2		
No Asbestos		
B00G-R0017 - General Storeroom - 9.88 m2		
No Asbestos		
B00G-R0018 - External Movement - 84.85 m2		
No Asbestos		
B00G-R0019 - External Stairs - 6.33 m2		
No Asbestos		
B00G-R0020 - External Stairs - 6.35 m2		
No Asbestos		
B00G-R1001 - Practical Activities - 1hb - 14.94 m2		
No Asbestos		
B00G-R1002 - Personal Effects Storage - 4.76 m2		
No Asbestos		
B00G-R1003 - Home Base Store - 6.16 m2		
No Asbestos		
B00G-R1004 - Home Base - 60.19 m2		
No Asbestos		

B00G - R1005 - Withdrawal Space - 2hb - 11.54 m2							
No Asbestos							
B00G - R1006 - Home Base - 60.34 m2							
No Asbestos							
B00G - R1007 - Home Base Store - 6.16 m2							
No Asbestos							
B00G - R1008 - Personal Effects Storage - 4.13 m2							
No Asbestos							
B00G - R1009 - Practical Activities - 1hb - 14.67 m2							
No Asbestos							
B00G - R1010 - Practical Activities - 1hb - 17.76 m2							
No Asbestos							
B00G - R1011 - Home Base Store - 5.92 m2							
No Asbestos							
B00G - R1012 - Withdrawal Space - 1hb - 9.95 m2							
No Asbestos							
B00G - R1013 - Home Base - 57.35 m2							
No Asbestos							
B00G - R1014 - Personal Effects Storage - 3.58 m2							
No Asbestos							
B00G - R1015 - Distribution Board - .68 m2							
							Note: No inspection of live electrical installation
No Asbestos							
B00G - R1016 - External Movement - 84.85 m2							
No Asbestos							
B00G - R1017 - External Stairs - 18.26 m2							
No Asbestos							
B00G - R1018 - External Stairs - 18.26 m2							
No Asbestos							
B00H - General Learning - 1999 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00H - R0001 - Home Base - 58.86 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00H - R0002 - Practical Activities - 1hb - 27.04 m2							
No Asbestos							
B00H - R0003 - Withdrawal Space - 1hb - 5.71 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00H - R0004 - Home Base Store - 5.72 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00H - R0005 - Movement - 20.62 m2							
Wall Linings Internal	Flat AC Sheeting						
B00H - R1001 - Home Base - 58.71 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00H - R1002 - Practical Activities - 1hb - 26.83 m2							
No Asbestos							
B00H - R1003 - Withdrawal Space - 1hb - 5.65 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00H - R1004 - Home Base Store - 5.72 m2							

Floor Coverings Res/Textile	No Asbestos Found	
B00H - R1005 - Distribution Board - 1.52 m2		Note: No inspection of live electrical installation
No Asbestos		
B00H - R1006 - Movement - 25.68 m2		
Wall Linings Internal	Flat AC Sheeting	
B00L - Library/Pupil Facilities - 2000 - Brick/Veneer		
Exterior		
Wall Cladding	Flat AC Sheeting	
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00L - R0001 - Special Programs Room - 33.48 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00L - R0002 - Reading Area - 188.13 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00L - R0003 - Library Office/Workroom - 26.27 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00L - R0004 - Communications Room - 15.93 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00L - R0005 - Special Programs Room - 24.54 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00L - R0006 - Toilets - Boys - 10.19 m2		
No Asbestos		
B00L - R0007 - Toilets - Girls - 10.22 m2		
No Asbestos		
B00L - R0008 - Movement - 54.06 m2		
Wall Linings Internal	Flat AC Sheeting	
B00L - R0009 - Distribution Board - .66 m2		Note: No inspection of live electrical installation
No Asbestos		

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020