


# Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Kurri Kurri Public School (7422)
Region:	Hunter/Central Coast AMU
State Electorate:	Cessnock
Local Government Area:	Cessnock

Last Reviewed By:	WSP 30-JUN-2017
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

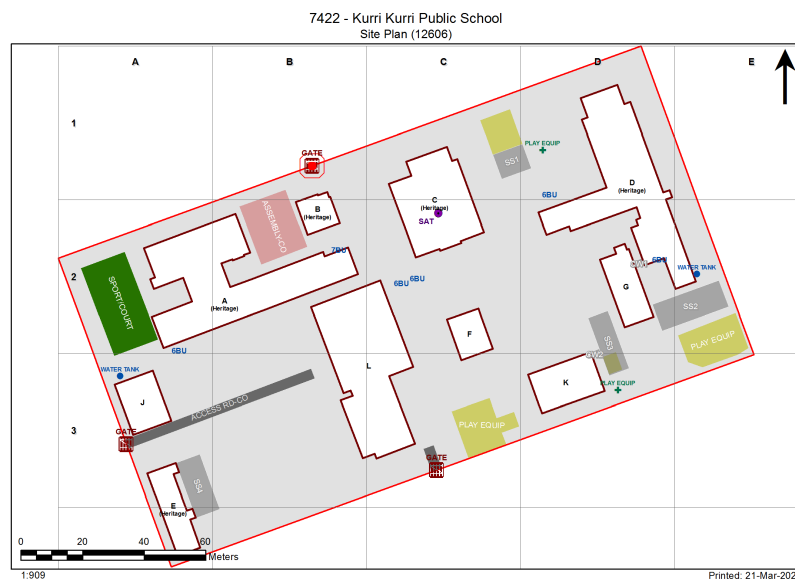

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - General Learning/Communal Facilities - 1904 - Timber</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	15m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Flat AC Sheeting	0.1	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00A - R0001 - Movement - 117.48 m2</b>							
Floor Coverings Res/Textile	Compressed AC Sheet						
<b>B00A - R0002 - Staff Toilet - 3.28 m2</b>							
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	3.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0003 - Staff Room Annexe - 16.53 m2</b>							
No Asbestos							
<b>B00A - R0004 - Movement - 6.08 m2</b>							
No Asbestos							
<b>B00A - R0005 - Movement - 2.41 m2</b>							
No Asbestos							
<b>B00A - R0006 - Staff Room Annexe - 9.16 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0007 - Home Base - 55.46 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0008 - Movement - 23.16 m2</b>							
No Asbestos							
<b>B00A - R0009 - Home Base - 55.27 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0010 - Movement - 20.6 m2</b>							
No Asbestos							
<b>B00A - R0011 - Home Base - 55.12 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0012 - General Assistant/Bulk Store - 9.45 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
Floor Coverings Res/Textile	Compressed AC Sheet	9.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00A - R0013 - Cleaning Distributed Store - 1.63 m2</b>							
No Asbestos							
<b>B00A - R0014 - Movement - 28.69 m2</b>							
No Asbestos							
<b>B00A - R0015 - Movement - 24.51 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	24.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0016 - Home Base - 54.22 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0018 - Movement - 24.28 m2</b>							

No Asbestos							
<b>B00A - R0019 - Staff Toilet - 2.4 m2</b>							
No Asbestos							
<b>B00A - R0020 - Staff Toilet - 2.38 m2</b>							
No Asbestos							
<b>B00A - R0021 - Toilets - Girls - 22.08 m2</b>							
No Asbestos							
<b>B00A - R0022 - Toilets - Boys - 26.4 m2</b>							
No Asbestos							
<b>B00A - R0025 - Movement - 42.37 m2</b>							
Floor Coverings Res/Textile	Compressed AC Sheet						
<b>B00A - R0026 - Practical Activities - 1hb - 74.57 m2</b>							
No Asbestos							
<b>B00A - R0027 - Home Base - 46.66 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0028 - Home Base - 46.91 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0029 - Home Base - 46.97 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0030 - Home Base - 46.99 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0031 - Craft Store - 13.5 m2</b>							
No Asbestos							
<b>B00A - R0032 - Movement - 18.29 m2</b>							
No Asbestos							
<b>B00A - R0033 - Toilets - Girls - 19.77 m2</b>							
No Asbestos							
<b>B00A - R0034 - Toilets - Boys - 26.3 m2</b>							
No Asbestos							
<b>B00A - R0036 - Home Base - 60.15 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0037 - Practical Activities - 1hb - 15.07 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0038 - Home Base - 57.76 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0039 - Practical Activities - 1hb - 20.3 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0040 - Home Base - 60.28 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0041 - Home Base Store - 9.16 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R9001 - General Assistant/Bulk Store - 14.47 m2</b>							
No Asbestos							
<b>B00A - R9002 - General Assistant/Bulk Store - 35.27 m2</b>							

No Asbestos							
<b>B00A - R9003 - General Storeroom - 134.65 m2</b>							
Wall Linings Internal	Compressed AC Sheet						
<b>B00B - Administration - 1909 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Vinyl Tiles	1	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00B - R0001 - External Movement - 5.46 m2</b>							
No Asbestos							
<b>B00B - R0002 - General Storeroom - 9.33 m2</b>							
No Asbestos							
<b>B00B - R0003 - Staff Toilet - 2.44 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0004 - Staff Toilet - 2.49 m2</b>							
Wall Linings Internal	Flat AC Sheeting	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0005 - Security Store - 9.34 m2</b>							
No Asbestos							
<b>B00B - R0006 - Cleaning Distributed Store - 2.01 m2</b>							
No Asbestos							
<b>B00B - R0007 - Movement - 10.47 m2</b>							
No Asbestos							
<b>B00B - R0008 - Principal - 23.39 m2</b>							
No Asbestos							
<b>B00B - R0009 - Clerical Office - 10.64 m2</b>							
No Asbestos							
<b>B00B - R0010 - Clerical Office - 11.46 m2</b>							
No Asbestos							
<b>B00B - R0011 - Duplicating Workroom - 8.71 m2</b>							
No Asbestos							
<b>B00B - R0012 - Entry Vestibule - 6.78 m2</b>							
No Asbestos							
<b>B00C - Library/Staff Facilities - 1909 - Brick/Block</b>							
<b>Exterior</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	8	Roof Area	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Window	Mastic						
<b>Interior</b>							
<b>B00C - R0001 - Movement - 23.07 m2</b>							
Floor Coverings Res/Textile	Compressed AC Sheet						
<b>B00C - R0002 - Interview - 9 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00C - R0003 - Movement - 6.3 m2</b>							
No Asbestos							
<b>B00C - R0004 - Other-Community Use - 21.02 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)							
<b>B00C - R0005 - Staff Room - 42.38 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)							
<b>B00C - R0006 - Staff Room - 42.13 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)							
<b>B00C - R0008 - Special Programs Room - 41.54 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)							
<b>B00C - R0009 - General Storeroom - 42.2 m2</b>								
Furniture / Fixtures - Blackboard	Flat AC Sheeting	0.1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R0010 - Seminar/Study - 14.16 m2</b>								
No Asbestos								
<b>B00C - R0011 - Seminar/Study - 12.57 m2</b>								
No Asbestos								
<b>B00C - R0012 - Reading Area - 47.71 m2</b>								
No Asbestos								
<b>B00C - R0013 - Reading Area - 51.48 m2</b>								
No Asbestos								
<b>B00C - R0014 - Reading Area - 42.32 m2</b>								
Floor Coverings Res/Textile	Resinous Membrane							
<b>B00C - R0015 - Library Office/Workroom - 7.19 m2</b>								
No Asbestos								
<b>B00C - R0016 - K.L.A. Store - 29.08 m2</b>								
No Asbestos								
<b>B00C - R0017 - Communications Room - 10.32 m2</b>								
No Asbestos								
<b>B00C - R0018 - Distribution Board - 2.05 m2</b>								
<b>Note: No inspection of live electrical installation</b>								
Wall Linings Internal	Flat AC Sheeting							
Electrical - Backing Board	Resinous Board	0.2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>B00C - R0019 - Disabled Toilet - 3.28 m2</b>								
Wall Linings Internal	Flat AC Sheeting							
<b>B00C - R0020 - Movement - 10.53 m2</b>								
No Asbestos								
<b>B00C - R0021 - Toilets - Boys - 3.26 m2</b>								
Wall Linings Internal	Flat AC Sheeting							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R0022 - Reading Area - 14.1 m2</b>								
No Asbestos								
<b>B00C - R0023 - Cleaning Distributed Store - 2.03 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles							
Wall Linings Internal	Flat AC Sheeting							
<b>B00C - R0024 - Movement - 3.71 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R0025 - Movement - 22.27 m2</b>								
No Asbestos								
<b>B00C - R0026 - Staff Room Annexe - 16.25 m2</b>								

No Asbestos							
<b>B00C - R0027 - Special Programs Room - 59.34 m2</b>							
No Asbestos							
<b>B00D - General Learning/Pupil Facilities - 1917 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Window	Mastic						
Eaves Linings	Flat AC Sheeting	25m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting	0.1	South	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00D - R0001 - Movement - 31.56 m2</b>							
No Asbestos							
<b>B00D - R0002 - Clerical Office - 16.74 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00D - R0003 - Movement - 6.15 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00D - R0004 - Staff Room Annexe - 16.34 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00D - R0005 - Movement - 75.28 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00D - R0006 - Home Base - 47.41 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00D - R0007 - Home Base - 47.34 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00D - R0008 - Home Base - 67.11 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00D - R0009 - Practical Activities - 1hb - 6.68 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00D - R0010 - Home Base - 67.62 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00D - R0011 - Practical Activities - 1hb - 6.73 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00D - R0012 - Home Base - 51.66 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00D - R0013 - Practical Activities - 1hb - 37.39 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00D - R0014 - Home Base - 67.73 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00D - R0015 - Home Base - 77.19 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						

<b>B00D - R0016 - Movement - 2.32 m2</b>							
No Asbestos							
<b>B00D - R0017 - Movement - 16.25 m2</b>							
No Asbestos							
<b>B00D - R0018 - Toilets - Girls - 17.85 m2</b>							
No Asbestos							
<b>B00D - R0019 - Toilets - Boys - 17.85 m2</b>							
No Asbestos							
<b>B00D - R0020 - Home Base - 47.54 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00D - R0022 - Movement - 4.16 m2</b>							
No Asbestos							
<b>B00D - R0023 - Home Base - 47.52 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00D - R0024 - Movement - 29.83 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00D - R0025 - Movement - 2.75 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	0.1m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0026 - Special Programs Room - 31.41 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00D - R0027 - Home Base - 47.25 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00D - R0028 - Staff Toilet - 4.74 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00D - R0029 - Sports Store - 7.22 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B00D - R0030 - Movement - 3.54 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0031 - General Storeroom - 4.31 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00D - R0032 - Movement - 13.91 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0033 - Toilets - Girls - 23.78 m2</b>							
No Asbestos							
<b>B00D - R0034 - Toilets - Boys - 23.78 m2</b>							
No Asbestos							
<b>B00D - R0035 - General Storeroom - 5.18 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00D - R0036 - Access Shower/Toilet - 9.99 m2</b>							
Wall Linings Internal	Flat AC Sheeting						



Floor Coverings Res/Textile	Compressed AC Sheet	9.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0037 - Movement - 17.26 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting						
<b>B00E - General Learning - 1928 - Timber</b>							
<b>Exterior</b>							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00E - R0001 - Movement - 5.19 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Compressed AC Sheet						
<b>B00E - R0002 - Home Base - 61.01 m2</b>							
No Asbestos							
<b>B00E - R0003 - Home Base - 58.14 m2</b>							
No Asbestos							
<b>B00E - R0004 - Practical Activities - 1hb - 14.05 m2</b>							
Ceiling Structures/Linings - Access Hatch	Flat AC Sheeting	0.2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0005 - Movement - 4.02 m2</b>							
No Asbestos							
<b>B00E - R0006 - Movement - 5.07 m2</b>							
No Asbestos							
<b>B00E - R0007 - Home Base - 73.73 m2</b>							
No Asbestos							
<b>B00F - Pupil Facilities - 1994 - Brick/Block</b>							
<b>Exterior</b>							
Underfloor Voids	Non Accessible Area						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00F - R0001 - Movement - 38.44 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00F - R0002 - Canteen - 46.61 m2</b>							
No Asbestos							
<b>B00F - R0003 - Canteen Office/Store - 11.4 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00G - Support Unit/General Learning - 1929 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Window	Mastic						
<b>Interior</b>							
<b>B00G - R0001 - Laundry - S - 3.53 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0002 - Movement - 2.02 m2</b>							

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R0003 - Toilet - S - 8.87 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Compressed AC Sheet	8.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00G- R0004 - Special Programs Room - 31.93 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00G- R0005 - Student Kitchen - 17.39 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00G- R0006 - Movement - 5.9 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R0007 - Home Base - S - 47.15 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	47.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00G- R0008 - Movement - 2.76 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00G- R0009 - General Storeroom - 4.02 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00G- R0010 - Practical Activities - 1hb - 16.39 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00G- R0011 - Movement - 5.83 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	1	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00G- R0012 - Home Base - 50.25 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00G- R0013 - General Storeroom - 8.84 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00J - General Learning - 2004 - Fibre Cement Clad</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Compressed AC Sheet						
<b>Interior</b>							
<b>B00J - R0001 - Movement - 38.48 m2</b>							
Floor Coverings Res/Textile	Compressed AC Sheet						
<b>B00J - R0002 - Practical Activities - 1hb - 19.4 m2</b>							

No Asbestos		
<b>B00J - R0003 - Home Base Store - 6.02 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00J - R0004 - Home Base - 59.2 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00J - R0005 - Withdrawal Space - 2hb - 11.35 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00J - R0006 - Home Base - 59.19 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00J - R0007 - Home Base Store - 6.02 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00J - R0008 - Practical Activities - 1hb - 19.4 m2</b>		
No Asbestos		
<b>B00K - General Learning - 2010 - Brick/Veneer</b>		
<b>Exterior</b>		
Ceiling Voids - Raked Ceiling	Non Accessible Area	
Underfloor Voids	Non Accessible Area	
<b>Interior</b>		
<b>B00K - R0001 - External Movement - 51.81 m2</b>		
No Asbestos		
<b>B00K - R0002 - Home Base - 58.47 m2</b>		
No Asbestos		
<b>B00K - R0003 - Withdrawal Space - 1hb - 9.63 m2</b>		
No Asbestos		
<b>B00K - R0004 - Home Base Store - 5.82 m2</b>		
No Asbestos		
<b>B00K - R0005 - Practical Activities - 2hb - 38.21 m2</b>		
No Asbestos		
<b>B00K - R0006 - Access Shower/Toilet - 18.66 m2</b>		
No Asbestos		
<b>B00K - R0007 - General Storeroom - .35 m2</b>		
No Asbestos		
<b>B00K - R0008 - Laundry - P - 5.51 m2</b>		
No Asbestos		
<b>B00K - R0009 - Access Shower/Toilet - 5.94 m2</b>		
No Asbestos		
<b>B00K - R0010 - Home Base - 57.92 m2</b>		
No Asbestos		
<b>B00K - R0011 - Withdrawal Space - 1hb - 9.61 m2</b>		
No Asbestos		
<b>B00K - R0012 - Home Base Store - 5.82 m2</b>		
No Asbestos		
<b>B00K - R0013 - Main Switch Board - .46 m2</b>		
No Asbestos		
<b>B00L - Communal Facilities - 2010 - Brick/Veneer</b>		
<b>Exterior</b>		

Underfloor Voids	Non Accessible Area	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00L - R0001 - Covered Outdoor Learning Area - 723.36 m2</b>		
No Asbestos		
<b>B00L - R0002 - Communal Space - 198.88 m2</b>		
No Asbestos		
<b>B00L - R0003 - Movement - 6.34 m2</b>		
No Asbestos		
<b>B00L - R0004 - Raised Platform - 58.55 m2</b>		
No Asbestos		
<b>B00L - R0005 - Ramp - 13.02 m2</b>		
No Asbestos		
<b>B00L - R0006 - Movement - 17.13 m2</b>		
No Asbestos		
<b>B00L - R0007 - Hall Chair Store - 11.13 m2</b>		
No Asbestos		
<b>B00L - R0008 - Communal/Performance Store - 10.93 m2</b>		
No Asbestos		
<b>B00L - R0009 - P.E Store - 16.36 m2</b>		
No Asbestos		
<b>B00L - R0010 - Toilet - Lobby - 2.51 m2</b>		
No Asbestos		
<b>B00L - R0011 - Toilets - Girls - 7.33 m2</b>		
No Asbestos		
<b>B00L - R0012 - Sound Cupboard - 2.06 m2</b>		
No Asbestos		
<b>B00L - R0013 - Toilet - Lobby - 3.43 m2</b>		
No Asbestos		
<b>B00L - R0014 - Toilets - Boys - 5.75 m2</b>		
No Asbestos		
<b>B00L - R0015 - Cleaning Distributed Store - 3.56 m2</b>		
No Asbestos		
<b>B00L - R0016 - General Storeroom - 1.62 m2</b>		
No Asbestos		
<b>B00L - R0017 - Main Switch Board - 3.34 m2</b>		
No Asbestos		
<b>B00L - R0018 - Access Shower/Toilet - 7.03 m2</b>		
No Asbestos		

## Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020