


# Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Kempsey High School (8123)
Region:	North Coast AMU
State Electorate:	Oxley
Local Government Area:	Kempsey

Last Reviewed By:	WSP 30-JUN-2017
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

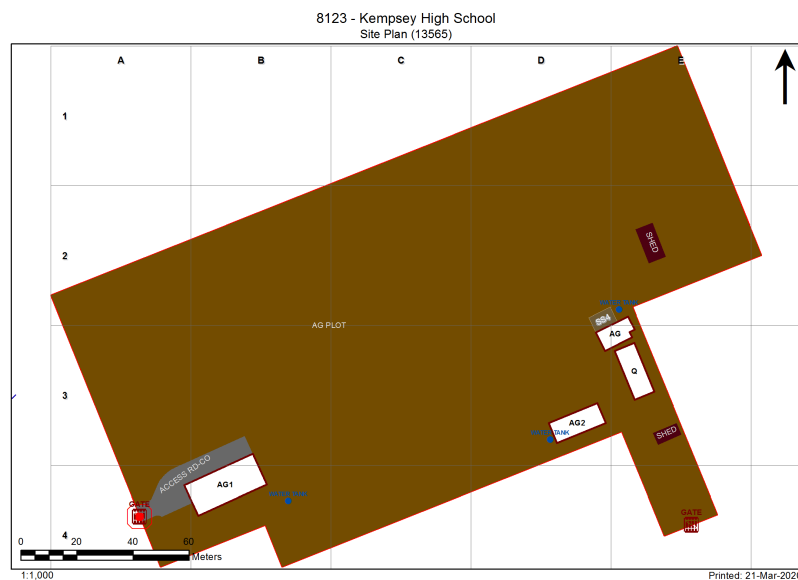

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

### Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

### Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

### Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

#### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - Administration/General Learning - 1972 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	100m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids	No Asbestos Found						
Ceiling Voids - Flat Roof	Non Accessible Area						
<b>Interior</b>							
<b>B00A - R0001 - General Storeroom - 2.83 m2</b>							
No Asbestos							
<b>B00A - R0002 - Security Store - 16.36 m2</b>							
No Asbestos							
<b>B00A - R0003 - Leading Teacher - 15.64 m2</b>							
No Asbestos							
<b>B00A - R0004 - Deputy Principal Office - 16.3 m2</b>							
No Asbestos							
<b>B00A - R0005 - Duplicating Workroom - 26.39 m2</b>							
No Asbestos							
<b>B00A - R0006 - Interview/Office - Type 1 - 16.52 m2</b>							
No Asbestos							
<b>B00A - R0007 - Interview/Office - Type 1 - 13.05 m2</b>							
No Asbestos							
<b>B00A - R0008 - Clinic - Boys - 12.98 m2</b>							
No Asbestos							
<b>B00A - R0009 - Toilets-Boys - 2.2 m2</b>							
No Asbestos							
<b>B00A - R0010 - Toilets-Girls - 2.33 m2</b>							
No Asbestos							
<b>B00A - R0011 - Clinic - Girls - 13.02 m2</b>							
No Asbestos							
<b>B00A - R0012 - Distribution Board Cupboard - 1.2 m2</b>							
No Asbestos							Note: No inspection of live electrical installation
<b>B00A - R0013 - Cleaning Store - Distributed - 3.88 m2</b>							
No Asbestos							
<b>B00A - R0014 - External Movement - 2.24 m2</b>							
No Asbestos							
<b>B00A - R0015 - Ancillary Staff - 21.99 m2</b>							
No Asbestos							
<b>B00A - R0018 - Principal Office - 19.32 m2</b>							
No Asbestos							
<b>B00A - R0019 - Public Entry - 21.01 m2</b>							
No Asbestos							
<b>B00A - R0020 - Administration - Clerical - 43.37 m2</b>							
No Asbestos							
<b>B00A - R0021 - Pupil Entry - 50.06 m2</b>							
No Asbestos							
<b>B00A - R0022 - External Movement - 10.38 m2</b>							
No Asbestos							
<b>B00A - R0023 - Movement - 24.97 m2</b>							
No Asbestos							

<b>B00A - R0024 - Movement - 26.86 m2</b>							
No Asbestos							
<b>B00A - R0025 - Toilet - Lobby - 3.74 m2</b>							
No Asbestos							
<b>B00A - R0026 - Staff - Toilet - 1.62 m2</b>							
No Asbestos							
<b>B00A - R1001 - General Learning Space - 53.73 m2</b>							
No Asbestos							
<b>B00A - R1002 - General Learning Space - 52.88 m2</b>							
No Asbestos							
<b>B00A - R1003 - Resources Store - 12.77 m2</b>							
No Asbestos							
<b>B00A - R1004 - General Learning Space - 40.6 m2</b>							
No Asbestos							
<b>B00A - R1005 - General Learning Space - 53.37 m2</b>							
No Asbestos							
<b>B00A - R1006 - Interview/Office - Type 1 - 26.21 m2</b>							
No Asbestos							
<b>B00A - R1007 - Staff - Toilet - 4.33 m2</b>							
No Asbestos							
<b>B00A - R1008 - Staff Study - 33.85 m2</b>							
No Asbestos							
<b>B00A - R1009 - Staff - Toilet - 4.26 m2</b>							
No Asbestos							
<b>B00A - R1010 - Movement - 68.33 m2</b>							
No Asbestos							
<b>B00B - General Learning - 1928 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	100m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	Non Accessible Area						
Underfloor Voids	AC Fragments/Debris		Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Underfloor Voids	AC Fragments/Debris		Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting	2	Around electrical conduits in southwest corner of void	Minimal Damage (2)	Low (1)	Low Priority (2-3)	, Amosite (brown asbestos)
<b>Interior</b>							
<b>B00B - R0001 - Resources Store - 5.01 m2</b>							
No Asbestos							
<b>B00B - R0002 - Performance Workspace - 86.24 m2</b>							
No Asbestos							
<b>B00B - R0003 - Performing Arts Store - 16.24 m2</b>							
No Asbestos							
<b>B00B - R0004 - Art Learning Space - 51 m2</b>							
No Asbestos							
<b>B00B - R0005 - General Learning Space - 51.14 m2</b>							
No Asbestos							
<b>B00B - R0006 - General Learning Space - 45.98 m2</b>							
No Asbestos							
<b>B00B - R0007 - Cleaning Store - Distributed - 5.23 m2</b>							

No Asbestos								
<b>B00B - R0008 - Movement - 22.11 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles							
<b>B00B - R0009 - Resources Store - 13.7 m2</b>								
No Asbestos								
<b>B00B - R0015 - Staff Study - 16.78 m2</b>								
No Asbestos								
<b>B00B - R0016 - Staff - Toilet - 3.38 m2</b>								
Wall Linings Internal	Flat AC Sheeting							
<b>B00B - R0017 - Movement - 90.11 m2</b>								
No Asbestos								
<b>B00B - R0018 - Movement - 4.24 m2</b>								
No Asbestos								
<b>B00B - R0019 - External Movement - 3.03 m2</b>								
No Asbestos								
<b>B00B - R0020 - External Movement - 2.38 m2</b>								
No Asbestos								
<b>B00B - R0021 - External Movement - 25.61 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout		Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00B - R0022 - External Movement - 4 m2</b>								
No Asbestos								
<b>B00B - R0023 - Toilets-Boys - 3.23 m2</b>								
Wall Linings Internal	Flat AC Sheeting							
Ceiling Structures/Linings	Flat AC Sheeting							
<b>B00B - R0024 - Toilets-Boys - 3.23 m2</b>								
Wall Linings Internal	Flat AC Sheeting							
Ceiling Structures/Linings	Flat AC Sheeting							
<b>B00B - R0025 - Toilets-Boys - 3.23 m2</b>								
Wall Linings Internal	Flat AC Sheeting							
Ceiling Structures/Linings	Flat AC Sheeting							
<b>B00B - R0026 - Toilets-Boys - 3.23 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting							
Wall Linings Internal	Flat AC Sheeting							
<b>B00B - R0027 - General Learning Space - 52.56 m2</b>								
No Asbestos								
<b>B00B - R0030 - Staff Lounge - 5.56 m2</b>								
No Asbestos								
<b>B00B - R0031 - Staff Kitchen - 28.02 m2</b>								
No Asbestos								
<b>B00B - R0032 - Staff Lounge - 35.4 m2</b>								
No Asbestos								
<b>B00B - R0033 - Staff Kitchen - 8.67 m2</b>								
No Asbestos								
<b>B00B - R0034 - Stairs - 8.1 m2</b>								

No Asbestos	
<b>B00B - R0035 - Stairs - 7.64 m2</b>	
No Asbestos	
<b>B00B - R0036 - Stairs - 3.42 m2</b>	
No Asbestos	
<b>B00B - R1001 - Resources Store - 8.97 m2</b>	
No Asbestos	
<b>B00B - R1002 - Resources Store - 8.81 m2</b>	
No Asbestos	
<b>B00B - R1003 - Computer Learning Space - 51.98 m2</b>	
No Asbestos	
<b>B00B - R1004 - General Learning Space - 52.72 m2</b>	
No Asbestos	
<b>B00B - R1005 - General Learning Space - 51.76 m2</b>	
No Asbestos	
<b>B00B - R1006 - Computer Learning Space - 51.91 m2</b>	
No Asbestos	
<b>B00B - R1007 - General Learning Space - 47.47 m2</b>	
No Asbestos	
<b>B00B - R1008 - Staff Study - 8.95 m2</b>	
No Asbestos	
<b>B00B - R1009 - Cleaning Store - Distributed - 1.99 m2</b>	
No Asbestos	
<b>B00B - R1011 - General Learning Space - 35.94 m2</b>	
No Asbestos	
<b>B00B - R1012 - Staff Study - 20.86 m2</b>	
No Asbestos	
<b>B00B - R1013 - Staff Study - 21.07 m2</b>	
No Asbestos	
<b>B00B - R1017 - Movement - 32.77 m2</b>	
No Asbestos	
<b>B00B - R1018 - Movement - 6.29 m2</b>	
No Asbestos	
<b>B00B - R1019 - General Storeroom - 14.53 m2</b>	
No Asbestos	
<b>B00B - R1020 - General Learning Space - 51.04 m2</b>	
No Asbestos	
<b>B00B - R1021 - Movement - 93.91 m2</b>	
No Asbestos	
<b>B00B - R1022 - Stairs - 12.41 m2</b>	
No Asbestos	
<b>B00B - R1023 - Stairs - 12.27 m2</b>	
No Asbestos	
<b>B00B - R9001 - Movement - 5.09 m2</b>	
No Asbestos	
<b>B00B - R9002 - Visual Arts Store - 2.86 m2</b>	
No Asbestos	
<b>B00B - R9003 - Visual Arts Store - 10.12 m2</b>	
No Asbestos	
<b>B00B - R9004 - Visual Arts Store - 12.53 m2</b>	
No Asbestos	

**B00C - General Learning - 1956 - Timber****Exterior**

Eaves Linings	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids	AC Fragments/Debris						
Ceiling Voids	Flat AC Sheeting		Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

**Interior****B00C - R0001 - Serviced Learning Space - 83.92 m2**

No Asbestos

**B00C - R0002 - Preparation - 8.8 m2**

Floor Coverings Res/Textile Vinyl Tiles

**B00C - R0003 - General Learning Space - 49.93 m2**

No Asbestos

**B00C - R0004 - Staff Study - 15.48 m2**

No Asbestos

**B00C - R0005 - Staff - Toilet - 4.64 m2**

No Asbestos

**B00C - R0006 - Cleaning Store - Distributed - 2.88 m2**

No Asbestos

**B00C - R0008 - External Movement - 2.16 m2**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------	--

**B00C - R0009 - General Storeroom - 6.35 m2**

No Asbestos

**B00C - R0010 - External Movement - 1.92 m2**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------	--

**B00C - R0011 - Movement - 32.01 m2**

Floor Coverings Res/Textile Vinyl Tiles

**B00C - R0012 - Movement - 20.83 m2**

Floor Coverings Res/Textile Vinyl Tiles

**B00F - Science/Art - 1965 - Brick/Block****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Bituminous Membrane						

**Interior****B00F - R0018 - Distribution Board Cupboard - 1.24 m2****Note: No inspection of live electrical installation**

No Asbestos

**B00F - R0020 - Main Switchroom - 4.43 m2**

No Asbestos

**B00F - R0021 - External Movement - 1.72 m2**

No Asbestos

**B00F - R0022 - External Movement - .97 m2**

No Asbestos

**B00F - R0024 - Pantry - 5.16 m2**

Floor Coverings Res/Textile	Vinyl Tiles	
<b>B00F - R0025 - Laundry - 9.49 m2</b>		
No Asbestos		
<b>B00F - R0026 - Preparation - 22.13 m2</b>		
No Asbestos		
No Asbestos		
<b>B00F - R0027 - Cleaning Store - Distributed - .9 m2</b>		
No Asbestos		
No Asbestos		
<b>B00F - R0028 - Kitchen - Type 1 - 106.32 m2</b>		
No Asbestos		
No Asbestos		
<b>B00F - R0029 - Materials Store - 19.22 m2</b>		
No Asbestos		
No Asbestos		
<b>B00F - R0030 - General Learning Space - 59.42 m2</b>		
No Asbestos		
No Asbestos		
<b>B00F - R0031 - Handwashing Facilities - 2.24 m2</b>		
No Asbestos		
No Asbestos		
<b>B00F - R0032 - Staff - Toilet - 2.25 m2</b>		
No Asbestos		
No Asbestos		
<b>B00F - R0033 - General Learning Space - 53.88 m2</b>		
No Asbestos		
No Asbestos		
<b>B00F - R0034 - Change - 5.18 m2</b>		
No Asbestos		
No Asbestos		
<b>B00F - R0035 - Materials Store - 8.41 m2</b>		
No Asbestos		
No Asbestos		
<b>B00F - R0036 - Movement - 5.08 m2</b>		
No Asbestos		
No Asbestos		
<b>B00F - R0037 - General Learning Space - 62.51 m2</b>		
No Asbestos		
No Asbestos		
<b>B00F - R0038 - Wood Technology Bay - 105.81 m2</b>		
No Asbestos		
No Asbestos		
<b>B00F - R0039 - General Learning Space - 59.35 m2</b>		
No Asbestos		
No Asbestos		
<b>B00F - R0040 - Movement - 194.16 m2</b>		
No Asbestos		
<b>B00F - R0041 - Materials Store - 25.31 m2</b>		
No Asbestos		
<b>B00F - R0042 - Staff Study - 33.87 m2</b>		



Floor Coverings Res/Textile	Vinyl Tiles	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0043 - Lift - 2.24 m2</b>							
No Asbestos							
<b>B00F - R0044 - Stairs - 2.72 m2</b>							
No Asbestos							
<b>B00F - R0045 - Stairs - 4.67 m2</b>							
No Asbestos							
<b>B00F - R0046 - Stairs - 2.72 m2</b>							
No Asbestos							
<b>B00F - R1022 - Distribution Board Cupboard - 1.06 m2</b>							
No Asbestos							
<b>B00F - R1023 - Distribution Board Cupboard - 1.29 m2</b>							
No Asbestos							
<b>B00F - R1025 - Darkroom Space - 2.67 m2</b>							
No Asbestos							
No Asbestos							
<b>B00F - R1026 - Dark Room - 22.22 m2</b>							
No Asbestos							
<b>B00F - R1027 - General Learning Space - 52.28 m2</b>							
No Asbestos							
<b>B00F - R1028 - Movement - 5.11 m2</b>							
No Asbestos							
<b>B00F - R1029 - Art Learning Space - 113.02 m2</b>							
No Asbestos							
<b>B00F - R1030 - Materials Store - 11.28 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00F - R1031 - Pottery Store - 9.71 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	9.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R1032 - Kiln Space - 9.62 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	9.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R1033 - Materials Store - 18.73 m2</b>							
No Asbestos							
No Asbestos							
<b>B00F - R1034 - General Learning Space - Type 4 - 59.35 m2</b>							
No Asbestos							
No Asbestos							
<b>B00F - R1035 - Staff Study - 26.4 m2</b>							
No Asbestos							
No Asbestos							
<b>B00F - R1036 - Seminar/Technology Space - 25.08 m2</b>							
No Asbestos							
No Asbestos							
<b>B00F - R1037 - Music Learning Space - 85.57 m2</b>							
No Asbestos							
No Asbestos							
<b>B00F - R1038 - Music Store - 12.78 m2</b>							
No Asbestos							
No Asbestos							
<b>B00F - R1039 - Practice/Seminar - 12.8 m2</b>							

No Asbestos	
No Asbestos	
<b>B00F - R1040 - Multi Media Workshop - 105.66 m2</b>	
No Asbestos	
No Asbestos	
<b>B00F - R1041 - Multi Media Store - 20.16 m2</b>	
No Asbestos	
No Asbestos	
<b>B00F - R1042 - Multi Media Studio - 11.18 m2</b>	
No Asbestos	
No Asbestos	
<b>B00F - R1043 - Cleaning Store - Distributed - 1.66 m2</b>	
No Asbestos	
No Asbestos	
<b>B00F - R1044 - Movement - 126.38 m2</b>	
No Asbestos	
<b>B00F - R1045 - Stairs - 5.76 m2</b>	
No Asbestos	
<b>B00F - R1046 - Stairs - 5.54 m2</b>	
No Asbestos	
<b>B00F - R9002 - Materials Store - 8.49 m2</b>	
No Asbestos	
<b>B00F - R9007 - Cleaning Store - Distributed - 7.6 m2</b>	
No Asbestos	
<b>B00F - R9010 - General Learning Space - 58.33 m2</b>	
No Asbestos	
No Asbestos	
<b>B00F - R9011 - Metal Technology Bay - 105.59 m2</b>	
No Asbestos	
No Asbestos	
<b>B00F - R9012 - General Learning Space - 58.47 m2</b>	
No Asbestos	
No Asbestos	
<b>B00F - R9013 - Movement - 55.76 m2</b>	
No Asbestos	
No Asbestos	
<b>B00F - R9014 - Materials Store - 47.31 m2</b>	
No Asbestos	
No Asbestos	
<b>B00F - R9015 - Distribution Board Cupboard - .64 m2</b>	
	<b>Note: No inspection of live electrical installation</b>
No Asbestos	
No Asbestos	
<b>B00F - R9016 - Movement - 5.06 m2</b>	
No Asbestos	
No Asbestos	
<b>B00F - R9018 - Stairs - 5.01 m2</b>	
No Asbestos	
No Asbestos	
<b>B00G - Pupil Facilities - 1930 - Brick/Veneer</b>	
<b>Exterior</b>	

Eaves Linings	Flat AC Sheeting	5m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00G - R0001 - No Access - 12.56 m2</b>							
No Asbestos							
<b>B00H - Multi Purpose Facilities - 1960 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00H - M0001 - General Storeroom - 18.2 m2</b>							
No Asbestos							
<b>B00H - R0001 - Staff Kitchen - 12.14 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00H - R0002 - Multi-Purpose Space - 408.29 m2</b>							
No Asbestos							
<b>B00H - R0003 - Stage - 113.36 m2</b>							
No Asbestos							
<b>B00H - R0004 - General Storeroom - 3.18 m2</b>							
No Asbestos							
<b>B00H - R0005 - Chair Store - 12.1 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00H - R0006 - External Movement - 42.97 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00H - R0007 - External Movement - 3.99 m2</b>							
No Asbestos							
<b>B00H - R0008 - External Movement - 4.25 m2</b>							
No Asbestos							
<b>B00H - R0009 - Stairs - 9.17 m2</b>							
No Asbestos							
<b>B00H - R0010 - Stairs - 8.56 m2</b>							
No Asbestos							
<b>B00H - R0011 - External Movement - 14.6 m2</b>							
No Asbestos							
<b>B00H - R0012 - Toilets-Boys - 3.23 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00H - R0013 - Toilets-Boys - 3.23 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00H - R0014 - Cleaning Supplies Store - 5.6 m2</b>							

Ceiling Structures/Linings	Flat AC Sheeting							
<b>B00H - R0015 - Toilets-Girls - 3 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting							
<b>B00H - R0016 - Access Student Shower/Toilet/Change - 5.54 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting							
<b>B00H - R0017 - Toilets-Girls - 3.3 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting							
<b>B00H - R0018 - Movement - 7.05 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting							
<b>B00H - R9001 - Movement - 4.01 m2</b>								
No Asbestos								
<b>B00H - R9002 - Performing Arts Changeroom - 25.44 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00H - R9003 - Toilets-Boys - 1.48 m2</b>								
No Asbestos								
<b>B00H - R9004 - Toilets-Boys - 1.48 m2</b>								
No Asbestos								
<b>B00H - R9005 - General Storeroom - 17.46 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00H - R9006 - General Storeroom - 26.59 m2</b>								
No Asbestos								
<b>B00H - R9007 - General Assistants - 16.93 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00H - R9008 - General Assistants - 28.34 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00H - R9009 - General Storeroom - 25.85 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00H - R9010 - External Movement - 3.99 m2</b>								
No Asbestos								
<b>B00H - R9012 - Stairs - 4.58 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00H - R9013 - Stairs - 9.17 m2</b>								
No Asbestos								
<b>B00H - R9014 - External Movement - 11.12 m2</b>								
No Asbestos								
<b>B00I - Building Services - 2000 - Timber Shed</b>								
<b>Exterior</b>								
Ceiling Voids	No Asbestos Found							
Underfloor Voids	No Asbestos Found							

<b>Interior</b>							
<b>B00I - R0001 - Sport Equipment Store - 36.13 m2</b>							
No Asbestos							
<b>B00J - Multi Purpose Facilities - 1973 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Fibre Cement Pipe	3	Southeastern section of void	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	Fibre Cement Pipe	2	Service conduits running through concrete slab	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting		Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Underfloor Voids	AC Fragments/Debris - Flat AC Sheet	4	Around electrical service conduits in southeast and southwest corners of void	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	, Amosite (brown asbestos)
<b>Interior</b>							
<b>B00J - R0001 - General Storeroom - 18.83 m2</b>							
No Asbestos							
<b>B00J - R0002 - Cleaning Store - Distributed - 1.01 m2</b>							
No Asbestos							
<b>B00J - R0003 - Sport Equipment Store - 16.94 m2</b>							
No Asbestos							
<b>B00J - R0004 - Distribution Board Cupboard - .92 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Non Accessible							
<b>B00J - R0005 - Movement - 77.12 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00J - R0006 - General Storeroom - 17.47 m2</b>							
No Asbestos							
<b>B00J - R0007 - Sport Equipment Store - 16.08 m2</b>							
No Asbestos							
<b>B00J - R0008 - Garden Store Room - 5.08 m2</b>							
No Asbestos							
<b>B00J - R0009 - Movement - 48.22 m2</b>							
No Asbestos							
<b>B00J - R0010 - General Storeroom - 10.11 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0011 - Student Canteen - 47.55 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0012 - General Storeroom - 6.53 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0013 - Cleaning Store - Distributed - .91 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0014 - Staff - Toilet - 3.17 m2</b>							
No Asbestos							
<b>B00J - R0015 - General Storeroom - 6.4 m2</b>							
No Asbestos							
<b>B00J - R0016 - General Storeroom - 3.26 m2</b>							
No Asbestos							

<b>B00J - R0017 - Cleaning Supplies Store - 5.08 m2</b>							
No Asbestos							
<b>B00J - R0018 - Movement - 47.57 m2</b>							
No Asbestos							
<b>B00J - R0019 - Multi-Purpose Space - 310.02 m2</b>							
No Asbestos							
<b>B00J - R0020 - Stairs - 9.24 m2</b>							
No Asbestos							
<b>B00J - R0021 - Stairs - 9.24 m2</b>							
No Asbestos							
<b>B00J - R0022 - External Movement - 28.86 m2</b>							
No Asbestos							
<b>B00J - R0023 - External Movement - 9.95 m2</b>							
No Asbestos							
<b>B00J - R1001 - Movement - 10.8 m2</b>							
No Asbestos							
<b>B00J - R1007 - Toilets-Boys - 14.2 m2</b>							
Partition Walls (Cubides)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R1008 - Shower/Change - 46.59 m2</b>							
No Asbestos							
<b>B00J - R1009 - Toilets-Girls - 14.04 m2</b>							
Partition Walls (Cubides)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R1010 - Shower/Change - 46.93 m2</b>							
No Asbestos							
<b>B00J - R1011 - Movement - 4.25 m2</b>							
No Asbestos							
<b>B00J - R1012 - Staff - Toilet - 8.12 m2</b>							
Partition Walls (Cubides)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R1013 - Staff Study - 6.9 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R1014 - Staff Shower - 1.54 m2</b>							
Partition Walls (Cubides)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R1015 - Cleaning Store - Distributed - 4.04 m2</b>							
No Asbestos							
<b>B00J - R1016 - Movement - 10.82 m2</b>							
No Asbestos							
<b>B00J - R1017 - Staff Study - 18.45 m2</b>							
No Asbestos							
<b>B00J - R1018 - Movement - 60.82 m2</b>							
No Asbestos							
<b>B00J - R1019 - Stairs - 53.4 m2</b>							
No Asbestos							
<b>B00J - R1020 - Stairs - 53.4 m2</b>							
No Asbestos							
<b>B00J - R1021 - Cleaning Store - Distributed - 4.43 m2</b>							
No Asbestos							
<b>B00L - Science/Library - 1972 - Brick/Block</b>							

Exterior							
Underfloor Voids	Non Accessible Area						
Ceiling Voids	Non Accessible Area						
Interior							
B00L - M1001 - Careers Advisers Office - 19.23 m2							
No Asbestos							
B00L - M1002 - Study Space - 121.02 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
B00L - M1003 - Movement - 1.46 m2							
No Asbestos							
B00L - M1004 - Plant Space - 31.86 m2							
No Asbestos							
B00L - M1005 - Stairs - 4.08 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
B00L - M1006 - Stairs - 3.98 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
B00L - R0001 - Laboratory L.S. - 92.09 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
B00L - R0002 - Apparatus Store - 14.65 m2							
No Asbestos							
B00L - R0003 - Distribution Board Cupboard - .78 m2							
No Asbestos							Note: No inspection of live electrical installation
B00L - R0004 - Laboratory L.S. - 91.99 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00L - R0005 - Preparation - 47.95 m2							
No Asbestos							
B00L - R0006 - Laboratory L.S. - 92.1 m2							
No Asbestos							
B00L - R0007 - Laboratory L.S. - 91.98 m2							
No Asbestos							
B00L - R0008 - Preparation - 47.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
B00L - R0009 - Movement - 42.83 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
B00L - R0010 - Movement - 29.72 m2							
No Asbestos							
B00L - R0011 - Cleaning Store - Distributed - 4.52 m2							
No Asbestos							
B00L - R0012 - Main Switchroom - 8.8 m2							
Electrical - Backing Board	Resinous Board	1	West, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00L - R0013 - Stairs - 12.82 m2							

No Asbestos							
<b>B00L - R0014 - Movement - 17.08 m2</b>							
No Asbestos							
<b>B00L - R0015 - Toilets-Girls - 2.84 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting						
<b>B00L - R0016 - Toilets-Girls - 2.84 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting						
<b>B00L - R0017 - Toilets-Girls - 2.84 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting						
<b>B00L - R0018 - Toilets-Girls - 2.84 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting						
<b>B00L - R0019 - Toilets-Girls - 2.87 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting						
<b>B00L - R0020 - Toilets-Girls - 2.81 m2</b>							
Non Accessible							
<b>B00L - R1001 - Seminar - 12.47 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00L - R1002 - Seminar - 12.64 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00L - R1003 - Distribution Board Cupboard - 2.45 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Ceiling Structures/Linings	No Asbestos Found						
<b>B00L - R1004 - Cleaning Store - Distributed - 2.76 m2</b>							
Ceiling Structures/Linings	No Asbestos Found						
<b>B00L - R1005 - Seminar - 12.68 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00L - R1006 - Seminar - 12.68 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00L - R1007 - Seminar - 37.24 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00L - R1008 - Workroom - 48.45 m2</b>							



Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
<b>B00L - R1009 - Librarian - 11.48 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00L - R1010 - Toilets-Girls - 6.57 m2</b>								
No Asbestos								
<b>B00L - R1011 - Entry - 4.45 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00L - R1012 - Toilets-Boys - 6.57 m2</b>								
No Asbestos								
<b>B00L - R1013 - Main Area - 363.67 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( > 250 m2) - ( X25 )							
Wall Linings Internal - Infill	Flat AC Sheeting	10m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00L - R1014 - Movement - 26.75 m2</b>								
No Asbestos								
<b>B00L - R1015 - Stairs - 18.37 m2</b>								
No Asbestos								
<b>B00L - R1016 - Stairs - .5 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00L - R1017 - Stairs - .5 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00M - Pupil Facilities - 2011 - Brick/Veneer</b>								
<b>Exterior</b>								
No Asbestos								
<b>Interior</b>								
<b>B00M - R0001 - Student Canteen - 48.32 m2</b>								
No Asbestos								
<b>B00M - R0002 - Distribution Board Cupboard - .45 m2</b>								
No Asbestos								
<b>B00M - R0003 - Office/Store - 10.89 m2</b>								
No Asbestos								
<b>B00M - R0004 - Store - Coolroom - 7.16 m2</b>								
No Asbestos								
<b>B00M - R0005 - External Movement - 105.42 m2</b>								
No Asbestos								
<b>B00N - Other/Multi Purpose Facilities - 2011 - Brick/Veneer</b>								
<b>Exterior</b>								
No Asbestos								
<b>Interior</b>								
<b>B00N - R0001 - Aboriginal Resource Centre - 65.59 m2</b>								
No Asbestos								
<b>B00N - R0002 - Staff Study - 19.45 m2</b>								
No Asbestos								
<b>B00N - R0003 - Interview/Office - Type 2 - 13.58 m2</b>								
No Asbestos								

<b>B00N - R0004 - Toilets-Unisex - 7 m2</b>		
No Asbestos		
<b>B00N - R0005 - Distribution Board Cupboard - .93 m2</b>		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00N - R0006 - External Movement - 16.74 m2</b>		
No Asbestos		
<b>B00O - Technological &amp; Applied Studies - 2011 - Brick/Veneer</b>		
<b>Exterior</b>		
No Asbestos		
<b>Interior</b>		
<b>B00O - R0001 - Outdoor Workshop - 97.04 m2</b>		
No Asbestos		
<b>B00O - R0002 - Materials Store - 36.59 m2</b>		
No Asbestos		
<b>B00O - R0003 - Handwashing Facilities - 9.17 m2</b>		
No Asbestos		
<b>B00O - R0004 - Dust Extraction Space - 8.31 m2</b>		
No Asbestos		
<b>B00O - R0005 - Distribution Board Cupboard - .81 m2</b>		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00O - R0006 - L.P.G Store - 1.56 m2</b>		
No Asbestos		
<b>B00P - Computer Learning/General Learning - 2010 - Brick/Veneer</b>		
<b>Exterior</b>		
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
<b>Interior</b>		
<b>B00P - R0001 - Computer Learning Space - 91.9 m2</b>		
No Asbestos		
<b>B00P - R0002 - Seminar - Type 2 - 18.84 m2</b>		
No Asbestos		
<b>B00P - R0003 - Resource/Project Store - 10.1 m2</b>		
No Asbestos		
<b>B00P - R0004 - Computer Store - 9.02 m2</b>		
No Asbestos		
<b>B00P - R0005 - External Movement - 28.77 m2</b>		
No Asbestos		
<b>B00P - R0006 - Distribution Board Cupboard - .46 m2</b>		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00Q - Technological &amp; Applied Studies - 2010 - Steel</b>		
<b>Exterior</b>		
No Asbestos		
<b>Interior</b>		
<b>B00Q - R0001 - General Learning Space - 53.17 m2</b>		
No Asbestos		
<b>B00Q - R0002 - Growing/Breeding - 17.24 m2</b>		
No Asbestos		
<b>B00Q - R0003 - External Movement - 28.42 m2</b>		
No Asbestos		
<b>B00Q - R0004 - External Movement - 19.34 m2</b>		

No Asbestos							
<b>B00Q - R0005 - Materials Store - 17.65 m2</b>							
No Asbestos							
<b>B00R - Technological &amp; Applied Studies - 2011 - Brick/Veneer</b>							
<b>Exterior</b>							
No Asbestos							
<b>Interior</b>							
<b>B00R - R0001 - External Movement - 10.8 m2</b>							
No Asbestos							
<b>B00R - R0002 - Food/Research Space - 29.39 m2</b>							
No Asbestos							
<b>B00R - R0003 - Distribution Board Cupboard - .92 m2</b>							
No Asbestos							
<b>B00R - R0004 - General Storeroom - 14.98 m2</b>							
No Asbestos							
<b>B00R - R0005 - Kitchen - Type 2 - 94.96 m2</b>							
No Asbestos							
<b>B00R - R0006 - Pantry - 8.13 m2</b>							
No Asbestos							
<b>B00R - R0007 - Preparation - Materials - 18.44 m2</b>							
No Asbestos							
<b>B0AG - Agricultural Science - 1970 - Brick/Block</b>							
<b>Exterior</b>							
Wall Cladding	Flat AC Sheeting	40m2	North, South, East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B0AG - R0001 - Staff - Toilet - 1.95 m2</b>							
No Asbestos							
<b>B0AG - R0002 - Staff Shower - 4.95 m2</b>							
No Asbestos							
<b>B0AG - R0003 - General Storeroom - 9.47 m2</b>							
No Asbestos							
<b>B0AG - R0004 - Machine Storage - 40.39 m2</b>							
No Asbestos							
<b>B0AG - R0005 - Plant Growing Space - 7.83 m2</b>							
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0AG - R0006 - Agriculture Covered Area - 18.02 m2</b>							
Wall Linings Internal	Flat AC Sheeting	5m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0G1 - General Learning - 1948 - Timber</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	AC Fragments/Debris		Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Ceiling Voids	AC Fragments/Debris		Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior							
<b>B0G1 - R0001 - General Learning Space - 52.42 m2</b>							
Wall Linings Internal	Flat AC Sheeting	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B0G1 - R0002 - General Learning Space - 52.34 m2</b>							
Wall Linings Internal	Flat AC Sheeting	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B0G1 - R0003 - General Learning Space - 52.06 m2</b>							
Wall Linings Internal	Flat AC Sheeting	30m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B0G1 - R0004 - Special Learning Space - 51.35 m2</b>							
Wall Linings Internal	Flat AC Sheeting	30m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B0G1 - R0005 - External Movement - 28.27 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B0G1 - R0006 - Cleaning Store - Distributed - 6.99 m2</b>							
Wall Linings Internal	Flat AC Sheeting	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B0G1 - R0007 - External Movement - 28.39 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B0G1 - R0008 - Resources Store - 6.78 m2</b>							
No Asbestos							
<b>B0G2 - General Learning - 1948 - Timber</b>							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Packing						
Underfloor Voids	AC Fragments/Debris		Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Interior							
<b>B0G2 - R0001 - General Learning Space - 44.19 m2</b>							
Wall Linings Internal	Flat AC Sheeting	40m2	North, South, East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B0G2 - R0002 - General Learning Space - 44.2 m2</b>							
Wall Linings Internal	Flat AC Sheeting	40m2	North, South, East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B0G2 - R0004 - General Storeroom - 6.54 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B0G2 - R0005 - External Movement - 27.88 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>BAG1 - Agricultural Science - 2009 - Brick/Veneer</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>BAG1 - R0001 - External Movement - 33.79 m2</b>							
No Asbestos							
<b>BAG1 - R0004 - General Storeroom - 199.97 m2</b>							
No Asbestos							
No Asbestos							
<b>BAG1 - R0005 - Staff Study - 12.17 m2</b>							
No Asbestos							
No Asbestos							
<b>BAG1 - R0006 - Cleaning Supplies Store - 5.98 m2</b>							
No Asbestos							
<b>BAG1 - R0007 - Movement - 20.6 m2</b>							
No Asbestos							
No Asbestos							
<b>BAG1 - R0008 - Movement - 20.12 m2</b>							
No Asbestos							
No Asbestos							
<b>BAG1 - R0009 - Toilets - Boys - 3.46 m2</b>							
No Asbestos							
No Asbestos							
<b>BAG1 - R0010 - Toilets - Girls - 3.46 m2</b>							
No Asbestos							
No Asbestos							
<b>BAG1 - R0011 - Staff - Toilet - 4.65 m2</b>							
No Asbestos							
No Asbestos							
<b>BAG1 - R0012 - Stairs - .71 m2</b>							
No Asbestos							
No Asbestos							
<b>BAG1 - R1001 - Computer Learning Space - 37.63 m2</b>							
No Asbestos							
No Asbestos							
<b>BAG1 - R1002 - Computer Resource - 29.26 m2</b>							

No Asbestos	
No Asbestos	
<b>BAG1 - R1003 - Movement - 2.17 m2</b>	
No Asbestos	
No Asbestos	
<b>BAG1 - R1004 - Stairs - 4.84 m2</b>	
No Asbestos	
No Asbestos	
<b>BAG2 - Agricultural Science - 2010 - Steel</b>	
<b>Exterior</b>	
No Asbestos	
<b>Interior</b>	
<b>BAG2 - R0001 - Movement - 6.93 m2</b>	
No Asbestos	
<b>BAG2 - R0002 - Staff Study - 10.23 m2</b>	
No Asbestos	
<b>BAG2 - R0003 - General Learning Space - 35.43 m2</b>	
No Asbestos	
<b>BAG2 - R0004 - Class Tools Storage - 34.95 m2</b>	
No Asbestos	
<b>BAG2 - R0005 - Outdoor Learning Area - 47.98 m2</b>	
No Asbestos	

## Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020